

Phase 3E - Fire Door Condition Assessment Report

<u>Rev.2</u>

<u>Author: Matthew Cooper</u> Surveyors: Rod Harrison / Matthew Cooper


Date: 01/08/2023

Table of Contents

Naming Convention:	3
Format of assessment:	4
Executive Summary	5
Condition Assessment	5

Naming Convention:

Each door has been named against the photographic survey reports submitted as part of the planning application for ease of reference i.e. D.G.7

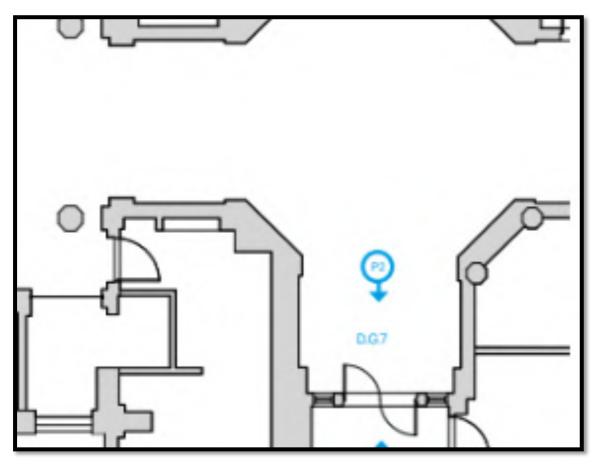

Format & Parameters of assessment:

- 1. Location i.e. Stair Core 1
- 2. Door code i.e. D.G.7
- 3. Door Photos
- 4. Door Type Requirements FD30 or FD60
- 5. Heritage Status i.e. listed or un-listed
- 6. Condition i.e. stating patent defects or challenges
- 7. Part M compliance door width, compliant is equal to or greater than an effective clear width of 750mm in a single leaf.
- 8. Part M compliance door force, compliant is equal to or less than 30N force on the leading edge of the door from 0-30 degrees, and then equal to or less than 22.5N force on the leading edge of the door from 30-60 degrees.
- 9. Fire Door? Yes or No
- 10. Fire requirements i.e. are new seals required?

Executive Summary

The purpose of this report is provide a clear statement of condition on all heritage fire doors included within the Phase 3E scope.

The key first takeaway from this report is that all doors except one (potentially two) are in a condition which should allow refurbishment. The extent of refurbishment varies with some doors requiring extensive reparational work to the timber and numerous fire enhancements, with others only requiring minor works, for example, installation of new hot, cold and drop seals.

Regardless of the opportunity to refurbish each door set, Part M is an underlying issue both in terms of effective clear width of a single leaf and force in Newtons required to open each leaf. All doors within the report failed the force push test, many by a large measure. Only a handful of doors met the minimum effective clear width requirement for a single leaf when opened.

Finally, all doors within the report, bar only a handful, are hinged from floor pivot plates. On the recently delivered Phase 2B project, new reproduction heritage fire doors were installed. The designer decided to utilize the pre-existing floor pivot hinge plates. Attaining certification on the door sets has been challenging due to the difficulty of sealing cold and hot passage around the floor pivot plates.

Given the above challenge, the planning submission for the Phase 3E project puts forward a proposal of installing an inner subframe solution which would allow the door leaves to be side hinged and rebated with continuous hot and cold seals around the door frame.

Condition Assessment

Location: Stair Core 1 Door Code: D.G.7 Photo:

Door Type: FD30s	
Heritage Status: Listed	
Condition:	
Good condition	
Misalignment of doors at leading edge, no bowing of	f timber however re-hinging required
Georgian Glass	
Floor pivot hinge plates	
Part M compliance door width:	Non-compliant under part M
Single leaf effective clear width: 740mm	
Double leaf effective clear width: 1480mm	
Part M compliance door force:	Non-compliant under part M
• 0-30: 45N	
• 30-60: 25N Fire Door?: Yes	
Fire requirements:	
New hot, cold and drop seals	
 Re-adjustment of hinges and frame to fix misalignme 	ant
Replacement of Georgian Glass	

Location: Stair Core 1	
Door Code: D.G.8	
Photo:	

Door Type: FD30s	
Heritage Status: Listed Condition:	
Good condition	
 Misalignment of doors at leading edge, no bowing of 	f timber however re-hinging required
Georgian Glass	
Floor pivot hinge plates	
Part M compliance door width:	Non-compliant under part M
• Single leaf effective clear width: 740mm	
Double leaf effective clear width: 1480mm	
Part M compliance door force:	Non-compliant under part M
• 0-30: 45N	
• 30-60: 35N	
Fire Door?: Yes	
Fire requirements:	
 New hot, cold and drop seals 	
Replacement of Georgian Glass	
Re-adjustment of hinges and timber frame in order t	o fix misalignment


Location: Stair Core 1	
Door Code: D.G.9	
Photo:	
Door Type: FD30s	
Heritage Status: Unknown (reception is a highly significant	area)
Condition:	
Good condition	
 Integrity of glass is questionable due to failing casir 	ng
• Fire resistance of glass is unknown	-
Hanging uneven	
Compromised smoke seal	
Part M compliance door width:	Compliant under Part M
 Single leaf effective clear width: 760mm 	
 Double leaf effective clear width: 1250mm 	
Part M compliance door force:	0-30 is compliant under Part M
• 0-30: 22.5N	30-60 is non-complaint under Part M
• 30-60: 30N	
Fire Door?: Yes	
Fire requirements:	
New cold & drop seal	
Replace glass	
 Re- adjustment of door frame or re-fix hinges to fix 	misalignment
 General decoration work required 	

Door Code: D.1.5	
Photo:	
<image/>	
Door Type: FD30s	
Heritage Status: Listed	
Condition:	
Good condition	
Faulty door closers	
No drop seal	
Misaligned	
Part M compliance door width:	Compliant under Part M, however
 Single leaf effective clear width: 750mm Double leaf effective clear width: 1550mm 	the sensors inhibit single leaf access/egress
 Sensor detection effective clear width: 1550mm 	
Part M compliance door force:	Non-compliant under Part M
• 0-30: 42.5N	
• 30-60: 42.5N	
Fire Door?: Yes	
Fire requirements:	
 Re-adjustment of door set to fix misalignment 	
• New cold, hot and drop seals	
- New Cold, not and drop seals	

Door Code: D.2.2	
Photo:	
Faculty of EPH & ITD	
Door Type: FD30s	
Heritage Status: Listed	
Condition:	
 Set is in poor condition (extensive repair required 	1)
 Door set is misaligned 	
Faulty door closers	
Georgian glass	
Floor pivot hinge plates	
Part M compliance door width:	Compliant under Part M
Single leaf effective clear width: 750mm	
Double leaf effective clear width: 1530mm	
Part M compliance door force:	Non-compliant under Part M
• 0-30: 57.5N	
• 30-60: 40N	
Fire Door?: Yes	
Fire requirements:	
 New cold, hot and drop seals 	
 Replacement of Georgian glass 	
 Faulty door closer to be replaced with Part M cor 	npliant closer
 Extensive joiner works to timber 	
 Re-adjustment of door set to fix misalignment (page 1) 	ack frame, re-hinge)


Door Code: D.3.5	
Photo:	
Facely of Higdass and Tapacal Diseases	
Door Type: FD30s	
Heritage Status: Listed	
Condition:	
Set in poor condition (extensive repair required)	
 Hanging uneven 	
Georgian glass	
Missing kickplate	
 Floor pivot hinge plates 	
Part M compliance door width:	Compliant under Part M
Single leaf effective clear width: 760mm	
 Double leaf effective clear width: 1500mm 	
Part M compliance door force:	Non-compliant under Part M
• 0-30: 37.5N	
• 30-60: 37.5N	
Fire Door?: Yes	
Fire requirements:	
Replacement of Georgian glass	
 Re-adjustment of door set to fix misalignment 	
 New cold, hot and drop seals 	
New kick plate	
Extensive joiner works to timber	

Door Code: D.4.1

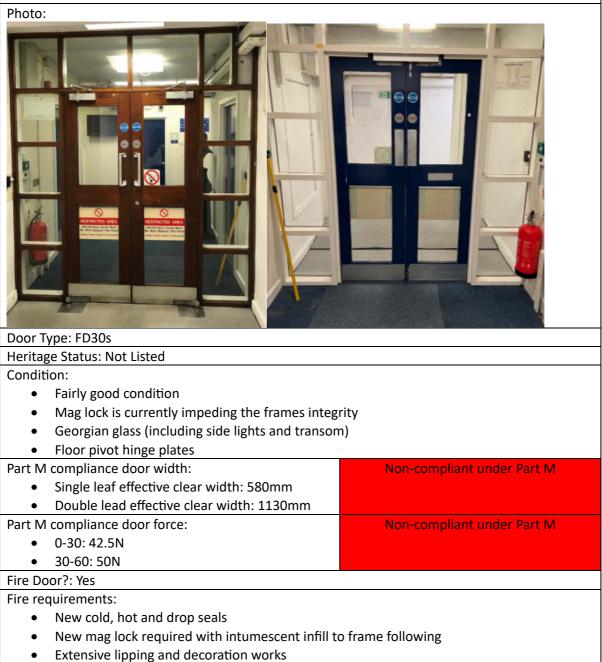

Replacement of Georgian glass

Door Code: D.LG.1

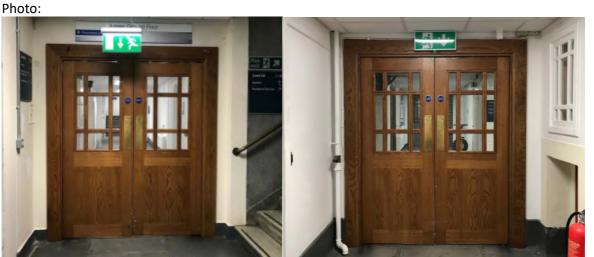

Door Type: FD30s

Heritage Status: Listed (unknown if reproduction)

Condition:

- Good condition •
- Integrated door closer will require new lipping on door •
- Infill required on door frame following removal of door closer

Floor pivot hinge plates •

Part M compliance door width:

• Single leaf effective clear width: 720mm

• Double leaf effective clear width: 1450mm

Part M compliance door force:

- 0-30: 47.5N
- 30-60: 37.5N

Fire Door?: Yes

Fire requirements:

- New cold, hot and drop seals •
- Replacement of Georgian glass
- Casing of windows require repair, and assessment of integrity, daylight visible through casing.

Non-compliant under Part M

Non-compliant under Part M

Location: Stair Core 2	
Door Code: D.LG.2	
Photo:	
Door Type: FD30s Heritage Status: Listed (unknown if reproduction)	
Condition:	
Fair condition	
 Lipping required to head threshold 	
 Georgian glass 	
Compromised seals	
Part M compliance door width:	Compliant under Part M
• Single leaf effective clear width: 750mm	
Double leaf effective clear width: 1530mm	
Part M compliance door force:	Non-compliant under Part M
0-30: 55N	
30-60: 40N	
Fire Door?: Yes	
Fire requirements:	
New cold, hot and drop seals	
New door closer	
Infill of head threshold and frame (following rem	oval of existing closer)
Replace Georgian glass	

Location: Stair Core 2	
Door Code: D.G.1	
Photo:	
Door Type: FD30s	
Heritage Status: Listed	
Condition:	
Good condition	
Compromised sealsGeorgian glass	
 Floor pivot hinge plates 	
Part M compliance door width:	Non-compliant under Part M
Single leaf effective clear width: 740mm	
 Double leaf effective clear width: 1480mm 	
	Non-compliant under Part M
Part IVI compliance door force:	
Part M compliance door force: • 0-30: 75N	
• 0-30: 75N	
 0-30: 75N 30-60: 57.5N 	
 0-30: 75N 30-60: 57.5N Fire Door?: Yes	
 0-30: 75N 30-60: 57.5N Fire Door?: Yes Fire requirements: 	

Door Code: D.G.2	
<image/> <image/>	
Heritage Status: Listed	
Condition:	
Good condition	
Georgian glass	
 Door set is misaligned at leading edge 	
Floor pivot hinge plates	
Part M compliance door width:	Non-compliant under Part M
Single leaf effective clear width: 740mm	
Double leaf effective clear width: 1450mm	
Part M compliance door force:	Non-compliant under Part M
• 0-30: 87.5N	
• 30-60: 42.5N Fire Door?: Yes	
Fire requirements:	
 New cold, hot and drop seals 	
 Replace Georgian glass 	
 Slight lipping and dec works required 	
 New part M compliant closer 	
 Re-adjustment of door set to fix misalignment (re 	-hinge)
, , , , , , , , , , , , , , , , , , , ,	- , - ,

Location: Stair Core 2	
Door Code: D.G.3	
Photo:	
Door Type: ED30s	
Door Type: FD30s Heritage Status: Listed	
Heritage Status: Listed	
Heritage Status: Listed Condition:	
Heritage Status: Listed Condition: • Fair condition	
Heritage Status: Listed Condition: • Fair condition • Area of damage at threshold	
Heritage Status: Listed Condition: • Fair condition • Area of damage at threshold • Georgian glass	
Heritage Status: Listed Condition: • Fair condition • Area of damage at threshold • Georgian glass • Floor pivot hinge plates	Non-compliant under Part M
Heritage Status: Listed Condition: • Fair condition • Area of damage at threshold • Georgian glass • Floor pivot hinge plates Part M compliance door width:	Non-compliant under Part M
Heritage Status: Listed Condition: • Fair condition • Area of damage at threshold • Georgian glass • Floor pivot hinge plates Part M compliance door width: • Single leaf effective clear width: 740mm	Non-compliant under Part M
Heritage Status: Listed Condition: • Fair condition • Area of damage at threshold • Georgian glass • Floor pivot hinge plates Part M compliance door width: • Single leaf effective clear width: 740mm • Double leaf effective clear width: 1480mm	
Heritage Status: Listed Condition: • Fair condition • Area of damage at threshold • Georgian glass • Floor pivot hinge plates Part M compliance door width: • Single leaf effective clear width: 740mm	Non-compliant under Part M Non-compliant under part M
Heritage Status: Listed Condition: • Fair condition • Area of damage at threshold • Georgian glass • Floor pivot hinge plates Part M compliance door width: • Single leaf effective clear width: 1480mm Part M compliance door force:	
Heritage Status: Listed Condition: • Fair condition • Area of damage at threshold • Georgian glass • Floor pivot hinge plates Part M compliance door width: • Single leaf effective clear width: 740mm • Double leaf effective clear width: 1480mm Part M compliance door force: • 0-30: 80N	
Heritage Status: Listed Condition: Fair condition Area of damage at threshold Georgian glass Floor pivot hinge plates Part M compliance door width: Single leaf effective clear width: 740mm Double leaf effective clear width: 1480mm Part M compliance door force: O-30: 80N 30-60: 65N Fire Door?: Yes	
Heritage Status: ListedCondition:• Fair condition• Area of damage at threshold• Georgian glass• Floor pivot hinge platesPart M compliance door width:• Single leaf effective clear width: 740mm• Double leaf effective clear width: 1480mmPart M compliance door force:• 0-30: 80N• 30-60: 65NFire Door?: YesFire requirements:	
Heritage Status: Listed Condition: • Fair condition • Area of damage at threshold • Georgian glass • Floor pivot hinge plates Part M compliance door width: • Single leaf effective clear width: 740mm • Double leaf effective clear width: 1480mm Part M compliance door force: • 0-30: 80N • 30-60: 65N Fire Door?: Yes	
Heritage Status: ListedCondition:• Fair condition• Area of damage at threshold• Georgian glass• Floor pivot hinge platesPart M compliance door width:• Single leaf effective clear width: 740mm• Double leaf effective clear width: 1480mmPart M compliance door force:• 0-30: 80N• 30-60: 65NFire Door?: YesFire requirements:• New cold, hot and drop seals	

Location: Stair Core 2 Door Code: D.1.1 Photo: Door Type: FD30s Heritage Status: Listed Condition: • Fair condition Slight damage at threshold Georgian glass Misalignment of door set • Floor pivot hinge plates Part M compliance door width: Compliant under Part M Single leaf effective clear width: 750mm • Double leaf effective clear width: 1300mm • Part M compliance door force: Non-compliant under Part M • 0-30: 80N 30-60: 60N • Fire Door?: Yes Fire requirements: Re-adjustment to fix misalignment • New cold, hot and drop seals

- Replace Georgian glass
- Part M compliant door closer

Door Code: D.1.2

Photo:



Door Type: FD30s

Heritage Status: Listed

Condition:

- Fair condition •
- Georgian glass •
- Misalignment of door set •
- Floor pivot hinge plates

Part M compliance door width:

Single leaf effective clear width: 740mm •

Double leaf effective clear width: 1480mm •

Part M compliance door force:

- 0-30: 80N •
- 30-60: 55N •

Fire Door?: Yes

Fire requirements:

- New cold, hot and drop seals •
- Replace Georgian glass
- Re-adjustment of set to fix misalignment
- Timber infills
- Light touch decorative works •


Non-compliant under Part M

Non-compliant under Part M

Location: Stair Core 2	
Door Code: D.2.1	
Photo:	
Door Type: FD30s Heritage Status: Listed	
Condition:	
Fair condition	
 One leaf has slightly bowed at the bottom of the 	ne door
Georgian glass	
Floor pivot hinge plates	
Part M compliance door width:	Non-compliant under Part M
 Single leaf effective clear width: 740mm Double leaf effective clear width: 1480mm 	
Part M compliance door force:	Non-compliant under Part M
• 0-30: 80N	
• 30-60: 60N	
Fire Door?: Yes	
Fire requirements:	
Reparation works to the leading edge of the til	nber door set
 New cold, hot and drop seals 	
 Re-adjustment of timber door set to fix misalig 	nment
 Replacement of Georgian Glass 	

New part M compliant door closer

Door Code: D.3.1

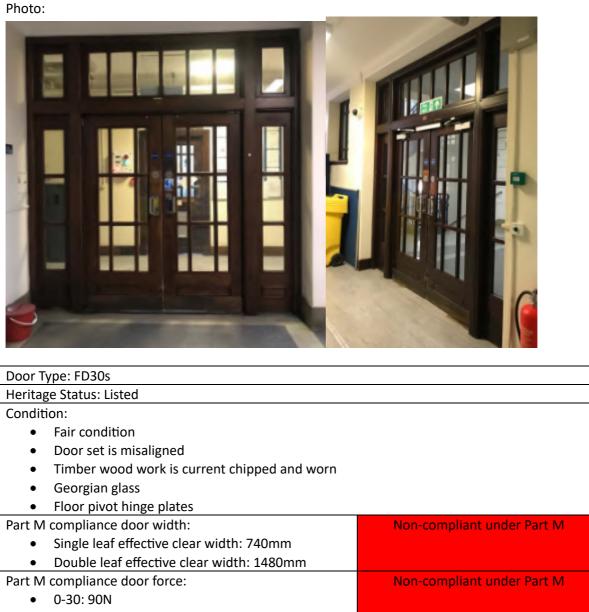


• 30-60: 82.5N

Fire Door?: Yes

- Re-adjustment of timber door set to fix misalignment •
- Reparation works to the leading edge of the timber door set •
- New cold, hot and drop seals •
- Replacement of Georgian glass •

Door Code: D.3.2

Photo:

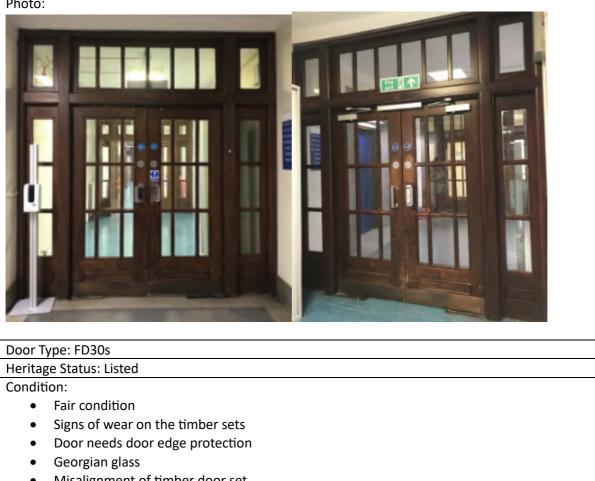

Non-compliant under Part M

Non-compliant under Part M

- Misalignment of timber door set •
- Floor pivot hinge plates •

Part M compliance door width:

- Single leaf effective clear width: 740mm
- Double leaf effective pinch width: 1480mm •

Part M compliance door force:

- 0-30: 97.5N
- 30-60: 62.5N •

Fire Door?: Yes

- Re-adjustment of timber door sets to fix misalignment •
- Reparation works to the timber
- Replacement of the Georgian glass
- New cold, hot and drop seals
- New part M compliant closer

Location: Stair Core 3	
Door Code: D.LG.3	
Door Code: D.LG.3 Photo:	
Door Type: FD30s	
Heritage Status: Listed (unknown if reproduction)	
Condition:	
Fair condition of door set	
Vertical frames require replacement	
Georgian glass	
Part M compliance door width:	Compliant under Part M
• Single leaf effective clear width: 750mm	
• Double leaf effective clear width: 1490mm	
Part M compliance door force:	Non-compliant under Part M
• 0-30: 52.5N	
• 30-60: 52.5N	
Fire Door?: Yes	
Fire requirements:	
 New cold, hot and drop seals 	
 Replacement of Georgian glass 	
 Reparations to the timber framework 	

Location: Stair Core 3		
Door Code: D.LG.4		
Photo:		
Door Type: FD30s Heritage Status: Listed		
Condition:		
Poor condition		
Base of the door has been re-enforced		
Georgian glass		
 Extensive damage to the base of the timber door 	set	
Part M compliance door width:	Non-compliant under Part M	
Single leaf effective clear width: 720mm		
Double leaf effective clear width: 1430mm		
Part M compliance door force: Non-compliant under Part M		
• 0-30: 92.5N		
• 30-60: 52.5N		
Fire Door?: Yes		
Fire requirements:		
New cold, hot and drop seals		
Replacement of Georgian glass		
 Extensive reparations to the existing timber set with infill work required 		
New ironmongery required		
 New Part M door closer required 		

Location: Stair Core 3 Door Code: D.G.4 Photo: LEVEL Door Type: FD30s Heritage Status: Listed Condition: Good condition • Misalignment of door set at leading edge • Georgian glass • • Floor pivot hinge plates Part M compliance door width: Non-compliant under Part M Single leaf effective clear width: 730mm • Double leaf effective clear width: 1470mm • Part M compliance door force: Non-compliant under Part M 0-30: 87.5N • 30-60: 87.5N • Fire Door?: Yes Fire requirements: Re-adjustment of timber door set to fix misalignment (re-hinge) • New cold, hot and drop seals ٠ Infill of timber set where existing closer has been fixed Replacement of Georgian glass

• Installation of new Part M compliant closer

Door Code: D.G.5

Photo:



Non-compliant under Part M

Non-compliant under Part M

Door Type: FD30s

Heritage Status: Listed

Condition:

- Good condition
- Georgian glass
- Floor pivot hinge plates

Part M compliance door width:

- Single leaf effective clear width: 730mm
- Double leaf effective clear width: 1470mm


Part M compliance door force:

- 0-30: 77.5N
- 30-60: 62.5N

Fire Door?: Yes


- Re-adjustment of timber door set to fix misalignment
- New cold, hot and drop seals
- Replacement of Georgian glass
- Infill of timber where existing closer has been fixed
- Installation of part M compliant closer

Door Code: D.G.6

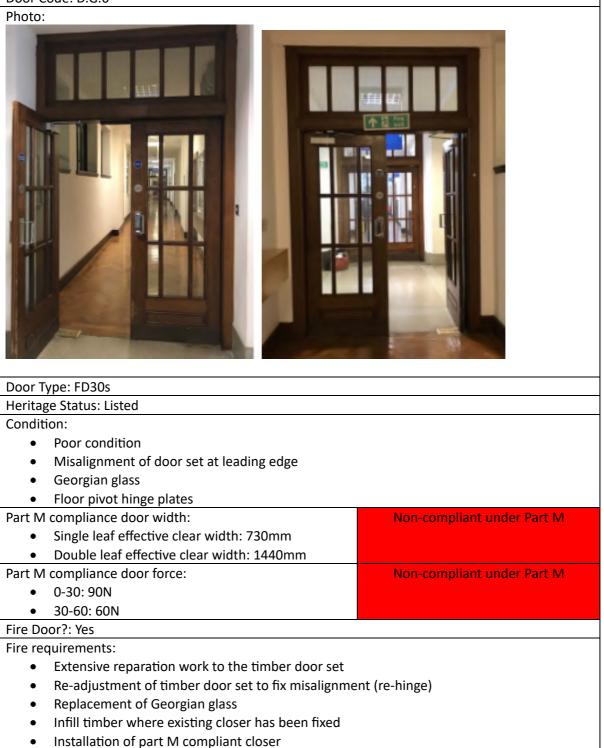

Location: Stair Core 3		
Door Code: D.1.3		
Photo:		
Door Type: FD30s		
Heritage Status: Listed		
Condition:		
Fair condition		
 Misalignment of door set at leading edge 		
Georgian glass		
 Floor pivot hinge plates 		
Part M compliance door width:	Non-compliant under Part M	
 Single leaf effective clear width: 730mm 		
 Double leaf effective clear width: 1480mm 		
Part M compliance door force:	Non-compliant under Part M	
• 0-30: 77.5N		
• 30-60: 60N		
Fire Door?: Yes		
Fire requirements:		
 Re-adjustment of timber door set to fix misalign 	nent (re-hinge)	
Replacement of Georgian glass		
 Infill of timber where existing closer is installed 		
Infill of timber where existing closer is installed		

Door Code: D.1.4

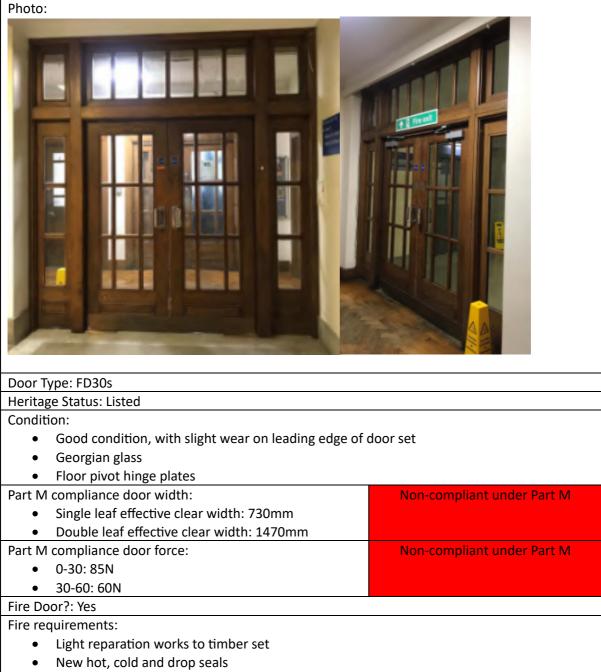

- Replacement of Georgian glass
- Installation of new part M compliant closer

Location: Stair Core 3	
Door Code: D.3.3	
Photo:	
Door Type: FD30s	
Heritage Status: Listed	
Condition:	
Fair condition	
Visible wear on the timber door sets	
Georgian glass	
Floor pivot hinge plates	
Part M compliance door width:	Non-compliant under Part M
 Single leaf effective clear width: 745mm Double leaf effective clear width: 1490mm 	
	Non compliant under Part M
Part M compliance door force: • 0-30: 80N	Non-compliant under Part M
 30-60: 62.5N 	
• 30-60. 62.3N Fire Door?: Yes	
Fire requirements:	
Reparation works to the timber door set	
 New hot, cold and drop seals 	
 Replacement of Georgian glass 	
 Infill of timber where existing closers installed 	

Door Code: D.3.4

Photo:



Non-compliant under Part M

Non-compliant under Part M

Door Type: FD30s

Heritage Status: Listed

Condition:

- Fair condition
- Georgian glass
- Floor pivot hinge plates
- Part M compliance door width:
 - Single leaf effective clear width: 740mm
 - Double leaf effective clear width: 1480mm

Part M compliance door force:

- 0-30: 87.5N
- 30-60: 60N

Fire Door?: Yes

- Slight reparation works to the timber door set
- Replacement of Georgian glass
- New hot, cold and drop seals
- Infill of timber where existing closer is fixed
- New part M compliant closer

Location: Ground floor circulation areas

Door Code: D.G.10

Photo:



Non-compliant under Part M

Non-compliant under Part M

Door Type: FD30s

Heritage Status: Listed

Condition:

- Good condition
- Damage to the top edge of the door set
- Integrity of glass questionable
- Floor pivot hinge plates

Part M compliance door width:

- Single leaf effective clear width: 680mm
- Double leaf effective clear width: 1360mm

Part M compliance door force:

- 0-30: 60N
- 30-60: 60N
- Fire Door?: Yes

- Replace glass with fire resistant glass
- Re-adjustment of door to fix misalignment
- New hot, cold and drop seals
- Infill timber with intumescent packing
- Light reparations to timber door set
- New part M compliant door closer

Location: Ground floor circulation areas	
Door Code: D.G.11	
Photo:	
Door Type: FD30s	
Heritage Status: Listed	
Condition:	
Good condition	
 Slight misalignment of door 	
 Floor pivot hinge plates 	
Part M compliance door width:	Non-compliant under Part M
 Single leaf effective clear width: 740mm 	
 Double leaf effective clear width: 1480mm 	
Part M compliance door force:	Non-compliant under Part M
 0-30: 75N 	
• 30-60: 45N	
Fire Door?: Yes	
Fire requirements:	nt
Re-adjustment of timber door set to fix misalignme	ant -
New hot, cold and drop seals	
Infill of timber where existing closer is installed	
New part M compliant closer	

Leastion, Cround floor circulation areas		
Location: Ground floor circulation areas		
Door Code: D.G.12		
Photo:		
Door Type: FD30s		
Heritage Status: Listed		
Condition:		
Fair condition		
 Slight signs of wear to the timber door sets 		
 Floor pivot hinge plates 		
Part M compliance door width:	Non-compliant under Part M	
 Single leaf effective clear width: 740mm 		
 Double leaf effective clear width: 1480mm 		
Part M compliance door force:	Non-complaint under Part M	
• 0-30: 75N		
• 30-60: 45N		
Fire Door?: Yes		
Fire Door?: Yes		
Fire Door?: Yes Fire requirements:		
Fire requirements:		
Fire requirements:Slight reparations to the timber sets		

Location: First floor circulation areas

Door Code: D.1.6

Photo:



Door T	ype: FD30s		
Herita	ge Status: Listed (unknown if reproduction)		
Condit	ion:		
•	Good condition		
•	 Very slight signs of wear to the timber 		
•	Floor pivot hinge plates		
Part M	compliance door width:	Compliant under Part M	
•	Single leaf effective clear width: 760mm		
•	Double leaf effective clear width: 1520mm		
Part M compliance door force:		Non-compliant under Part M	
•	0-30: 47.5N		
•	30-60: 47.5N		
Fire Do	Fire Door?: Yes		
Fire re	quirements:		
•	Light reparation works to the timber door set		
•	New hot, cold and drop seals		
•	 Infill timber where existing closer is installed 		
•	New part M compliant closer		

Location: First floor circulation areas

Door Code: D.1.7

Photo:			
Door Type: FD30s Heritage Status: Listed			
Condition:			
Fair condition			
Georgian glass			
Slight wear on the timber set			
Floor pivot hinge plates			
Part M compliance door width: Non-compliant under Part M			
Single leaf effective clear width: 680mm			
Double leaf effective clear width: 1340mm			
Part M compliance door force: Non-compliant under Part M			
• 0-30: 47.5N			
• 30-60: 55N Fire Door?: Yes			
Fire requirements:			
Light reparations to the timber door set			
 New hot, cold and drop seals 			
 Replace Georgian glass 			
 New part M compliant door closer 			
Infill timber where existing closers are installed			

Location: First floor circulation areas

Door Code: D.1.8

Photo:	
Door Type: FD30s	
Heritage Status: Listed	
Condition: • Good condition • Poor installation of door closer, clashes with reveal • Georgian glass	l and restricts full swing of door
 Floor pivot hinge plates 	
Part M compliance door width:	Non-compliant under Part M
 Single leaf effective clear width: 620mm Double leaf effective clear width: 850mm (Due to restricted swing) 	
Part M compliance door force: • 0-30: 70N • 30-60: 75N	Non-compliant under Part M
Fire Door?: Yes	
Fire requirements:	
 Light reparations to the timber door set Re-adjustment of timber door set to fix misalignme New hot, cold and drop seals Replace Georgian glass 	ent

Door	Code:	D.2.3

Door Type: FD30s	
Heritage Status: Listed	
Condition:	
Poor condition	
Door hinge plate closer misaligned so no seal	
Georgian glass	
Floor pivot hinge plates	
Part M compliance door width:	Compliant under Part M
Single leaf effective clear width: 770mm	
Double leaf effective clear width: 1540mm	
Part M compliance door force:	Non-compliant under Part M
Part M compliance door force: • 0-30: 52.5N	Non-compliant under Part M
	Non-compliant under Part M
• 0-30: 52.5N	Non-compliant under Part M
 0-30: 52.5N 30-60: 52.5N 	Non-compliant under Part M
 0-30: 52.5N 30-60: 52.5N Fire Door?: Yes 	Non-compliant under Part M
0-30: 52.5N 30-60: 52.5N Fire Door?: Yes Fire requirements:	
 0-30: 52.5N 30-60: 52.5N Fire Door?: Yes Fire requirements: Extensive reparations to the timber sets 	
 0-30: 52.5N 30-60: 52.5N Fire Door?: Yes Fire requirements: Extensive reparations to the timber sets Re-adjustment of timber door sets to fix misalign 	

• New part M compliant door closer

Location: Third floor circulation areas

Door Code: D.3.6

Photo:	
	A CONTRACTOR OF THE OWNER OWNER OF THE OWNER
	and the second se
Carlos and Car	Contraction of the second s
	and the second
	Contraction of the second
	Contraction of the local division of the loc
Door Type: FD30s	
Heritage Status: Listed	
Condition:	
Fair condition	
Georgian glass	
Floor pivot hinge plates	
Broken floor hinge plate closer, causing doors	
Part M compliance door width:	Compliant under Part M
Single leaf effective clear width: 750mm	
Double leaf effective clear width: 1520mm	
Part M compliance door force:	Non-compliant under Part M
• 0-30: 60N	
• 30-60: 60N	
Fire Door?: Yes	
Fire requirements:	
Light reparations to the timber sets	
Re-adjustment of timber door sets to fix misalignment	
New side vertical frame hinges Deplace Coording glass	
 Replace Georgian glass 	

- New hot, cold and drop seals
- New part M compliant door closer

Location: Third floor circulation areas

Door Code: D.3.7

Photo:



Non-compliant under Part M

Non-compliant under Part M

Door Type: FD30s

Heritage Status: Listed

Condition:

- Fair condition •
- Georgian glass •
- Slight signs of wear to the timber sets
- Floor pivot hinge plates

Part M compliance door width:

- Single leaf effective clear width: 700mm •
- Double leaf effective clear width: 1400mm

Part M compliance door force:

- 0-30: 62.5N •
- 30-60: 62.5N

Fire Door?: Yes

- Light reparations to the timber sets
- Re-adjustment of timber door sets to fix misalignment •
- **Replace Georgian glass**
- New hot, cold and drop seals
- New part M compliant door closer •

Location: Third floor circulation areas

Door Code: D.3.8

