July 2018 CBA10696 v1C

# James Youngman via vPPR Architects

# ARBORICULTURAL DEVELOPMENT STATEMENT

Site: 092: 133-137 Brecknock Road, London



East Lodge, Leylands Business Park, Colden Common, Winchester, SO22 1TH Tel: 023 8098 6229 Email: info@cbatrees.co.uk www: cbatrees.co.uk The Complete Arboricultural Consultancy



# **ARBORICULTURAL DEVELOPMENT STATEMENT**

Arboricultural Implications Assessment and Method Statement

guided by recommendations within BS5837:2012

Client:	James Youngman via vPPR Architects
Site:	092: 133-137 Brecknock Road
Arboricultural Consultant:	Dominic Poston F.Arbor.A, MICFor, CEnv, Prof Dip (RFS), BSc (Hons), HND
Date:	July 2018

#### SUMMARY

The proposal is for the construction of a new, detached residential property to the rear of 133-137 Brecknock Road.

This Arboricultural Development Statement (ADS) will demonstrate the protection measures for the trees and should be read in association with the Tree Protection Plan CBA10696.02B TPP and vPPR Architects drawing package (092\_A\_P2) and LBH Engineering basement Impact Assessment (LBH4521 Ver 1.2). It follows the initial tree survey, implications assessment and on-going discussions to minimise the impact upon the existing tree stock.

The emphasis of the report is predominantly that of preservation and tree protection. It identifies methodologies to provide protection for trees, to ensure their healthy and safe retention during and post development, as guided by BS5837:2012 and current best practice.

No existing trees on or adjacent to the site are to be removed to facilitate this development. Furthermore, all existing trees on or adjacent to the site can be successfully retained with no long term detrimental harm provided the methodologies and measures detailed here and by vPPR Architects are implemented and adhered to.

#### **CONTENTS**

#### Section Title

Page No.

## PART 1

ARBORICULTURAL IMPLICATIONS ASSESSMENT

1.0	INTRODUCTION	3
2.0	CLIENT'S BRIEF	3
3.0	DESCRIPTION OF THE SITE	4
4.0	THE TREE STOCK	4
5.0	TREE PRESERVATION ORDER/CONSERVATION AREA	5
6.0	PROPOSED TREE RETENTION AND TREE LOSS	5
7.0	SUMMARY OF ARBORICULTURAL IMPLICATIONS	6

## PART 2

# **ARBORICULTURAL / CONSTRUCTION METHOD STATEMENTS**

8.0	PRE-COMMENCEMENT SITE MEETING	7
9.0	ADDITIONAL ARBORICULTURAL ADVICE FOR SITE PERSONNEL	7
10.0	TREE PROTECTION MEASURES	7
11.0	EXISTING SERVICES	9
12.0	AVOIDING DAMAGE TO STEMS AND BRANCHES	10
13.0	VEHICULAR MOVEMENTS	10
14.0	SITING OF TEMPORARY OFFICES, TOILETS AND MATERIAL STORAGE	
	COMPOUNDS	10
15.0	GENERAL CONSIDERATIONS WITHIN AND OUTSIDE THE	
	CONSTRUCTION EXCLUSION ZONE	
16.0	UTILITY SERVICE CONNECTIONS	
17.0	FOUNDATION DESIGN AND CONSTRUCTION	12
18.0	EXCAVATION WITHIN IDENTIFIED RPA'S	12
19.0	SITE MONITORING AND SUPERVISION	12
20.0	REPORT DAMAGE TO TREES AND TREE PROTECTION BARRIERS	
21.0	CONCLUSIONS	
22.0	CONTACT LIST	14

**SUPPORTING INFORMATION/APPENDICES:** 

- CB1 Tree Survey Schedule and Tree Survey Plan CBA10696.01A TSP
- CB2 Root Protection Area Schedule
- CB3 Tree Protection Plan CBA10696.02B TPP

#### **GUIDING PRINCIPLES/APPENDICES:**

- CB4 Tree Protection Guidance Leaflet Construction Exclusion Zone Site Notice Common Causes of Damage During Construction Works
- CB5 Qualifications and Experience

# 1.0 INTRODUCTION

- 1.1 There is a development proposal for the site occupying the rear of 133-137 Brecknock Road, London.
- 1.2 The proposal is for the partitioning of part of the three rear gardens and construction of a new detached property accessed off of Ospringe Road / Montpellier Grove.
- 1.3 Document disclosure provided:
  - Existing and proposed site layout drawings by vPPR Architects
  - LBH Engineering Basement Impact Assessment
- 1.4 The client provided the original site plans and locations of the trees, and these have been the basis for the production of subsequent plans. Whilst CBA Trees has had a limited input in defining the contents of the development plan, it broadly conforms to the requirements of BS5837:2012 *"Trees in Relation to Design, Demolition and Construction Recommendations"* and current best practice advice.
- 1.5 Our advice has been sought on the principles of the development in relation to the potential impact on the existing tree stock, to inform and to facilitate the development layout that is acceptable in arboricultural terms.


# 2.0 CLIENT'S BRIEF

- 2.1 In line with our written quotation and verbal instructions, information has been compiled in accordance with BS5837:2012 and current best practice advice.
  - To undertake a Tree Survey, appended at CB1.
  - To produce an AutoCAD compliant Tree Survey Plan that relies on the accuracy of the plans provided by the client. (Plan CBA10696.01A TSP appended with the Tree Survey Schedule at CB1).
  - To produce a schedule of Root Protection Areas in accordance with BS5837:2012 Annex D, appended at CB2.
  - To provide Tree Constraints advice.
  - To undertake an Arboricultural Implications Assessment (AIA) of the development provided by the client to identify which trees will be lost, which can be retained and suggest mitigating build techniques in order to retain trees.
  - Based on the above and further on-going discussions, to provide an Arboricultural Development Statement detailing the methodologies for the retention of the tree stock where feasible, in relation to the approved development layout including a Tree Protection Plan (Plan CBA10696.02B TPP appended at CB3).
- 2.2 The advice provided is in support of the current planning application and has been formulated without discussion with the main construction contractors who at this stage have not been appointed. Once the main contractors are appointed, amendments to this Method Statement may be required for construction purposes.

All amendments will be assessed by the retained arboricultural consultant and approved in writing by the local authority.

# 3.0 DESCRIPTION OF THE SITE

- 3.1 The site consists of residential rear garden space, bounded by a mix of timber fencing and brick-built walls.
- 3.2 These existing, boundary walls are an important consideration; their existence has informed and influenced the tree protection measures detailed within this report. Following numerous trial trenches, along with LBH Engineering's site investigation it is CBA Trees opinion that this boundary wall (which separates all off-site trees from the development site) has acted as an effective barrier to shallow root growth. See below for an illustrative guide to trial trench locations. No existing significant roots were discovered.

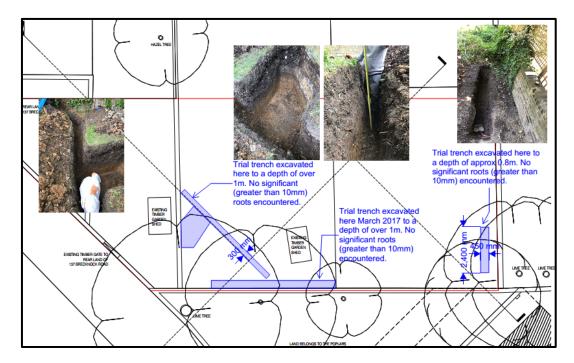

# 4.0 THE TREE STOCK

4.1 A tree survey was undertaken by CBA Trees on 16<sup>th</sup> December 2016. The tree survey exercise identified 4 (four) individual trees and 1 (one) group of trees; a Tree Survey Schedule and Plan (CBA10696.01A TSP) are appended at CB1.

# 4.2 Tree Categorisation Method

Category U = Trees in such a condition that any value would be lost within 10 years, or should be removed for reasons of sound arboricultural

Note: BS5837:2012 states "Category U trees are those in such a condition that they cannot realistically be retained as living trees in the context of the current land use for longer than 10 years."

management. There were no 'U' grade trees on or adjacent to the site at the time of surveying.

- Category A = Trees of high quality and value: in such a condition as to make a substantial contribution, (40 years or more is recommended). There were no individual 'A' grade trees on or adjacent to the site at the time of surveying.
- Category B = Trees of moderate quality and value, capable of making a significant contribution for in excess of 20 years. There was 1 (one) individual 'B' grade tree adjacent to the site at the time of surveying (Tree 1).
- Category C = Trees of low quality and value which might remain for a minimum of 10 years or young trees with stems of less than 150mm diameter. There were 3 (three) individual 'C' grade trees in or adjacent to the site at the time of surveying (Trees 2, 3 and 4).

Note: Trees under these categories are trees that should be a material consideration in the development process; the subcategories are intended to reflect arboricultural, landscape and cultural values respectively.

- 4.3 There was 1 (one) group of trees immediately adjacent to the site which have been categorised as low grade 'C' grade (Group 1).
- 4.4 For more details of the existing tree stock, refer to the Tree Survey Schedule (appended at CB1).

# 5.0 TREE PRESERVATION ORDER/CONSERVATION AREA

5.1 Following consultation with the London Borough of Camden CBA Trees has been made aware that the site is not located within a Conservation Area and none of the identified trees are covered by an existing Tree Preservation Order.

# 6.0 PROPOSED TREE RETENTION AND TREE LOSS

- 6.1 In accordance with the recommendations contained within BS5837:2012, an experienced arboriculturist has assessed the requirements for tree protection and the Root Protection Area (RPA) (appended at CB2). The implications of the proposed development are detailed below, along with any mitigating measures to ensure the retention of these trees.
- 6.2 As part of the assessment, dimensions have been scaled from the proposed development drawing prepared and modified, to include the relevant Tree Survey data and the information as shown on plan CBA10696.02B TPP, appended at CB3.
- 6.3 No existing trees will be lost to facilitate the development as proposed.

# 7.0 SUMMARY OF ARBORICULTURAL IMPLICATIONS

7.1 The following summary of implications relates to only those trees which will require mitigation measures to allow for construction operations. Trees and groups not listed below can be fully protected in accordance with BS5837:2012 as indicated on Plan CBA10696.02B TPP.

Tree No.	Species	BS 5837:2012 Cat	Potential cause of harm	Implication	Mitigation
Grp 1	Lime	С	RPA encroachment	<ul> <li>Root loss (physiological harm)</li> </ul>	<ul> <li>Excavation under arboricultural supervision.</li> </ul>
1	Lime	В	RPA encroachment	<ul> <li>Root loss (physiological harm)</li> </ul>	<ul> <li>Very minor infringement into RPA, considered insignificant. However adjacent excavation to be undertaken under arb supervision.</li> </ul>
2	Sycamore	С	RPA encroachment	<ul> <li>Root loss (physiological harm)</li> </ul>	<ul> <li>Excavation under arboricultural supervision.</li> </ul>
3	Cherry	С	RPA encroachment	<ul> <li>Root loss (physiological harm)</li> </ul>	<ul> <li>Excavation under arboricultural supervision.</li> </ul>

# 7.2 Group 1 and Trees 2 and 3:

Group 1 is a group of lime located within a private rear garden adjacent to the development site. Development is proposed within its theoretical RPA as shown on CBA Trees Tree Protection Plan (CBA10696.02B TPP). CBA Trees has reviewed the situation closely and identified the following:

- I. Trial trenches (see 3.2 above) and LBH site investigations indicate no shallow root encroachment. Careful excavation according to the enclosed methodologies, and under arboricultural supervision can ensure limited impact.
- II. Group 1 are poor quality pollard lime in apparent decline, with observable decay at pollard points. Trees unlikely to be laying down exploratory roots and re-pollard in near future is advisable.
- III. Trees 2 and 3 are low value and quality with limited landscape value, being suppressed by Tree 1.

# 7.3 Tree 1:

Tree 1 is a significant lime, prominent in the street scene and likely to contribute to local amenity for some time. Development is proposed within its theoretical RPA as shown on CBA Trees Tree Protection Plan (CBA10696.02B TPP). CBA Trees has reviewed the situation closely and identified the following:

- I. Trial trenches (see 3.2 above) and LBH site investigations indicate no shallow root encroachment.
- II. However due to its relative high value in the street scene, maturity and size, it is likely to have laid down significant roots deeper than 1000mm. Therefore, no deep excavation is proposed in this area.

# 8.0 PRE-COMMENCEMENT SITE MEETING

8.1 It is recommended that a pre-commencement site meeting should be held prior to any works commencing on site to agree all approved processes with the arboricultural consultant, the construction personnel and the local authority. This meeting could be used to formally agree the methods of work, position of site offices, material storage, compounds, parking and tree protection measures prior to commencement of the development and the associated clearance work.

# 9.0 ADDITIONAL ARBORICULTURAL ADVICE FOR SITE PERSONNEL

- 9.1 To provide site personnel with additional information regarding the requirements of Tree Protection, a leaflet, appended at CB4 shall be issued to all staff at the time of their site induction. Spare copies of this leaflet shall be available in the site office as replacements.
- 9.2 In order to inform site personnel of the purpose of the barriers, information notices shall be fixed to the barriers at 5m intervals. These notices shall be of all-weather construction and shall be in the form of the specimen provided at appendix CB4 and replaced as and when necessary.

# 10.0 TREE PROTECTION MEASURES

#### 10.1 Reasons for Tree Protection

The correct and timely installation and maintenance of tree protection measures is the most important action necessary to ensure retained trees, groups, woodlands and hedgerows on and adjacent to the site, remain unaffected by development operations. Exclusion of construction activity from the outset of site preparation will ensure those trees identified for retention are maintained in a safe and healthy condition.

Although aerial parts of the tree, trunk, branches and twigs are obvious, extensive and irreparable damage can be caused to the roots and rooting environment without any immediately noticeable effect. Severance of large roots in close proximity to the stem can result in the immediate loss of stability and/or rapid death whilst damage to more distal parts of the root system or rooting environment will result in a slow decline in tree health over a period of several years, resulting in premature loss.

#### 10.2 Damage to Trunks Stems and Branches

Impact damage to the crown of the tree can result in the loss of leaves which produce starch and sugars (carbohydrates) and a reduction in the visual amenity which established trees provide. These carbohydrates are necessary for maintaining all biological functions within the tree, including growth, reproduction and defence. Extensive crown damage will reduce the tree's ability to produce carbohydrates and increase physiological stress on the tree.

The bark protects the underlying vascular tissue and cells responsible for growth from drying, disease and decay. Bark is loosely attached to the underlying tissue and can be easily damaged or removed through direct contact. It is particularly susceptible to damage when trees are young or in early spring following the onset of growth.

Impact damage which removes bark, results in dysfunction of the underlying vascular tissue preventing transport of water, mineral nutrients and carbohydrates to parts of the tree to which they are connected. If damage to the bark extends around the whole circumference, the root, branch or trunk the section beyond the damage will be killed.

Branches which are either broken or are torn from the trunk of the tree, create wounds which are prone to colonization by wood destroying organisms. These organisms cause internal decay, which result in future tree failure and premature loss.

#### 10.3 Purpose of Tree Protection


All site operations will be planned, implemented and supervised so as to prevent the following:

- Root Severance
- Damage to the bark, branches and trunks
- Compaction of the soil within the Construction Exclusion Zone
- Alterations in soil level
- Soil contamination by phytotoxic materials such as herbicides, petrol, oils, diesel, cement and concrete washings or other construction additives

#### 10.4 *Tree Protection*

Whilst in-situ, existing boundary treatments will act as sufficient tree protection for Group 1 and Trees 1-3. However, immediately prior to wall demolishment, trees will be protected by installing the following protective barrier (shown on next page) as indicated on Tree Protection Plan CBA10696.02B TPP, appended at CB3. The barrier is to comprise of a vertical and horizontal framework, well braced to resist impacts, with vertical tubes spaced at a maximum interval of 3m. Onto this, weldmesh panels should be securely fixed with wire or scaffold clamps.

### Figure 1: Protective Barrier

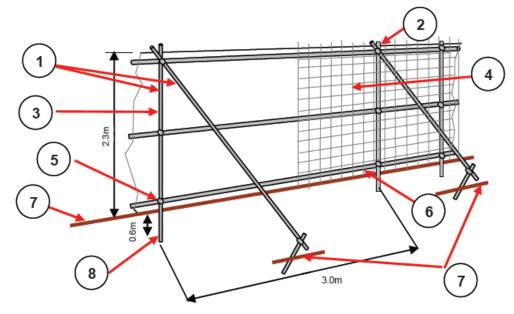

- 1. Standard scaffold poles
- 2. Uprights to be driven into the ground
- 3. Panels secured to uprights with wire ties and where necessary standard scaffold clamps
- 4. Weldmesh wired to the uprights and horizontals
- 5. Standard clamps
- 6. Wire twisted and secured on inside face of barriers to avoid easy dismantling
- 7. Ground level
- 8. Approximately 0.6m driven into the ground

Example of protective barrier:



The area within the CEZ will be regarded as **sacrosanct**, and no storage of materials or construction access may be permitted within it without written approval of the local authority.

# 11.0 EXISTING SERVICES

- 11.1 No information has been provided on the location and size of existing services.
- 11.2 Cabling will only be recovered from beneath a CEZ where it is located in ducting, and can be removed by winching from an existing service manhole beyond the CEZ.

11.3 Service pipes and ducts, where they are located within the CEZ or RPA of retained trees, will be made redundant either by pipe bursting or by filling with an inert material such a foamed concrete.

# 12.0 AVOIDING DAMAGE TO STEMS AND BRANCHES

12.1 Care shall be taken when planning site operations, to ensure that wide or tall loads, or plant with booms, jibs and counterweights can operate without coming into contact with retained trees. Such contact could result in serious damage to them, and might make their safe retention impossible. Consequently, any transit or traverse of plant in close proximity to trees, will be conducted under the supervision of a banksman, in order to ensure adequate clearance from trees is maintained at all times.

# 13.0 VEHICULAR MOVEMENTS

13.1 There shall be no vehicular plant movement within the RPA of any retained tree/group.

# 14.0 SITING OF TEMPORARY OFFICES, TOILETS AND MATERIAL STORAGE COMPOUNDS

- 14.1 It is anticipated that all storage of materials and deliveries shall avoid unnecessary damage to tree roots.
- 14.2 The locations shall be agreed in writing with the local authority prior to the commencement of works on site, and will remain in only those agreed locations throughout the construction phases. If an alternative location is required, this must be agreed in writing with the local authority. This will also include the delivery; storage and movement of all essential facilities, as well as aspects such as temporary contractor vehicle parking and site location of chemical mixing (e.g. concrete). All such locations will be outside of the RPAs, and avoid areas where 'run off' of chemicals may flow into RPAs.

#### 14.3 Site Huts

All site huts (if required) that are to be situated on ground that is not existing hard surfacing, shall have appropriate footings or be situated on a temporary surface, which will aid in reducing the potential for compaction of the ground, where they are in close proximity to the existing tree protective barrier line. Site huts can be used as part of the protective barrier boundary, and in some cases, can be beneficial where installation does not conflict with the aerial parts of the tree.

If it is proposed that site huts, ground protection or stores are to be located within the RPA of retained trees for more than 3 months, a temporary irrigation and aeration system will be installed to ensure that the rooting environment is maintained in a good condition. The system will included with a compressible layer of composted wood chip or forest bark over a geotextile separation layer, on which ground protection or

site huts can be placed. Watering will depend on permeability of the soil, weather conditions and the extent of the area covered, but should include weekly watering from April to September, when no rainfall has occurred for more than four consecutive days.

#### 14.4 Material Storage

This shall be accommodated outside of the CEZ, particularly to avoid harmful spillages of fuel, or phytotoxic substances that may damage the health of retained trees.

# 15.0 GENERAL CONSIDERATIONS WITHIN AND OUTSIDE THE CONSTRUCTION EXCLUSION ZONE

- 15.1 Inside the CEZ formed by the protective barriers and ground protection measures, the following prohibitions shall apply:
  - No construction activity will occur within the CEZ unless otherwise stated in this report, or agreed in writing with the local authority prior to the specific activity taking place.
- 15.2 In addition to the above, further precautions are necessary adjacent to trees outside the CEZ:
  - Materials, which will contaminate the soil e.g. concrete mixing, diesel oil and vehicle washings, shall not be discharged within 10 metres of the tree stem. This should take into consideration the topography of the site and slopes, to avoid materials such as concrete washings running towards trees.
  - Fires shall not be lit in a position where their flames can extend to within 5 metres of foliage, branches or trunk. This will depend on the size of the fire and the wind direction.
  - Notice boards, telephone cables or other services shall not be attached to any part of the tree. (See appendix CB4 Common Causes of Damage During Construction Works)

# 16.0 UTILITY SERVICE CONNECTIONS

16.1 Details of service location proposals have not been forwarded to CBA Trees at the time of compiling this assessment. It is however assumed, given the location of the trees, that services will be installed outside the root protection areas of retained trees, and connected to the existing where practicable, this will avoid disturbance of tree roots and ensure their healthy retention.

# 17.0 FOUNDATION DESIGN AND CONSTRUCTION

- 17.1 Building foundations are proposed within the theoretical RPA of Trees 1, 2, 3 and Group 1.
- 17.2 As noted earlier and as informed by exploratory trial trenches on site it is anticipated that no significant roots will be encountered, however all excavation within RPA's will be undertaken under arboricultural supervision.

# 18.0 EXCAVATION WITHIN IDENTIFIED RPA's

- 18.1 All excavation in the top 1500mm must be carried out carefully using spades, forks and trowels, taking care not to damage the bark and wood of any roots. Specialist tools for removing soil around roots using compressed air may be an appropriate alternative to hand digging, if available. All soil removal must be undertaken with care to minimise the disturbance of roots beyond the immediate area of excavation. Where possible, flexible clumps of smaller roots, including fibrous roots, should be retained if they can be displaced temporarily or permanently beyond the excavation without damage. If digging by hand, a fork should be used to loosen the soil and help locate any substantial roots. Once roots have been located, the trowel should be used to clear the soil away from them without damaging the bark.
- 18.2 Beyond 1500mm (maximum excavation anticipated at 3000mm), mechanical excavation may be practicable for safety reasons, but all operations must be undertaken with a straight edged bucket and under arboricultural supervision.
- 18.3 Exposed roots to be removed should be cut cleanly with a sharp saw or secateurs 10-20cm behind the final face of the excavation. Roots temporarily exposed must be protected from direct sunlight, drying out and extremes of temperature by appropriate covering. Roots greater than 2.5cm in diameter should be retained where possible. Roots 2.3-10cm in diameter should only be cut in exceptional circumstances. Roots greater than 10cm in diameter should only be cut after consultation with the appropriate supervisory officer.

# 19.0 SITE MONITORING AND SUPERVISION

- 19.1 It is recommended that on-going arboricultural site monitoring takes place for the duration of the proposed development, to be carried out by a qualified and experienced arboriculturist at pre-determined and agreed time intervals, and governed by the type, timing, location and intensity of site works.
- 19.2 If Conditioned, it will take the form of regular inspections (to be agreed, but at least one visit per month during the construction phase of the development is advised, together with additional visits to supervise works with the CEZ of retained tree/s), the aim of the visits is to maintain on-going liaison with all personnel involved in the site development, the local authority and its Tree Officer.

- 19.3 Any defects requiring rectification shall be notified to the Contractor/Site Manager and the client.
- 19.4 In addition, a site logbook for tree protection measures is kept to record all stages of the development from the erection of the protective barriers, right through to the completion of the project. This will be made available to the arboricultural consultant and the London Borough of Camden if required, to show evidence of continuous site monitoring.

#### Example pro-forma

Date	Activity	Checked	Comments/ damage noted	By whom	Signed	Action taken
	Erection of protective barriers					
	Inspection of protective barriers					

19.5 The London Borough of Camden Tree Officer (or appropriate representative) will have agreed access to the site, and will report on any problem areas directly to the developer's retained arboriculturist, who will then visit the site and make recommendations to the developer on how best to rectify the situation and ensure the implementation.

# 20.0 REPORT DAMAGE TO TREES AND TREE PROTECTION BARRIERS

- 20.1 Should any damage be caused to trees noted for retention, either by the above works or as the result of any other action, the damage should be reported to the site supervisor immediately. The site supervisor shall report up the chain of responsibility to the retained consultant arboriculturist, or in the absence of such an appropriately qualified arboriculturist, to enable remedial measures to be implemented as necessary and as agreed with the local authority.
- 20.2 Should protective barriers become damaged so as to impair its function in protecting trees, all work shall cease in the vicinity of the damage, until the barrier has been returned to standard.

# 21.0 CONCLUSIONS

- 21.1 The approved development proposals for the construction of a new detached property to the rear of 133-137 Brecknock Road have been assessed broadly in accordance with BS5837:2012 *"Trees in Relation to Design, Demolition and Construction Recommendations"*.
- 21.2 It is our opinion that the trees identified for retention can be afforded due respect and provided adequate protection, ensuring their safe and healthy retention during the development process.

# 22.0 CONTACT LIST

- 22.1 It is suggested that points of contact and lines of communication are established prior to commencement of the works on site including: -
  - Arboricultural Consultant
  - Project Architect
  - Highways Engineer
  - Structural Engineer
  - Drainage Engineer
  - Landscape Architects
  - London Borough of Camden's Tree Officer
  - London Borough of Camden's Planning Case Officer
  - Site Supervisor and Foreman
- 22.2 It is advised that the site supervisor establishes their own listing of contact details at the pre-start site meeting, and displays this in their office for general use as necessary.







# TREE SURVEY NOTES

This Tree Survey has been undertaken within the recommendations of British Standards 5837:2012 and current arboricultural best practice.

- > Each tree has been numbered and, where instructed, for future identification on site, has been tagged using small durable metal or plastic tags.
- > Due to variations of existing ground levels through the site, height dimensions are estimated and are given in metres. Accurate heights, measured with the aid of optical instruments can be provided where instructed.
- Trunk/stem diameters are measured in mm at 1.5 metres above ground level, using a standard measuring tape as defined by British Standards, unless otherwise stated.
- Estimated branch spread is taken in metres from the centre of the trunk, at the four cardinal points of a compass, to achieve an accurate representation of the crown shape which will be recorded on the tree survey plan.
- > An assessment of a tree's age classification is made in terms of its maturity within the site's landscape and defined as:
  - Y = young trees
  - SM = semi-mature trees
  - EM = early mature trees
  - M = mature trees
  - OM = over-mature trees
- > An assessment of a tree's physiological condition is defined as:
  - Good = fully functioning biological system showing average vitality i.e. normal bud growth, leaf size, crown density and wound closure
  - Fair = fully functioning biological system showing below average vitality i.e. reduced bud growth, smaller leaf size, lower crown density and reduced wound closure
  - Poor = a biological system with limited functionality showing significantly below average vitality i.e. limited bud growth, small and chlorotic leaves, low crown density and limited wound closure
  - Dead = dead
- An assessment of a tree's structural condition is defined as:
  - Good = no significant structural defects
  - Fair = structural defects which could be alleviated through remedial tree surgery or management practices
  - Poor = structural defects which cannot be alleviated through tree surgery or management practices
  - Dead = dead

> An assessment of a tree's future life expectancy is defined as: <10, 10+, 20+ or 40+ years.

#### **Categorisation of Trees**

The category for each tree is assessed using the recommendations of BS5837:2012. The assessment has not considered any site-specific development proposals, but will have considered any changes on or off-site which may have an effect on the conditions surrounding the surveyed trees.

The trees have been classified into one of the following categories (and one or more sub-categories [this will however not increase the value of the tree]) and are indicated on the associated drawings by colours as indicated.

Category U				Identification colour on plan
Trees in such a condition that they cannot realistically be retained as living trees in the context of the current land use for longer than 10 years	DARK RED			
Category A	1 – Mainly arboricultural values	2 – Mainly landscape values	3 – Mainly cultural values	Identification colour on plan
<b>Trees of high quality</b> with an estimated remaining life expectancy of at least 40 years	Trees that are particularly good examples of their species, especially if rare or unusual; or those that are essential components of groups or formal or semi-formal arboricultural features (e.g. the dominant and/or principal trees within an avenue	Trees, groups or woodlands of particular visual importance as arboricultural and/or landscape features	Trees, groups or woodlands, of significant conservation, historical, commemorative or other value (e.g. veteran trees or wood-pasture)	LIGHT GREEN
Category B	1 – Mainly arboricultural values	2 – Mainly landscape values	3 – Mainly cultural values	Identification colour on plan
Trees of moderate quality with an estimated remaining life expectancy of at least 20 years	Trees that might be included in category A, but are down-graded because of impaired condition (e.g. presence of significant though remediable defects, including unsympathetic past management and storm damage), such that they are unlikely to be suitable for retention for beyond 40 years; or trees lacking the special quality necessary to merit the category A designation	Trees present in numbers, usually growing as groups or woodlands, such that they attract a higher collective rating than they might as individuals; or trees occurring as collectives but situated so as to make little visual contribution to the wider locality	Trees with material conservation value or other cultural value	MID BLUE
Category C	1 – Mainly arboricultural values	2 – Mainly landscape values	3 – Mainly cultural values	Identification colour on plan
<b>Trees of low quality</b> with an estimated remaining life expectancy of at least 10 years, or young trees with a stem diameter below 150mm	Unremarkable trees of very limited merit or such impaired condition that they do not qualify in higher categories	Trees present in groups or woodlands, but without this conferring on them significantly greater collective landscape value; and/or trees offering low or only temporary/transient landscape benefits	Trees with no material conservation or other cultural value	GREY

Clients are advised that Tree Surveys are a basic data collection exercise and record of tree condition at the time of survey. This will identify any visible signs of ill-health or major defects, advising a further detailed investigation where appropriate. This will most often take the form of a request for either "*full ground level inspection*" or "*climbing inspection required*". There may also be a further reference to the need for "*decay detection equipment*" to aid diagnosis. A tree survey does not include a comprehensive schedule or specification of remedial tree works, but may contain a guide to the work which might be undertaken by a prudent tree owner, purely for reasons of health and safety.

A Tree Survey should not be confused with a Tree Inspection or Arboricultural Implication Assessment, which are totally separate exercises.

CBA10696

		TREE SURVEY REPORT (BS5837:2012)
	Site:	092: 133-137 Brecknock Road
	Date:	16 December 2016
	Consultant:	Dominic Poston F.Arbor.A. MICFor, CEnv, Prof Dip (RFS), BSc (Hons), HND
<b>D</b> A Trees	Tagged:	No

Notes:-

1. It may be advised that some trees should have the ivy removed to enable a re-survey to be carried out. This would also alleviate the tree from becoming suppressed; carrying additional weight that increases the chance of windthrow due to a larger dense crown area; and only receiving restricted light. Unless otherwise stated, in order to prevent regrowth, it is only necessary to remove a 300mm section of ivy and clear around the base.

2. It may be advised that it was only possible to estimate the diameter of some trees because of ivy smothering, dense vegetation, or trees located off-site with no access.

3. The estimated remaining contribution in years, and the tree grading category have been calculated for the current situation and may alter where further investigation works are advised.

4. Some trees or groups may have been given an interim grade. The reason for the interim grading is addressed in the timescales given as this may have a bearing on health and safety and/or any development proposals.

5. Tree Groups have been assessed with estimated and representative data.

6. This is not a Tree Works Schedule. Any preliminary management recommendations are listed in the interests of health and safety and should be carried out by a prudent tree owner.

7. Any management recommendations are suggested for reasons of health and safety only, regardless of development proposals at this stage. However, the defects requiring remedial tree surgery are by their very nature potential wildlife habitats, including protected species which needs consideration prior to any tree surgery works commencing.


#### TREE PRESERVATION ORDER/CONSERVATION AREA:


CBA Trees has been instructed to investigate whether trees on or adjacent to the site are protected by a Tree Preservation Order or located within a Conservation Area. The Local Authority has confirmed that none of the trees are protected by Tree Preservation Order and the site does not lie within a Conservation Area.

Tree No	Species	H't (m)	Single/ Multi- Stemmed (S or MS)	Stem Diam (mm)	N	Spr	nch read n) S	w	N	A (I	Crown GL n) S	w	Life Stage	Physio- logical Condition	Structural Condition and General Observations	Preliminary Management Recommendations	Est. Rem. Contrib. (Yrs)	Cat
1	Lime <i>Tilia spp</i>	10	S	350	5.0	3.0	5.0	5.0	2.5	2.5	2.5	2.5	Μ			Sever and remove ivy and reinspect	40+	B1 Interim
	Common Sycamore Acer pseudoplatanus	9	S	240	2.0	5.0	5.0	1.0	3.0	3.0	3.0	3.0	SM		Fair Offsite tree Suppressed by T1 Measurements estimated due to no access	Gain access and reinspect	20+	C2 Interim

#### CBA10696

Tree No	Species	H't (m)	Single/ Multi- Stemmed (S or MS)	Stem Diam (mm)	N	Spr (r	n)	N	N	AC (r	n)	w	Life Stage	Physio- logical Condition	Structural Condition and General Observations	Preliminary Management Recommendations	Est. Rem. Contrib. (Yrs)	Cat
	Flowering Cherry Prunus spp	8	S	100	3.0	4.0	3.0	2.0	3.0	3.0	3.0	3.0	Y	Fair	Fair Offsite tree Measurements estimated due to no access	Gain access and reinspect	20+	C2 Interim
	Hazel Corylus spp	7	S	50	2.5	2.5	2.5	2.5	1.0	1.0	1.0	1.0	Y	Good	Good Measurements estimated due to no access	Gain access and reinspect	40+	C1 Interim
Grp 1	Lime <i>Tilia spp</i>	10	S	280	4.0	3.0	3.0	4.0	2.5	2.5	2.5	2.5	Μ	Fair	Poor Two trees previously pollarded Encroaching on adjacent building Decay evident at pollard head Measurements estimated due to no access	Recommend re-pollard	20+	C2

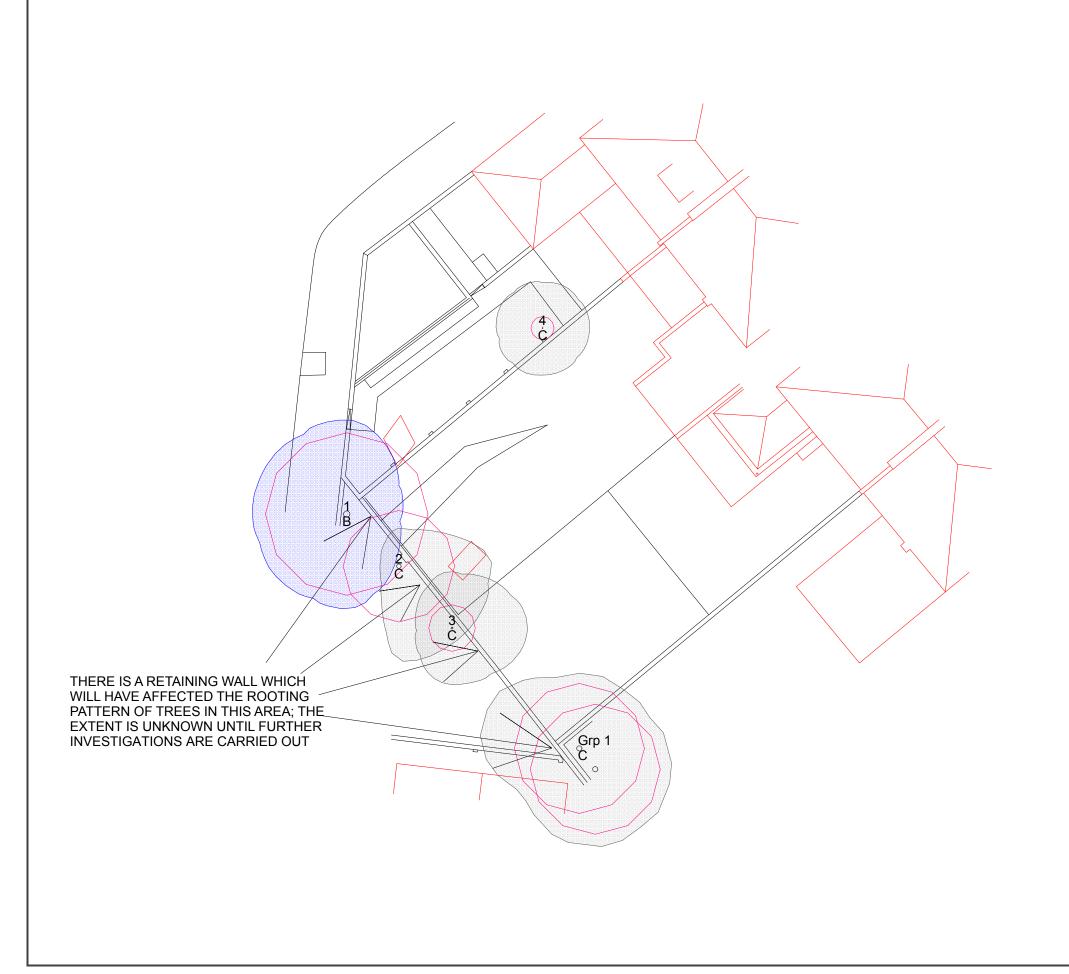

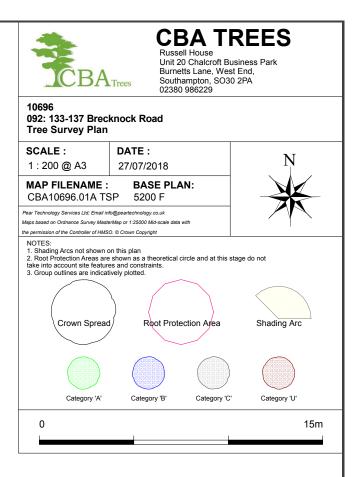



CBA10696

		BS5837:2012 TREE ROOT PROTECTION AREA SCHEDULE
	Site:	092: 133-137 Brecknock Road
CDA.	Date:	16 December 2016
DATrees	Consultant:	Dominic Poston F.Arbor.A. MICFor, CEnv, Prof Dip (RFS), BSc (Hons), HND

#### Notes:

1. This is an assessment of the Root Protection Area (RPA) required, based on the individual tree data collected and Section 4.6.1 of BS5837:2012.

2. At this juncture this document is for your sole guidance and ongoing discussions purposes only and is not intended for general circulation, as it assumes that all but the 'U' trees will be retained, which clearly may not be the case.

3. For all single stem trees with a stem diameter greater than 1250mm, and multi-stem trees with a stem diameter greater than 1500mm, the calculated RPA has been capped at 707m2 in accordance with Section 4.6.1 of BS5837.2012.


#### TREE PRESERVATION ORDER/CONSERVATION AREA:

CBA Trees has been instructed to investigate whether trees on or adjacent to the site are protected by a Tree Preservation Order or located within a Conservation Area.

The Local Authority has confirmed that none of the trees are protected by Tree Preservation Order and the site does not lie within a Conservation Area.

Tree No	Species	Category	Single/ Multi-Stemmed (S or MS)	Stem Diameter (mm)	Initial Linear Root Protection Distance (Radius m)	Root Protection Area (m2)
1	Lime Tilia spp	B1 Interim	S	350	4.20	55.42
	Common Sycamore Acer pseudoplatanus	C2 Interim	S	240	2.88	26.06
	Flowering Cherry Prunus spp	C2 Interim	S	100	1.20	4.52
4	Hazel Corylus spp	C1 Interim	S	50	0.60	1.13
Grp 1	Lime Tilia spp	C2	S	280	3.36	35.47



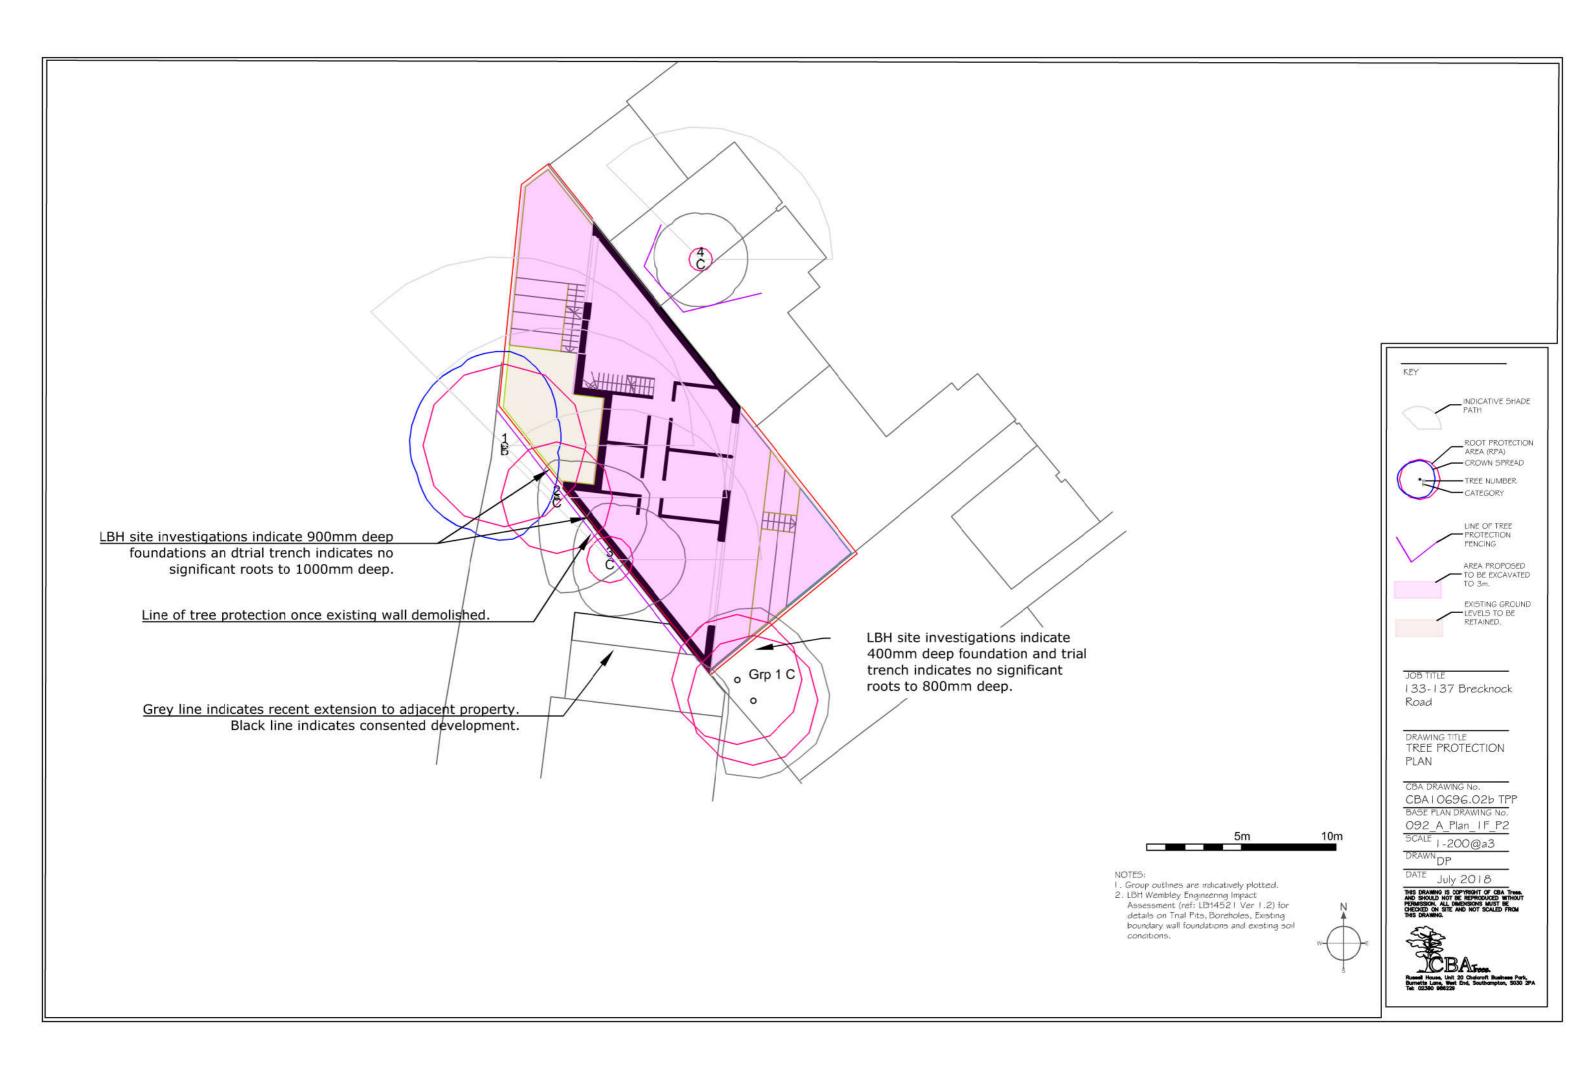





### SUMMARY OF

## TREE PROTECTION MEASURES

#### Introduction

This leaflet shall be issued to all site personnel as part of their induction briefing.

It describes in summary form, the precautions that site personnel shall at all times follow, to ensure that the existing trees on the site come to no harm.

The precautions described are neither arbitrary nor reducible and must be adhered to in full.

These precautions are necessary because unprotected trees are very vulnerable to damage during demolition and construction works.

Furthermore, many of the trees on the site are under LEGAL PROTECTION and damaging them can result in heavy fines.

Two common misconceptions about trees:

**MYTH:** Trees have deep taproots and so shallow excavations will not harm the tree.

**FACT:** 90% of all tree's roots are found in the top 600mm of soil; all excavations near to trees are likely to cause root damage which can kill the tree.

**MYTH**: Trees will quickly heal over any bark wound, with no ill effect.

**FACT:** Bark wounds take years to heal and larger ones never do; missing bark can lead to disease and even the death of the tree.

#### Tree Protection

All trees adjacent to unsupervised work areas have been protected by fencing.

This fencing must be respected at all times and no attempts shall be made to damage, bypass or ignore it.

In areas designated for supervised working, no works shall be undertaken without the supervisor being present or without him/her issuing a "carry on" chit.

#### Prohibitions Adjacent to Trees

Inside the exclusion area of the tree protection, the following prohibitions shall apply.

- No digging or scraping
- No storage of plant or materials
- No vehicular access
- No fire lighting
- No handling, discharge or spillage or any chemical substance
- No water-logging

In addition to the above, further precautions shall be taken near to trees.

- A 10m separation distance shall be observed between trees and any substance injurious to their health, including fuels, oil, bitumen, cement (including washings) builders' sand, concrete mixing and other chemicals.
- No fire shall be lit such that flames come within 5m of any foliage; this shall be taken to mean a fire separation distance to the leaves of 20m.

#### Avoiding Damage to Stem and Branches

Care shall be taken when planning site operations to ensure that wide or tall loads or plant with booms, jibs and counterweights, can operate without coming into contact with trees.

Consequently, any transit or traverse of plant in proximity to trees shall be conducted under the supervision of a spotter to ensure that adequate clearance is at all times maintained.

In some circumstances, it may be impossible to achieve this, necessitating the pruning of the tree.

If this is necessary, a specialist team shall be called in following referral to the project Arboriculturist.


No tree pruning shall be undertaken by demolition or construction personnel.

#### Asking for Help

If you see any damage to a tree or its protective fencing, or if you need a tree pruning for plant clearance, contact **CBA Trees** as follows:

Office Telephone: 02380 986229

REMEMBER: ALL TREE DAMAGE IS AVOIDABLE – SO AVOID IT!

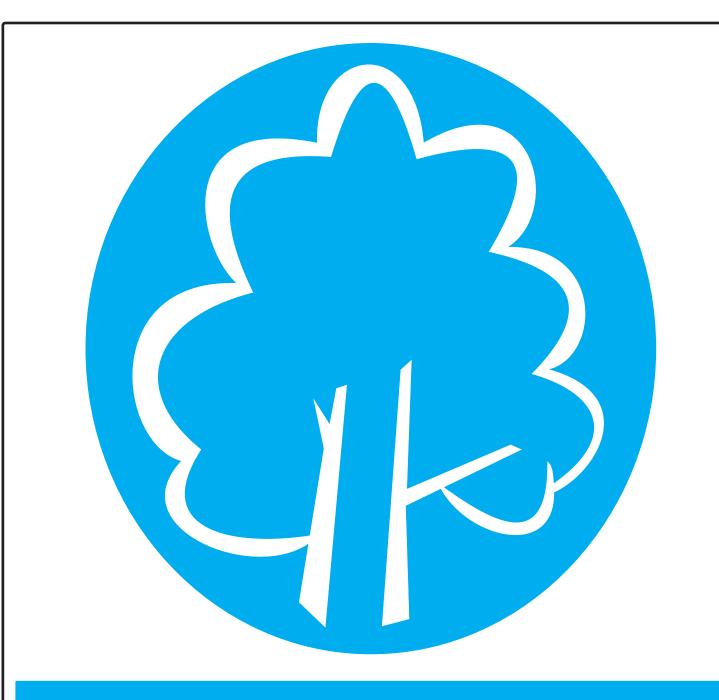

PROTECTIVE FENCING. THIS FENCING MUST BE MAINTAINED IN ACCORDANCE WITH THE APPROVED PLANS AND DRAWINGS FOR THIS DEVELOPMENT.




# TREE PROTECTION AREA KEEP OUT !

(TOWN & COUNTRY PLANNING ACT 1990) TREES ENCLOSED BY THIS FENCE ARE PROTECTED BY PLANNING CONDITIONS AND/OR ARE THE SUBJECTS OF A TREE PRESERVATION ORDER. CONTRAVENTION OF A TREE PRESERVATION ORDER MAY LEAD TO CRIMINAL PROSECUTION

ANY INCURSION INTO THE PROTECTED AREA MUST BE WITH THE WRITTEN PERMISSION OF THE LOCAL PLANNING AUTHORITY

# **COMMON CAUSES OF TREE DEATH**

# The use of properly positioned protective barriers can prevent tree deaths occurring.

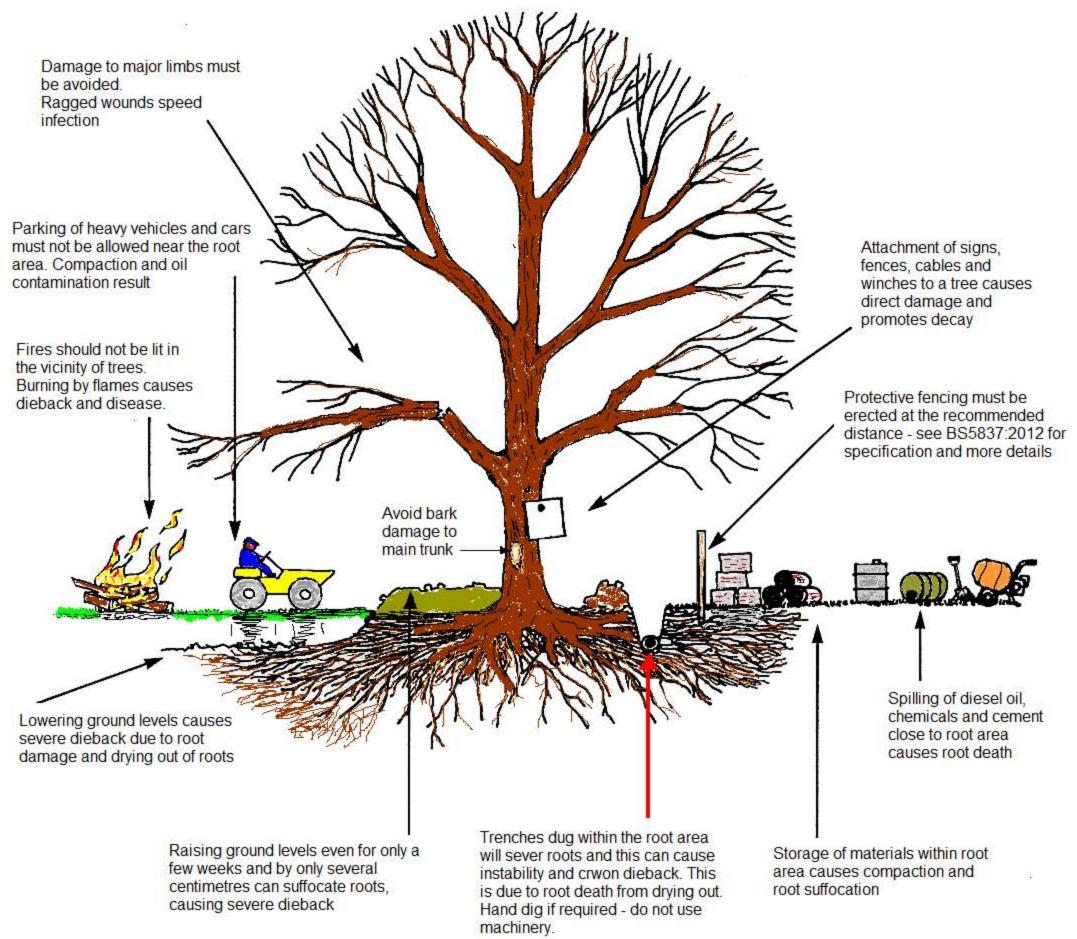





The Professional Arboricultural Consultancy

# Qualifications of Dominic Poston Senior Consultant

**Dominic Poston F.Arbor.A. MICFor, CEnv, Prof Dip (RFS), BSc (Hons), HND** has recently joined CBA Trees as a Senior Consultant and brings with him a wealth of knowledge and experience. He has over 15 years' experience of undertaking a variety of arboricultural assessments for a wide range of public, corporate and private clients.

Having attained a Bachelor of Science Degree in Horticulture, a Higher National Diploma in Landscape Management and the prestigious Royal Forestry Society's Professional Diploma in Arboriculture, Dominic is now a fellow of the Arboricultural Association, a Chartered Arboriculturist and Chartered Environmentalist and has attained Registered Consultant status with the Institute of Chartered Foresters.

He has considerable experience as an advisor to planning teams, currently acting as lead arboriculturist on three high volume (<1000units) active development sites in East Anglia as well as several smaller developments nationwide.

Dominic has appeared numerous times at planning related Public Inquiries, and also undertakes advocacy at Inquiries on behalf of Rule 6 parties. Additionally he has been instructed as an expert witness on several occasions to assist local authorities with prosecutions for offences under Tree Preservation Order legislation, and has appeared at Crown Court.