 


## ARBORICULTURAL ASSESSMENT REPORT

<b>For:</b>	<b>Client:</b>	Sedgwick International UK
	<b>Insurer:</b>	
<b>Site:</b>	<b>Policyholder:</b>	108 Greencroft Gardens Ltd
	<b>Risk Address:</b>	Flat 1 & 2 108 Greencroft Gardens, London, NW6 3PH
<b>Refs:</b>	<b>PRI Ref:</b>	
	<b>Client Ref:</b>	
	<b>Insurer Ref:</b>	Client Account

<b>Arborist Name:</b>	Ryan Ollman	<b>Date:</b>	19/09/2019
<b>Revisit</b>	Will Hinde		06/11/2019
<b>QC:</b>	Margaret MacQueen	<b>Date:</b>	11/11/2019



## **CONTENTS**

1.0 INTRODUCTION & BRIEF .....	3
2.0 LIMITATIONS.....	3
3.0 DISCUSSION AND ANALYSIS .....	4
4.0 CONCLUSIONS AND RECOMMENDATIONS.....	5
5.0 STATUTORY CONTROLS.....	5
6.0 APPENDIX 1: TREE TABLES .....	6
7.0 APPENDIX 2: SITE PLAN .....	9
8.0 APPENDIX 3: SITE PHOTOGRAPHS.....	11



## **1.0 INTRODUCTION & BRIEF**

- 1.1** Property Risk Inspection has been instructed behalf of the building insurers of the insured property. We have been advised that the insured property has suffered differential movement and damage that is considered to have been caused by trees growing adjacent to the property influencing soils beneath its foundations.
- 1.2** We have been instructed to undertake a survey of the vegetation growing adjacent to the insured property in order to provide our opinion as to whether, based on the available information, any of this vegetation is likely to be influencing soil moisture levels beneath the foundations of the property, and if so, to provide recommendations as to what tree management could be implemented to effectively prevent damage continuing.
- 1.3** The vegetation growing adjacent to the risk address has been surveyed from the ground. All distances are measured to the nearest point of the risk address unless otherwise stated.

## **2.0 LIMITATIONS**

- 2.1** Recommendations with respect to tree management are associated with the risk address as stated on the front cover of this report and following consultation with investigating engineers. The survey of trees and any other vegetation is associated with impacts on the risk address subject of this report. Matters of tree health, structural condition, and/or the safety of vegetation under third party control are specifically excluded. Third party land owners are strongly advised to seek their own professional advice as it relates to the health and stability of trees under their control.
- 2.2** Recommendations do not take account of any necessary permission (statutory or otherwise) that must be obtained before proceeding with any tree works.
- 2.3** Recommendations do not take account of any requirements for survey or mitigation relating to European or other protected species, e.g. bird nesting or bats. Land owners must obtain their own professional advice in respect of any protected species.



## **3.0 DISCUSSION AND ANALYSIS**

### **3.1 Soils, soil water and vegetation**

All vegetation requires water to live, and this water is substantially accessed from the soil within which the plants' roots grow.

If the soil is classified as a clay soil, then it will hold very much more water than sands, gravels and loam soils. As plants abstract water from the clay soil, the soil volume will 'shrink' and 'swell' during the summer as water is first removed and then added by summer rainfall. In years in which rainfall during the summer is less than the total amount of water taken from the soil by plants, shrinkage will occur. This shrinkage may remove support from building foundations, leading to cracking in the fabric of the building.

### **3.2 Vegetation management**

The control of trees, shrubs, and climbers, by removal or pruning as appropriate, are proven techniques that can control total soil water loss thereby minimising soil shrinkage and allowing repairs to proceed.

If vegetation management works are carried out promptly, then repairs can usually proceed very quickly and the duration and distress associated with the disruption that tree related subsidence brings can be minimised.

### **3.3 Third party liaison and statutory controls**

Tree roots do not respect physical or property boundaries and can travel for many metres beyond the above ground 'dripline' of the canopy of the vegetation.

The purpose of this report is to ascertain which vegetation is the most likely substantial and/or effective contributory cause of the damage witnessed to allow for liaison with third parties or with local administrative Councils as necessary.

### **3.4 Evidential framework**

The engineer has determined on a preliminary basis the damage to the property, its location and the likely mechanism of movement, and has concluded that the building failure is related to differential subsidence damage caused as a result of the action of vegetation.

Where a factual geotechnical report has been completed, this will describe the below ground foundation design, soil and geotechnical conditions, as well as any root identification where available.



## 4.0 CONCLUSIONS AND RECOMMENDATIONS

### 4.1 Recommendations

On the basis of our findings, we have considered a practical vegetation management specification.

This specification will assist in reducing the impact of the adjacent vegetation on soil moisture levels, thereby potentially stabilising foundations of the affected area of the building.

Where felling has been proposed, this will be on the basis that the vegetation in question would not respond well to a severe reduction in leaf area that would inevitably lead to decay, the development of potential hazards, and an annual or other on-going management commitment and cost.

If pruning is recommended, the specification will be designed to allow continual ease of re-pruning with a reasonable prospect of a reduction in soil water use.

### 4.2 Recommended vegetation management to address the current subsidence:

Tree No:	Species	Works Required
T1	Acer	Fell and treat stump
T2	Lilac	Fell and treat stump
T4	Lime	Fell and treat stump
T5	Poplar	Fell and treat stump
ST1	Oak	Treat stump

## 5.0 STATUTORY CONTROLS

Camden Council has confirmed that none of the implicated vegetation is subject to a Tree Preservation Order But there are Conservation Area controls.



## 6.0 APPENDIX 1: TREE TABLES





Tree No	Common Name	Age Class	Condition	Height (m)	Crown Spread (m)	Stem diam. (mm)	Dist to bldg. (m)	Roots Implicated	Pruning history	Recommendation	Tree work constraints	Notes	Owner address	Owner
T1	Acer	Mature	Fair	7.5	6	200	1	N	Subject to past management	Fell and treat stump	Access through side/rear gate		106 Greencroft Gardens London NW6 3PH	P3P
T2	Lilac	Mature	Fair	4	1.50	80	2	N	Subject to past management	Fell and treat stump	Access through side/rear gate		flat 1 & 2 108 Greencroft Gardens London NW6 3PH	PH
T3	Plum (Purple leafed)	Mature	Fair	7.5*	6*	400*	8*	N	Subject to past management	No work required	Access through side/rear gate. Obstructions sheds/greenhouses		106 Greencroft Gardens London NW6 3PH	P3P
T4	Lime	Mature	Fair	17*	8*	500*	12.4	N	Subject to past management	Fell and treat stump	Access through side/rear gate. Obstructions sheds/greenhouses		flat 1 & 2 108 Greencroft Gardens London NW6 3PH	PH



Tree No	Common Name	Age Class	Condition	Height (m)	Crown Spread (m)	Stem diam. (mm)	Dist to bldg. (m)	Roots implicated	Pruning history	Recommendation	Tree work constraints	Notes	Owner address	Owner
T5	Poplar	Mature	Fair	26*	7.0*	1150*	16*	Y	Subject to past management	Fell and treat stump	Access through side/rear gate. Obstructions sheds/greenhouses		106 Greencroft Gardens London NW6 3PH	P3P
T6	Poplar	Mature	Poor	18*	6*	800*	20*	Y	Subject to past management	No work required	Access through side/rear gate		106 Greencroft Gardens London NW6 3PH	P3P
T7	Apple	Mature	Fair	11*	6	340	12.5	N	Subject to past management	No work required	Access through side/rear gate		flat 1 & 2 108 Greencroft Gardens London NW6 3PH	PH
C1	Jasmine	Mature	Fair	3	1.0	60	2.5	N	Managed as a climber	No work required	Access through side/rear gate		flat 1 & 2 108 Greencroft Gardens London NW6 3PH	PH
ST1	Oak	N/A	DDDD	0.2	0	600	5.2	Y	Subject to past Removal	Treat stump			flat 1 & 2 108 Greencroft Gardens London NW6 3PH	PH


\* Value is estimated





## 7.0 APPENDIX 2: SITE PLAN



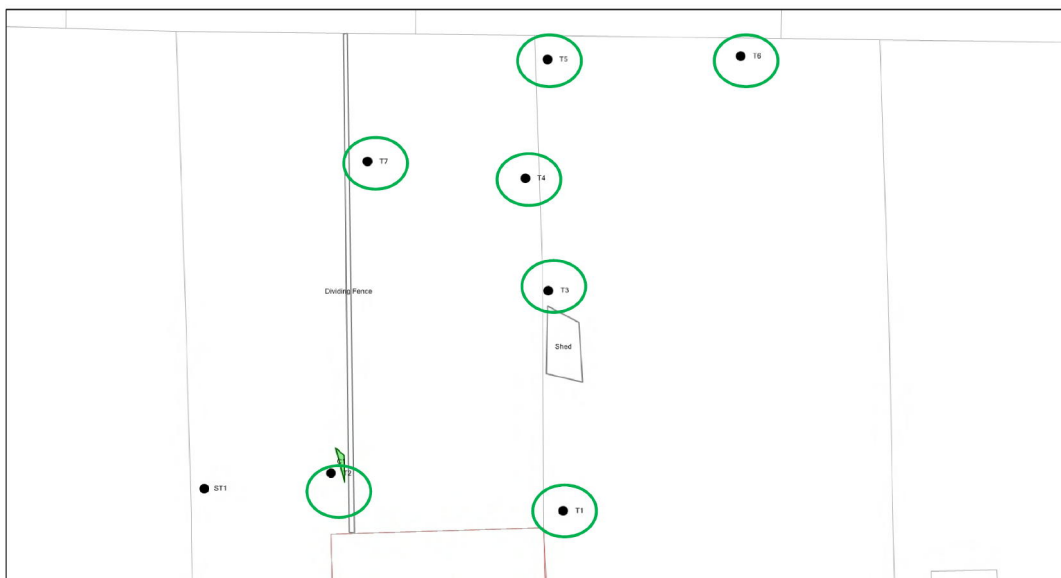

Location:	flat 1 & 2 108 Greencroft Gardens, London, NW6 3PH
Job Ref:	135710
Survey Date:	19/09/2019 - NTS
By Property Risk Inspection - Insurance Services	
Crown copyright 2016. License number 100043594	




## 8.0 APPENDIX 3: SITE PHOTOGRAPHS



	
T1 - Acer	T1 - Acer
	
T1 - Acer	T1 - Acer
	
T2 - Lilac	T2 - Lilac
	
T2 - Lilac	C1 - Jasmine
	
C1 - Jasmine	C1 - Jasmine

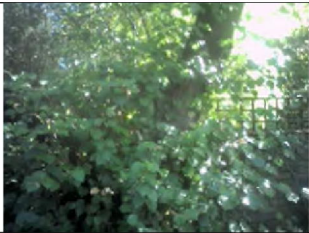

	
T3 - Plum (Purple leafed)	T3 - Plum (Purple leafed)
	
T3 - Plum (Purple leafed)	T4 - Lime
	
T4 - Lime	T4 - Lime
	
T4 - Lime	T5 - Poplar
	
T5 - Poplar	T5 - Poplar
	
T5 - Poplar	T5 - Poplar

 
 


	
T6 - Poplar	T6 - Poplar
	
T7 - Apple	T7 - Apple
	
T7 - Apple	T7 - Apple
	
T7 - Apple	T7 - Apple
	
T7 - Apple	ST1 - Oak



# Property Risk Inspection

L I M I T E D



Property Services



Insurance Services



Planning Services



Consumer Services



Data Services