### PROPOSED SCOPE OF WORK

The following captures headline proposals only and should be read in conjunction with the Heritage, Design & Access Statement (HDAS) for a more detailed explanation. Each item is numbered in the HDAS and corresponds with the numbers noted on the proposed plans and elevations.

Item 1 - Roof Repairs

1

2

3

4

5

6

8

9

<del>10</del>

11

12

13

14

Proposed Works: Existing rooflight to be reduced in size to increase clearance between upstand and parapet wall to introduce suitable flashing detail in order to address suitable flashing detail.

Item 2 - Parapet Repairs

Item 6 - Front Parapet Wall

Item 10 - Drainage Repairs

Item 11 - Internal Masonry

Item 7 - Render Repairs / Replacement

Item 8 - Decoration of Previously Painted Masonry

Item 3 - Repairs to Concrete Coping

Proposal Works Local repairs required to third floor parapet to adress failing lead flashing, pointing and spalled brickwork all of which are contributing to internal water ingress.

Proposed Works: Local repairs required to third floor parapet concrete coping to address a number of defects within the concrete, including large cracks, exposed reinforcement and DPC.

Item 4 - Timber Window Repairs

Proposed Works - Local repairs needed to timber window elements to address failed or failing components.

Item 5 - Stucco Render Repairs

Proposed Works: Rebuild existing stuccy render detailing across princiapl facade to address various areas of failed, spalled and genearlly degraded render detailing.

Proposed Works: Bituminous waterproof covering to be reapplied to front gutter course and parapet coping to reinstate waterproofing coating.

7 Proposed Works: Re-render principal elevation from basement to first floor level to addres large areas of saturated render.

Proposed Works: Decorate all previously painted external surfaces to address poor decorative condition and restore the building's appearance.

Item 9 - Brick Repairs Adjacent Front Door

Proposed Works: Masonry wall adjacent front door should be rebuilt to match original profile and affected surfaces re rendered.

Proposed Works: Repair defective below ground drainage and introduce new hardstanding and drainage to light well. Works are vital to address excess ground water and halt ongoing movement of the building.

Proposed Works: Rebuild failing pier brickwork beneath modern concrete lintel. Orginal bricks and surrounding plaster are saturated and failing underneath modern engineering bricks.

Item 12 - External Staircase Repairs

Proposed Works: Access stairs to lightwell should be repaired including steelwork and finishes.

Item 13 - Corbelled Brickwork FoundationsProposed Works: Reinstate missing brickwork from foundations - assumed to have been removed in the past for services.


Item 14 - First Floor Balcony

Replace failed asphalt waterproofing to first floor balcony. Further investigations required to establish extent of corrosion to cast iron cantilevered members.

# Ligthwell 33 Tavistock Square (out of scope) 32 Tavistock Square (out of scope)

## **EXISTING LIGHTWELL**

Scale 1:100 @ A3

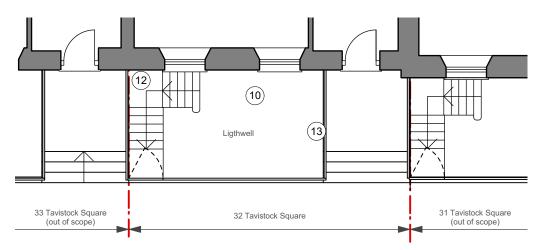

### PROPOSED LIGHTWELL

Scale 1:100 @ A3

# **EXISTING & PROPOSED LIGHTWELL**

0 2.5 5.0 7.5 10.0 12.5 M

Scale 1:100 @ A3

