 


ARBORICULTURAL ASSESSMENT REPORT

For:	Client:	
	Insurer:	Zurich
Site:	Policyholder:	
	Risk Address:	70-75 Auden Place, London, NW1 8ND
Refs:	PRI Ref:	
	Client Ref:	
	Insurer Ref:	

Arborist Name:	Will Hinde	Date:	10/05/2021
QC:	Margaret MacQueen	Date:	11/05/2021



CONTENTS

1.0 INTRODUCTION & BRIEF	3
2.0 LIMITATIONS.....	3
3.0 DISCUSSION AND ANALYSIS	4
4.0 CONCLUSIONS AND RECOMMENDATIONS.....	5
5.0 STATUTORY CONTROLS.....	5
6.0 APPENDIX 1: TREE TABLES	6
7.0 APPENDIX 2: SITE PLAN.....	9
8.0 APPENDIX 3: SITE PHOTOGRAPHS.....	11



1.0 INTRODUCTION & BRIEF

- 1.1** Property Risk Inspection has been instructed on behalf of the building insurers of the insured property. We have been advised that the insured property has suffered differential movement and damage that is considered to have been caused by trees growing adjacent to the property influencing soils beneath its foundations.
- 1.2** We have been instructed to undertake a survey of the vegetation growing adjacent to the insured property in order to provide our opinion as to whether, based on the available information, any of this vegetation is likely to be influencing soil moisture levels beneath the foundations of the property, and if so, to provide recommendations as to what tree management could be implemented to effectively prevent damage continuing.
- 1.3** The vegetation growing adjacent to the risk address has been surveyed from the ground. All distances are measured to the nearest point of the risk address unless otherwise stated.

2.0 LIMITATIONS

- 2.1** Recommendations with respect to tree management are associated with the risk address as stated on the front cover of this report and following consultation with investigating engineers. The survey of trees and any other vegetation is associated with impacts on the risk address subject of this report. Matters of tree health, structural condition, and/or the safety of vegetation under third party control are specifically excluded. Third party land owners are strongly advised to seek their own professional advice as it relates to the health and stability of trees under their control.
- 2.2** Recommendations do not take account of any necessary permission (statutory or otherwise) that must be obtained before proceeding with any tree works.
- 2.3** Recommendations do not take account of any requirements for survey or mitigation relating to European or other protected species, e.g. bird nesting or bats. Land owners must obtain their own professional advice in respect of any protected species.



3.0 DISCUSSION AND ANALYSIS

3.1 Soils, soil water and vegetation

All vegetation requires water to live, and this water is substantially accessed from the soil within which the plants' roots grow.

If the soil is classified as a clay soil, then it will hold very much more water than sands, gravels and loam soils. As plants abstract water from the clay soil, the soil volume will 'shrink' and 'swell' during the summer as water is first removed and then added by summer rainfall. In years in which rainfall during the summer is less than the total amount of water taken from the soil by plants, shrinkage will occur. This shrinkage may remove support from building foundations, leading to cracking in the fabric of the building.

3.2 Vegetation management

The control of trees, shrubs, and climbers, by removal or pruning as appropriate, are proven techniques that can control total soil water loss thereby minimising soil shrinkage and allowing repairs to proceed.

If vegetation management works are carried out promptly, then repairs can usually proceed very quickly and the duration and distress associated with the disruption that tree related subsidence brings can be minimised.

3.3 Third party liaison and statutory controls

Tree roots do not respect physical or property boundaries and can travel for many metres beyond the above ground 'dripline' of the canopy of the vegetation.

The purpose of this report is to ascertain which vegetation is the most likely substantial and/or effective contributory cause of the damage witnessed to allow for liaison with third parties or with local administrative Councils as necessary.

3.4 Evidential framework

The engineer has determined on a preliminary basis the damage to the property, its location and the likely mechanism of movement, and has concluded that the building failure is related to differential subsidence damage caused as a result of the action of vegetation.

Where a factual geotechnical report has been completed, this will describe the below ground foundation design, soil and geotechnical conditions, as well as any root identification where available.



4.0 CONCLUSIONS AND RECOMMENDATIONS

4.1 Recommendations

On the basis of our findings, we have considered a practical vegetation management specification.

This specification will assist in reducing the impact of the adjacent vegetation on soil moisture levels, thereby potentially stabilising foundations of the affected area of the building.

Where felling has been proposed, this will be on the basis that the vegetation in question would not respond well to a severe reduction in leaf area that would inevitably lead to decay, the development of potential hazards, and an annual or other on-going management commitment and cost.

If pruning is recommended, the specification will be designed to allow continual ease of re-pruning with a reasonable prospect of a reduction in soil water use.

4.2 Recommended vegetation management to address the current subsidence:

Tree No:	Species	Works Required
SG2	Mixed species shrubs	Fell and treat stumps with eco plugs (deciduous)
T2	Plane (London)	Fell and treat stump with eco plugs (deciduous)

5.0 STATUTORY CONTROLS

Camden Council has confirmed that the implicated London Plane vegetation is subject to a Tree Preservation Order. The location is also within a Conservation Area.



6.0 APPENDIX 1: TREE TABLES



Tree No	Common Name	Age Class	Condition	Height (m)	Crown Spread (m)	Stem diam. (mm)	Dist to bldg. (m)	Roots Implicated	Pruning history	Recommendation	Tree work constraints	Notes	Owner address	Owner
C1	Ivy	Mature	Good	3.5	2	100*	4	N	Subject to past management.	No work required.			69 Auden Place London NW1 8ND	P3P
C2	Ivy	Semi-Mature	Fair	0.5	0.30	30	1.2	N	Subject to recent management.	No work required.		Recently cut off at 0.5m.	70-75 Auden Place London NW1 8ND	PH
SG1	Hydrangea	Semi-Mature	Good	0.3	0.30	5	1	N	Subject to past management.	No work required.			70-75 Auden Place London NW1 8ND	PH
SG2	Mixed species shrubs	Early Mature	Fair	1	1.0	10	1.1	N	Subject to past management.	Fell and treat stumps with eco plugs (deciduous).		Two mature Cotoneaster stumps with regrowth, one Cypress. Implicated due to size and location.	70-75 Auden Place London NW1 8ND	PH


Tree No	Common Name	Age Class	Condition	Height (m)	Crown Spread (m)	Stem diam. (mm)	Dist to bldg. (m)	Roots Implicated	Pruning history	Recommendation	Tree work constraints	Notes	Owner address	Owner
SG3	Mixed species shrubs	Semi-Mature	Good	1	1.0	10	2.8	N	Subject to past management.	No work required.		Includes Holly, Cotoneaster, Cypress and Grass.	70-75 Auden Place London NW1 8ND	PH
SG4	Mixed species shrubs	Semi-Mature	Good	1	0.50	10	0.3	N	Subject to recent management.	No work required.		Includes Cypress, Rose, Lonicera and Euonymous.	70-75 Auden Place London NW1 8ND	PH
SG5	Pyracantha	Early Mature	Good	1.5	1.0	50	3	N	Subject to recent management.	No work required.			70-75 Auden Place London NW1 8ND	PH
T1	Lime	Mature	Good	12	7.0	300*	10	N	Subject to past management.	No work required.		Three stems.	54 Regents Park Road London NW1 7SX	P3P
T2	Plane (London)	Mature	Good	21	12	1000*	5.5	Y	Subject to past management.	Fell and treat stump with eco plugs (deciduous).		Ivy clad stem. 70 resident said wall below may be listed.	52 Regents Park Road London NW1 7SX	P3P
TG1	Pittosporum	Semi-Mature	Good	6	2	80*	6	N	Subject to past management.	No work required.		Multistem group.	52 Regents Park Road London NW1 7SX	P3P

* Value is estimated



7.0 APPENDIX 2: SITE PLAN



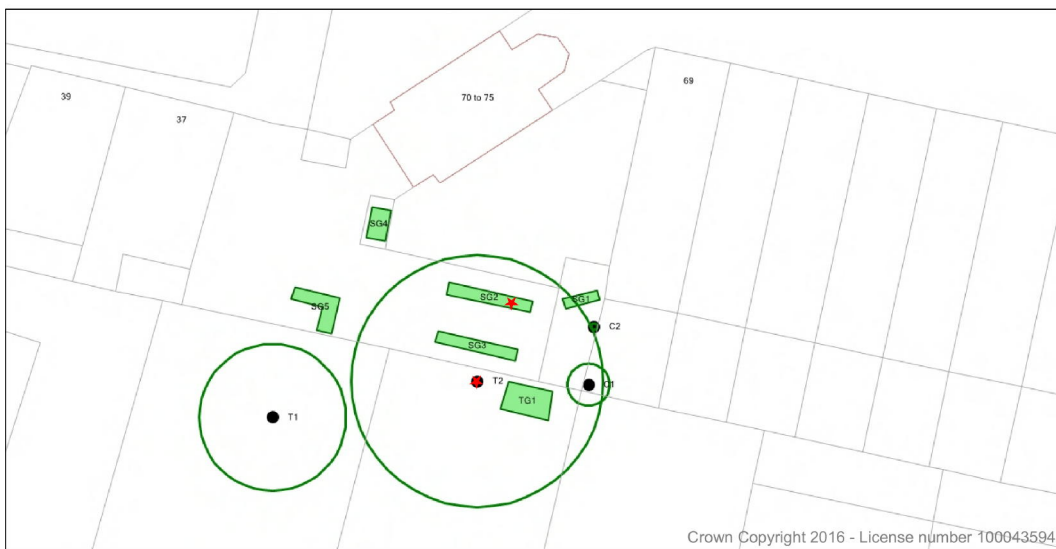

Location:	70-75 Auden Place, London, NW1 8ND
Job Ref:	191430
Survey Date:	10/05/2021 - NTS
By Property Risk Inspection - Insurance Services	









8.0 APPENDIX 3: SITE PHOTOGRAPHS



	
T1 - Lime	T2 - Plane (London)
	
T2 - Plane (London)	T2 - Plane (London)
	
TG1 - Pittosporum	C1 - Ivy
	
C1 - Ivy	C2 - Ivy
	
SG1 - Hydrangea	SG2 - Mixed species shrubs



	
SG2 - Mixed species shrubs	SG2 - Mixed species shrubs
	
SG2 - Mixed species shrubs	SG3 - Mixed species shrubs
	
SG4 - Mixed species shrubs	SG5 - Pyracantha



**Property Risk Inspection
Insurance Services**

