


Crack repaired with 3 no. stainless steel pins, 4 mm diameter grouted into place with min. 100 mm embedment.

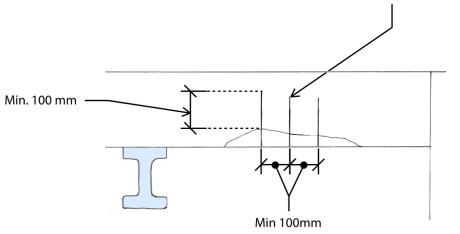


REPAIR DETAIL A (1:10)

SECTION 5-5 (1:20)



VEIW 15

Contractor to allow for temporarily diverting services in order to carry out repairs to cast iron beams

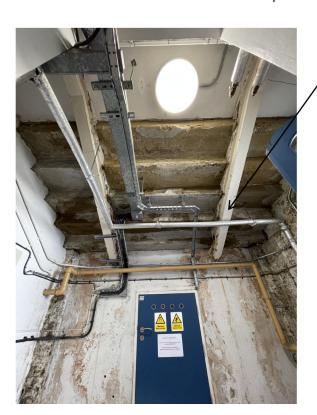

VEIW 16

VEIW 17

See repair detail A



1. This drawing is to be read in conjunction with all relevant Architect's and Engineer's drawings and the specification.

NOT FOR CONSTRUCTION

Ą	10.02.23	ISSUED FOR LISTED BUILDING CONSENT	MSp
-	22.02.22	ISSUED FOR TENDER	LK

British Museum Phase 6 Fabric Repairs Staircases

Repairs to Stair 6

LK AEs scale (original - A3) January 2022 ~1:50

Alan Baxter

75 Cowcross Street London EC1M 6EL tel 020 7250 1555 email aba@alanbaxter.co.uk

www.alanbaxter.co.uk

1910/20/08

Alan Baxter Ltd is a limited company registered in England and Wales, number 06600598. Registered office as above.