


PLAN OF STAIR 8  
(1:50)

Making good to finishes to top of staircase to Architect's details in order to mitigate water ingress to structure below


Repairs as noted on Detail B

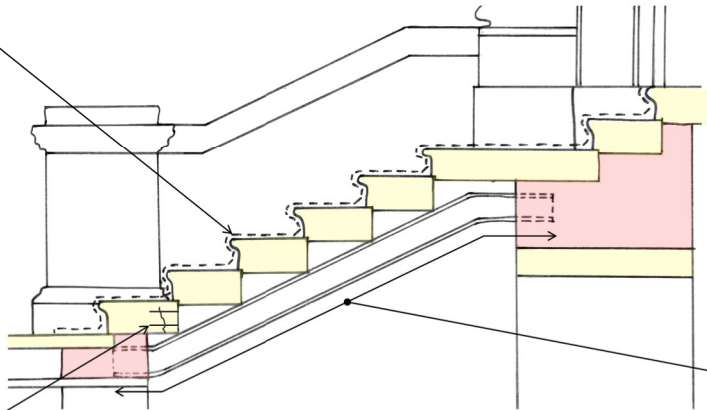

SECTION 8-8  
(1:20)

Repair type 1 to be applied to full extents of 2 no. cast iron beams, including embedded ends

Crack repaired with 2 no. stainless steel 4 mm diameter pins grouted into place with min. 150 mm embedment, installed horizontally.

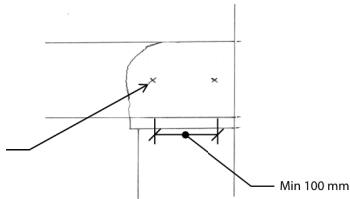

REPAIR DETAIL B  
(1:10)

notes

1. This drawing is to be read in conjunction with all relevant Architect's and Engineer's drawings and the specification.

NOT FOR  
CONSTRUCTION



VIEW 18



VIEW 19



VIEW 20

Crack repaired as per detail B above.

Note water ingress in this area

A	10.02.23	ISSUED FOR LISTED BUILDING CONSENT	LK
-	22.02.22	ISSUED FOR TENDER	LK

job
<b>British Museum Phase 6 Fabric Repairs Staircases</b>

title
Repairs to Stair 8

drawn	checked
AEs	LK
date	scale (original - A1)
January 2022	1:50

Alan Baxter

75 Cowcross Street London EC1M 6EL  
tel 020 7250 1555  
email aba@alanbaxter.co.uk

www.alanbaxter.co.uk

dtg. no.	rev.
<b>1910/20/09</b>	<b>A</b>