

## Arboricultural Consultancy for Lloyds Bank

**Note:** This report is intended for use between the client, Environmental Services and any parties detailed within the report. It is based on the understanding at the time of visiting the property that Engineers are satisfied that damage is attributable to clay shrinkage subsidence exacerbated by vegetation.

### 1. Case Details

Insured		Address	50 Patshull Road, London, NW5 2LD	
Client		Contact		Claim No.
		Consultant		Contact No.
Report Date	11/12/2018			

**Scope of Report:** To survey the property and determine significant vegetation contributing to subsidence damage, make recommendation for remedial action and assess initial mitigation and recovery prospects. The survey does not make an assessment for decay or hazard evaluation.

### 2. Property and Damage Description

The insured structure is a 3 storey semi-detached house. It has been extended with a single-storey extension to the rear. The property occupies a level site with no adverse topographical features.

Damage relates to the rear extension where cracking indicates downward movement. Please refer to the engineers report for a full description of the claim history and damage.

### 3. Technical Reports


In preparing our report we have had the benefit of the following technical investigations:

Drain Report ☒ Root Analysis ☒ Engineers Report ☒

### 4. Action Plan

Mitigation	
Insured involved?	Yes
Local Authority involved?	No
Other third party Mitigation involved?	No
Recovery	
Is there a potential recovery action?	No

Treeworks	
Local Authority	Camden London Borough
TPO / Conservation Area / Planning Protection Searches	Insured: Conservation Area Adjacent & Adjoining properties: Unanswered
Additional Comments	
Awaiting Further Instructions.	



## Arboricultural Consultancy for Lloyds Bank

### 5. Technical Synopsis

This report is based upon our understanding at the time of visiting the property that Subsidence Management Services's engineers are satisfied that damage is due to clay shrinkage subsidence exacerbated by vegetation.

A survey of the drainage system at the property has been undertaken and some defects noted, however, where engineers confirm that they do not consider damaged or leaking drains to be a material cause of the current subsidence then vegetation is deemed to retain the capacity to be causal to the current movement / damage.

The footings of the subject property are within the normally accepted influencing distance of vegetation on site.

Site Investigations revealed the presence of functionally active (alive) roots underside of foundations in TP/BH1, these roots were identified (using anatomical analysis) as having emanated from a shrub species (possibly Clematis) and a broadleaved species, too juvenile for positive identification.

We have therefore been instructed to advise on the causal vegetation and to deliver management proposals which will provide on-going and long term stability allowing repairs to be undertaken.

In assessing the potential drying influence of the vegetation on site, we have considered, in addition to the above, species profile, normally accepted influencing distance and the position of vegetation relative to the observed damage.

Based on our observations on site and with due regards to species profile, the Mixed Species Climbers (SG1) and Apple (T1) are the most likely source of the recovered root material and accordingly we have identified them as the principal cause of the subsidence damage.

The size and proximity of this vegetation is consistent with the location of damage and advised mechanism of movement.

Considering engineers conclusions, results of site investigations and our observations on site, vegetation management is considered appropriate with a view to restoring stability.

Please refer to Section 6 for management prescriptions.

In order to mitigate the current damage and allow soils beneath the property to recover to a position such that an effective engineering repair solution can be implemented we recommend a program of management as listed by this report.

Vegetation management in the form of selective removal and appropriate stump treatment will help to promote the restoration of long-term stability to the insured property; pruning alone should not be considered as representing an effective or reliable long-term alternative solution given the size and proximity of the vegetation.

Pruning in isolation is generally ineffective and in the context of the current claim we consider the above vegetation is simply too large and/or close for pruning to be effective.

Removal of SG1 and T1 will offer the most certain and reliable arboricultural solution likely to restore long-term stability.

Replacement planting is considered appropriate however due consideration must be given to the ultimate size of the replacement and future management requirements. Species selection should be appropriate for the chosen site and ultimate tree height should not exceed 75% of the available distance to built structures.

We recommend the efficacy of the management recommendations be qualified by means of further monitoring to confirm stability.

Please note that the footing of the insured property fall within the anticipated rooting distance of additional vegetation which we believe presents a foreseeable risk of future damage and accordingly we have made recommendations in respect of this.



## Arboricultural Consultancy for Lloyds Bank

Is vegetation likely to be a contributory factor in the current damage?	Yes
Is vegetation management likely to contribute to the future stability of the property?	Yes
Is replacement planting considered appropriate?	Yes
Would DNA profiling be of assistance in this case?	No

### 6.0 Recommendations

#### 6.1 Current Claim Requirements

These recommendations may be subject to review following additional site investigations.

Tree No.	Species	Age Cat	Approx. Height (m)	Distance to Building (m) *	Ownership	Action	Requirement
SG1	Mixed species climbers: Includes jasmine and clematis.	1	1.8	0.1	C - Insured	Remove	Remove close to ground level and treat stumps to inhibit regrowth.
T1	Apple	1	4.5	6.5	C - Insured	Remove	Remove close to ground level; do not treat stump due to translocation risk. Where such a risk exists, we advise that any emergent regrowth is removed annually.

**Age Cat:** 1 = Younger than property; 2 = Similar age to the property; 3 = Significantly older than property

\* Estimated

#### 6.2 Future Risk Recommendations


These recommendations may be subject to review following additional site investigations.

Tree No.	Species	Age Cat	Approx. Height (m)	Distance to Building (m) *	Ownership	Action	Requirement
C1	Vine	1	4.4	2.6	C - Insured	Action to avoid future risk	Do not allow to exceed current dimensions by way of regular pruning.
C2	Hydrangea (Climbing)	1	3	0.1	C - Insured	Action to avoid future risk	Do not allow to exceed current dimensions by way of regular pruning.
S1	Aucuba	1	2.4	0.2	C - Insured	Action to avoid future risk	Do not allow to exceed current dimensions by way of regular pruning.
SG2	Mixed species shrubs: Pyracantha, Viburnum and Hypericum.	1	2.1	4	C - Insured	Action to avoid future risk	Do not allow to exceed current dimensions by way of regular pruning.
T2	Birch	1	3.3	9	C - Insured	Action to avoid future risk	Do not allow to exceed 6m max height / spread by way of regular pruning.
T3	False Acacia	1	11.7	1.85	C - Insured	Action to avoid future risk	Do not allow to exceed current dimensions by way of regular pruning.
T4	Maple (Japanese)	1	5.5	1.8	C - Insured	Action to avoid future risk	Do not allow to exceed current dimensions by way of regular pruning.

**Age Cat:** 1 = Younger than property; 2 = Similar age to the property; 3 = Significantly older than property


\* Estimated

Third party property addresses should be treated as indicative only, should precise detail be required then Environmental Services can undertake Land Registry Searches



## Arboricultural Consultancy for Lloyds Bank

### 7. Site Plan

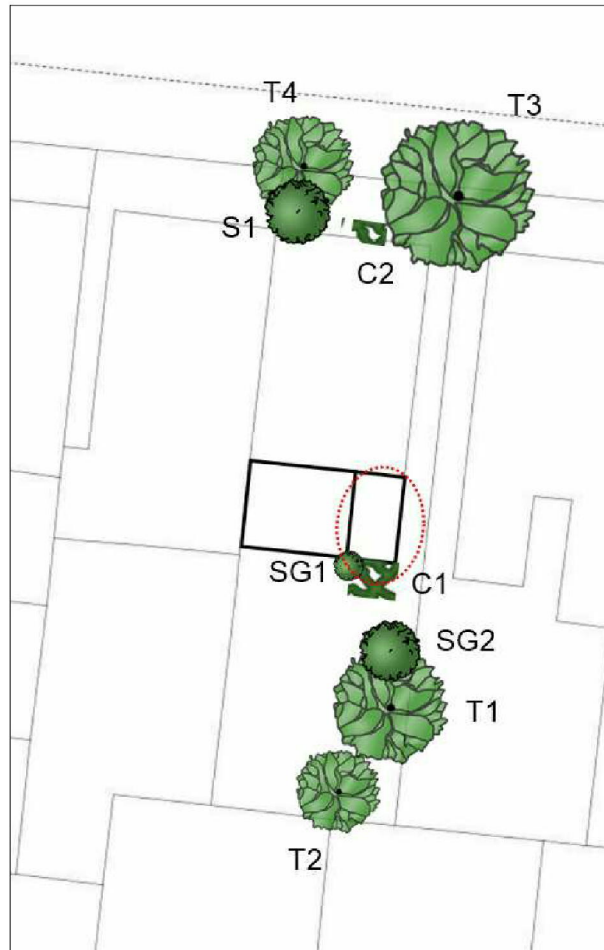


Please note that this plan is not to scale. OS Licence No. 100043218

## Arboricultural Consultancy for Lloyds Bank


### 8. Photographs



T2 - Birch

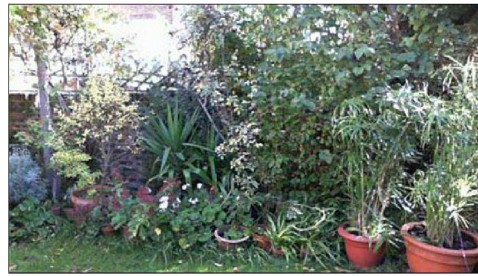


SG2 - Mixed species shrubs

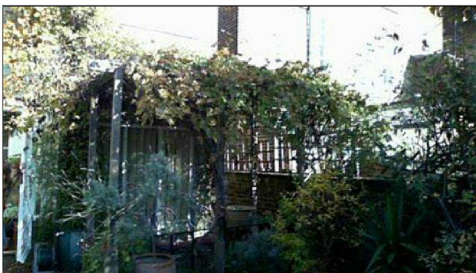

C1 - Vine




SG1 - Mixed species climbers




## Arboricultural Consultancy for Lloyds Bank



C1 - Vine

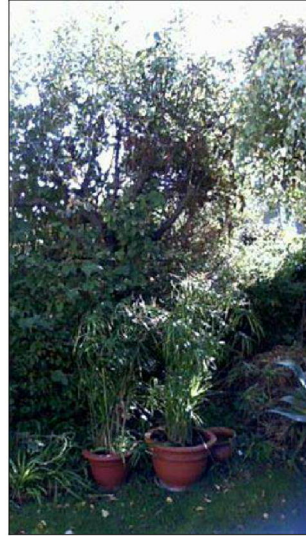

T1 - Apple



## Arboricultural Consultancy for Lloyds Bank

Date: 11/12/2018

Property: 50 Patshull Road, London, NW5 2LD

### 9. Tree Works Reserve - Does not include recommendations for future risk.

Insured Property Tree Works	
Third Party Tree Works	
Provisional Sum	

- The above prices are based on works being performed as separate operations.
- The above is a reserve estimate only.
- Ownerships are assumed to be correct and as per Section 6.
- A fixed charge is made for Tree Preservation Order/Conservation Area searches unless charged by the Local Authority in which case it is cost plus 25%.
- Should tree works be prevented due to statutory protection then we will automatically proceed to seek consent for the works and Appeal to the Secretary of State if appropriate.
- All prices will be subject to V.A.T., which will be charged at the rate applying when the invoice is raised.
- Trees are removed as near as possible to ground level, stump and associated roots are not removed or included in the price.
- Where chemical application is made to stumps it cannot always be guaranteed that this will prevent future regrowth. Should this occur we would be pleased to provide advice to the insured on the best course of action available to them at that time. Where there is a risk to other trees of the same species due to root fusion, chemical control may not be appropriate.

### 10. Limitations

This report is an appraisal of vegetation influence on the property and is made on the understanding that that engineers suspect or have confirmed that vegetation is contributing to clay shrinkage subsidence, which is impacting upon the building. Recommendations for remedial tree works and future management are made to meet the primary objective of assisting in the restoration of stability to the property. In achieving this, it should be appreciated that recommendations may in some cases be contrary to best Arboricultural practice for tree pruning/management and is a necessary compromise between competing objectives.

Following tree surgery we recommended that the building be monitored to establish the effectiveness of the works in restoring stability.

The influence of trees on soils and building is dynamic and vegetation in close proximity to vulnerable structure should be inspected annually.

**The statutory tree protection status as notified by the Local Authority was correct at the time of reporting. It should be noted however that this may be subject to change and we therefore advise that further checks with the Local Authority MUST be carried out prior to implementation of any tree works. Failure to do so can result in fines**

Our flagging of a possible recovery action is based on a broad approach that assume all third parties with vegetation contributing to the current claim have the potential for a recovery action (including domestic third parties). This way opportunities do not "fall through the net"; it is understood that domestic third parties with no prior knowledge may be difficult to recover against but that decision will be fully determined by the client.

**A legal Duty of Care requires that all works specified in this report should be performed by qualified, arboricultural contractors who have been competency tested to determine their suitability for such works in line with Health & Safety Executive Guidelines. Additionally all works should be carried out according to British Standard 3998:2010 "Tree Work. Recommendations".**

