



**Level and Crack Monitoring**



Date of Issue: 22/09/2022

**Provider Details**



**Monitoring Details**

<b>Instruction Date:</b>	11/12/2014		
<b>Number of visits</b>	<b>MUFN</b>	<b>Visit Frequency (Wks)</b>	<b>8</b>

**Visit Dates (future dates are estimated)**

<b>Setup</b>	<b>1</b>	<b>2</b>	<b>3</b>	<b>4</b>	<b>5</b>	<b>6</b>

**Client Details**

Insurance Co.:	<b>Sterling Insurance Company Ltd</b>
Client Ref:	
Client Name:	<b>Sedgwick</b>
Technical Mgr:	<b>Yiu-Shan Wong</b>
Customer support	<b>Paula Haythornthwaite</b>
Tel:	
Email:	


**Risk Address**

Occupier:	<b>Removed for data protection purposes</b>
Address:	<b>57 Aberdare Gardens</b>
Address:	
Town:	<b>London</b>
County:	
Post Code:	<b>NW6 3AL</b>
Contact Name	<b>Removed for data protection purposes</b>

Level and Crack Monitoring - Site Sketch



Date of Issue: 22/09/2022

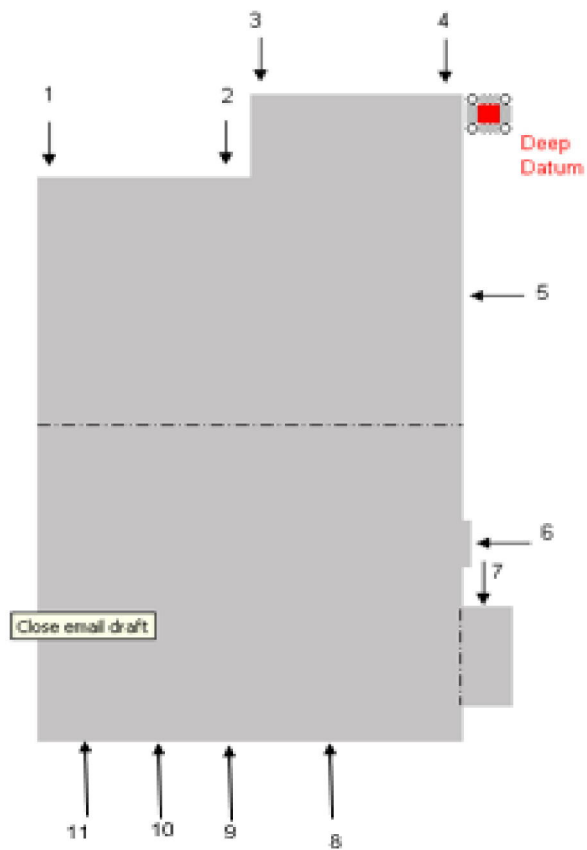

■ TBM 2  
OUTSIDE NO  
57 IN KERB













[Redacted]	Client Name	Issue Date
[Redacted]	Sedgwick	22/09/2022

**Stud locations**

1	EXT RH Rear Elevation Junction of Extension/House
2	Flat 2 LHS of party wall
3	Flat 2 Above door RHS dart board
4	INT Flat 4 above bathroom door
5	INT Flat 4 bedroom 2
6	INT Flat 4 first floor hallway

Additional instructions / notes

**Crack Monitoring - Readings**

Studs nos	Align-ment	Visit Date	03/01/17	Visit Date	06/01/21	Visit Date	11/03/21	Visit Date	26/05/21	Visit Date	19/06/21	Visit Date	14/01/22
		Reading	Current c/w	Reading	Current c/w	Reading	Current c/w	Reading	Current c/w	Reading	Current c/w	Reading	Current c/w
1	H	84.82					filed						
1	D	111.69				108.94	filed	108.90		108.99	filed	108.72	
1	Check	65.06											
2	H							94.34	2.71	54.26	2.69	54.29	2.51
2	D							85.76	3.50	85.88	3.53	85.75	3.01
2	Check							101.95		101.94		101.95	
3	H							66.18	1.15	66.15	1.31	66.25	0.87
3	D							38.22	0.72	38.58	0.66	38.29	0.21
3	Check							74.36		74.41		74.40	
4	H			38.03	1.03	38.05	1.01	38.14	1.09	38.27	1.14	38.15	1.23
4	D												
4	Check												
5	H			47.56	0.78	47.45	0.75	47.40	0.71	47.35	0.58	47.20	0.77
5	D												
5	Check												
6	H			58.53	HL	58.44	HL	58.40	HL	58.33	hl	58.33	
6	D												
6	Check												
Caliper nos		2500		9141		6386		449		449		6863	
Technicians		AL/JCC		WS		IH		IH		NJ		RH	





[Redacted]	Client Name	Issue Date
	Sedgwick	22/09/2022

**Stud locations**

1	EXT RH Rear Elevation Junction of Extension/House
2	Flat 2 LHS of party wall
3	Flat 2 Above door RHS dart board
4	INT Flat 4 above bathroom door
5	INT Flat 4 bedroom 2
6	INT Flat 4 first floor hallway

Additional instructions / notes

**Crack Monitoring - Readings (Continuation Sheet)**

Studs nos	Align-ment	Visit Date	09/03/22	Visit Date	11/05/22	Visit Date	26/07/22	Visit Date	21/09/22	Visit Date	Visit Date	Visit Date
		Reading	Current c/w	Reading	Current c/w	Reading	Current c/w	Reading	Current c/w	Reading	Current c/w	Reading
1	H											
1	D											
1	Check											
2	H	54.36	2.44	54.33		54.36		55.71	3.65			
2	D	85.63	3.51	85.63		85.69		85.83	4.96			
2	Check	101.93		101.99		101.95		101.78				
3	H	66.30	1.32	65.79		65.84		66.69	1.02			
3	D	38.20	0.76	38.21		38.28		38.95	2.26			
3	Check	74.32		74.35		74.42		74.55				
4	H	38.66	1.42	37.74	1.99	38.48	2.07					
4	D											
4	Check											
5	H	47.27	0.87	47.16	1.07	47.31	1.05					
5	D											
5	Check											
6	H	58.24	0.80	58.28	0.81	58.36	1.06	58.65	1.55			
6	D											
6	Check											
Caliper nos		9171		9171		9171		9171				
Technician		BA		BA		BA		BA				

[Redacted]	Client Name	Issue Date
	Sedgwick	22/09/2022

**Crack Monitoring - Movement Against Time**

