



Monitoring Details

Provider Name:	My Home Needs Ltd	Monitoring Interval:	2 Monthly
Instruction Date:	06/07/2022	Number of Visits:	4
Reading Date:	03/10/2022	Visits Completed:	2
Date of Issue:	04/10/2022	Visits Outstanding:	2

Client Details

Client:	Crawfords	Engineer / Handler:	Lacy M
Job Reference:	[REDACTED]		

Monitored Address

Occupier:	[REDACTED]
Address:	22a Harley Road, Hampstead, London, NW3 3BN

Locations Monitored

- Set 1:** Internal. Living room over arch to rear bay
- Set 2:** External. Living room over french doors
- Set 3:** External. Conservatory to RHS junction
- Set 4:** Internal. Conservatory to LHS junction




Crack Readings (Displayed in millimetres) - Living room over arch to rear bay

Visits	1 = 2 H
04/08/2022	85.14
03/10/2022	52.78

Crack Reading Differences (Displayed in millimetres)

Visits	1 = 2 H
04/08/2022	N/A
03/10/2022	-32.36 ↓

Crack Reading Chart

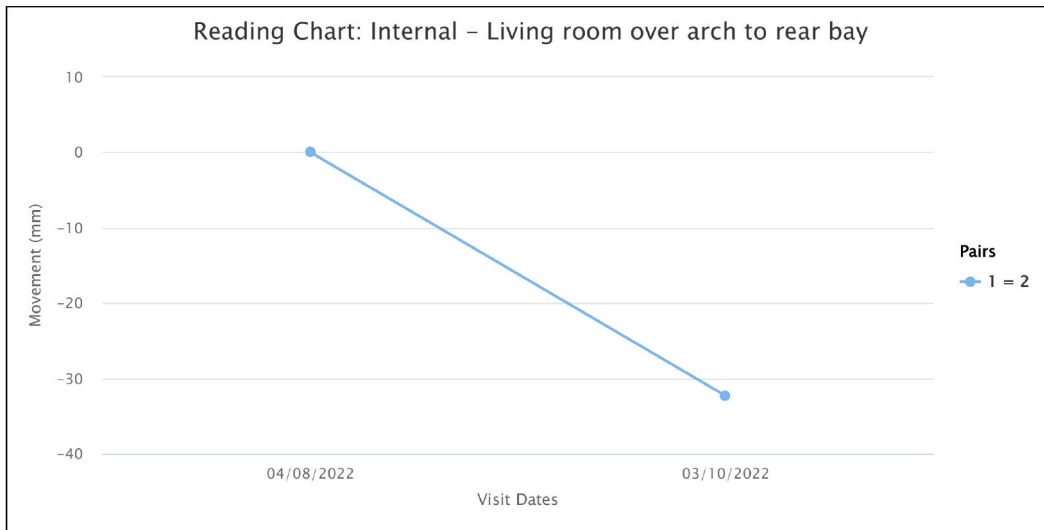


Crack Readings (Displayed in millimetres) - Living room over french doors

Visits	4 = 5 H	3 = 5 V	4 = 3 DC
04/08/2022	81.36	74.28	97.19
03/10/2022	81.55	74.35	97.19

Crack Reading Differences (Displayed in millimetres)

Visits	4 = 5 H	3 = 5 V	4 = 3 DC
04/08/2022	N/A	N/A	N/A
03/10/2022	0.19 ↑	0.07 ↑	0.00 =

Crack Reading Chart

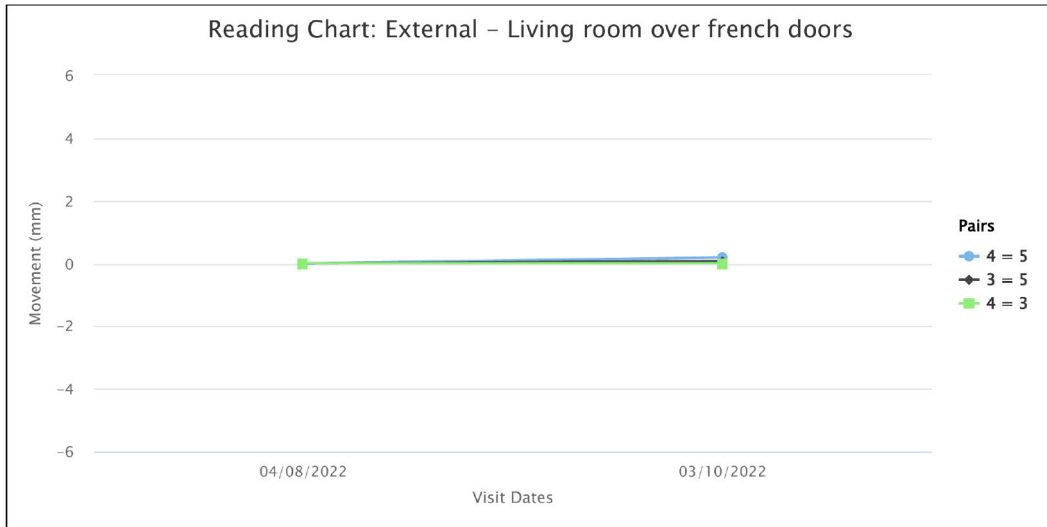


Crack Readings (Displayed in millimetres) - Conservatory to RHS junction

Visits	6 = 7 H	6 = 8 V	7 = 8 DC
04/08/2022	78.11	95.79	129.54
03/10/2022	77.38	97.12	129.59

Crack Reading Differences (Displayed in millimetres)

Visits	6 = 7 H	6 = 8 V	7 = 8 DC
04/08/2022	N/A	N/A	N/A
03/10/2022	-0.73 ↓	1.33 ↑	0.05 ↑

Crack Reading Chart

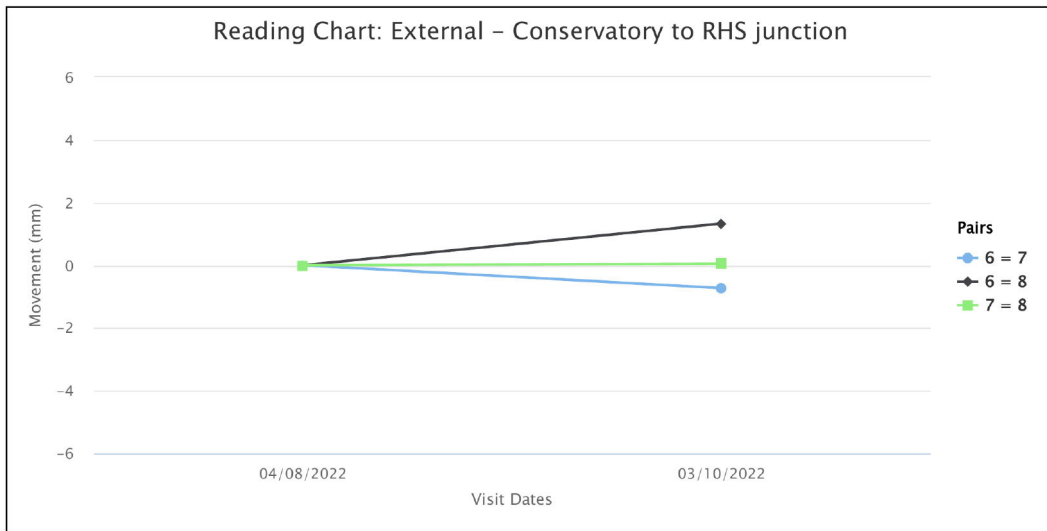


Crack Readings (Displayed in millimetres) - Conservatory to LHS junction

Visits	9 = 10 H
04/08/2022	76.54
03/10/2022	76.26

Crack Reading Differences (Displayed in millimetres)

Visits	9 = 10 H
04/08/2022	N/A
03/10/2022	-0.28 ↓

Crack Reading Chart

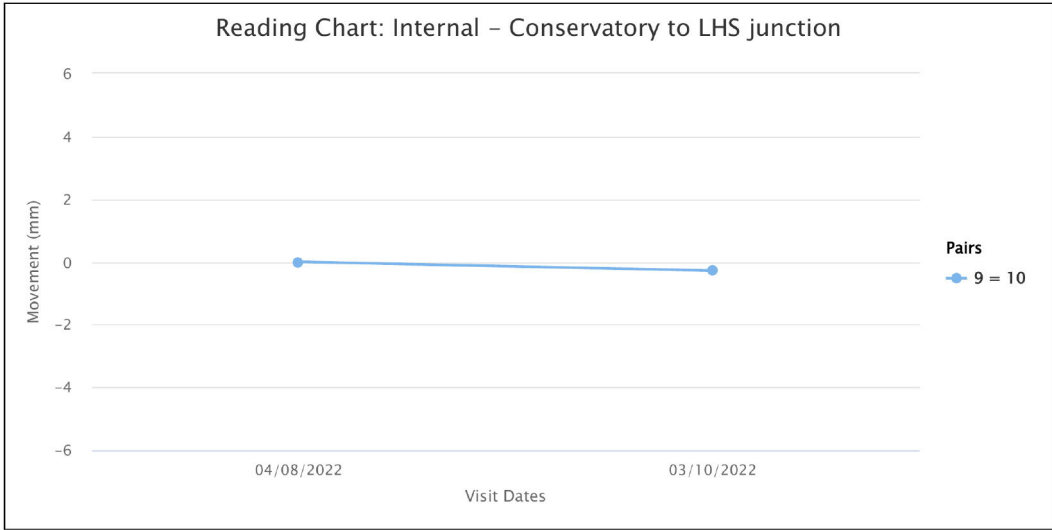



Homeowner Notes

Visit	Homeowner Notes
04/08/2022	No concerns raised.
03/10/2022	No concerns raised.