


GENERAL NOTES:

- Outside Scope of Works
- Grey hatch indicates adjacent buildings.


NOTES:

- Existing painted metal railings and balustrade redecorated.
- New mechanical equipment and service runs to roofs. Refer to MEP information for details on services and structural engineers information for roof strengthening works.
- Existing painted metal bars redecorated white.
- New glazing to replace existing top panels modified for plant vent.
- New sash window.
- New wall mounted external lights.
- New external door.
- Existing metal gangway retained and re-supported to structural engineers details. Existing painted metalwork redecorated black.
- New metal bars installed externally to existing window to match existing.
- Existing rain water goods cleaned and redecorated black. Damaged or poorly installed components repaired and replaced.
- New metal balustrade painted black.
- New plant screen and door.
- New roof membrane overlaid onto existing asphalt flat roof areas.
- Existing parapet gutters to be overlaid with liquid applied waterproofing.
- New vent for shower and toilet extract, cast iron air brick painted to match surrounding finish, details to be agreed.
- New vent for kitchenette extract wall fan, cast iron air brick painted to match surrounding finish, details to be agreed.
- New vent for toilet extract wall fan, cast iron air brick painted to match surrounding finish, details to be agreed.
- New vent for shower extract, cast iron air brick painted to match surrounding finish, details to be agreed.
- New free standing roof edge protection to flat roof perimeter.
- Existing tiles to mansard roofs carefully removed, new membrane installed below and repairs to timber undertaken, tiles reinstated with localised replacement of missing/damaged tiles to match existing.
- New casement window to match existing.
- New mechanical equipment located on roofs. Refer to MEP information for details on services and structural engineers information for roof strengthening works or raised kerbs.
- Existing chimney render and flashing's repaired.
- Existing parapet and party walls repaired.
- New extended external stairs to match existing.
- Condenser units in rear courtyard, refer to MEP information for details.
- New roof access hatches.
- Existing dormers leadwork, roofs and flashing's to be repaired.
- New decking to rear external courtyards.
- Boosted cold water service to serve bib tap, refer to MEP drawings and schedules for details.
- All existing windows refurbished unless noted as new.

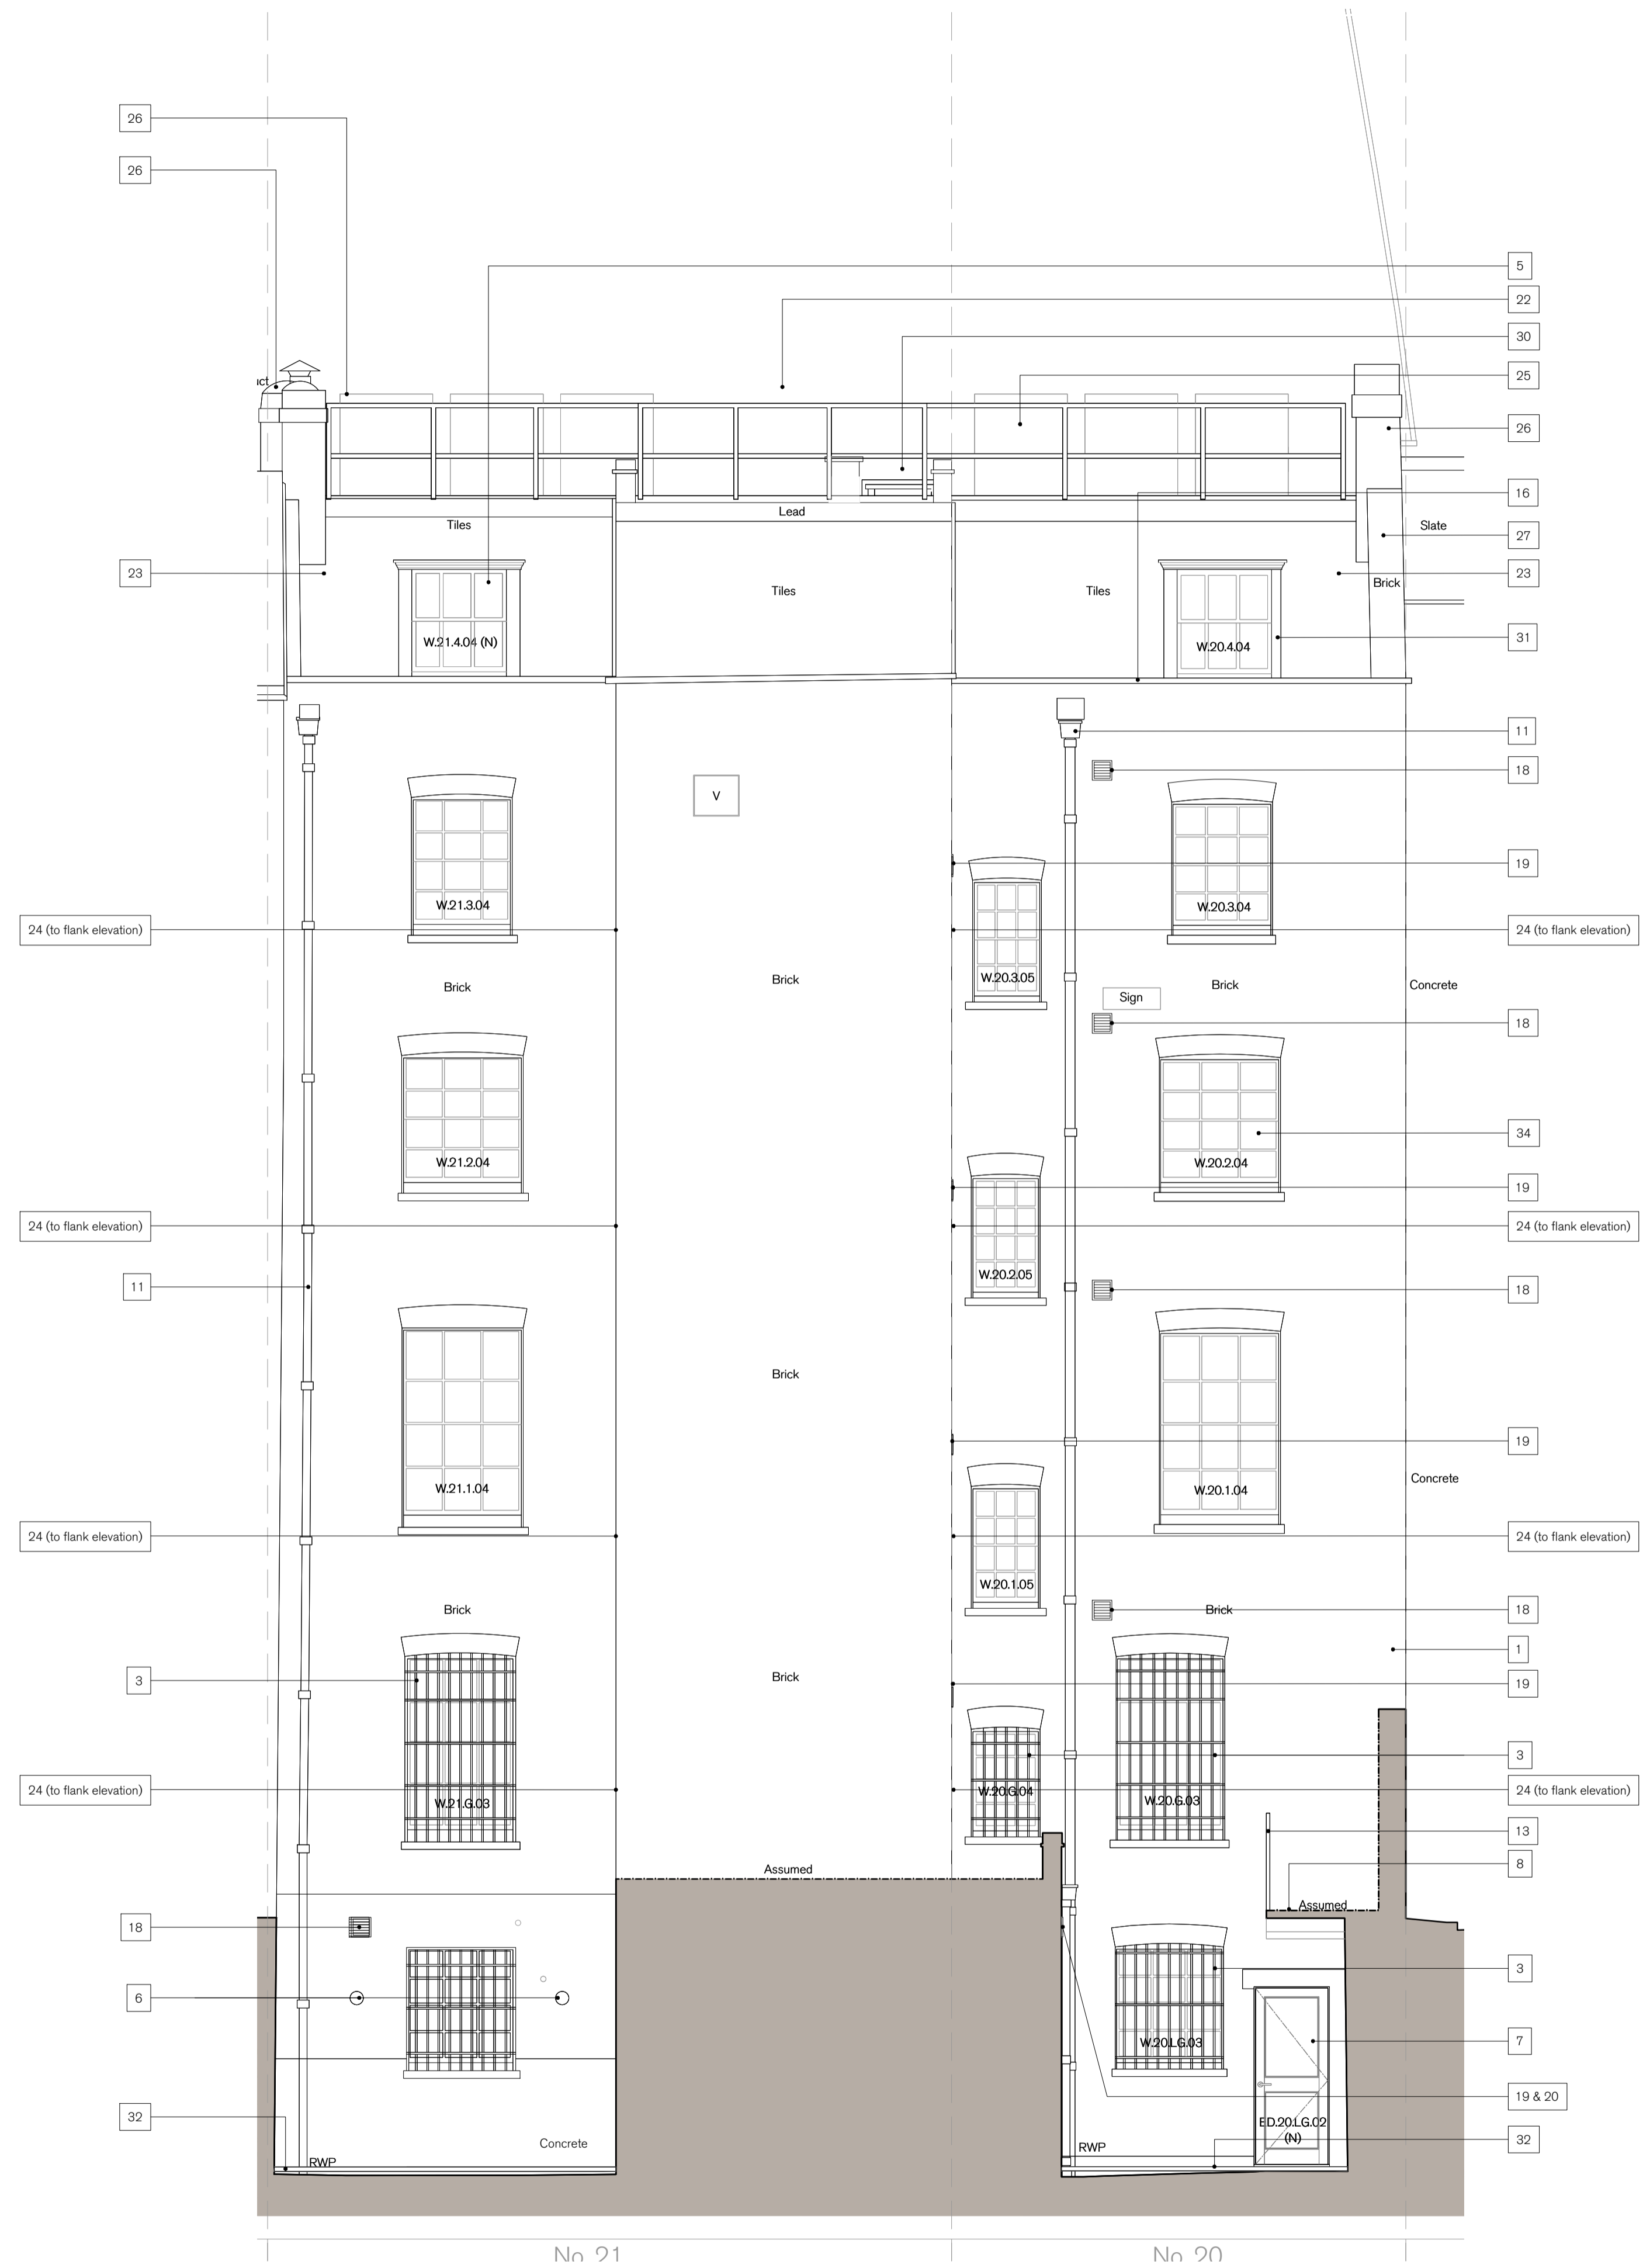

With exception of works to parapet gulleys, tile replacement, and cast iron air bricks, all external works have already secured Full Planning & Listed Building Consent under application refs. 2023/0223/P and 2023/0878/L. They have been detailed on the plans for completeness.

All external fabric repairs have already secured Listed Building Consent 2022/1811/L.

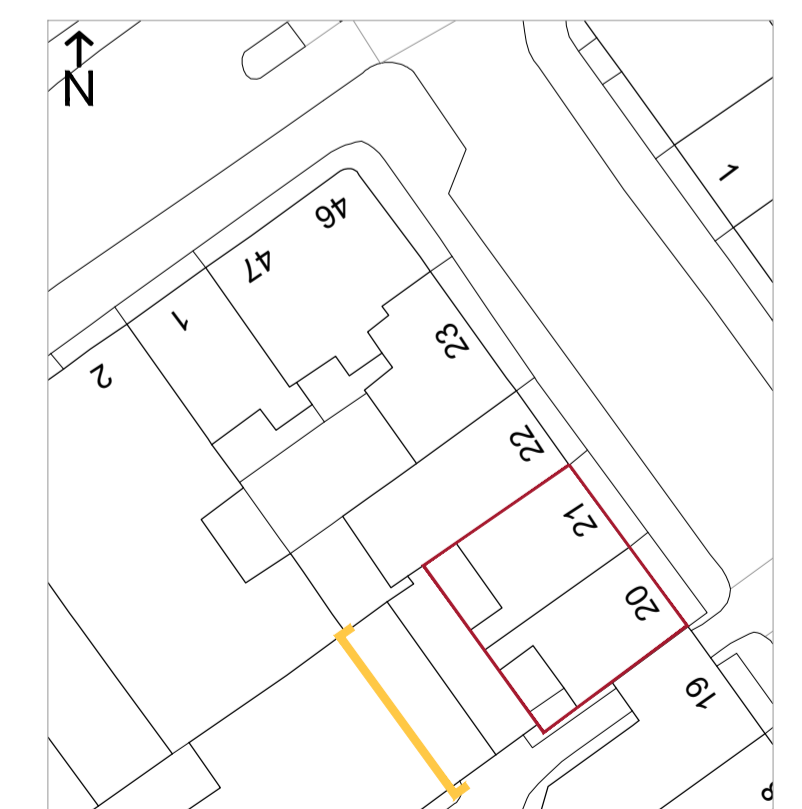

REV.	ISSUED	DESCRIPTION
L2	26.07.24	General note updated.

DRAWN	CHECKED
RE	RE

PROJECT
HOLBORN LINKS
PROJECT 5
20-22 SP & 46-47 BS

DESCRIPTION
20-21 SP PROPOSED REAR
ELEVATION

DATE
JULY '21
SCALE AT A1
1:50

JOB NO
21.865
DRAWING NO
PL1541

CLIENT
EDR

DRAWN
CW

CHECKED
RE

REV
L2