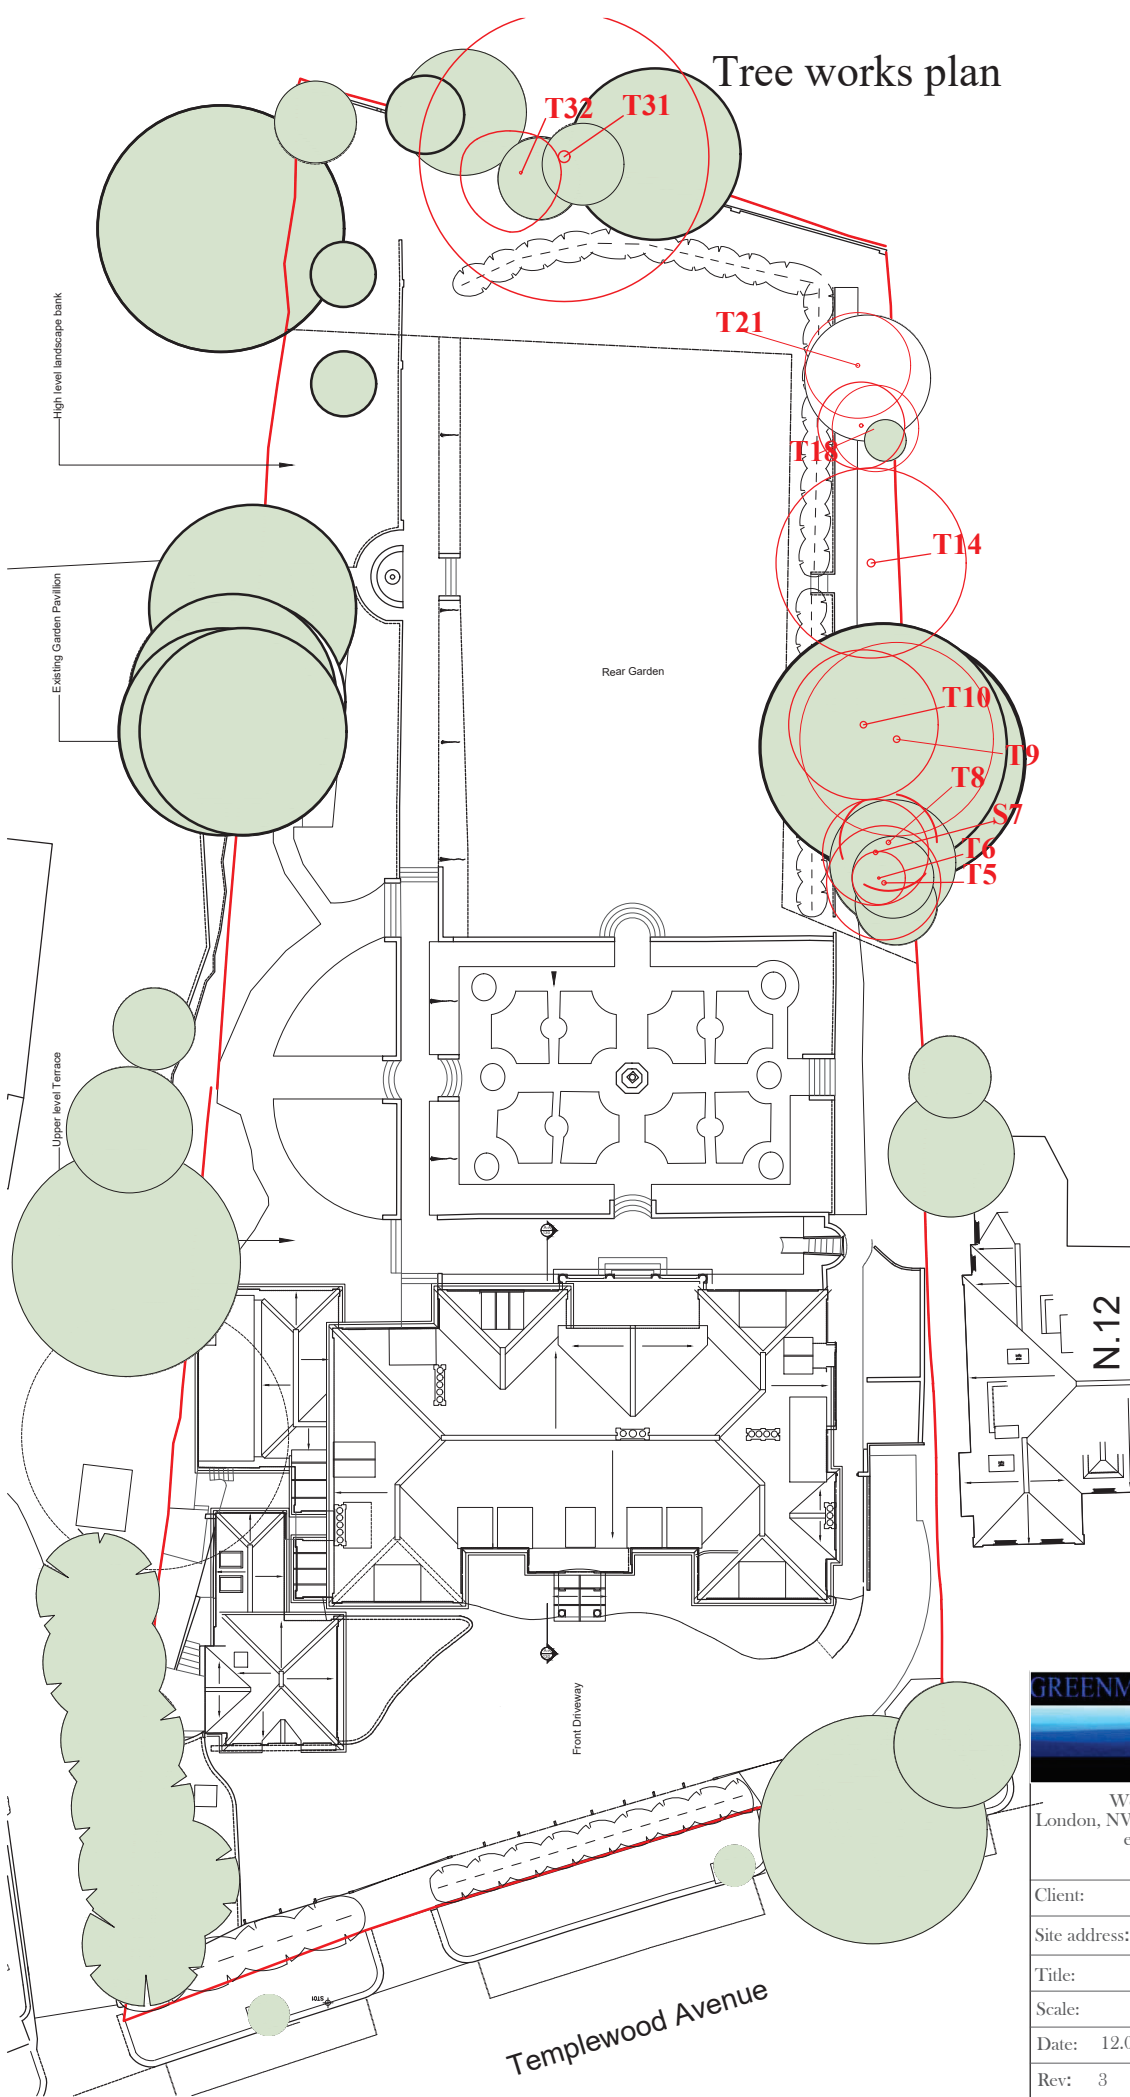








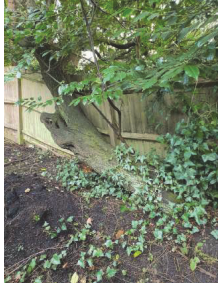
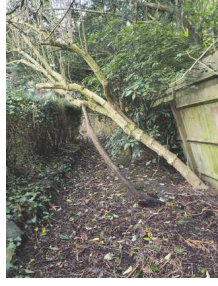
Tree works plan




GREENMANTLE	
Woodfield Nurseries Cool Oak Lane London, NW9 7NB, tel. 02082009559 Greenmantle Ltd email: admin@greenmantle.co.uk	
Client:	Benjamin Khalili
Site address:	14 Templewood Ave, London NW3 7XA
Title:	Tree works plan
Scale:	1:250 Paper size A3
Date:	12.02.2025 Doc/Num 14TA/ 004
Rev:	3

Tree ID	Species	Life stage	Condition Notes	Survey date	RPA (m ²)	RR (m)	Life expectancy (yrs)	BS Category	Works Description	Replacement Planting	Image
T5	Crataegus sp. (Hawthorn sp.)	Mature	Structural condition Poor. Physiological condition Dead. Dead tree / trees.	09.08.2024	26,1	2,9	0-10	U	Fell to ground level and grind out stump to prepare for replanting	Crataegus standard 12-14cmg	
T6	Ilex aquifolium (Holly)	Early Mature	Structural condition Poor. Physiological condition Fair. Competition - Adjacent trees. Leaning trunk - Minor.	09.08.2024	5,5	1,3	10-20	C2	Fell to ground level and grind out stump to prepare for replanting	Ilex aquifolium 12-14cmg	
S7	Ligustrum sp. (Privet sp.)	Mature	Structural condition Fair. Physiological condition Fair. Arboricultural work - Historic. Competition - Adjacent trees. Multi-stemmed.	09.08.2024	22,0	2,6	10-20	C2	Fell to ground level and grind out stump to prepare for replanting	Ligustrum ovalifolium 1.5-2m bush	

Tree ID	Species	Life stage	Condition Notes	Survey date	RPA (m ²)	RPR (m)	Life expectancy (yrs)	BS Category	Works Description	Replacment Planting	Image
T8	Ilex aquifolium (Holly)	Mature	Structural condition Fair. Physiological condition Fair. Competition - Adjacent trees.	09.08.2024	18,3	2,4	10-20	C2	No works		
T9	Betula pendula (Silver Birch)	Mature	Structural condition Fair. Physiological condition Fair. Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Competition - Adjacent trees. Ivy or climbing plant.	09.08.2024	72,4	4,8	10-20	C2	No works		

Tree ID	Species	Life stage	Condition Notes	Survey date	RPA (m ²)	RPR (m)	Life expectancy (yrs)	BS Category	Works Description	Replacement Planting	Image
T10	Acer pseudoplatanus (Sycamore)	Early Mature	Structural condition Fair. Physiological condition Fair. Arboricultural work - Historic. Base / stems obscured - Vegetation. Competition - Adjacent trees. Decay / structural defect in crown limb / limbs - Localised. Deadwood - Minor. Ivy or climbing plant. Leaning trunk - Minor.	09.08.2024	43,5	3,7	20-40	C2	Fell to ground level and grind out stump to prepare for replanting	Acer Campestris 12-14cmg	
T14	Prunus cerasifera 'Pissardii' (Pissard's Plum)	Mature	Structural condition Poor. Physiological condition Fair. Arboricultural work - Historic. Competition - Adjacent trees. Decay / structural defect in crown limb / limbs - Localised. Deadwood - Minor. Decay / structural defect - Base. Decay / structural defect - Bole. Leaning trunk - Major. Pruning wounds - Historic. Unbalanced crown - Major.	09.08.2024	68,8	4,7	10-20	C2	Fell to ground level and grind out stump to prepare for replanting	Prunus avium 12-14cmg	
T18	Sambucus nigra (Elder)	Early Mature	Structural condition Poor. Physiological condition Poor. Decay / structural defect in crown limb / limbs - Localised. Deadwood - Minor. Decay / structural defect - Base. Decay / structural defect - Bole. Epicormic growth - Bole / principal stems. Leaning trunk - Major. Root plate movement - Historic (suspected stabilised). Propped by a dead hawthorn (unsurveyed).	09.08.2024	14,7	2,2	0-10	U	Fell to ground level and grind out stump to prepare for replanting	Crataegus standard 12-14cmg	

Tree ID	Species	Life stage	Condition Notes	Survey date	RPA (m2)	RP R (m)	Life expectancy (yrs)	BS Category	Works Description	Replacement Planting	Image
T21	Taxus baccata (Yew)	Early Mature	Structural condition Fair. Physiological condition Fair. Competition - Adjacent trees.	09.08.2024	21,9	2,6	20-40	C2	No work		
T31	Tilia x vulgaris (Common Lime) in neighbours property	Mature	Structural condition Poor. Physiological condition Fair. Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Structure. Base / stems obscured - Vegetation. Deadwood - Major. Deadwood - Minor. Decay / structural defect - Base. Form - Poor crown structure. Leaning trunk - Major. Off-Site. Growing upon the brick retaining wall; the wall has failed and is leaning away from the tree (i.e., towards the Site).	09.08.2024	162,9	7,2	10-20	5,5	Fell to ground level and grind out stump to prepare for replanting	Carpinus betulus 18-20cmg - planted within 14 Templewood Ave	
T32	Aesculus hippocastanum (Horse Chestnut)	Semi Mature	Structural condition Poor. Physiological condition Fair. Competition - Adjacent trees. Leaning trunk - Minor. Suppressed crown - Minor. Unbalanced crown - Minor.	09.08.2024	8,9	1,7	10-20	C2	Fell to ground level and grind out stump to prepare for replanting	Carpinus betulus 18-20cmg	