

Monitoring Details:

Crack and Level Monitoring

Provider Name: My Home Needs

Monitoring Interval: Every 8 weeks

Instruction Date: 19/09/2024

Number of Visits: 7

Reading Date: 10/03/2025

Visits Completed: 2

Date of Issue: 10/03/2025

Visits Outstanding: 5

Client Details:

Client: Questgates

Engineer / Handler: -

Job Reference: QG1S1287571


Monitored Address:

Address: 222 Finchley Road, London, NW3 6DH

Front Elevation



Site Plan

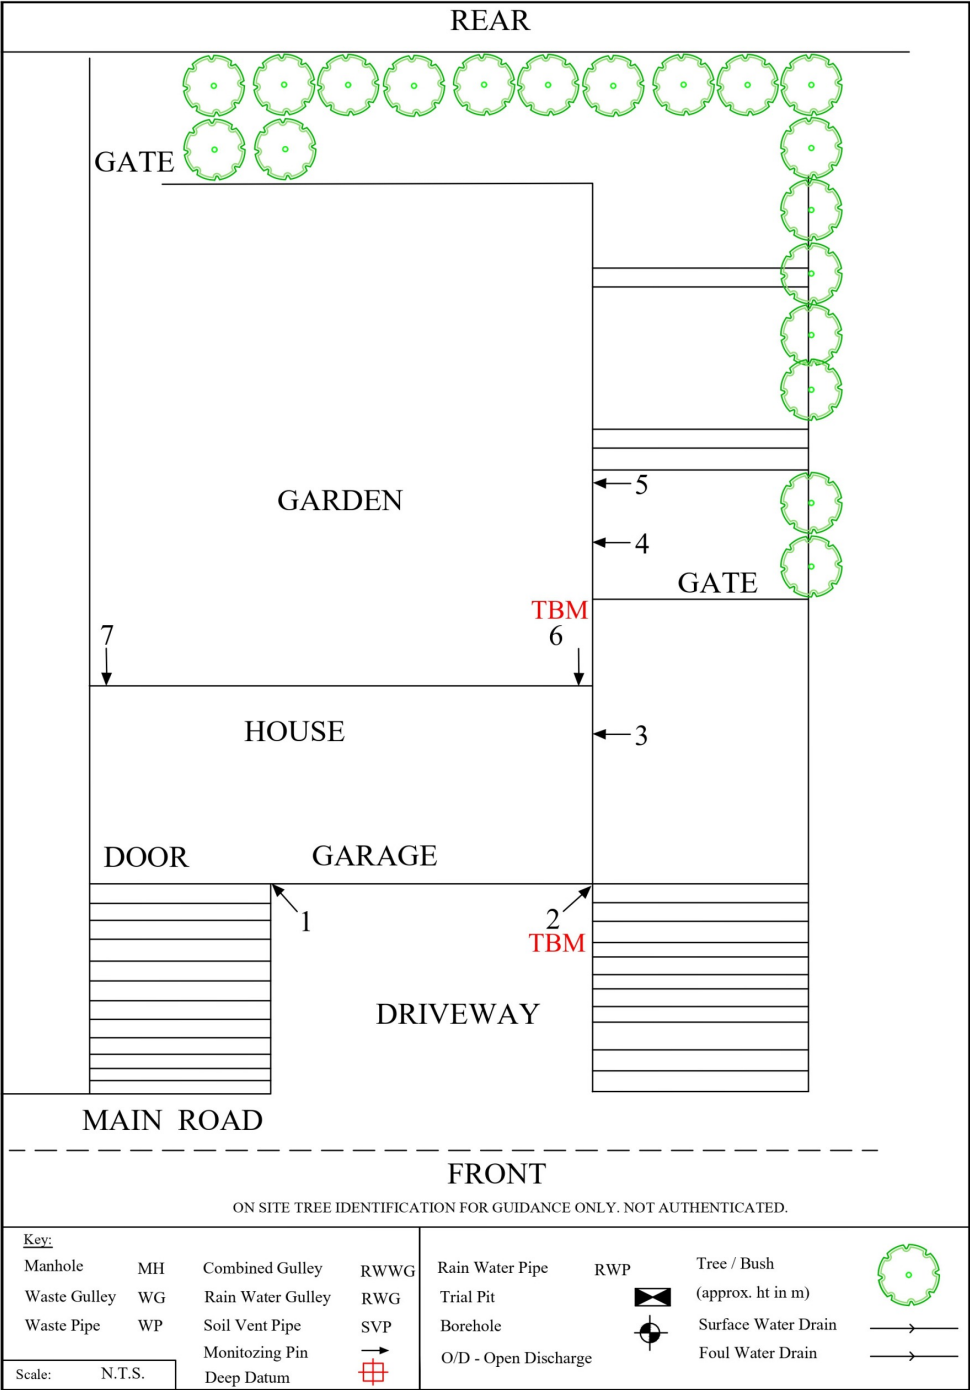

Visit Notes

No visit notes have been entered for any visits


Level Readings

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8
	29/10/24	10/03/25						
TBM 2	10.0000	10.0000						
1	10.8568	10.8552						
3	10.7979	10.7972						
4	10.6265	10.6283						
5	10.5266	10.5309						
TBM 6	10.0000	10.0000						
7	10.2502	10.2483						
Taken by	DD	BA						
Serial number	523713	521816						


Level Movement (Displayed in Millimeters)

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8
	29/10/24	10/03/25						
TBM 2	0	0						
1	0	-1.6						
3	0	-0.7						
4	0	+1.8						
5	0	+4.3						
TBM 6	0	0						
7	0	-1.9						

Level Readings Chart (Points TBM 2 - 7)

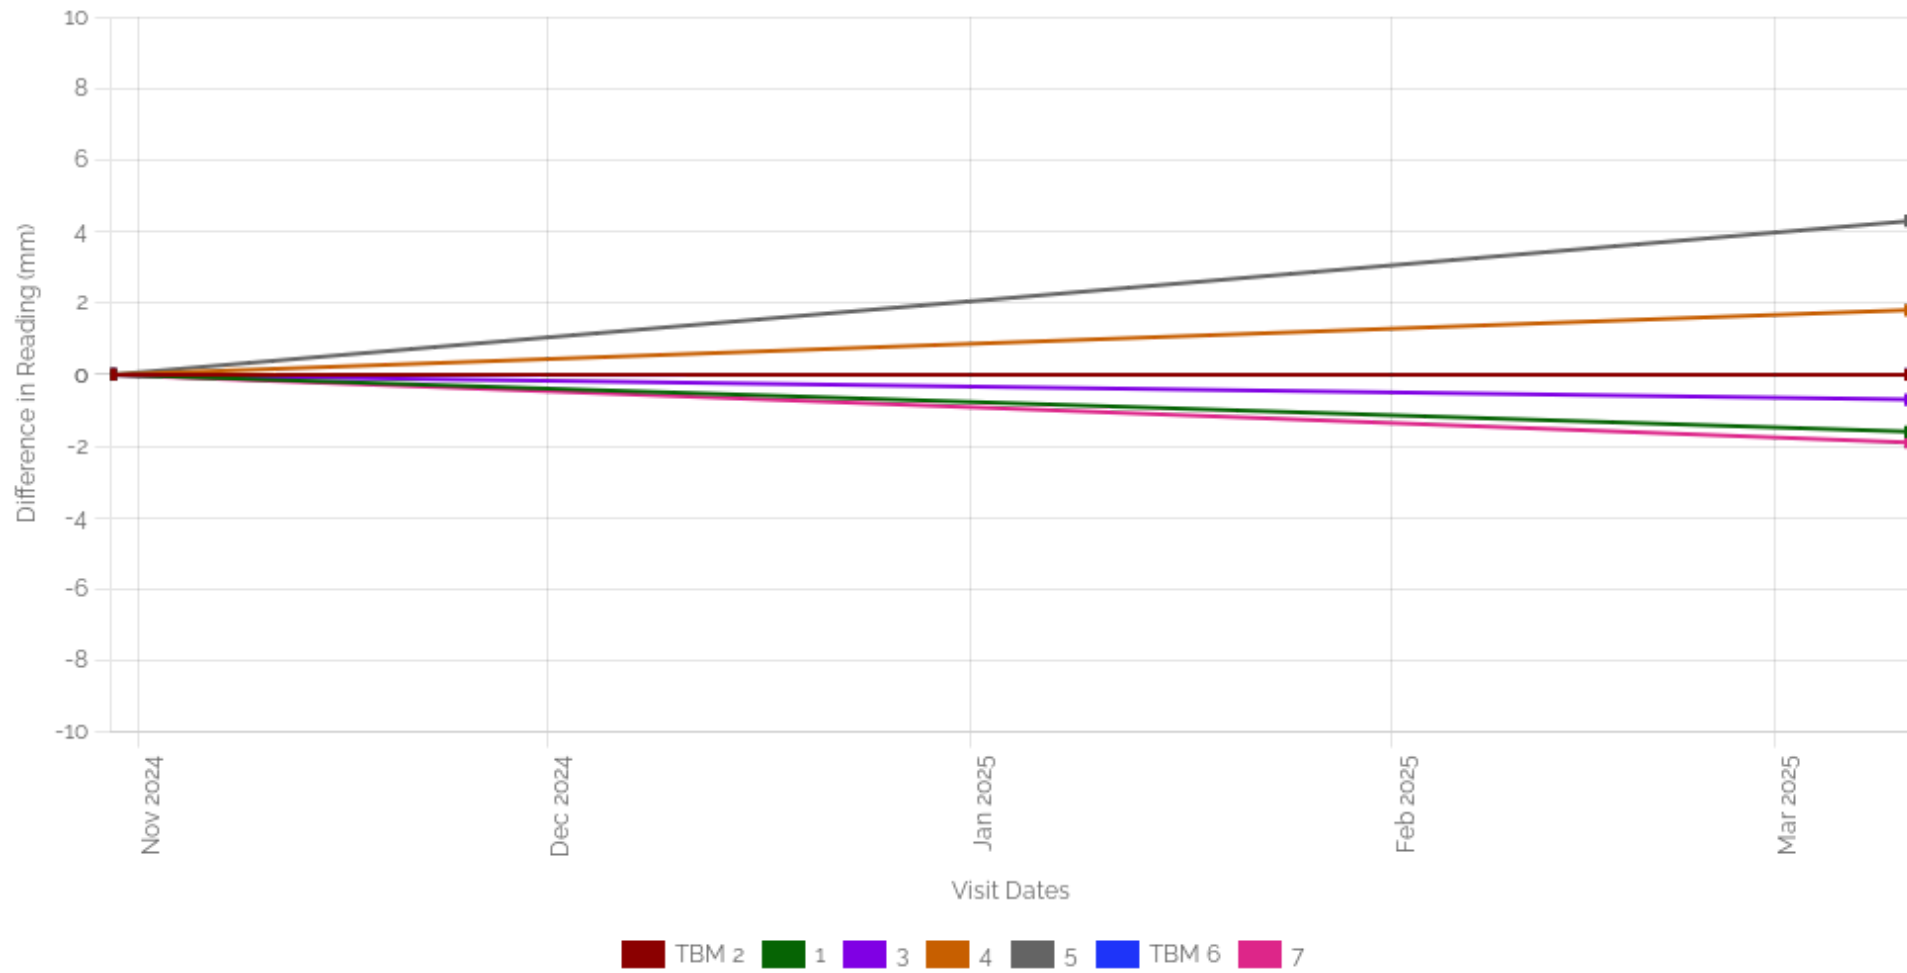

Relative Movement (Relative Survey, for illustration purposes only)

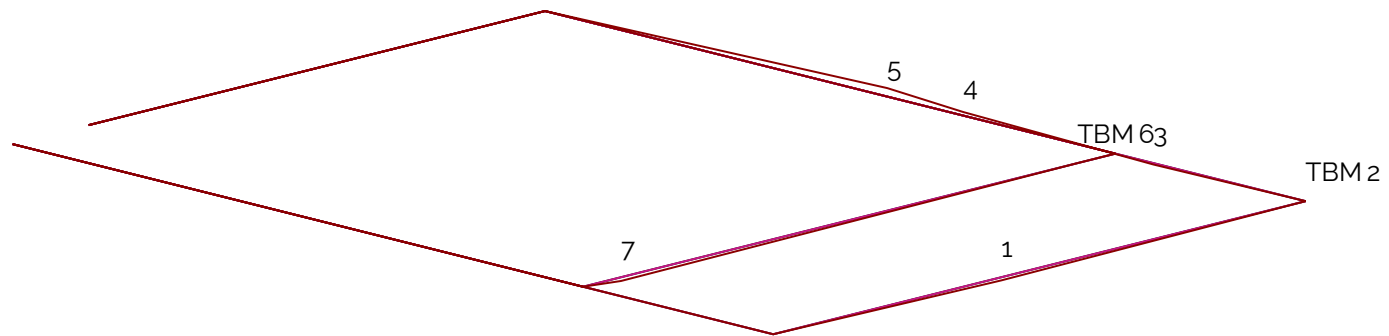

29/10/2024



10/03/2025


Crack Monitoring

Right of wall after gate before stairs

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8
	29/10/24	10/03/25						
H	7759	78						
D	10556	106						
C	7426	7424						
Taken by	DD	BA						
Callipers	1819	9083						

Right of wall after gate before stairs - Crack Readings Differences (Displayed in Millimetres)

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8
	29/10/24	10/03/25						
H	0	0.41						
D	0	0.44						
C	0	-0.02						

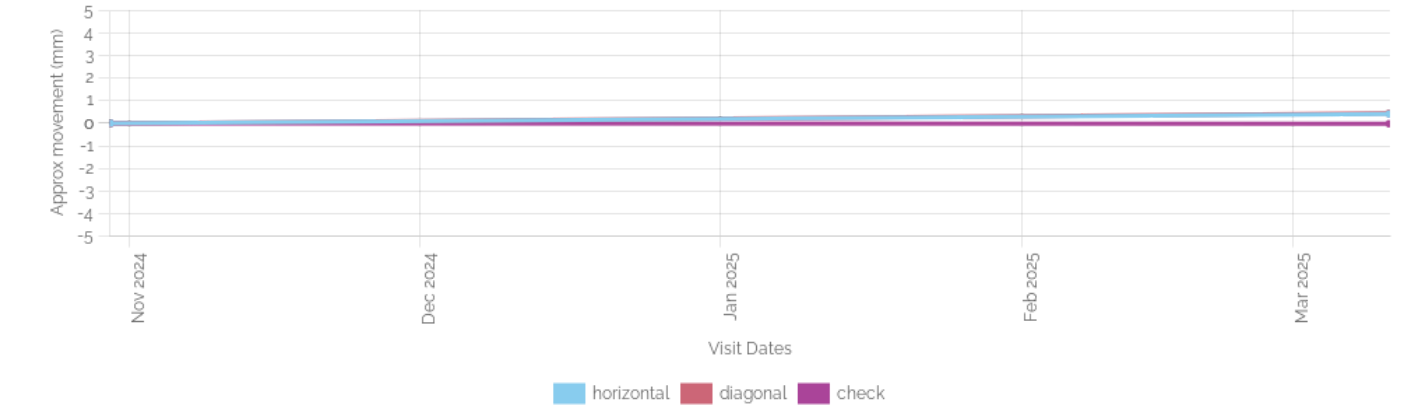

Right of wall after gate before stairs - Visit #1



Right of wall after gate before stairs - Visit #2

