

Monitoring Details:

Crack and Level Monitoring

Provider Name: My Home Needs

Instruction Date: 19/09/2024

Reading Date: 09/05/2025

Date of Issue: 13/05/2025

Monitoring Interval: Every 8 weeks

Number of Visits: 7

Visits Completed: 3

Visits Outstanding: 4

Client Details:

Client: Questgates

Job Reference: QG1S1287571

Engineer / Handler: -


Monitored Address:

Address: 222 Finchley Road, London, NW3 6DH





Site Plan

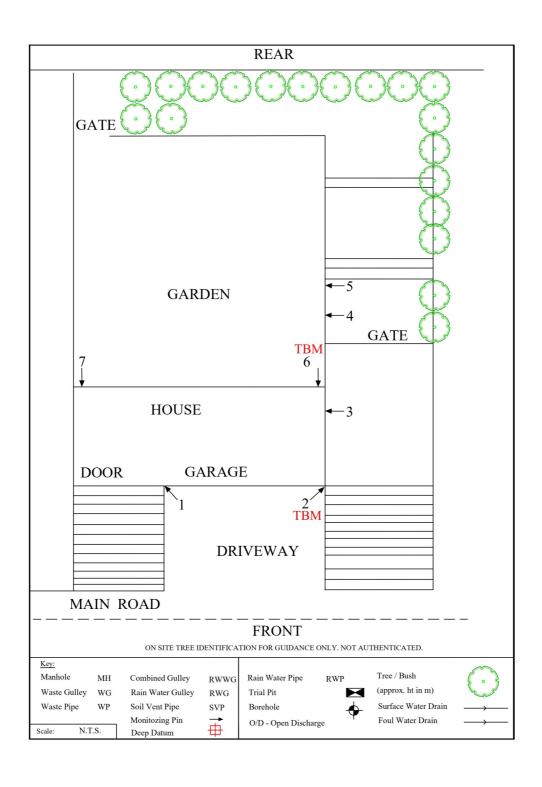



Visit Notes

No visit notes have been entered for any visits

Level Readings


	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8
	29/10/24	10/03/25	09/05/25					
TBM 2	10.0000	10.0000	10.0000					
1	10.8568	10.8552	10.8549					
3	10.7979	10.7972	10.7972					
4	10.6265	10.6283	10.6286					
5	10.5266	10.5309	10.5302					
ТВМ 6	10.0000	10.0000	10.0000					
7	10.2502	10.2483	10.2487					
Taken by	DD	BA	ВА					
Serial number	523713	521816	521816					

Level Movement (Displayed in Millimeters)

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8
	29/10/24	10/03/25	09/05/25					
TBM 2	0	0	0					
1	0	-1.6	-1.9					
3	0	-0.7	-0.7					
4	0	+1.8	+2.1					
5	0	+4.3	+3.6					
TBM6	0	0	0					
7	0	-1.9	-1.5					




Level Readings Chart (Points TBM 2 - 7)

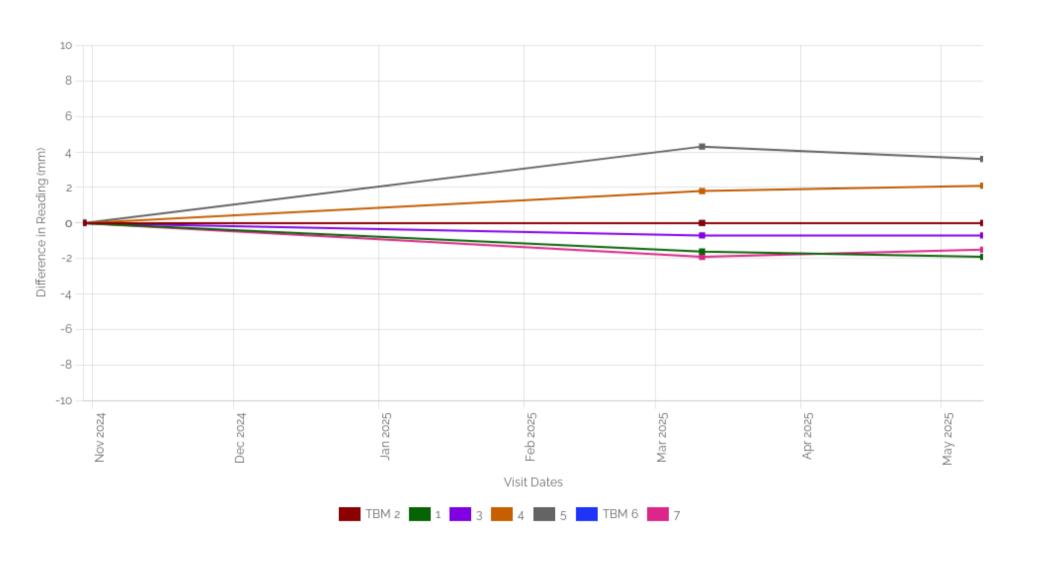



Relative Movement (Relative Survey, for illustration purposes only)

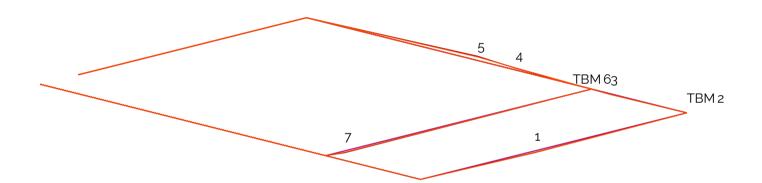





Crack Monitoring

Right of wall after gate before stairs

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8
	29/10/24	10/03/25	09/05/25					
Н	77:59	78	77.71					
D	105.56	106	105.57					
С	74.26	74.24	74.25					
Taken by	DD	ВА	ВА					
Callipers	1819	9083	1819					

Right of wall after gate before stairs - Crack Readings Differences (Displayed in Millimetres)

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8
	29/10/24	10/03/25	09/05/25					
Н	0	0.41	0.13					
D	0	0.44	0.01					
С	0	-0.02	-0.01					



Right of wall after gate before stairs - Visit #1



Right of wall after gate before stairs - Visit #3

