



Elevation Of Ground Floor Right Hand External Window 1:10

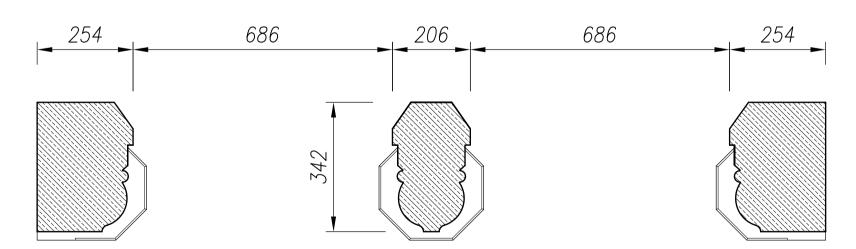

Plan Section At Capitals 1:10

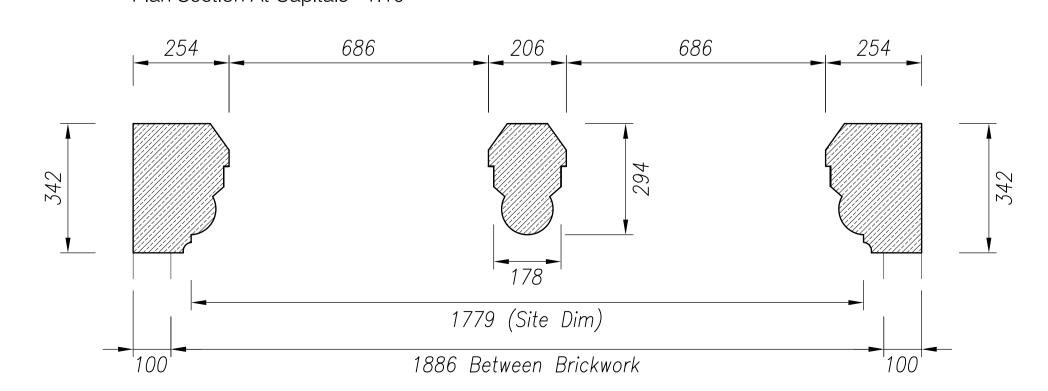


Plan Section Through Jambs/Mullions 1:10


<u>Note:</u>

Stone Sections, Profiles, Moulds And Jointing Patterns Have Been Taken From The Existing Remnants On Site. The Detailing Shown Is As Faithful A Reproduction As Is Possible To Achieve Given The Extensive Level Of Fire Damage To The Existing Masonry.

Mullions Ref: W36 & W37 Are To Be Edge Bedded As The Originals On Site To Achieve The Required Height Dimensions.

All Stone Is To Ancaster Hard White As Approved Sample.

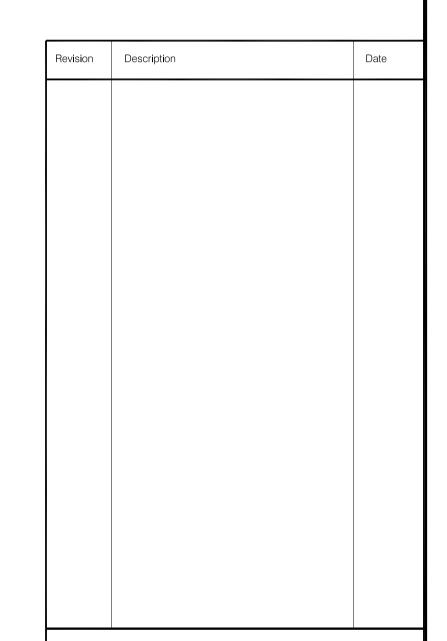

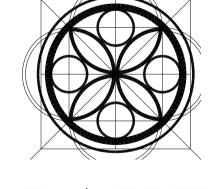

Paye Stonework & Restoration Ltd. Stationmasters House Mottingham Station Approach London, SE9 4EL Tel: 020 8857 9111 Fax: 020 8857 9222 e-mail: PAYE@payestone.co.uk www.payestone.co.uk

St Pancras London

Replacement External Window Units To Fire Damaged Stonework Ground Level Left Hand Window

Drawn By: Tony Barratt Date: 07/08 1:10 @A1

PAYE_SP_05