## PLANNING AND LISTED BUILDING APPLICATION 57 – 60 LINCOLN'S INN FIELDS, YARD WALL REBUILDING WORKS SUPPORTING PHOTOGRAPHS



1. General view of the walls within the front yard of 59-60 LIF. Front piers are original, dividing walls are rebuilds.



2. South wall, looking north. Note it is unclear whether the red brickwork is original, however it is older than the late c.19<sup>th</sup> buff brickwork that exists elsewhere. Render to the lhs is a younger application.



3. South wall, looking south. Note the buff stock bricks date from the rebuilding during the late c.19<sup>th</sup>.



4. North wall, looking north. Note the buff stock bricks date from the rebuilding during the late  $c.19^{th}$ .



5. North wall, looking south. Note the render and decorations are modern, undertaken without authorisation by the neighbours to the north.



6. Bowing and leaning of the south wall.



7. Bowing and leaning of the south wall.



8. Leaning of the north wall.



9. Buff stock brickwork to the north wall and to the north face of the south wall.



10. Mixed, mainly soft red, brickwork to the south face of the south wall.




11. Evidential remains of older red brickwork at the abutment to the north wall.



12. Current copings: Inadequate roughcast concrete, with insufficient overhangs, no drip throat, no weathering slopes (flat top) and no dpc.



13. Leaning south pier; foundations requiring investigation.

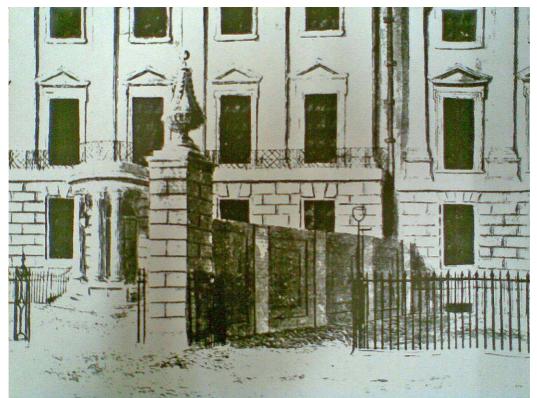

14. 1809 image of the north face of the south wall, showing previous recessed panel design of brickwork set between piers. Similar aesthetic treatment existed to the south face of the north wall. It is not clear whether similar treatment existed to the outer faces, although these were likely to have been flush faced brickwork (as per photo 2).



15. Proposed brick type of Colefords Dark Mixed Tudor Red, as shown against the areas of older mixed red brickwork. Note that the older brickwork is heavily soiled with soot, and the clean colours are very similar.



16. Proposed brick type of Colefords Dark Mixed Tudor Red, as shown against the areas of older mixed red brickwork (lhs, hidden behind render). Note that the older brickwork is heavily soiled with soot, and the clean colours are very similar.