



Addressing All Aspects of Arboricultural Consultancy

BS5837 ARBORICULTURAL REPORT,

ARBORICULTURAL IMPACT ASSESSMENT

& METHOD STATEMENT

| OUR REFERENCE | AC.2015.147 |
|--------------------|---|
| CLIENT | Mr Jeremy Gay, of Origin Architecture |
| SITE | Flat 1, 242 Grafton Rd, London, NW5 4AU |
| REPORT BY | I S Thompson (known as Tom) M.Arbor.A., BSc.(Hons) Arb, |
| | MSc. eFor |
| DATE | 12 th January 2016 |
| Date of Site Visit | 11 th January 2016 |

ARBOR CULTURAL LTD. 36 CENTRAL AVENUE, WEST MOLESEY, SURREY, KT8 2QZ Phone: 0333 577 5523

W: <u>www.arbor-cultural.co.uk</u>

E: admin@arbor-cultural.co.uk

Arbor Cultural www.arbor-cultural.co.uk



Flat 1, 242 Grafton Rd, London, NW5 4AU

Application Ref No Unknown

Extension to the rear of an existing detached residential property.

Report produced by

I S Thompson M.Arbor.A., BSc. (Hons) Arb MSc. eFor Principal Arboricultural Consultant

ARBOR CULTURAL LTD. 36 CENTRAL AVENUE, WEST MOLESEY, SURREY, KT8 2QZ Phone: 0333 577 5523 W: <u>www.arbor-cultural.co.uk</u>

E: admin@arbor-cultural.co.uk

Signed

la S fly

.....

ura

Date......12th January 2016.....

AC.2015.107 Flat 1, 242 Grafton Road, London BS5837 Report 12th January 2016

www.arbor-cultural.co.uk



TABLE OF CONTENTS

| T/ | TABLE OF CONTENTSii | | | |
|----|--|--|--|--|
| A | PPEN | IDICESiii | | |
| 1 | т | TERMS OF REFERENCE1 | | |
| 2 | IN | ITRODUCTION | | |
| | 2.1 | Site5 | | |
| | 2.2 | Trees | | |
| | 2.3 | Proposed Development | | |
| | 2.4 | Description (including levels)7 | | |
| | 2.5 | Soils | | |
| 3 | Α | RBORICULTURAL IMPACT ASSESSMENT8 | | |
| | 3.1 | Presence of Tree Preservation Orders (TPO) or Conservation Area Designation | | |
| | 3.2 | Effects on the amenity value of the trees by the development and facilitation pruning8 | | |
| | 3.3 | Potential incompatibilities between the layout and the trees proposed for retention9 | | |
| | 3.4 | Infrastructure requirements – Highway Visibility, Lighting, CCTV, Services | | |
| | 3.5 | Mitigating tree loss and new planting10 | | |
| | 3.6 | Proximity of trees to structures10 | | |
| | | | | |
| | 3.7 | Issues to be addressed by the arboricultural method statement | | |
| A | - | Issues to be addressed by the arboricultural method statement | | |
| A | - | · | | |
| A | RBO | RICULTURAL METHOD STATEMENT12 | | |
| A | RBO 1 | RICULTURAL METHOD STATEMENT | | |
| A | RBO 1 2 | RICULTURAL METHOD STATEMENT | | |
| A | RBO 1 2 3 | RICULTURAL METHOD STATEMENT | | |
| A | RBO 1 2 3 4 | RICULTURAL METHOD STATEMENT | | |
| A | RBO 1 2 3 4 5 | RICULTURAL METHOD STATEMENT | | |
| A | RBO 1 2 3 4 5 6 | RICULTURAL METHOD STATEMENT | | |
| A | RBO 1 2 3 4 5 6 7 | RICULTURAL METHOD STATEMENT | | |
| A | RBO 1 2 3 4 5 6 7 8 | RICULTURAL METHOD STATEMENT | | |
| A | RBO 1 2 3 4 5 6 7 8 9 | RICULTURAL METHOD STATEMENT | | |
| A | RBO 1 2 3 4 5 6 7 8 9 10 | RICULTURAL METHOD STATEMENT | | |
| A | RBO 1 2 3 4 5 6 7 8 9 10 11 | RICULTURAL METHOD STATEMENT. 12 Construction Exclusion Zone. 12 Ground Protection Measures 13 Access Details 13 Contractors car parking 14 Site Huts and Toilets 14 Storage Space 14 Additional Precautions 14 Demolition 15 Hard Surfaces within the RPA 15 Construction within the RPA (No-dig) 16 Alternative Foundation Designs 16 | | |
| Α | RBO 1 2 3 4 5 6 7 8 9 10 11 12 | RICULTURAL METHOD STATEMENT. 12 Construction Exclusion Zone. 12 Ground Protection Measures 13 Access Details 13 Contractors car parking 14 Site Huts and Toilets 14 Storage Space 14 Additional Precautions 14 Demolition 15 Hard Surfaces within the RPA 15 Construction within the RPA (No-dig) 16 Alternative Foundation Designs 16 Remedial Tree Works 16 | | |
| Α | RBO 1 2 3 4 5 6 7 8 9 10 11 12 13 | RICULTURAL METHOD STATEMENT. 12 Construction Exclusion Zone 12 Ground Protection Measures 13 Access Details 13 Contractors car parking 14 Site Huts and Toilets 14 Storage Space 14 Additional Precautions 14 Demolition 15 Hard Surfaces within the RPA 15 Construction within the RPA (No-dig) 16 Alternative Foundation Designs 16 Use of Herbicides 17 | | |
| A | RBO 1 2 3 4 5 6 7 8 9 10 11 12 13 14 | RICULTURAL METHOD STATEMENT. 12 Construction Exclusion Zone. 12 Ground Protection Measures 13 Access Details 13 Contractors car parking 14 Site Huts and Toilets 14 Storage Space 14 Additional Precautions 14 Demolition 15 Hard Surfaces within the RPA 15 Construction within the RPA (No-dig) 16 Alternative Foundation Designs 16 Remedial Tree Works 16 Use of Herbicides 17 Contingency Plan 17 | | |
| A | RBO 1 2 3 4 5 6 7 8 9 10 11 12 13 14 15 | RICULTURAL METHOD STATEMENT. 12 Construction Exclusion Zone 12 Ground Protection Measures 13 Access Details 13 Contractors car parking 14 Site Huts and Toilets 14 Storage Space 14 Additional Precautions 14 Demolition 15 Hard Surfaces within the RPA 15 Construction within the RPA (No-dig) 16 Alternative Foundation Designs 16 Remedial Tree Works 16 Use of Herbicides 17 Responsibilities 17 | | |

AC.2015.107 Flat 1, 242 Grafton Road, London BS5837 Report 12th January 2016 Arbor Cultural www.arbor-cultural.co.uk



APPENDICES

| APPENDIX I | QUALIFICATIONS AND EXPERIENCE |
|------------|-------------------------------|
| | |

- APPENDIX II SPECIFICATIONS FOR TREE PROTECTION MEASURES
- APPENDIX III KEY TO BS5837 TREE SURVEY RECORDS
- APPENDIX IV PHOTOGRAPHS
- APPENDIX V ARBORICULTURAL SUPERVISION RECORDING TEMPLATE
- APPENDIX VI GROUND GUARD SPECIFICATION
- APPENDIX VII TREE SURVEY RECORDS



1 TERMS OF REFERENCE

- 1.1 I have been instructed in writing by Mr J Gay of Origin Architecture with regards to a planning application to be made by himself in respect of the above erection of a rear extension to an existing residential property and report on the following in accordance with BS 5837 Trees in Relation to Design, Demolition and Construction Recommendations 2012:
 - I. Tree survey
 - II. Arboricultural Impact Assessment
- III. Arboricultural Method Statement
- IV. Tree Protection Plan
- 1.2 The site was surveyed by I Thompson (known as Tom) on Monday 11thJanuary 2016 in the morning. The weather was overcast but visibility was good. The relative quantitative and qualitative tree data was recorded in order to assess the condition of the trees, their value, and any constraints that they pose to the prospective development and where necessary the tree protection measures and construction methods required to ensure their safe retention.
- 1.3 The tree information recorded relates to the tree condition, age, safe useful life expectancy, location, canopy spread, canopy height and tree height and direction of first significant branch as well as any tree work that is required.
- 1.4 I have based this report on my site observations and investigations and I have come to conclusions in the light of my qualifications obtained and experience gained whilst working in the field of arboriculture. I have qualifications and practical experience in arboriculture and forestry and list the details in Appendix I.

Page 1 of 24 AC.2015.107 Flat 1, 242 Grafton Road, London BS5837 Report 12th January 2016

or Cultural www.arbor-cultural.co.uk



1.5 LIMITATIONS AND USE OF COPYRIGHT:

- **1.5.1** All rights in this report are reserved. No part of it may be reproduced or transmitted, in any form or by any means without our written permission. Its contents and format are for the exclusive use of Origin Architecture and their associates. It may not be sold, lent out or divulged to any third party not directly involved in this situation without the written consent of Arbor Cultural Ltd. This report will remain the intellectual property of Arbor Cultural Ltd. until payment has been received in full.
- **1.5.2** This report contains all my advice and opinions and any representation and/or statements that have or may have been made which are not specifically and expressly included in this report should not be relied upon and no responsibility is taken for the accuracy of such statements.
- 1.5.3 The Inspections were carried out on the basis of ground level, Visual Tree Assessment (VTA) examination of external features of each individual tree. Binoculars were used to assess the aerial parts. The report and recommendations relate to the condition of the trees and their relationship to their surroundings at the time of inspection only. All measurements, proportions and assessments of age are approximate.
- 1.5.4 Visual assessment, in accordance with accepted arboricultural practice, was based on apparent vitality (leaf cover, extension growth), presence of deadwood and die back, fractured and detached limbs, evidence of excessive basal movement and external indications of stem and basal decay likely to affect the structural condition of the tree. No decay detection equipment either invasive or non-invasive was employed.



- 1.5.5 Trees are living organisms whose health and condition can change rapidly. The conclusions and recommendations in this report are only valid for one year. This report will be invalidated if there are any changes to the site as it stands at present, e.g. building of extensions, excavation works, importing of soils, extreme weather events etc.
 - 1.5.6 The survey findings are of a preliminary nature with regard to assessment of risk of direct damage (by contact) from trees to built structures. No soil samples were taken or trial pits were dug, therefore no risk assessment was carried out with regard to subsidence (indirect damage). No parts of the drainage or service systems were inspected on site as I am not qualified to do so.
 - **1.5.7** If you, or your advisers, have at your disposal any information to suggest that the property is or has been suffering any tree related structural defect, I would ask that you release the information to us. All relevant data is presented within this report together with any recommendations for further analysis, as appropriate.
 - 1.6 A principle aspect of tree inspections in relation to proposed developments is an assessment of the risk posed by trees in proximity to people or property. Generally tree risk will increase with the age of the trees. The benefits afforded by the trees will also increase with age. The management recommendations will be guided by an analysis of the risk posed by the trees and the benefits afforded by them.



1.7 Documentation

- **1.7.1** The following documentation was provided when the work was commissioned.
 - > Letter/Email to confirm commission of the work.
 - ▶ Plans of the site, Ref 15114 P-101, showing the existing and proposed layout.

1.8 Disclaimer

- **1.8.1** I have no connection with any of the parties involved in this situation that could influence the opinions expressed in this report.
- **1.8.2** Following an initial site visit to assess the likely position of the extension the following arboricultural information is provided in support of the application.



2 INTRODUCTION

- 2.1 Site
- 2.1.1 The proposed site of the extension is within the current boundary of Flat 1, 242 Grafton Rd, London, NW5 4AU, and will be adjacent to two currently unprotected but significant trees. Following the site visit the measures identified in this tree report are recommended so as to minimise any likely impacts of the trees on the new structure and its foundations and any likely impacts of the construction on the trees, see plan AC.2015.147 TPP-01 Rev A attached.

2.2 Trees

- 2.2.1 The two trees are located in the rear garden of the property in raised beds. There are two other small trees/shrubs and a further group of shrubs, all located in raised planting beds. They collectively provide a contribution to the appearance and character of Grafton Road and soften the views from the road frontage. A schedule of the significant trees, their condition and category of retention is attached as Appendix VII.
- **2.2.2** The property contains a mix of young to early mature shrubs and trees with the species comprising sumach, sorbus, hornbeam and cotoneaster. The closest retained trees to the proposed extension are T1 and T2 in the raised bed at the top of the site (west) by the rear entrance.



- 2.2.3 An accurate topographical survey of the site was not provided. The tree locations were measured in relation to the site boundaries and other known features and triangulated and are accurate to +/-0.5m. The drawing number AC.2015.147 TPP-01 Rev A provides a good representation of the tree locations in relation to the site and the proposed extension.
- 2.2.4 The trees have been assessed and categorised in relation to the methodology in Table 1 of BS 5837 (2012) Trees in Relation to Design, Demolition and Construction, as specified in Appendix II. The results are recorded in Appendix VII.
- 2.2.5 Any trees not included individually in the survey were either in groups or had other trees whose constraints exceeded theirs's in respect to the proposed development and all associated works.
- 2.2.6 All tree works considered necessary for health and safety reasons or to facilitate the development will be agreed with the Local Planning Authority and undertaken in accordance with the planning conditions attached to the planning consent. They will be undertaken in accordance with British Standard 3998 (2010) Recommendations for Tree Works, unless otherwise specified with clear justification for any deviation from the British Standard. This will be undertaken by an arboricultural contractor approved by the Local Authority Tree Officer.
- 2.2.7 If at any time additional pruning works are required permission must be sought from the Local Planning Authority first and then carried out in accordance with BS 3998 Recommendations for Tree Works (2010), unless otherwise specified with clear justification for any deviation from the British Standard. This will be undertaken by an arboricultural contractor approved by the Local Authority Tree Officer.

Page 6 of 24 AC.2015.107 Flat 1, 242 Grafton Road, London BS5837 Report 12th January 2016

www.arbor-cultural.co.uk



2.3 Proposed Development

2.3.1 The proposed position of the extension will place its nearest point around 2 metres away from the nearest significant retained tree, T2 a sumach. The new extension is positioned to the east of the significant trees, so there will be some shading of the extension in the winter evenings. This will be addressed with a suitable design of windows and sky lights to ensure that there is adequate natural lighting during the summer and winter months.

2.4 Description (including levels)

2.4.1 This is currently a detached residential dwelling with an existing hard standing area and raised beds in the rear garden to the west. The rear garden slopes down significantly from west to east, with the garden divided by steps in the centre leading down to the back door and raised beds on either side. All the significant vegetation is situated in the raised beds.

2.5 Soils

2.5.1 There is no information provided about the soils and there was no investigation undertaken.

Page 7 of 24 AC.2015.107 Flat 1, 242 Grafton Road, London BS5837 Report 12th January 2016



3 ARBORICULTURAL IMPACT ASSESSMENT

- 3.1 Presence of Tree Preservation Orders (TPO) or Conservation Area Designation
- 3.1.1 The Local Planning Authority has not yet been contacted to establish whether any Tree Preservation Order (TPO) covers any of the trees, or to determine if the site is situated within a Conservation Area (CA). It would be necessary to determine whether either of these planning controls are in operation before commencement of any tree works.

3.1.2 Exemptions

There are a number of exemptions when this notification or permission are not required. They are detailed below:

- Removal of an imminent threat to people or property
- Removal of deadwood or dead trees

3.2 Effects on the amenity value of the trees by the development and facilitation pruning

3.2.1 All of the trees and vegetation are to be retained with the exception of T3. This is only a very small tree/shrub so there is only a very limited detrimental effect to the local amenity value.

Page 8 of 24 AC.2015.107 Flat 1, 242 Grafton Road, London BS5837 Report 12th January 2016 or Cultural www.arbor-cultural.co.uk



3.3 Potential incompatibilities between the layout and the trees proposed for retention

- **3.3.1** No construction of foundations or installation of services is to take place within any Root Protection Area (RPA). All new services will run from the existing building.
- **3.3.2** The crowns of all retained trees and vegetation will remain unaffected by the proposed development. All tree surgery works will be undertaken prior to construction activity and in accordance with the Arboricultural Method Statement Section 12 Remedial Tree Works.
- **3.3.3** Site access will be from the north western end of the site which is the existing gate entrance and hard standing patio area.

3.4 Infrastructure requirements – Highway Visibility, Lighting, CCTV, Services

- **3.4.1** There is no requirement for any tree removal or pruning to create adequate highway visibility. There will be no requirement for street lighting or CCTV visibility or services close to any of the trees.
- **3.4.2** No services or other infrastructure requirements will have any impact on the retained trees. All new services will run from the existing building.

Page 9 of 24 AC.2015.107 Flat 1, 242 Grafton Road, London BS5837 Report 12th January 2016



3.5 Mitigating tree loss and new planting

3.5.1 There is limited space for new tree planting but as no vegetation is being lost other than one small tree and some small shrubs in the lower raised bed there is no replacement planting proposed within this application.

3.6 Proximity of trees to structures

- **3.6.1** The impact of trees on buildings and vice versa and allowance for future growth have all been considered in the siting of the new buildings and structures. Tree size, future growth, light/shading, leaf and fruit nuisance etc. have received due attention and are not considered to be an issue. This is due to the considerable distance of the retained trees from the development and the protection measures proposed within this report.
- **3.6.2** As the trees are contained in raised beds with significant level changes to the areas outside it is likely that only a small number of minor roots of less than 5mm diameter will be encountered during foundation construction. Any severance of a small number of minor roots found in these reduced levels will have an insignificant effect on the future growth and health of the retained trees.
- **3.6.3** The structure has been placed well outside of the modified RPA's of trees and therefore exceeds the recommendations of BS 5837.



3.6.4 Overall the processes of construction are highly unlikely to have a detrimental effect upon the health of the retained trees assuming recommendations made in this report are adhered to at all times by the contractors e.g. the positioning of a stout fence is placed between the retained trees and all construction activities prior to commencement of any works and for it to remain intact and in position throughout the duration of the construction activities.

3.7 Issues to be addressed by the arboricultural method statement

- > Tree protection fencing measures
- Ground protection measures around the RPA of retained trees where work access is required.
- Site access
- > Contractors parking, welfare facilities and storage areas
- > Demolition

Page 11 of 24 AC.2015.107 Flat 1, 242 Grafton Road, London BS5837 Report 12th January 2016 or Cultural www.arbor-cultural.co.uk



ARBORICULTURAL METHOD STATEMENT

Tree Protection throughout the Duration of Demolition and Construction Works All of the details specified in this method statement will need to be supervised by an Arboricultural Consultant with suitable qualifications and experience.

Arboricultural Method Statement includes a Tree Protection Plan to identify:

- Trees to be retained identified with a dashed line with RPA written within it and green, blue or grey location marker circles and the corresponding A, B or C category label.
- > Protective fence positions identifying the Construction Exclusion Zones (CEZ).
- Ground protection measures
- Contractor huts and storage areas

1 Construction Exclusion Zone

1.1 No works will be undertaken within any Construction Exclusion Zone (CEZ). The CEZs are to be afforded protection at all times and will be protected by fencing. A protective fence shall be erected prior to the commencement of any site works e.g. before any materials or machinery are brought on site, development or the stripping of soil commences. The fence shall have signs attached to it stating that this is a Construction Exclusion Zone and that NO WORKS are Permitted within the fence, see Image 4 in Appendix II. The tree protection fencing may only be removed following completion of all construction works.



- 1.2 The fence is required to be sited in accordance with the Tree Protection Plan ref AC.2015.147 TPP-01 Rev A enclosed with this method statement. They must ideally be constructed as per Figure 2 in BS 5837 2012 and be fit for the purpose of excluding any construction activity, (See Appendix II). Any other fence or barrier used must be fit for the purpose.
- **1.3** All tree protection fencing shall be regarded as sacrosanct and will not be removed or altered without prior written consent of the Local Authority Tree Officer.

2 Ground Protection Measures

2.1 The ground protection measures will be for pedestrian work access only. This will consist of a single thickness of scaffold boards placed either on top of a driven scaffold frame so as to form a suspended walkway, or on top of a compression-resistant layer (e.g. 100mm minimum depth of woodchip), laid onto a geotextile membrane. Alternatively Ground Guards or a similarly tested product, as detailed in Appendix II and VI could be used. This is accordance with BS 5837 (2012) and is to prevent compaction to the underlying soil.

3 Access Details

3.1 Site access will be from the north western end of the site which is the existing gate entrance and hard standing patio area. This will be limited to pedestrian access.



4 Contractors car parking

4.1 This will be off-site.

5 Site Huts and Toilets

5.1 Due to the small scale of this development there will not an on-site office. The Portaloo will be at the top off the site, as shown on AC.2015.147 TPP-01 Rev A.

6 Storage Space

6.1 This will be at the top off the site, as shown on AC.2015.147 TPP-01 Rev A.

7 Additional Precautions

- 7.1 No storage of materials or lighting of fires will take place within any constructionExclusion Zone. No mixing or storage of materials will take place up a slope where they may leak into a Construction Exclusion Zone.
- **7.2** There shall generally be a presumption against burning on site. Where it does occur no fires will be lit within 20 metres of any tree stem and will take into account fire size and wind direction so that, no flames come within 5m of any foliage. Situations where fires are not permitted at all are:



- Where the ground is waterlogged as the heat will transfer through the water and damage tree roots significant distances away.
- During periods of drought, where there are peaty or highly organic soils, as there is a risk of underground fires occurring.
- 7.3 No notice boards, cables or other services will be attached to any tree.
- **7.4** Materials which may contaminate the soil will not be discharged within 10m of any tree stem. When undertaking the mixing of any material it is essential that, any slope of the ground does not allow contaminates to run towards a tree root area.

8 Demolition

8.1 There will be no demolition within any of the RPAs of retained trees, so there will not need to be any special measures or precautions undertaken other than the tree protection fencing, which shall be installed prior to any site works commencing.

9 Hard Surfaces within the RPA

9.1 There is to be a decking around created on the upper raised bed, around T1 and T2. As the span is 2.1 m max this shall be designed to span from the existing brick kerb to the path edge across to the garden wall on the street without touching the soil at all. This will result in no compaction of the soil in the RPAs and no significant impact to the air filtration and water percolation in the soil.



10 Construction within the RPA (No-dig)

10.1 There is no construction within the RPA of any retained trees other than the decking around T1 and T2. This has been addressed in Section 9 above.

11 Alternative Foundation Designs

11.1 As there is no construction of foundations within the RPA of any retained trees there will be no requirement for any alternative foundations.

12 Remedial Tree Works

- 12.1 Tree works (see schedule at Appendix VII) will be undertaken in one phase, and this will be undertaken prior to any construction or demolition works and prior to the installation of any tree protection measures. All tree works are to be carried out in accordance with BS 3998 (British Standard Recommendations for Tree Work 2010) unless otherwise specified with clear justification for any deviation from the British Standard.
- **12.2** The only tree works proposed at this time is the removal of T3 a very small leaning tree/shrub.

Page 16 of 24 AC.2015.107 Flat 1, 242 Grafton Road, London BS5837 Report 12th January 2016 www.arbor-cultural.co.uk



12.3 If at any time additional pruning works are required permission must be sought from the Local Planning Authority first and then carried out in accordance with BS 3998 Recommendations for Tree Works 2010, unless otherwise specified with clear justification for any deviation from the British Standard.

13 Use of Herbicides

13.1 It is not planned to use any herbicide in the proposed development. However, if any is required it shall be systemic, spot applied, and mixed according to manufacturer's recommendations.

14 Contingency Plan

14.1 Water is readily available on site and will be used to flush spilt materials through the soil and avoid contamination to tree roots. At the time of any spillage the main contractor will contact an arboriculturist for advice.

15 Responsibilities

- **15.1** It will be the responsibility of the main contractor to ensure that the planning conditions attached to planning consent are adhered to at all times and that a monitoring regime in regards to tree protection is adopted on site.
- **15.2** The main contractor will be responsible for contacting the Local Planning Authority at any time issues are raised related to the trees on site.

Page 17 of 24 AC.2015.107 Flat 1, 242 Grafton Road, London BS5837 Report 12th January 2016

or Cultural www.arbor-cultural.co.uk



- **15.3** The main contractor will ensure the build sequence is appropriate to ensure that no damage occurs to the trees during the construction processes. Protective fences will remain in position until completion of **ALL** construction works on the site.
- **15.4** The fencing, signage and ground protection measures must be maintained in position at all times and shall be checked on a regular basis by an on-site person designated that responsibility.
- **15.5** The main contractor will be responsible for ensuring sub-contractors do not carry out any process or operation that is likely to adversely impact upon any tree on site or those immediately adjacent to it.

16 Arboricultural Supervision

16.1 Since BS5837 was amended in 2012 site supervision has been identified as a key element of the process of protecting trees during construction. It requires that there is "an auditable system of arboricultural site monitoring. This should extend to arboricultural supervision whenever construction and development activity is to take place within or adjacent to any RPA."

16.2 Site Supervision

16.2.1 A site agent must be nominated to be responsible for all arboricultural matters on site.They must be nominated for each phase of work, if demolition and construction contracts are to be awarded separately. The agent(s) must:

Page 18 of 24 AC.2015.107 Flat 1, 242 Grafton Road, London BS5837 Report 12th January 2016

rbor Cultura www.arbor-cultural.co.uk



- > Be present on site for the majority of the time
- Be aware of the arboricultural responsibilities. This will require a site briefing/meeting between the agent and arboricultural consultant prior to the commencement of each phase of works
- Have the authority to stop any work that is causing or has the potential to cause harm to any trees
- Be responsible for ensuring that all site operatives are aware of their responsibilities towards trees on the site and the consequences of failure to observe these responsibilities
- Make immediate contact with the local authority and/or a retained arboriculturist in the event of any tree related problems occurring, whether actual or potential
- > Contact details for Arbor Cultural Ltd are provided within this report
- > Contact details for local authority tree officer are;

Tree officer

| Address Planning - Development Control, Camden Council, Camden T | |
|--|-------------------------------|
| | Judd Street, London, WC1H 8ND |
| Main Switchboard | 0207 974 4444 |
| Email | planning@camden.gov.uk |

16.3 Arboricultural Consultant

16.3.1 A suitably qualified arboricultural consultant should be appointed to oversee development works and liaise with the council and the developer and contractors during the construction phase in order to ensure compliance with these guidelines.

> Page 19 of 24 AC.2015.107 Flat 1, 242 Grafton Road, London BS5837 Report 12th January 2016

oor Cultural www.arbor-cultural.co.uk



- 16.3.2 Note: Failure to fulfil planning conditions or breaches of statutory legislation can lead to delays due to "stop notices" and can lead to the prosecution of contractors and company directors.
- **16.3.3** Adequate site supervision can protect the developer from delays, wasted expense and criminal prosecution.
- **16.3.4** The arboriculturalist will arrive at the site, check in at the site office and be safely escorted around the site by the site agent, checking the maintenance of tree protection measures. Routine visits will generally be unannounced. However, the arboriculturist will also visit subject to advance notification and agreement to supervise any agreed works within the RPA.
- **16.3.5** Monitoring will involve a schedule of routine visits. The frequency of these visits will vary depending on the size of the proposed development and the site-specific constraints. For private single residential developments this will normally involve monthly supervision but for larger sites with multiple structures this could be weekly or fortnightly. This will need to be agreed with the local tree officer.
- 16.3.6 These visits will include a pre-commencement meeting to ensure that all tree protection measures have been implemented and a sign-off sheet at the end of the development. Each visit will be accompanied by a small report detailing the findings identifying any actions and addressing any issues that have arisen. This is to provide ongoing liaison between the local planning authority (LPA) and all personnel involved in the site development. Any defects requiring rectifying must be notified to the site agent the client and the LPA by email as soon as possible.



- **16.3.7** Emergency situations will be notified by phone calls. Appropriate records will be kept and made available to the LPA if required to show evidence of the site monitoring. An example of this is shown in Appendix V.
- **16.3.8** Supervision will not require the arboriculturist to be present throughout all operations, to ensure that all tasks are carried out as per the approved methodology. They will be required at key times during any planned or unplanned incursions into the tree protection areas. This supervision will require the arboriculturist to attend site, if not for the whole task, to ensure that the arboricultural objectives that are met. Where tasks are ongoing, provided that the arboriculturalist is satisfied that the method statement is being followed and after an appropriate briefing the supervision may be reduced to telephone or email contact between the site supervisor and the arboriculturist.

16.4 The critical stages for site supervision are as follows:

- Prior to the start of construction, all tree protection measures as described must be checked as appropriate and signed off by an arboriculturalist. There will be a precommencement meeting with all party attendance, including LPA tree officer, to ensure that there are no unresolved issues.
- II At predetermined activity related times as specified in Table 1. The tree protection measures as described must be checked as being retained and signed off by an arboriculturalist. All defects to be reported to the client and LPA.



- III The potentially damaging activity to the trees must be observed by a suitably qualified arboriculturalist to ensure that the method statements are adhered to and the damage is kept to an absolute minimum. All defects to be reported to the client and LPA.
- IV At periodic intervals during the construction process, the tree protection measures must be checked as being retained and signed off. All defects to be reported to the client and LPA.
- V At the end of the construction phase, an arboricultural consultant must check that no damage has occurred to the trees and any remedial measures, e.g. de-compaction of soil must be recommended as required and remedial measures undertaken as soon as practicable. The outcome shall be reported to the client and local authority
- 16.4.1 The site supervision visits will be documented and circulated to the site agent, developer, architect and Local Planning Authority as appropriate. The reports will detail the date of the visit, the operations being supervised and any issues that require action to meet the aims and objectives of this method statement.



Table 1 Site Supervision Programme

| | Activity | Comments |
|-------|---|--------------------------|
| 1 | Inspection of all tree protection measures to | Report any defects or |
| | ensure that it is secure and fit for purpose prior to | damage to the client and |
| | work commencing. This will need to be signed off | the LPA and ensure that |
| | by the arboriculturalist. | they are made good. |
| 2 | Pre-commencement meeting with all party | Report any defects or |
| | attendance, including LPA tree officer, to ensure | damage to the client and |
| | that there are no unresolved issues. This will need | the LPA and ensure that |
| | to be signed off by the arboriculturalist. | they are made good. |
| 3 | Monthly monitoring of site and tree protection | Report any defects or |
| | measures. This will need to be signed off by the | damage to the client and |
| | arboriculturalist. | the LPA and ensure that |
| | | they are made good. |
| Final | Completion of work, removal of all tree protection | Report any defects or |
| | measures and inspection of trees and root zone for | damage to the client and |
| | any damage. Any compaction of the soil must be | the LPA and ensure that |
| | rectified with remedial measures and damaged | they are made good. |
| | branches taken back to suitable growth points with | |
| | a clean cut. This will need to be signed off by the | |
| | arboriculturalist. | |

Replacement Planting 17

As most of the trees and shrubs are being retained unaffected it is not proposed to plant 17.1 any replacement trees as part of this planning application. There remains a good canopy cover both in the property and the wider area.

ura



References and Bibliography

Anon, British Standard BS 5837 (2012), "Guide for Trees in Relation to Construction", British Standards Institute. London.

Anon, British Standard BS 3998 (2010), "Recommendations for Tree Work", British Standards Institute. London.

DOE, "Tree Preservation Orders - A guide to the law and good practice", Department of Environment, 1994.

Forbes-Laird, J. (2010) THREATS, Tree Hazard: Risk Evaluation and Treatment System, A method for identifying, recording & managing hazards from trees <u>http://www.flac.uk.com/wp-</u> <u>content/uploads/2010/07/THREATS-GN-June-2010.pdf</u>, Accessed 20/06/2012.

Harris, R.W. (1983) Arboriculture; Care of trees, shrubs and vines in the landscape. Prentice Hall, London

Lonsdale L (1999) Principles of Tree Hazard Assessment and Management HMSO

Mattheck, C. and Breloer, H. (1994) The body language of trees. HMSO 240 pp

Matheny N.P & J.R.Clarke, (1994), "A photographic guide to the Evaluation of hazard trees in urban areas, 2nd Edition, International Society of Arboriculture.

Shigo, A.L., (1986) A new tree biology. Shigo & trees, associates, Durham, New Hampshire, USA, 595 pp

Shigo, A.L. (1991) Modern Arboriculture. Shigo & trees, associates. Durham, New Hampshire, USA, 490pp

Town & Country Planning Act Part VIII (1990). Issued by the Secretary of State for the Environment, HMSO.

Page 24 of 24 AC.2015.107 Flat 1, 242 Grafton Road, London BS5837 Report 12th January 2016

www.arbor-cultural.co.uk



APPENDIX I – QUALIFICATIONS AND EXPERIENCE

I S Thompson (known as Tom) BSc (Hons Arb), MSc eFor, M.Arbor.A Cert Arb

1 QUALIFICATIONS

| Subjects | Level | Dates |
|---|---------------|--------------|
| International Society of Arboriculture Certified Arborist | Pass | May – 2012 |
| Professional Tree Inspection Course (LANTRA) | Pass | April - 2011 |
| BSc Hons Arboriculture | (2.1) | 2008 - 2009 |
| FdSc Arboriculture | Distinction | 2004 - 2007 |
| MSc. Environmental Forestry (MSc eFor) | Pass | 2001 - 2002 |
| BSc. Hons Env Science (Conservation Management) | (2.2) | 1997 - 2000 |
| Environmental Studies | Access Course | 1996 - 1997 |
| Forestry & Practical Environmental Skills | NVQ I & II | 1996 – 1997 |
| | | |

2 CAREER SUMMARY

Tom Thompson began his career with trees in 1994 completing various practical forestry and environmental courses with BTCV as well as undertaking various voluntary roles within this field whilst studying to gain entry to university. During the completion of a degree in Environmental Science from the University of Surrey he spent six months working on sustainable forestry operations in British Columbia, Canada. He then spent one month on a forest based work camp in Japan before commencing an MSc in Environmental Forestry at the University of Wales Bangor.

He then spent five years working in new woodland creation, firstly for ADAS in the National Forest and then for 18 months with the Forestry Commission in Cobham, Kent. During this time he began a degree in Arboriculture through Myerscough College.

This course enabled him to make the transition from forestry to arboriculture where he spent 5 years as a tree officer, firstly at St Albans and then more recently at King's Lynn and West Norfolk. He joined Connick Tree Care in May 2012, where he worked as an Arboricultural Consultant for 2 years. He has been the Principal Arboricultural Consultant at Arbor Cultural Ltd. since it was founded in June 2014.

3 AREAS OF EXPERTISE

- > Tree hazard risk assessments for tree owners
- Decay assessment and mapping
- Mortgage and Insurance reports to assess the influence of trees on buildings
- > Pre-development site surveys and arboricultural implication studies
- Tree management reports to prioritise maintenance programs
- Tree related insurance claims
- Diagnosis of tree disorders
- General arboricultural advice
- Woodland design for conservation

Page 1 of 2

APPENDIX I

AC.2015.107 Flat 1, 242 Grafton Road, London BS5837 Report 12th January 2016

Arbor Cultural www.arbor-cultural.co.uk



4 SELECTED CONTINUAL PROFESSIONAL DEVELOPMENT

| Risk Assessment D Lonsdale & J Barrel | ISA & CSA | June | 2013 |
|---|----------------------------------|------------|------|
| BS 5837 Training | Tree Life Training | May | 2013 |
| Pests and Diseases Road Show | Arboricultural Association | , April | 2013 |
| Subsidence; Giles Biddle Part 2 | Arboricultural Association | April | 2013 |
| Arboricultural Consultancy Course | Arboricultural Association | April | 2013 |
| Subsidence Seminar | | March | 2013 |
| BS 5837 2012 & Tree Regs Changes | Arboricultural Association | May | 2012 |
| BS 3998 Changes to Standard | London Tree Officers Association | May | 2012 |
| Bat Course for Arboriculturalists | AA & Bat Conservation Trust | April | 2012 |
| Tree Biomechanics (Germany) | Claus Mattheck | Oct | 2011 |
| Designing with Trees | T Kirkham & P Thurman | Sept | 2011 |
| Urban Forest–Climate Change, Shade & SUDS | Peter MacDonagh | Sept | 2011 |
| Arb Consultancy Report Writing | Consulting Arb Society | July | 2011 |
| BS5837 Seminar on new 2011 draft | Arb Association & ICF | June | 2011 |
| BS3998 Road show presenting 2010 document | Arb Association | May | 2011 |
| New Pests and Diseases Advance | David Rose | Mar | 2011 |
| Fungal Management Strategies | Barcham Nursery | Nov | 2010 |
| Perfect Roots & Tree Growth | Gary Watson | June | 2010 |
| Fungi Recognition and Response | Tree Life Training | May | 2010 |
| Visual Tree Assessment | Claus Mattheck | May | 2010 |
| Arboriculture in Planning | Arb Solution | April | 2010 |
| Trees and the Law Charles Minors | Barcham Nursery | Oct | 2009 |
| Tree Related Subsidence | Tree Life Training | Oct | 2009 |
| CAVAT as a management tool | NATO | Sept | 2009 |
| CAVAT Training | NATO | Sept | 2009 |
| THREATS Tree Assessment | JFL Arboriculture | Aug | 2009 |
| BS 5837 (Trees in Relation to Construction) | Tree Life Training | Jul | 2009 |
| Trees and Hard Surfaces | NATO | June | 2009 |
| BS 5837 (Trees in Relation to Construction) | Richard Nicholson | May | 2009 |
| Native Woodland Plan Advisor | F C Wales | | 2002 |

5. PROFESSIONAL AFFILIATIONS

| Arboricultural Association Professional Member | since 2008 |
|---|------------|
| International Society of Arboriculture Certified Arborist | since 2012 |
| Consulting Arboriculturalist Society | Since 2013 |
| Royal Forestry Society | since 1999 |

Page 2 of 2 APPENDIX I AC.2015.107 Flat 1, 242 Grafton Road, London BS5837 Report 12th January 2016 Arbor Cultural www.arbor-cultural.co.uk



APPENDIX II SPECIFICATIONS FOR TREE PROTECTION MEASURES

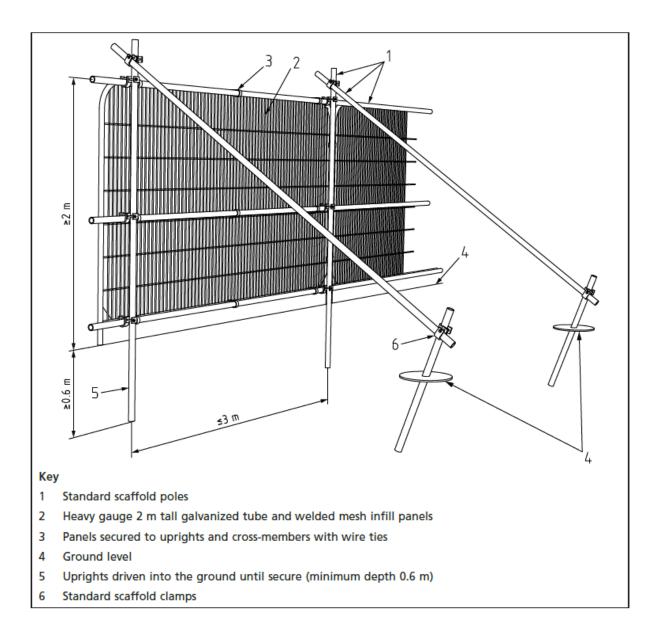


Figure 1 Default Tree Protection Fencing Design BS5837 (2012)

Page 1 of 4 APPENDIX II AC.2015.107 Flat 1, 242 Grafton Road, London BS5837 Report 12th January 2016 Arbor Cultural www.arbor-cultural.co.uk




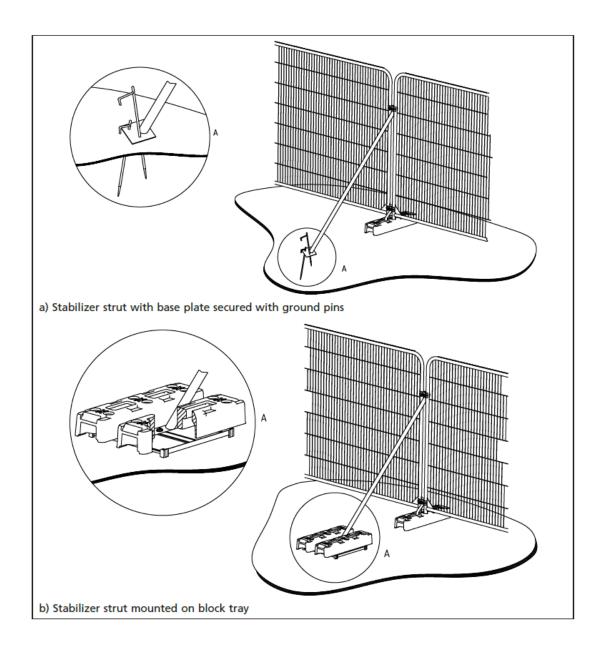


Figure 2 Tree Protection Fencing Design for Hard Surfaced Areas Only (BS5837 2012)





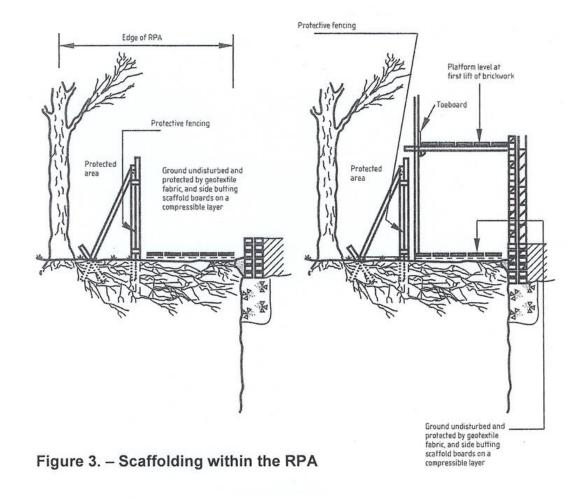

Page 3 of 4 APPENDIX II AC.2015.107 Flat 1, 242 Grafton Road, London BS5837 Report 12th January 2016 Arbor Cultural www.arbor-cultural.co.uk





CONSTRUCTION EXCLUSION ZONE - NO ACCESS

This area has been identified as a tree protection zone, no access is to be permitted.

DO NOT ENTER WITHOUT SPECIFIC INSTRUCTION OR SUPEVISON

Figure 4 Construction Exclusion Zone Signage

Page 4 of 4 APPENDIX II AC.2015.107 Flat 1, 242 Grafton Road, London BS5837 Report 12th January 2016 Arbor Cultural www.arbor-cultural.co.uk



APPENDIX III KEY TO BS5837 TREE SURVEY RECORDS

Tree No.

Tree numbers applied as T1 etc. to each tree are as per the Tree Survey Plan and subsequent drawings, where trees occur as a cohesive group these are suffixed with a G, they are assessed as such, with all size data being given as mean figures unless otherwise stated. Any trees on-site and off-site that are appropriate to be included but are omitted from the topographical survey supplied are included in the schedule, though their positions are shown only indicatively.

The measurement conventions are as follows.

- a) Height, crown spread and crown clearance are recorded to the nearest half metre (crown spread is rounded up) for dimensions up to 10 m and the nearest whole metre for dimensions over 10 m.
- b) Stem diameter is recorded in millimetres, rounded to the nearest 10 mm (0.01 m).
- c) Estimated dimensions (e.g. for off-site or otherwise inaccessible trees where accurate data cannot be recovered) should be clearly identified as such (e.g. suffixed with a "#").

Height (m)

Tree height measured in metres.

Page 1 of 6 APPENDIX III AC.2015.107 Flat 1, 242 Grafton Road, London BS5837 Report 12th January 2016

rbor Cultura www.arbor-cultural.co.uk



Stem Diameter (mm)

Stem diameter in millimetres measured at 1.5m above ground level. Where the stem is divided below 1.5m, measurement is taken as directed by BS 5837 Annex C.

Branch Spread (m)

Radial crown spread in metres, measured for each of the four cardinal points of the compass from the centre of the trunk.

Height of Lowest Branch (m) and direction of growth

Height above ground in metres of the lowest branch and use of the 4 cardinal points of the compass.



Life Stage:

| Y | Young | A recently planted or establishing tree that could be transplanted without |
|----|--------------|--|
| | | specialist equipment, i.e. up to 12-14cm stem diameter. |
| SM | Semi-Mature | An establishing tree which is still exhibiting apical dominance and has |
| | | significant growth potential. |
| EM | Early-Mature | A tree that has reaching its ultimate potential height and has lost |
| | | its apical dominance, and whose growth rate is slowing down but will still |
| | | has potential for a significant increase in stem diameter and crown spread |
| | | and has a significant safe life expectancy remaining |
| м | Mature | A tree with limited potential for any increase in size but with reasonable |
| | | safe useful life expectancy. |
| ом | Over Mature | A senescent or moribund specimen with a limited safe useful life |
| | | expectancy. |
| | | |
| V | Veteran | A tree of great age for species with important biological, aesthetic, |
| | | conservation or cultural value. Trees are in a state of decline due to old |
| | | age. |

Page 3 of 6 APPENDIX III AC.2015.107 Flat 1, 242 Grafton Road, London BS5837 Report 12th January 2016 Arbor Cultural www.arbor-cultural.co.uk



Condition of Trees

Physiological Condition (P) An assessment of the physiological condition (i.e. health/vitality) of the tree categorised into:

| Good | A tree in a healthy condition with no significant problems |
|------|---|
| Fair | A tree generally in good health with some problems that can be remediated |
| Poor | A tree in poor health with significant problems that can't be remediated |
| Dead | A tree without sufficient live material to sustain life |

| Structural Condition (S) | An assessment of the structural/safe condition of the tree |
|--------------------------|--|
| | categorised into: |

| Good | A tree in a safe condition with no significant defects. |
|------|--|
| Fair | A tree in a safe condition at present but with defects or with significant defects |
| | that can be remediated. |
| Poor | A tree with significant defects that can't be remediated |

Notes related to both physiological and structural condition follow the categorization in order support the statement and give greater detail on the true quality and value of the tree.

Page 4 of 6 APPENDIX III AC.2015.107 Flat 1, 242 Grafton Road, London BS5837 Report 12th January 2016 www.arbor-cultural.co.uk



Preliminary Management Recommendations

These may include further investigations for the presence or extent of decay or climbed inspections, ivy removal or pruning works when access is a non-moveable aspect etc. (NB this is not intended to be a specification for tree work and further advice maybe required prior to implementation). Trees assessed as being in apparently immediately hazardous condition will be notified to the client separately as soon as practicable.

Estimated Remaining Life Contribution

This is an estimate of the remaining life contribution in years that the tree or group of trees is expected to have based on species, condition on the site in its current context. The following bands are used:

- <10 Tree is dead or dying and unlikely to contribute beyond 10 years
- 10+ Tree is assessed as being able to contribute to the site for 10+ years
- 20+ Tree is assessed as being able to contribute to the site for 20+ years
- 40+ Tree is assessed as being able to contribute to the site for 40+ years

Quality and Value Category Grade

| U | Trees that cannot be realistically retained | Dark red |
|---|---|-------------|
| Α | Those trees of HIGH value quality to retain | Light green |
| В | Those trees of MODERATE quality to retain | Mid blue |
| С | Those trees of LOW quality to retain | Grey |

Page 5 of 6 APPENDIX III AC.2015.107 Flat 1, 242 Grafton Road, London BS5837 Report 12th January 2016

rbor Cultural www.arbor-cultural.co.uk



Deadwood Categorisation

| Minor Deadwood | Less than 50mm in diameter or less than 3m in length |
|----------------|--|
|----------------|--|

Major Deadwood Greater than 50mm in diameter or greater than 3m in length

Page 6 of 6 APPENDIX III AC.2015.107 Flat 1, 242 Grafton Road, London BS5837 Report 12th January 2016 Arbor Cultural www.arbor-cultural.co.uk



APPENDIX IV PHOTOGRAPHS



Image 1 T1, 2 and 3 viewed from the eastern end of the site



Image 2 T1, 2 and 3 viewed from the western end of the site showing the level change

Page 1 of 4 APPENDIX IV AC.2015.107 Flat 1, 242 Grafton Road, London BS5837 Report 12th January 2016 Arbor Cultural www.arbor-cultural.co.uk

Arbor Cultural

www.arbor-cultural.co.uk



Image 3 Stems of T1 and T2 showing their proximity to the wall.



Image 4 T4, in the raised bed to the north of the site

Page 2 of 4 APPENDIX IV AC.2015.107 Flat 1, 242 Grafton Road, London BS5837 Report 12th January 2016 Arbor Cultural www.arbor-cultural.co.uk



Image 5 G1, further along the northern raised bed

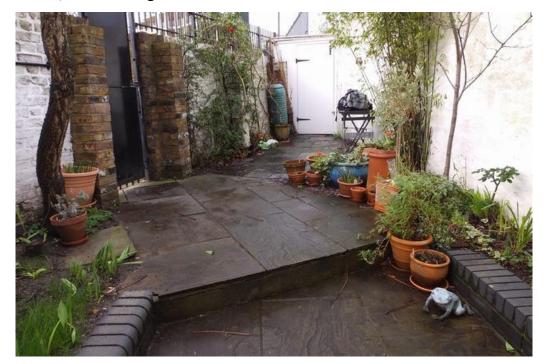


Image 6 Relatively flat area to the west to be used for storage area

Page 3 of 4 APPENDIX IV AC.2015.107 Flat 1, 242 Grafton Road, London BS5837 Report 12th January 2016 Arbor Cultural www.arbor-cultural.co.uk





Image 7 Showing the significant drop between the raised beds



Image 8 Showing ground level at the rear of the building and steps leading to the west

Page 4 of 4 APPENDIX IV AC.2015.107 Flat 1, 242 Grafton Road, London BS5837 Report 12th January 2016 Arbor Cultural www.arbor-cultural.co.uk



APPENDIX V ARBORICULTURAL SUPERVISION RECORDING TEMPLATE

| Client: | | | Planning Ref: | | |
|-------------------------|------------|-------------|------------------------------|---|------|
| Local Authority: | | | Date: | | |
| Site Address | | | | | |
| Proposal: | | | | | |
| Visit Checklist | | X /N | | | V /N |
| VISIT CHECKIIST | | Y/N | | | Y/N |
| Tree Protection Fencing | ; in place | | Tree protection as approved | | |
| Ground Protection in pl | ace | | Ground Protection as approve | d | |
| Tree or Ground protect | | | Trees damaged | | |
| Site Agent briefed by A | C | | | | |
| AC briefed by Site Agen | t | | | | |
| LPA informed | | | | | |
| Remedial action require | ed | | | | |
| Comments | | | | | |
| | | | | | |
| | | | | | |
| | | | | | |
| | | | | | |
| Recommendations | | | | | |
| | | | | | |
| | | | | | |
| | | | | | |
| | | | | | |
| | | | | | |
| Outcome | | | | | |
| 1 | | | | | |
| 2 | | | | | |
| 3 | | | | | |
| 4 | | | | | |
| 5 | | | | | |

Page 1 of 1 APPENDIX V AC.2015.107 Flat 1, 242 Grafton Road, London BS5837 Report 12th January 2016 Arbor Cultural www.arbor-cultural.co.uk



APPENDIX VI

APPENDIX VII GROUND GUARDS

Ground-Guards Introduction

Driven by passion, consistency and excellence, we strive to provide you with the most innovative and forwardthinking ground protection solutions available today.

GROUND GUARDS

Our ground protection mats enable you to construct durable roadways, walkways and pad areas, with the support of our highly experienced team who can assist with bespoke designs to suit your specific requirements, step-by-step installation guidance, and an after-sales care service second-to-none.

The suitability of any trackway solution is largely governed by ground and weather conditions, which can vary dramatically from site to site and month to month, and over which we have no control.

Our clients trust us because we offer practical, step-by-step guidance, site visits (subject to location), and technical support. Our highly trained, experienced and friendly support team are ready to provide you with the expertise you need for the job on hand.

The data below highlights the typical applications for the various products in the Ground- Guards range. Please note that as a further precaution, optimum stability can be achieved by the use of a woven geotextile membrane under the mats.

Remember, cutting corners is a big risk to take. Time is money, and life is irreplaceable. If you are in any doubt whatever as to the requirements for your site, feel free to call one of our team for advice.

| Product | Surface | Typically suitable for* |
|--------------|-------------------|---|
| LiteTrack | Multiple surfaces | Pedestrians, cars, light goods vehicles |
| MultiTrack | Multiple surfaces | Pedestrians, cars, construction plant, heavy goods vehicles |
| MaxiTrack | Multiple surfaces | Pedestrians, cars, construction plant, heavy goods vehicles |
| BogMats | Multiple surfaces | Construction plant of all sizes, depending on thickness of mats |
| FastCover | Grass | Pedestrians, golf buggies |
| | Crushed Stone | Pedestrians, cars, light goods vehicles |
| | Concrete | Pedestrians, cars, construction plant, heavy goods vehicles |
| TrenchGuards | Pavements | Pedestrians, cars |
| | | |

*dependent on ground and weather conditions. If in doubt, please speak to our support team for advice.

+44 (0) 113 267 6000

info@ground-guards.co.uk

FastCover is a 1200 x 800mm matting system available in 22mm and 43mm thicknesses. It has interlocking flanged edges, and provides clean, safe and wellprotected floors in an incredibly

pedestrian ground protection

Rapid, safe and simple

rapid installation time.

Ground-Guards FastCover

It's unique add-on end ramp design minimises the possibility of trip hazards, making it the product of choice for any situation where safety is a high priority.

It's numerous applications include pedestrian walkways, indoor and outdoor event floors, temporary car parks, factory flooring and welfare compounds.

Not only is it a low-hazard product, but each mat has been formed from entirely recycled raw material to reduce impact on the environment.

+44 (0) 113 267 6000 Ground-Guards

www.ground-guards.co.uk

Ground-Guards

info@ground-guards.co.uk

www.ground-guards.co.uk

Page 1 of 3 APPENDIX VI

AC.2015.107 Flat 1, 242 Grafton Road, London BS5837 Report 12th January 2016

Arbor Cultural www.arbor-cultural.co.uk



Ground-Guards LiteTrack

Ground-Guards LiteTrack Accessories



The light yet strong ground protection mat

LiteTrack is crafted from a specially recycled LDPE polymer, allowing it to remain flexible enough to follow the contours, yet strong enough to protect your surface.

This cost-conscious system has been created for light vehicles and pedestrian access, making it a great solution for many construction sites and events.

The 2400 x 1200 LiteTrack mats provide the perfect alternative to using plywood, without incurring the expense of a trackway system which may be over-engineered for the job.

With a full range of accessories, LiteTrack is fast becoming the system of choice for contractors, events and local authorities. It's well positioned costing makes it a super investment that will pay dividends for many years to come.

+44 (0) 113 267 6000 Ground-Guards





LiteTrack Accessories:

LiteTrack accessories increase efficiency and safety on site. Joiner clips lock the mats together, ground pins reduce slippage on inclines, and HandiHooks make light work of handling.

Many sites are required to segregate between roads and walkways, for protection of pedestrians. Our high-visibility post-and-chain system achieves this rapidly.

SafeStore stillages secure 30 LiteTrack mats in place when not in use. They can be stacked six high, maximising space-saving on site.

- 1. Double joiner clip
- 2. Single joiner clip
- 3. Low profile double joiner clip
- 4. Low profile single joiner clip
- 5. Post and chain system
- 6. Ground anchor pin
- 7. HandiHook 8. SafeStore stillage

+44 (0) 113 267 6000 Ground-Guards

info@ground-guards.co.uk

www.ground-guards.co.uk

info@ground-guards.co.uk

www.ground-guards.co.uk

Page 2 of 3 APPENDIX VI


AC.2015.107 Flat 1, 242 Grafton Road, London BS5837 Report 12th January 2016

Arbor Cultural www.arbor-cultural.co.uk



Ground-Guards MultiTrack

Ground-Guards MultiTrack Accessories

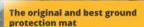

MultiTrack's unique HDPE polymer offers virtual indestructibility. At 2400 x 1200mm, it weighs just 39kg making it very easy to handle.

With a great range of accessories, trackways and pad areas are rapid to lay, reducing the need for stone roadways and the expense of reinstating these areas.

The dual purpose finish provides both pedestrian and vehicular tread patterns for the price of one. MultiTrack users find huge benefit over any other system. With up to 120 tonnes UDL (uniformly distributed load), these mats remain in a league of their own.

Please note that weight loadings quoted are entirely subject to ground and weather conditions, both of which are beyond our control. Whilst it is the user's responsibility to ascertain their suitability in each instance, our friendly support team are on hand to guide you at every step of your project.

+44 (0) 113 267 6000 Ground-Guards





MultiTrack Accessories

MultiTrack accessories compliment the system, increasing efficiency and safety on site. Joiner clips lock the mats together, ground pins reduce slippage on inclines, and HandiHooks make light work of handling.

Many sites are required to segregate between roads and walkways, for protection of pedestrians. Our high-visibility post-and-chain system achieves this rapidly.

SafeStore stillages secure 25 MultiTrack mats in place when not in use. They can be stacked six high, maximising space-saving on site.

- 1. Double joiner clip
- 2. Single joiner clip
- 3. Low profile double joiner clip 4. Low profile single joiner clip
- 5. Post and chain system
- 6. Ground anchor pin
- 7. HandiHook
- 8. SafeStore stillage

+44 (0) 113 267 6000 Ground-Guards

info@ground-guards.co.uk

www.ground-guards.co.uk

info@ground-guards.co.uk

www.ground-guards.co.uk

Page 3 of 3 APPENDIX VI

AC.2015.107 Flat 1, 242 Grafton Road, London BS5837 Report 12th January 2016

Arbor Cultural www.arbor-cultural.co.uk

APPENDIX VII - TREE SURVEY RECORDS

Date of Survey - 11th January 2016

| | | | | | | | | | | | | | | - | | | | BS | BS | Phys & | | | |
|-------|------------|------|------|------|-----|----|---------|--------|----|-----|-----|-----|---------|------|-----|-------|------|------|------|-----------|---------------------------|--------------|-------|
| | | Stem | | Tree | Ult | | | | | FSB | | | | | | | | 5837 | | Struct | | | RPA |
| Tree | Tree | Diam | Stem | Hgt | Hgt | Cı | rown | Heig | ht | Hgt | FSB | Ca | nopy | Spre | ad | Life | Life | Cat | Cat | Conditio | | Recommend | Annex |
| ld No | Species | (mm) | No | (m) | (m) | N | , E, S, | , W (n | n) | (m) | Dir | N | , E, S, | W (n | n) | Stage | Ехр | Pre | Post | n | Comments | ed Work | D (m) |
| | | | | | | | | | | | | | | | | | | | | | Mutual crown | | |
| | | | | | | | | | | | | | | | | | | | | | suppression and some | | |
| | | | | | | | | | | | | | | | | | | | | | low branch and | | |
| | Staghorn | | | | | | | | | | | | | | | | | | | | conflicting branch | No Action | |
| | sumach, | | | | | | | | | | | | | | | | | | | | removals. | Required at | |
| | Rhus | | | | | | | | | | | | | | | | | | | P Good S | Located in a small raised | this time | |
| | typhina | 140 | 1 | 6 | 6 | 3 | 3 | 4 | 4 | - | - | 2.5 | 2 | 2 | 1.5 | EM | 40+ | C1 | | Good | bed. | (NAR) | 1.8 |
| | -71 | - | | | | _ | | | | | | | | | | | _ | | - | | | , , | |
| | | | | | | | | | | | | | | | | | | | | | Mutual crown | | |
| | | | | | | | | | | | | | | | | | | | | | suppression and some | | |
| | | | | | | | | | | | | | | | | | | | | | low branch and | | |
| | Staghorn | | | | | | | | | | | | | | | | | | | | conflicting branch | | |
| | sumach, | | | | | | | | | | | | | | | | | | | | removals. | | |
| | Rhus | | | - | | | | _ | _ | | | | | | | | | | | | Located in a small raised | | |
| Т2 | typhina | 100 | 1 | 6 | 6 | 4 | 4 | 5 | 5 | - | - | 1.5 | 2.5 | 2 | 0 | EM | 40+ | C1 | C1 | Good | bed. | NAR | 1.2 |
| | Rowan | | | | | | | | | | | | | | | | | | | | | Remove | |
| | Sorbus | | | | | | | | | | | | | | | | | | | P Good, S | Severe lean to the west | poor quality | |
| Т З | acuparia | 50 | 1 | 4 | 6 | 1 | 1 | 1 | 1 | - | - | 0.5 | 0.5 | 1 | 2 | Y | 40+ | C1 | C1 | Fair | Poor crown shape | tree | N/A |
| | Hornbeam, | | | | | | | | | | | | | | | | | | | | | | |
| | Carpinus | | | | | | | | | | | | | | | | | | | P Good, S | Topped at 2m to contain | | |
| Т4 | betulus | 30 | 1 | 3 | 5 | 1 | 1 | 1 | 1 | - | - | 0.5 | 1 | 1 | 0.5 | Y | 40+ | C1 | C1 | Fair | in small environment. | NAR | N/A |
| | | | | | | | | | | | | | | | | | | | | | | | |
| | Cotoneaste | | | | | | | | | | | | | | | | | | | P Good, S | Growing in group in | | |
| G 1 | r Sp | M/S | Many | 3 | 3 | 1 | 1 | 1 | 1 | - | - | 0.5 | 1 | 0.5 | 1 | SM | 40+ | C2 | | Fair | raised bed along wall. | NAR | N/A |