

____63.00m

____62.00m

____61.00m

_____60.00m


____59.00m

ELEVATION KEY - E2



Client: The Danish Church in London 4 St Katharine's Precinct London NW1 4HH

Drawing 043-E2-S03-01 Issue date Sept 2016 FOR TENDER Scale 1:10@ A1

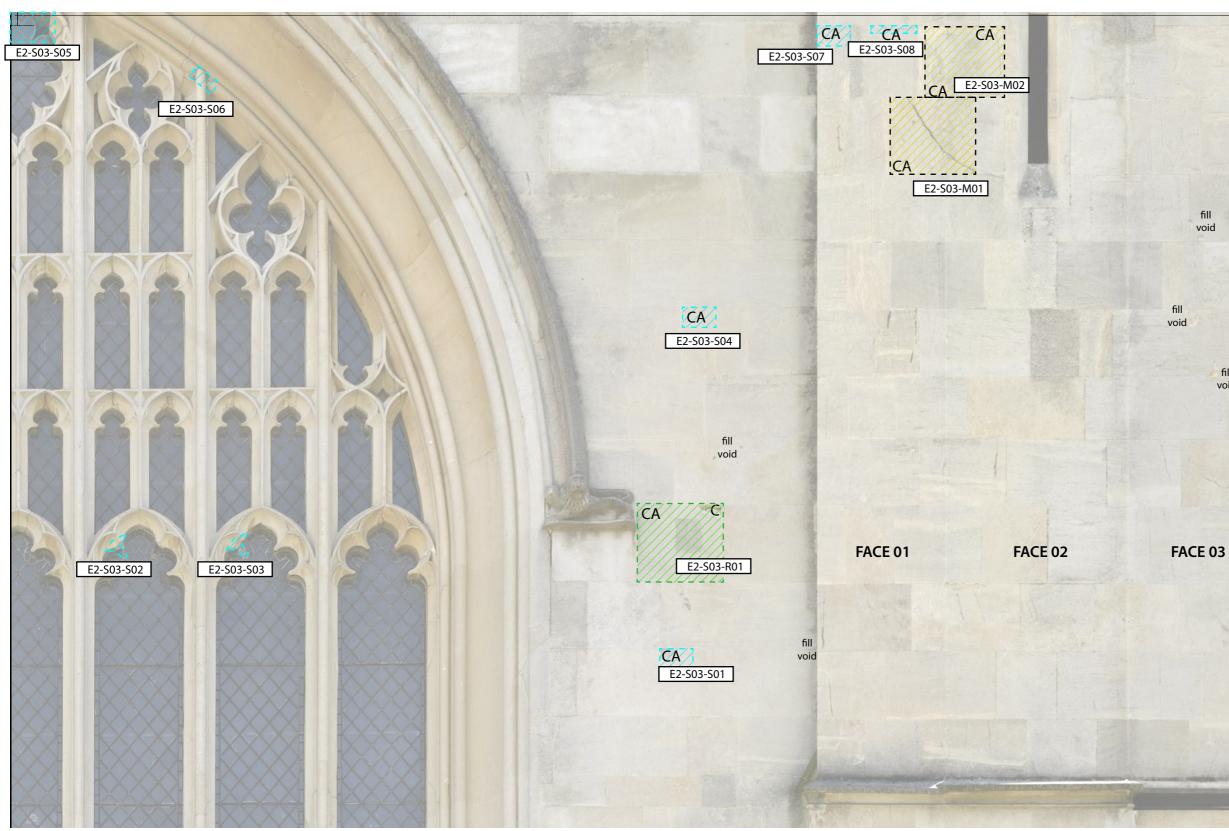

Notes: Drawing units are metres. Stair/ slope arrows point up Direction of floor boards Direction of roof slope (up)	Abbreviations:	Notes: THIS SURVEY WAS BEEN CARRIED OUT WITH AN ACCURACY CONSISTENT WITH A SCALE OF 150. INTERROGATED DIMENSIONS WILL BE WITHIN THE TOLERANCE ASSOCIETED WITH THIS AND SMALL RE SCALES ONLY. ALL LEVELS ARE IN METRES, RELATED TO AN ARBITRARY DATUM	St. Katharine's - The Danish Church in London	SURVEYED & DRAWN BY: James Brennan Associates Chartered Surveyors www.jkrennansociates.co.uk UNIT 6 WARREN HOUSE	Architect/ Surveyor:
	UNITS ARE MILLIMETRES.	UNITS ARE MILLIMETRES.		DEEPDALE BUSINESS PARK ASHFORD ROAD, BAKEWELL DE45 1GT TEL: 01629 814654 EMAIL: mail@brennanassociates.co.uk	0207 6847244 0795 0781411 <u>mf@mfryer-architects.com</u> www.mfryer-architects.com

GENERAL NOTES

To be read in conjunction with prelims and specialist stonemason details

Final scope of work to be agreed with CA prior to commencement.

CLEANING

External cleaning to be completed prior to commencement of stonework repairs, following approved external cleaning trials with DOFF steam as per spec A12r/460 in consultation with CA.

REPOINTING GENERALLY

Allow for ashlar repointing to open joints only (approximately 50% of total surface area) as per specification Z21r/ 490. All hairline fissures to ashlar and retained rendered surfaces to be filled where possible, in consultation with CA.



í /_/_/.

С

CA

Replace Stonework

Carefully replace stonework as per specification F21r and approved sample.

Mortar Repair

Repair with lime mortar as per specification F21r/750 and approved sample.

Stone Indent Repair

Indented repair as per specification F21r/710 and approved sample.

Replace Cramp

Careful removal of existing cramp and cramp replacement as per specification F21r/610. Allow for stone replacement, indent repair or mortar repair as scheduled.

Cramp Assumed

Evidence suggests corrosion of embedded cramp within face stonework. Area to be investigated by specialist stonemason. Allow for careful removal of cramp and cramp replacement as per specification F21r/610, and stone replacement, indent repair or mortar repair as scheduled.

For Structural Investigation

Signs of movement or structural concern at time of survey to be investigated by Structural Engineer

Shelter Coat

As per specification F21r/860

ELEVATION KEY - E2



Malcolm Fryer rchitect


The Danish Church in London 4 St Katharine's Precinct London NW1 4HH

Drawing 043-E2-S03-02 Issue date Oct 2016 FOR TENDER Scale 1:10@ A1

fill void

> fill void



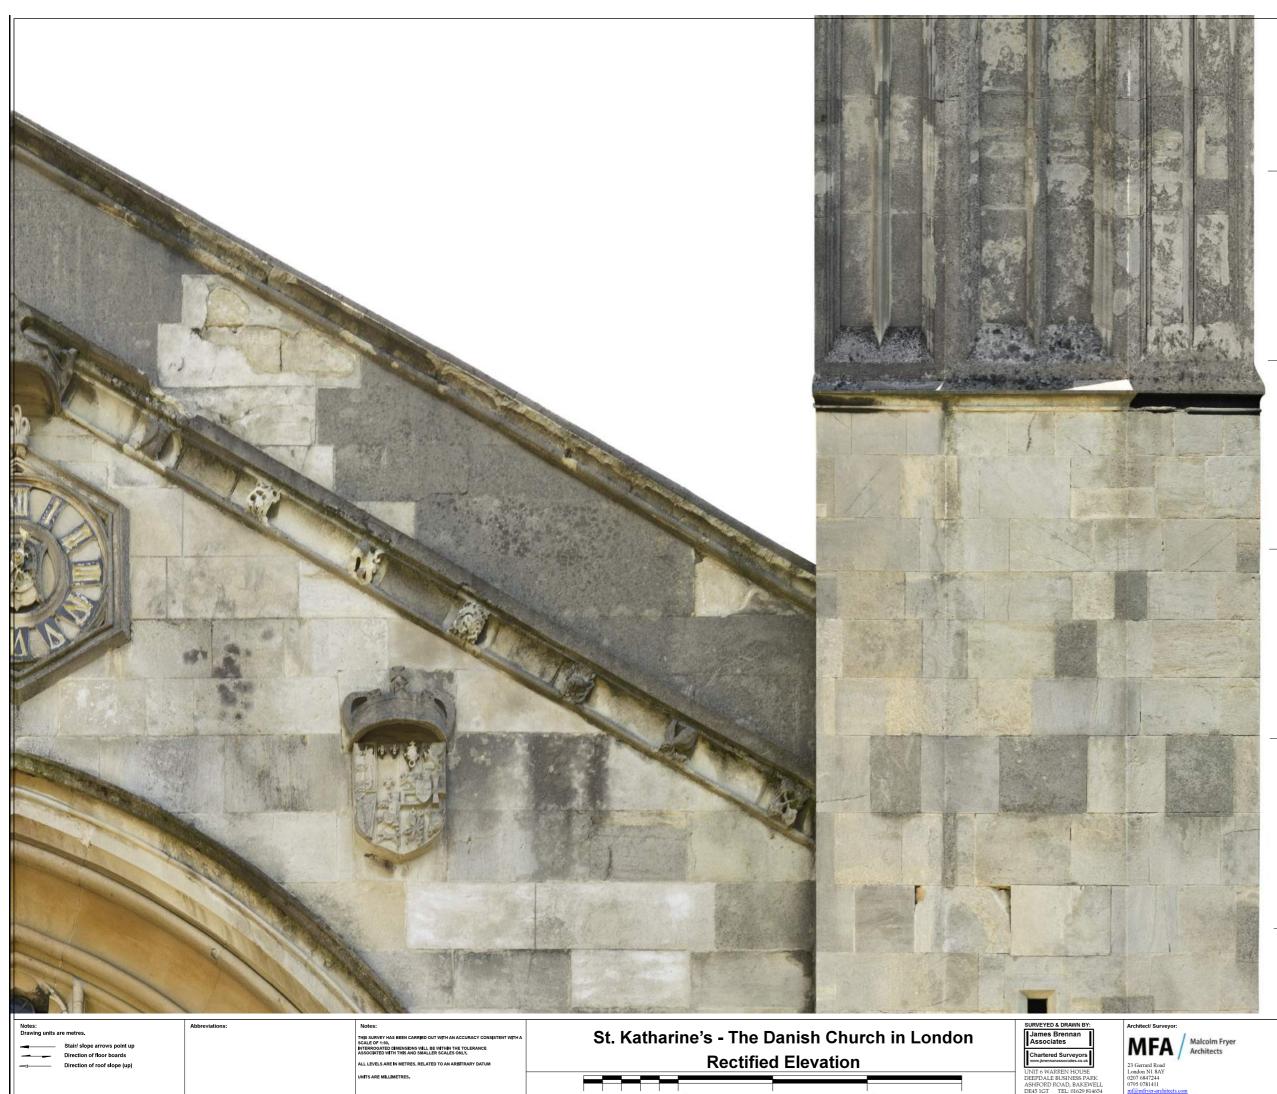

0 0.1 0.2 0.3 0.4 0.5

____68.00m

_____67.00m

____66.00m

_____65.00m

_____64.00m


ELEVATION KEY - E2



2 metres

Client: The Danish Church in London 4 St Katharine's Precinct London NW1 4HH

Drawing 043-E2-S04-01 Issue date Sept 2016 FOR TENDER Scale 1:10@ A1

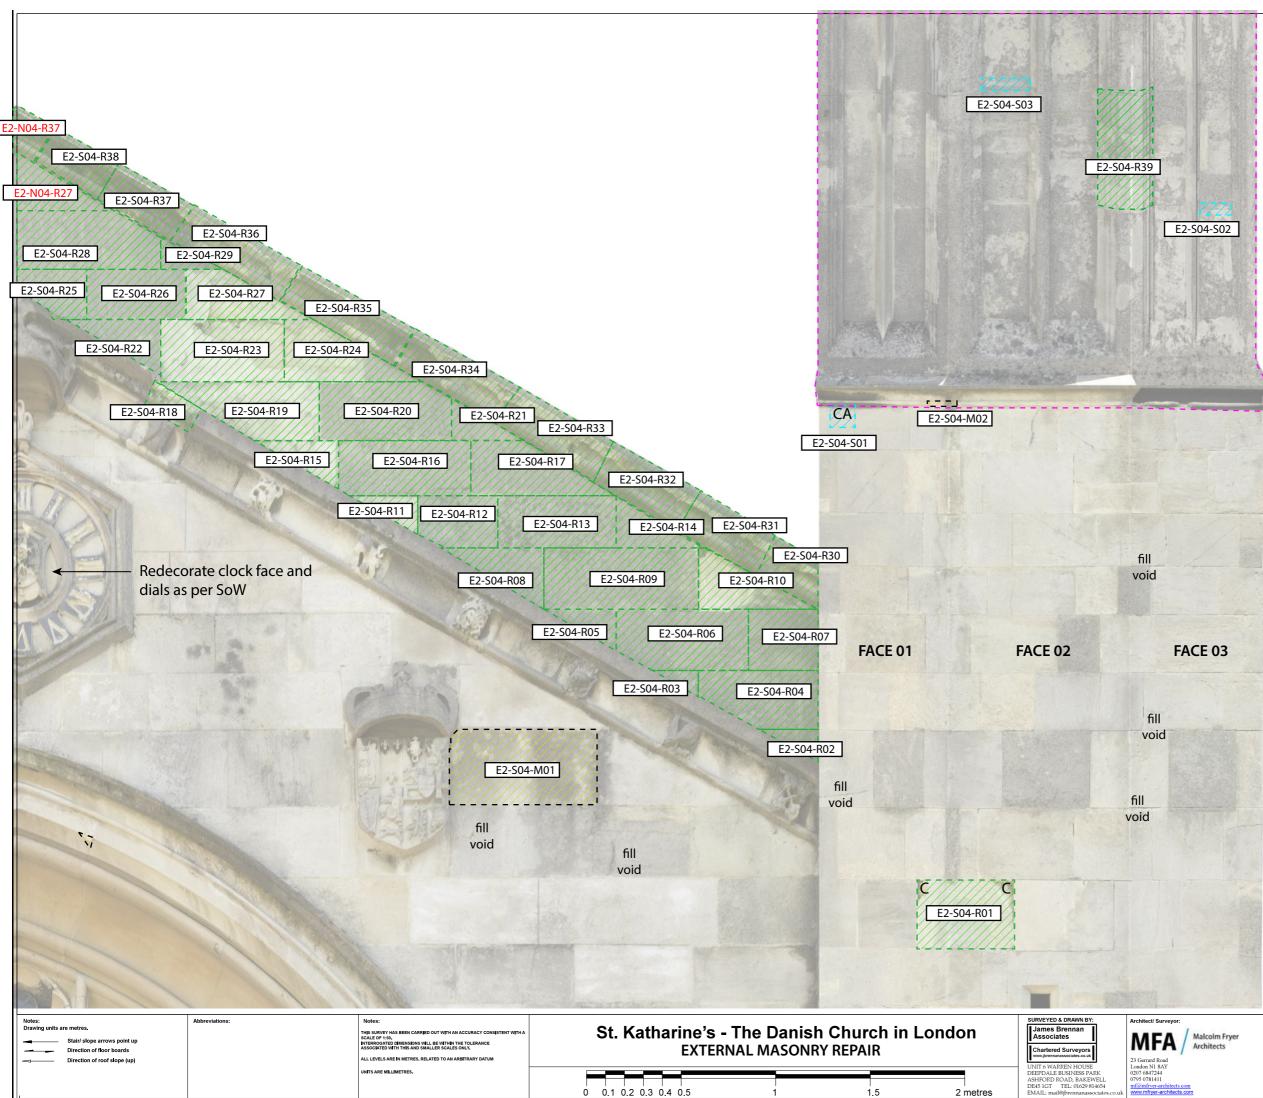

GENERAL NOTES

To be read in conjunction with prelims and specialist stonemason details

Final scope of work to be agreed with CA prior to commencement.

CLEANING

External cleaning to be completed prior to commencement of stonework repairs, following approved external cleaning trials with DOFF steam as per spec A12r/460 in consultation with CA.

REPOINTING GENERALLY

Allow for ashlar repointing to open joints only (approximately 50% of total surface area) as per specification Z21r/ 490. All hairline fissures to ashlar and retained rendered surfaces to be filled where possible, in consultation with CA.



Replace Stonework

Carefully replace stonework as per specification F21r and approved sample.

Mortar Repair

Repair with lime mortar as per specification F21r/750 and approved sample.

Stone Indent Repair

Indented repair as per specification F21r/710 and approved sample.

Replace Cramp

Careful removal of existing cramp and cramp replacement as per specification F21r/610. Allow for stone replacement, indent repair or mortar repair as scheduled.



С

Cramp Assumed

Evidence suggests corrosion of embedded cramp within face stonework. Area to be investigated by specialist stonemason. Allow for careful removal of cramp and cramp replacement as per specification F21r/610, and stone replacement, indent repair or mortar repair as scheduled



For Structural Investigation

Signs of movement or structural concern at time of survey to be investigated by Structural Engineer

Shelter Coat

As per specification F21r/860

ELEVATION KEY - E2



The Danish Church in London 4 St Katharine's Precinct London NW1 4HH

Drawing 043-E2-S04-02
Issue date Oct 2016
FOR TENDER
Scale 1:10@ A1