

63.00m

62.00m

61.00m

60.00m

59.00m

ELEVATION KEY - E2



Notes:
Drawing units are metres.

← Stair/ slope arrows point up
→ Direction of floor boards
↗ Direction of roof slope (up)

Abbreviations:

Notes:
THIS SURVEY HAS BEEN CARRIED OUT WITH AN ACCURACY CONSISTENT WITH A SCALE OF 1:50.
INTERROGATED DIMENSIONS WILL BE WITHIN THE TOLERANCE ASSOCIATED WITH THIS AND SMALLER SCALES ONLY.
ALL LEVELS ARE IN METRES, RELATED TO AN ARBITRARY DATUM
UNITS ARE MILLIMETRES.

St. Katharine's - The Danish Church in London
Rectified Elevation

SURVEYED & DRAWN BY:
James Brennan Associates
www.jbrennanassociates.co.uk
Chartered Surveyors

UNIT 6 WARREN HOUSE
DEEPDALE BUSINESS PARK
ASHFORD ROAD, BAKEWELL
DE45 1GT TEL: 01629 814654
EMAIL: mail@jbrennanassociates.co.uk

Architect/ Surveyor:
MFA / Malcolm Fryer Architects
23 Gerrard Road
London N1 8AY
0207 6847244
0795 0781411
mfm@mfryer-architects.com
www.mfryer-architects.com

Client:
The Danish Church in London
4 St Katharine's Precinct
London
NW1 4HH

Drawing 043-E2-N03-01
Issue date Sept 2016
FOR TENDER
Scale 1:10@ A1

GENERAL NOTES

To be read in conjunction with prelims and specialist stonemason details

Final scope of work to be agreed with CA prior to commencement.


CLEANING


External cleaning to be completed prior to commencement of stonework repairs, following approved external cleaning trials with DOFF steam as per spec A12r/460 in consultation with CA.


REPOINTING GENERALLY

Allow for ashlar repointing to open joints only (approximately 50% of total surface area) as per specification Z21r/490. All hairline fissures to ashlar and retained rendered surfaces to be filled where possible, in consultation with CA.

KEY


 **Replace Stonework**
Carefully replace stonework as per specification F21r and approved sample.

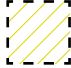
 **Mortar Repair**
Repair with lime mortar as per specification F21r/750 and approved sample.

 **Stone Indent Repair**
Indented repair as per specification F21r/710 and approved sample.

C **Replace Cramp**
Careful removal of existing cramp and cramp replacement as per specification F21r/610. Allow for stone replacement, indent repair or mortar repair as scheduled.

CA **Cramp Assumed**
Evidence suggests corrosion of embedded cramp within face stonework. Area to be investigated by specialist stonemason. Allow for careful removal of cramp and cramp replacement as per specification F21r/610, and stone replacement, indent repair or mortar repair as scheduled.

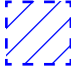


 **For Structural Investigation**
Signs of movement or structural concern at time of survey to be investigated by Structural Engineer

 **Shelter Coat**
As per specification F21r/860



ELEVATION KEY - E2




Notes:
Drawing units are metres.
 Stair/ slope arrows point up
 Direction of floor boards
 Direction of roof slope (up)

Abbreviations:

Notes:
THIS SURVEY HAS BEEN CARRIED OUT WITH AN ACCURACY CONSISTENT WITH A SCALE OF 1:50.
INTERROGATED DIMENSIONS WILL BE WITHIN THE TOLERANCE ASSOCIATED WITH THIS AND SMALLER SCALES ONLY.
ALL LEVELS ARE IN METRES, RELATED TO AN ARBITRARY DATUM
UNITS ARE MILLIMETRES.

St. Katharine's - The Danish Church in London
EXTERNAL MASONRY REPAIR



SURVEYED & DRAWN BY:
James Brennan Associates
Chartered Surveyors
www.jbrennansurveyors.co.uk
UNIT 6 WARREN HOUSE
DEEPDALE BUSINESS PARK
ASHFORD ROAD, BAKEWELL
DE45 1GT TEL: 01629 814654
EMAIL: mail@jbreennansurveyors.co.uk

Architect/ Surveyor:
MFA / Malcolm Fryer Architects
23 Gerrard Road
London N1 6AY
0207 6847244
0795 0781411
mfm@mfryer-architects.com
www.mfryer-architects.com

Client:
The Danish Church in London
4 St Katharine's Precinct
London
NW1 4HH

Drawing 043-E2-N03-02
Issue date Oct 2016
FOR TENDER
Scale 1:10@ A1

68.00m
67.00m
66.00m
65.00m
64.00m



ELEVATION KEY - E2



Notes:
Drawing units are metres.
 Stair/ slope arrows point up
 Direction of floor boards
 Direction of roof slope (up)

Abbreviations:

Notes:
THIS SURVEY HAS BEEN CARRIED OUT WITH AN ACCURACY CONSISTENT WITH A SCALE OF 1:50.
INTERPOLATED DIMENSIONS WILL BE WITHIN THE TOLERANCE ASSOCIATED WITH THIS AND SMALLER SCALES ONLY.
ALL LEVELS ARE IN METRES, RELATED TO AN ARBITRARY DATUM
UNITS ARE MILLIMETRES.

St. Katharine's - The Danish Church in London
Rectified Elevation



SURVEYED & DRAWN BY:
James Brennan Associates
Chartered Surveyors
www.jbrennanassociates.co.uk
UNIT 6 WARREN HOUSE
DEEPALE BUSINESS PARK
ASHFORD ROAD, BAKEWELL
DE45 1GT TEL: 01629 814654
EMAIL: mail@jbrennanassociates.co.uk

Architect/ Surveyor:
MFA / Malcolm Fryer Architects
23 Gerrard Road
London N1 8AY
0207 6847244
0795 0781411
mfa@mfr-architects.com
www.mfr-architects.com

Client:
The Danish Church in London
4 St Katharine's Precinct
London
NW1 4HH

Drawing **043-E2-N04-01**
Issue date **Sept 2016**
FOR TENDER
Scale **1:10@ A1**

GENERAL NOTES

To be read in conjunction with prelims and specialist stonemason details.

Final scope of work to be agreed with CA prior to commencement.






CLEANING AND SHELTER COAT

External cleaning to be completed prior to commencement of stonework repairs, following approved external cleaning trials with DOFF steam as per spec A12r/460 in consultation with CA.


REPOINTING GENERALLY




Allow for ashlar repointing to all open joints only (approximately 50% of total surface area) as per specification Z21r/490. All hairline fissures, open joints to mortar repairs and other small voids to be filled where possible, in consultation with CA.

KEY

-  **Replace Stonework**
Carefully replace stonework as per specification F21r and approved sample.
-  **Mortar Repair**
Repair with lime mortar as per specification F21r/750 and approved sample.
-  **Stone Indent Repair**
Indented repair as per specification F21r/710 and approved sample.
- C** **Replace Cramp**
Careful removal of existing cramp and cramp replacement as per specification F21r/610. Allow for stone replacement, indent repair or mortar repair as scheduled.
- CA** **Cramp Assumed**
Evidence suggests corrosion of embedded cramp within face stonework. Area to be investigated by specialist stonemason. Allow for careful removal of cramp and cramp replacement as per specification F21r/610, and stone replacement, indent repair or mortar repair as scheduled.
-  **For Structural Investigation**
Signs of movement or structural concern at time of survey to be investigated by Structural Engineer
-  **Shelter Coat**
As per specification F21r/860

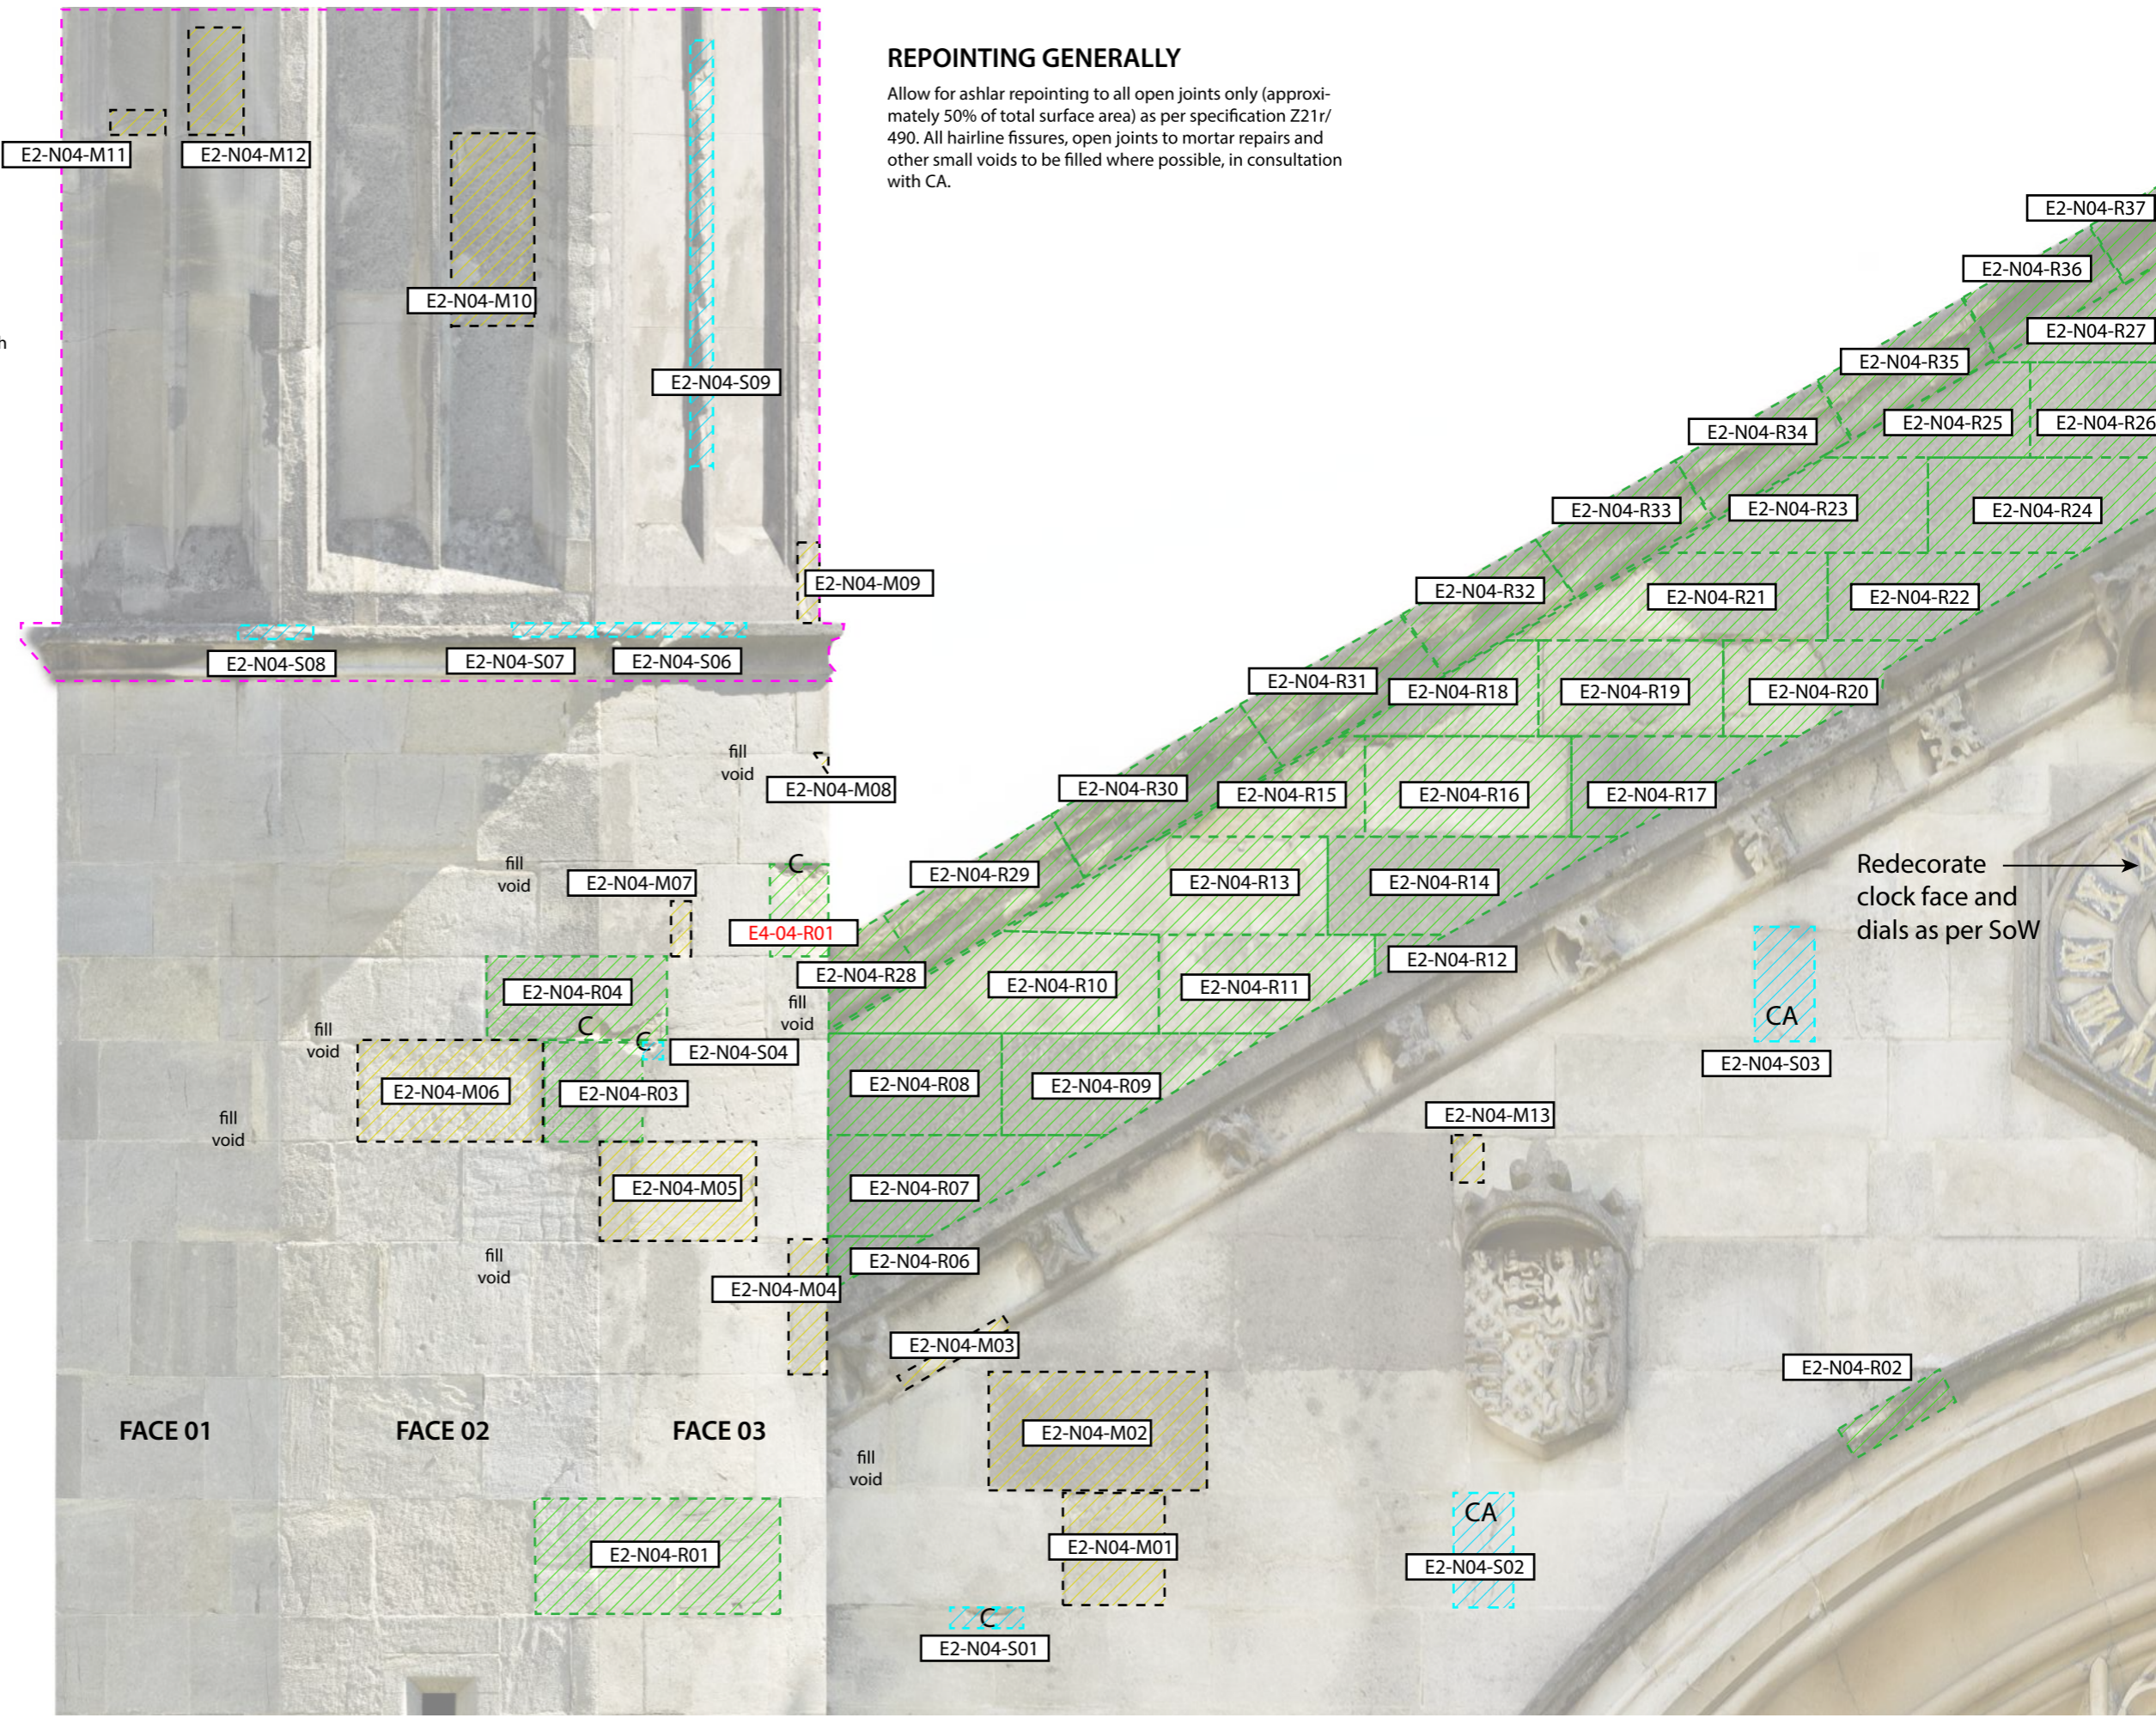ELEVATION KEY - E2




Notes:
Drawing units are metres.
 Stair/ slope arrows point up
 Direction of floor boards
 Direction of roof slope (up)

Abbreviations:

Notes:
THIS SURVEY HAS BEEN CARRIED OUT WITH AN ACCURACY CONSISTENT WITH A SCALE OF 1:50.
INTERPOLATED DIMENSIONS WILL BE WITHIN THE TOLERANCE ASSOCIATED WITH THIS AND SMALLER SCALES ONLY.
ALL LEVELS ARE IN METRES, RELATED TO AN ARBITRARY DATUM
UNITS ARE MILLIMETRES.

St. Katharine's - The Danish Church in London
EXTERNAL MASONRY REPAIR

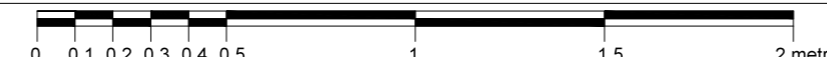

SURVEYED & DRAWN BY:
James Brennan Associates
Chartered Surveyors
www.jbrennanassociates.co.uk
UNIT 6 WARREN HOUSE
DEEPDALE BUSINESS PARK
ASHFORD ROAD, BAKEWELL
DE45 1GT TEL: 01629 814654
EMAIL: mail@jbrennanassociates.co.uk

Architect/ Surveyor:
MFA / Malcolm Fryer Architects
23 Gerrard Road
London N1 8AY
0207 6847244
0795 0781411
m@mfryer-architects.com
www.mfryer-architects.com

Client:
The Danish Church in London
4 St Katharine's Precinct
London
NW1 4HH

Drawing 043-E2-N04-02
Issue date Oct 2016
FOR TENDER
Scale 1:10@ A1

! "# \$ % &