

Level Monitoring - Relative Movement Over Time

Our Ref: 00/30237 Date of Issue 08/01/18

Provider Details

Name: **CET**

Monitoring Details

Instruction Date:	24/09/15
First Reading Date:	22/10/15
Maximum No Visits:	6
Anticipated Expiry Date:	
Monitoring Int (Wks):	8 Weekly

Client Details

Insurance Co.:	
Client Name:	Cunningham Lindsey
Technical Mgr:	Yiu-Shan Wong
Email:	
Client Ref:	6095485
Address:	
Tel:	
Other Email:	

Risk Address


Occupier:	[REDACTED]
Address:	54 Compayne Gardens
Address:	
Town:	London
County:	
Post Code:	NW6 3RY
Tel Day:	[REDACTED]
Tel Eve:	
Mobile:	
Other:	
Other:	

Level Monitoring - Site Sketch

Our Ref: 00/30237

Date of Issue

08/01/18

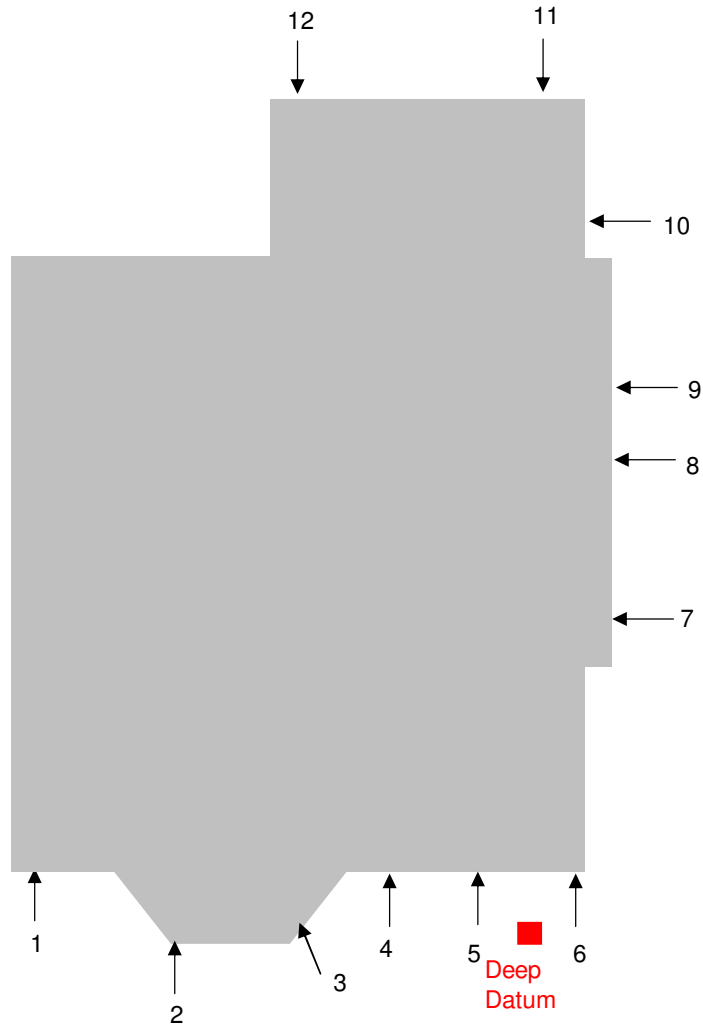

FRONT



Level Monitoring - Comments

Our Ref: 00/30237

Date of Issue

08/01/18

8/1/18

points 5,6 no access ther is cable in way



Level Monitoring - Reduced Levels

Our Ref: 00/30237

Date of Issue 08/01/18

Reading Date	22/10/15	18/12/15	26/02/16	05/05/16	13/07/16	22/09/16	24/11/16	09/02/17	25/04/17	22/06/17	16/08/17	06/10/17
Point / Reading	1	2	3	4	5	6	7	8	9	10	11	12
1	10.785	10.788	10.792	10.792	10.791	10.787	10.788	10.790	10.791	10.789	10.789	10.789
2	11.165	11.170	11.174	11.174	11.173	11.167	11.169	11.172	11.172	11.170	11.170	11.170
3	11.159	11.164	11.170	11.170	11.169	11.161	11.163	11.167	11.167	11.166	11.165	11.165
4	10.693	10.698	10.705	10.705	10.704	10.697	10.698	10.702	10.703	10.700	10.700	10.701
5	10.455	10.458	10.469	10.470	10.469	10.461	10.461	10.465	10.469	10.465	10.462	10.466
6	10.502	10.505	10.515	10.516	10.515	10.507	10.507	10.512	10.515	10.512	10.508	10.512
7	11.103	11.101	11.105	11.105	11.105	11.102	11.105	11.103	11.104	11.104	11.102	11.104
8	10.734	10.733	10.735	10.735	10.734	10.734	10.735	10.734	10.734	10.735	10.733	10.734
9	10.719	10.721	10.722	10.721	10.720	10.719	10.722	10.721	10.720	10.720	10.720	10.720
10	10.562	10.564	10.565	10.565	10.564	10.563	10.566	10.564	10.563	10.563	10.563	10.563
11	10.561	10.563	10.565	10.565	10.565	10.563	10.567	10.565	10.564	10.564	10.563	10.563
12	10.513	10.516	10.520	10.520	10.521	10.517	10.521	10.521	10.520	10.519	10.518	10.516
Not used												
Not used												
Not used												
Not used												

Highest reduced level is displayed green, lowest reduced level is displayed red



Level Monitoring - Reduced Levels

Our Ref: 00/30237

Date of Issue 08/01/18

Reading Date	08/01/18	13	14	15	16	17	18	19	20	21	22	23	24
Point / Reading													
1		10.792											
2		11.174											
3		11.169											
4		10.704											
5													
6													
7		11.105											
8		10.735											
9		10.721											
10		10.564											
11		10.565											
12		10.521											
Not used													
Not used													
Not used													
Not used													

Highest reduced level is displayed green, lowest reduced level is displayed red



Giving our all

MS ref	Client ref	Client Name	Issue Date
00/30237	6095485	Cunningham Lindsey	08/01/18

Stud locations

1	EXT - RH elevation junction with main building near front above gas box
2	INT - Flat 2 , rear lounge L/H side junction
3	INT - Flst 2 , front bedroom R/H side junction
4	
5	
6	

Additional instructions / notes

Studs nos.	Align-ment	Current C/W	Visit Date											
			22/10/15	18/12/15	26/02/16	05/05/16	13/07/16	22/09/16	24/11/16	09/02/17	25/04/17	22/06/17	16/08/17	06/10/17
1=2	H		74.65	73.00	68.54	68.24	68.17	69.85	69.34	68.24	67.57	67.54	68.13	67.95
2=3	D		114.70	112.87	107.86	107.34	107.38	110.35	109.97	108.31	107.55	107.47	107.92	107.46
1=3	Check		79.61	79.64	79.60	79.58	79.57	79.55	79.55	79.51	79.55	79.54	79.50	79.53
4=5	H	1.05	79.20	77.98	77.34	77.19	77.42	77.45	77.17	77.18	77.07	77.18	77.08	77.65
4=6	D		92.38	90.97	90.73	90.19	90.49	90.82	90.39	90.42	90.30	90.35	90.53	91.20
5=6	Check		53.73	53.71	53.68	53.62	53.68	53.64	53.65	53.62	53.64	53.63	53.64	53.64
7=8	H		66.66	65.00	61.47	61.20	60.68	61.23	61.16	repaired	repaired	repaired	repaired	repaired
7=9	D		84.81	83.12	78.99	78.26	76.10	78.30	78.16	repaired	repaired	repaired	repaired	repaired
8=9	Check		44.62	44.60	44.55	44.50	44.51	44.46	44.48	repaired	repaired	repaired	repaired	repaired
4	H													
4	D													
4	Check													
5	H													
5	D													
5	Check													
6	H													
6	D													
6	Check													
		Customer :	No issues	No issues	No issues	No issues	No issues	No issues	No issues	No issues	No issues	No issues	No issues	No issues
		New cracking :												
		See "current c/w" :												
		Calliper nos :	6173	6173	2860	2860	9256	850	850	2860	4141	4141	850	2860
		Technician :	AL/DD	AL/NM	AL/NM	AL/DD	JM	NM/DD	NM/DD	AL/NM	DD/RH	DD/RH	NM/RH	AL



Giving our all

MS ref: 00/30237 Client ref: 6095485 Client Name: Cunningham Lindsey Issue Date: 08/01/18

CONTINUATION SHEET - STUD GROUPS 1-6

Stud locations

1	1st main building near front above gas box
2	near lounge L/H side junction
3	at bedroom R/H side junction
4	
5	
6	

Additional instructions / notes

Studs nos.	Align-ment	Current C/W	08/01/18	Visit Date
1	H		67.56	
1	D		107.20	
1	Check		79.48	
2	H		77.18	
2	D		90.23	
2	Check		53.75	
3	H			
3	D			
3	Check			
4	H			
4	D			
4	Check			
5	H			
5	D			
5	Check			
6	H			
6	D			
6	Check			
		Customer:	No issues	
		New cracking:		
		See "current c/w":		
		Calliper nos:	9839	
		Technician:	AJZ	



Giving our all

MS ref	Client Name	Issue Date
00/30237	6095485 Cunningham Lindsey	08/01/18

