



Level and Crack Monitoring

Our Ref: 505891 **Date of Issue:** 30/08/2018

Provider Details

CET Property Services - 0116 2605309

Monitoring Details

Instruction Date:	03/04/2018		
Number of visits	4	Visit Frequency (Wks)	8

Visit Dates (future dates are estimated)

Setup	1	2	3	4	5	6
04/05/18	29/06/18	24/08/18	19/10/18	14/12/18	N/A	N/A

Client Details

Insurance Co.:	
Client Ref:	667535
Client Name:	Cunningham Lindsey
Technical Mgr:	Gavin Catherine
Customer support	Paula Haythornthwaite
Tel:	
Email:	


Risk Address

Occupier:	Removed for Data Protection
Address:	221 Goldhurst Terrace
Address:	
Town:	London
County:	
Post Code:	NW6 3EP
Contact Name	Removed for Data Protection

Level and Crack Monitoring - Site Sketch

Our Ref: 505891

Date of Issue: 30/08/2018

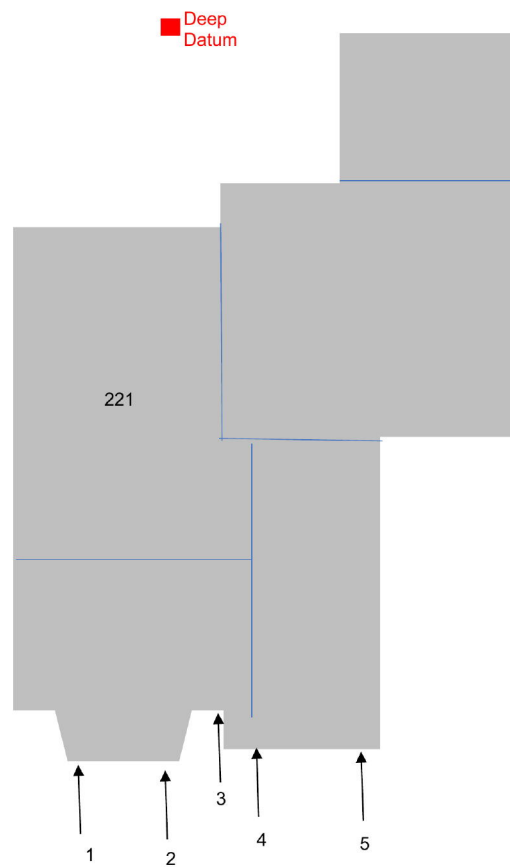

FRONT





Level Monitoring - Reduced Levels (in metres)

Our Ref:		505891		Date of Issue: 30/08/18											
Reading Date	4/5/18	28/6/18	30/8/18	4	5	6	7	8	9	10	11	12			
Point / Reading	1	2	3	4	5	6	7	8	9	10	11	12			
1	11.9718	11.9713	11.9701												
2	11.9588	11.9581	11.9556												
3	11.9519	11.9507	11.9489												
4	11.9529	11.9520	11.9499												
5	11.9779	11.9765	11.9747												
not used															
not used															
not used															
not used															
not used															
not used															
not used															
not used															
not used															
not used															
Tech Initials	AJZ	AJZ	RH												
Level S/N.	521817	520038	521816												

[illegible]

Level Monitoring - Movement relative to datum against Date

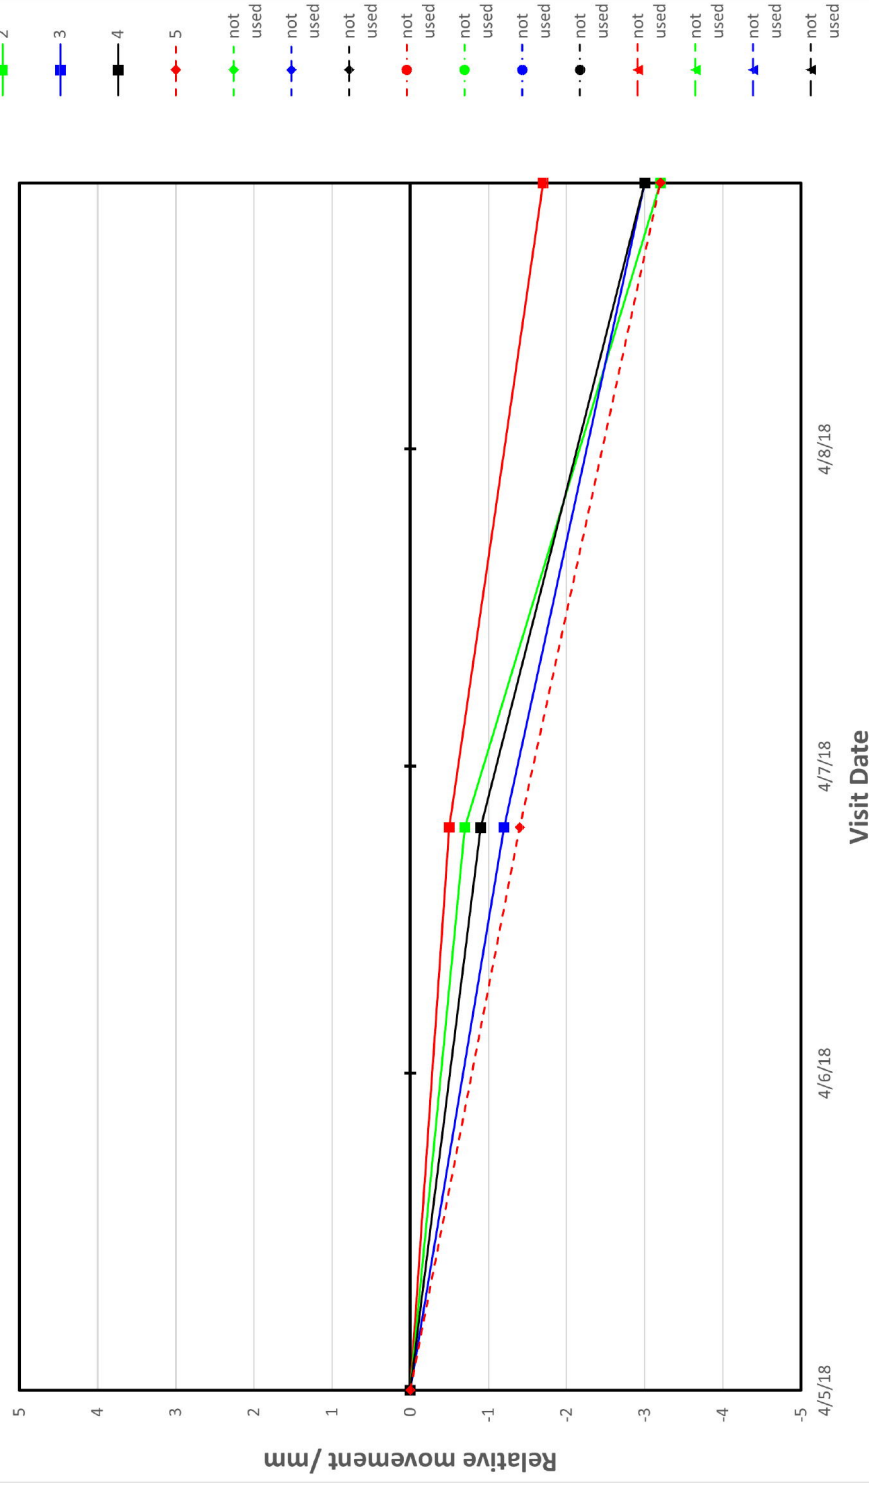




Stud locations

Crack Monitoring - Readings

Studs nos.	Align-ment	Visit Date		04/05/18		Visit Date		28/06/18		Visit Date		30/08/18		Visit Date		Current c/w		Visit Date		Current c/w	
		Reading		79.25	17.78	32.92	17.78	79.07	17.87	17.87	79.98	17.58	17.58	32.30	32.30	85.85	85.85		Reading		Current c/w
1	H																				
1	D			115.02	32.92	114.92	32.91	115.54	32.91	115.54	32.30	32.30									
1	Check			85.86		85.86															
2	H																				
2	D																				
2	Check																				
3	H																				
3	D																				
3	Check																				
4	H																				
4	D																				
4	Check																				
5	H																				
5	D																				
5	Check																				
6	H																				
6	D																				
6	Check																				
Technician :		4190		4190		AJZ		2860		RH											


Our ref	Client ref	Client Name	Issue Date
505891	667535	Cunningham Lindsey	30/08/2018

Crack Monitoring - Movement Against Time

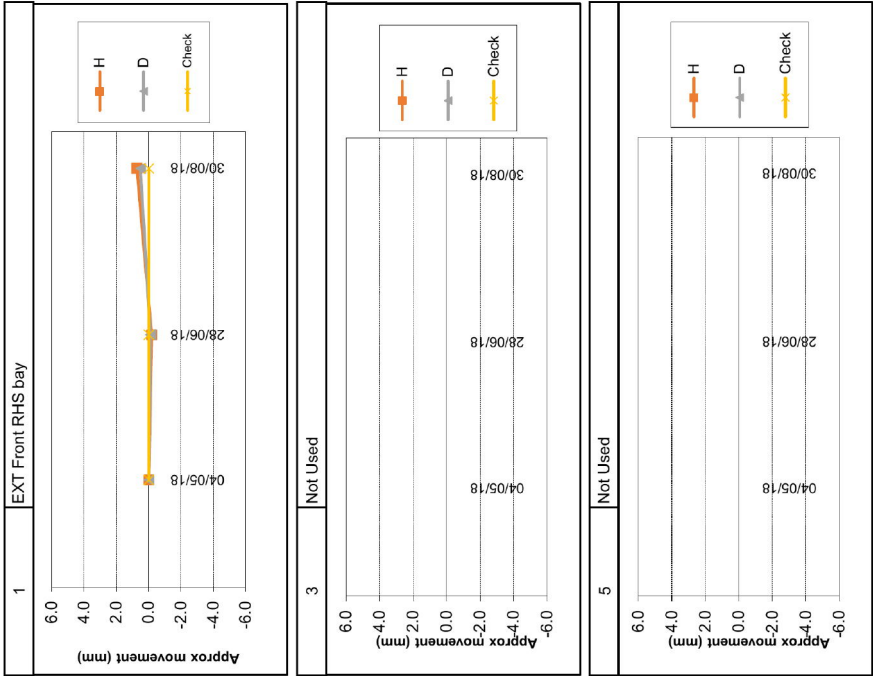

3


Not Used

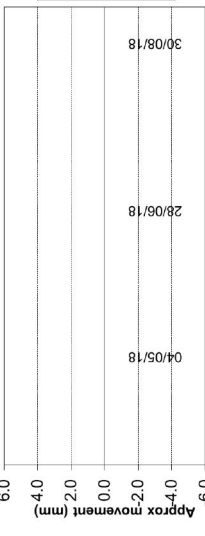


Date	H (mm)	D (mm)	Check (mm)
04/05/18	0.0	0.0	0.0
28/06/18	0.0	0.0	0.0
30/08/18	0.0	0.0	0.0

5

Not Used

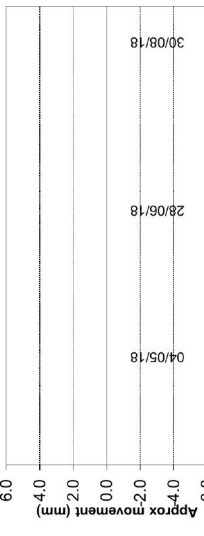


Date	H (mm)	D (mm)	Check (mm)
04/05/18	0.0	0.0	0.0
28/06/18	0.0	0.0	0.0
30/08/18	0.0	0.0	0.0

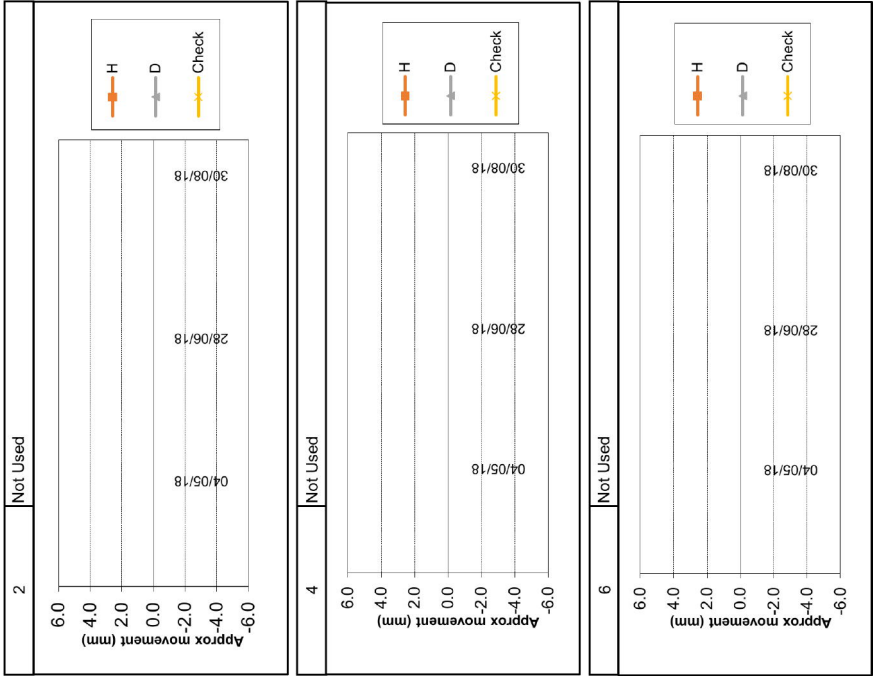

4


Not Used

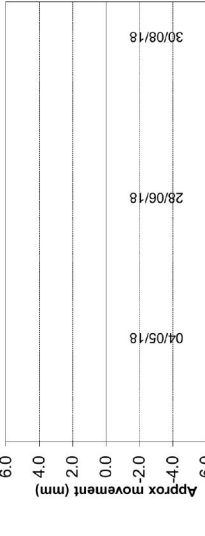

Date	H (mm)	D (mm)	Check (mm)
04/05/18	0.0	0.0	0.0
28/06/18	0.0	0.0	0.0
30/08/18	0.0	0.0	0.0

6

Not Used

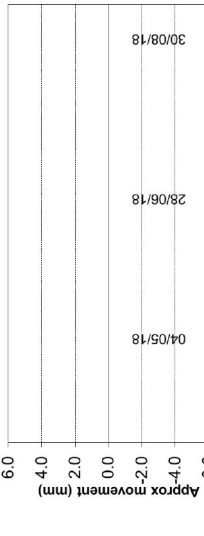

Date	H (mm)	D (mm)	Check (mm)
04/05/18	0.0	0.0	0.0
28/06/18	0.0	0.0	0.0
30/08/18	0.0	0.0	0.0