



**Level and Crack Monitoring**

[Redacted]

Date of Issue: 10/01/2019

**Provider Details**

CET Property Services [Redacted]

**Monitoring Details**

<b>Instruction Date:</b>	19/09/2019		
<b>Number of visits</b>	6	<b>Visit Frequency (Wks)</b>	8

**Visit Dates (future dates are estimated)**

Setup	1	2	3	4	5	6
08/11/18	03/01/19	28/02/19	25/04/19	20/06/19	15/08/19	10/10/19

**Client Details**

Insurance Co.:	[Redacted]
Client Ref:	[Redacted]
Client Name:	[Redacted]
Technical Mgr:	[Redacted]
Customer support	[Redacted]
Tel:	[Redacted]
Email:	[Redacted]


**Risk Address**

Occupier:	Removed for data protection purposes
Address:	5 Froggnal Close
Address:	
Town:	London
County:	
Post Code:	NW3 6YB
Contact Name	Removed for data protection purposes

**Level and Crack Monitoring - Site Sketch**



Date of Issue: 10/01/2019

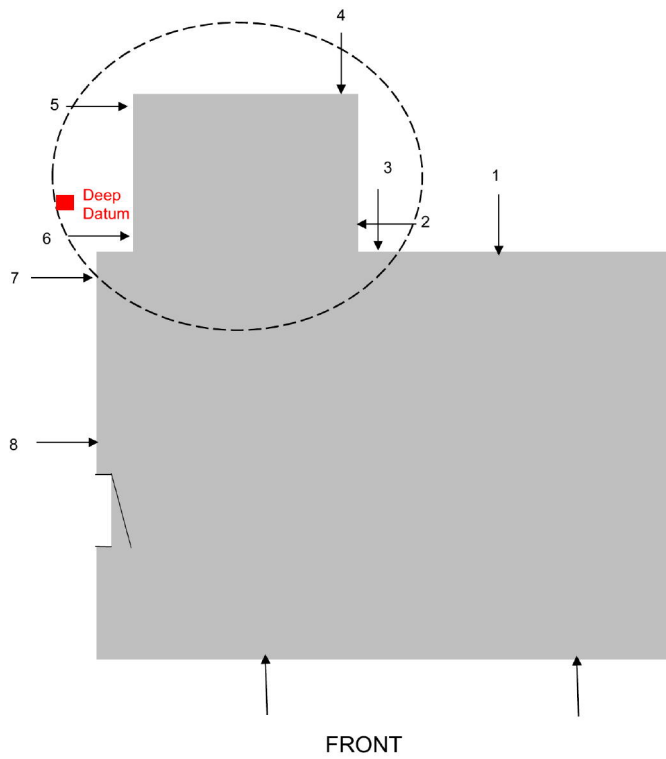








Level Monitoring - Movement relative to datum against Date

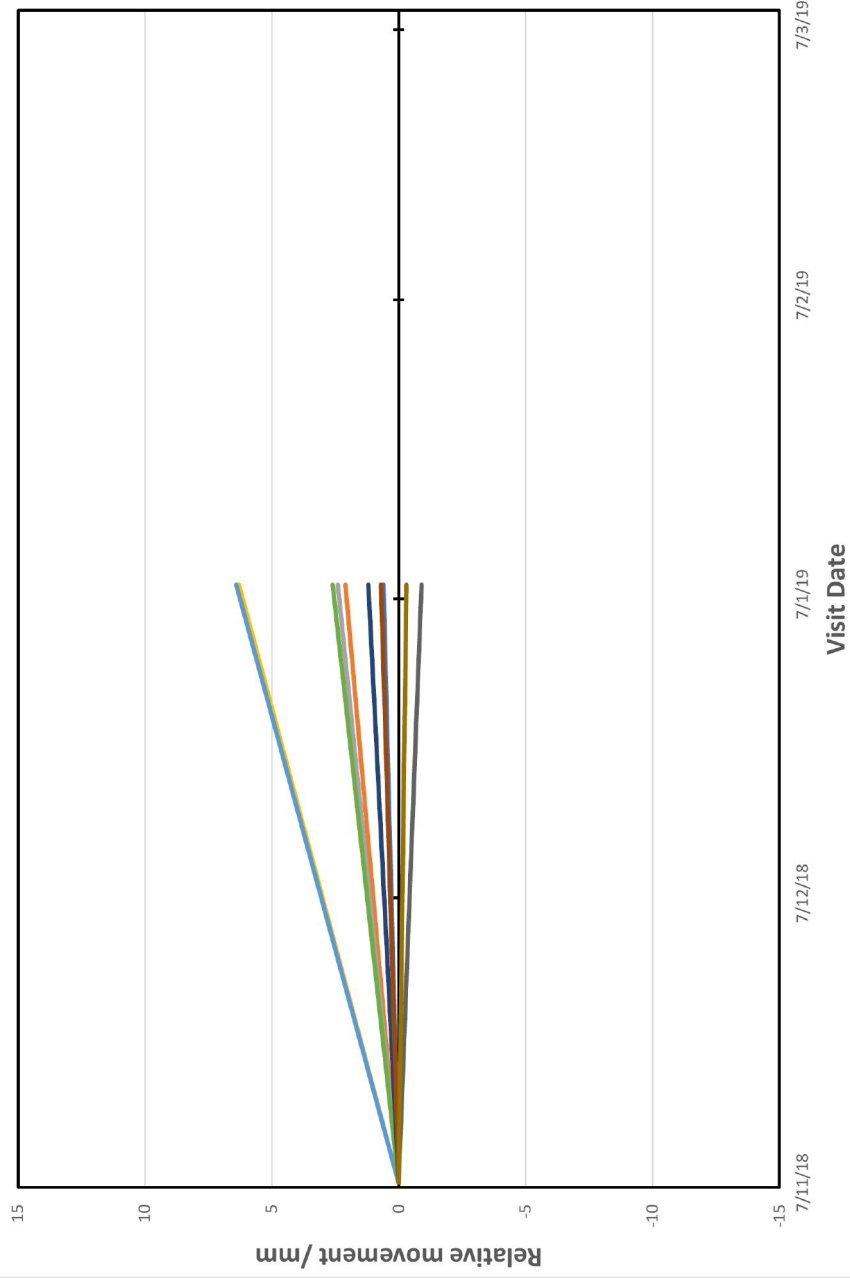



Our ref: [redacted] Client ref: [redacted] Client Name: [redacted] Issue Date: 10/01/2019

**Stud locations**

- 1 EXT LH elevation below extension rear window
- 2 INT above dining room patio doors
- 3 INT below rear left window music room
- 4
- 5
- 6

Additional instructions / notes

**Crack Monitoring - Readings**

Studs nos.	Alignment	07/11/18		08/01/19		Visit Date		Visit Date		Visit Date	
		Reading	Current c/w	Reading	Current c/w	Reading	Current c/w	Reading	Current c/w	Reading	Current c/w
1	H	51.24	3.78	50.15	2.60						
1	D	58.33	13.12	58.17	13.00						
1	Check	83.12		83.15							
2	H	58.18	1.59	57.90	1.30						
2	D										
2	Check										
3	H	59.85	2.30	59.02	1.64						
3	D	88.92	0.92	88.54	0.70						
3	Check	92.72		92.77							
4	H										
4	D										
4	Check										
5	H										
5	D										
5	Check										
6	H										
6	D										
6	Check										
Calliper nos :		2860		2860							
Technician :		NM/RB		NM							

**Crack Monitoring - Movement Against Time**

