

TYPICAL FLOOR JOIST SUPPORT DETAIL IN EXTG. MASONRY WALLS.


DETAIL 1 1:10

TYPICAL TIMBER JOIST EXTENSION DETAIL WHERE EXISTING JOIST CUT BACK DUE TO ROT


DETAIL 2 1:10

NEW TIMBER TRIMMER SHOWING **BOLTING REQUIREMENTS**


DETAIL 3 1:10

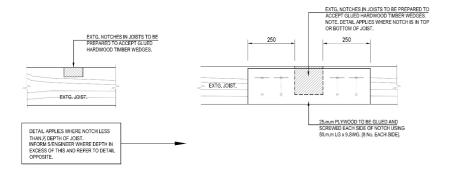

TYPICAL EXISTING TIMBER JOIST NOTCH REPAIR DETAILS DETAIL 4 1:10

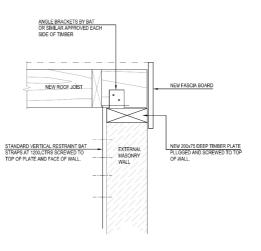

VERTICAL RESTRAINT DETAIL TO **EXISTING EXTERNAL MASONRY** DETAIL 5 1:10

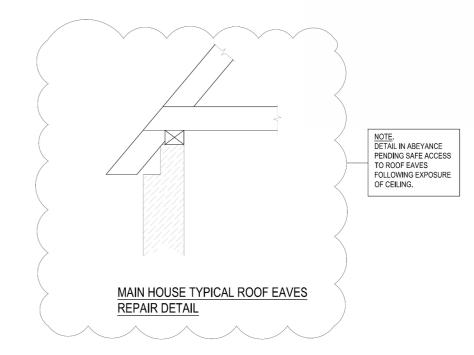

WEST HAMPSTEAD COTAGES

CLIENT

CONSULTANT

AECOM Aldgate Tower 2 Leman Street London, E1 8FA

GENERAL NOTES

THIS DRAWING IS TO BE READ IN CONJUNCTION WITH ALL OTHER RELEVANT DOCUMENTATION.
 TO NOT SCALE FRONT THIS DRAWING.
 ALL DIMENSIONS ARE IN MILLIMETRES. ALL CHAINAGES, LEVELS AND CO-ORDINATES ARE IN METERS DURESS DEFINED OTHERWISE.
 A. THIS DRAWING IS TO BE READ IN CONJUNCTION WITH THE PROJECT HEALTH AND SERVET FLEE FOR ANY IDENTIFIED PORTENTIAL RISKS.

ISSUE/REVISION

	Α	08.11.18	ISSUED FOR INFORMATION
	I/R	DATE	DESCRIPTION

KEY PLAN

PROJECT NUMBER

SHEET TITLE

WEST HAMPSTEAD COTTAGES.
TYPICAL REPAIR DETAILS

SHEET NUMBER

WHC-ACM-XX-XX-DE-SE-0001