

SITE RECORD DETAILS




INSURED: London Borough Of Camden

ADDRESS: Camden Arts Centre, Arkwright Road, Camden, London, NW3 6DG

MEETING ATTENDEES: Chris Lerner - Camden Arts Centre Manager,
Mark Wood - Sedgwick

DATE: 14/2/19

PHOTOS/SKETCHES:

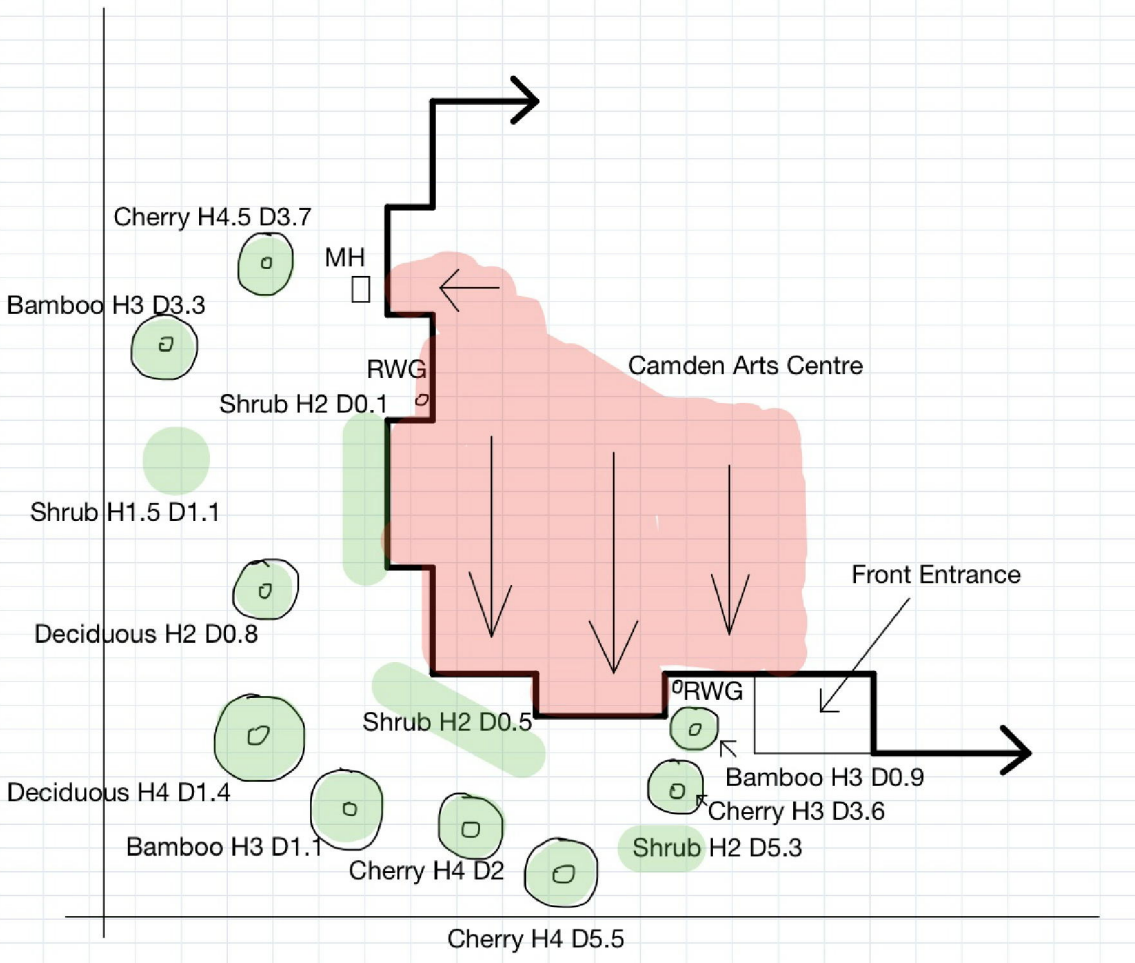

LOCATION:

ROOM SIZE L:

W:

H:

NOTES:

PHOTOS / SKETCHES:



Camden Arts Centre



Front Elevation



Left Flank Elevation



Crack To Left Flank Below Front Window

LOCATION: Repairs
External

ROOM SIZE L: **W:** **H:**

NOTES: Repoint 6lm of cracks to front left hand bay window and left flank wall around flank windows. Allow for scaffolding to undertake repairs
Internal
Front Entrance - Take up deflected section of floor tiles (previously repaired 2 rows of tiles,) repair crack to underlying slab, replace 2 rows of tiles to match existing mirroring previous repair

PHOTOS / SKETCHES:



Crack To Left Flank Above Front Window



Crack To Left Flank Below First Bay Window



General View Of First Floor Gallery 3



Crack Above Left Flank Internal Door In Gallery 3

LOCATION:

ROOM SIZE L:

W:

H:

NOTES: Gallery 3 (14.02l x 7.58w x 6.16h) 6lm EML repair, rake and fill 40lm of cracks, paint walls and ceiling, locally take up parquet floor finish around front bay, repair crack to underlying slab, relay parquet flooring, sand and seal floor.
Drawing Room (8.62l x 8.14w x 6.14h) 1lm EML repair, rake and fill 12lm of cracks, paint walls and ceiling.

PHOTOS/SKETCHES:



Crack Below RH Flank Window In
Gallery 3



General View Of Crack To Floor To
Front Section Of Gallery 3



Close Up Of Cracking To Floor To
Front Of Gallery 3



Crack Above Right Hand Door To
Flank Wall Of Drawing Room

LOCATION:

ROOM SIZE L:

W:

H:

NOTES: Ground Floor Small Front Office (3.13l x 4.67w x 3.11) repoint 4lm of cracks, rake and fill 5lm of cracks, skim ceiling, paint walls and ceiling
Ground Floor Main Office (10.8l x 7.6w x 3.14h) 3lm EML repair, rake and fill 30lm of cracks, paint walls and ceiling

PHOTOS / SKETCHES:



General View Of Movement Of Ground Floor In Front Entrance



Close Up Of Movement Of Floor Of Ground Floor Front Entrance (Dropped 9mm Over 1200mm Length)



Previous Repair To Ground Front Entrance Floor In Same Area As Current Movement



Cracking To LH Flank In Ground Floor Office

LOCATION:

ROOM SIZE L:

W:

H:

NOTES:

PHOTOS / SKETCHES:



Cracking To Front Section Of Ground Floor Office



Cracking To Front Section Of Ground Floor Office



Cracking To Left Flank In Rear Main Ground Floor Office



Cracking To Rear Section O& Left Flank Wall In Ground Floor Main Office

LOCATION:


ROOM SIZE L:

W:

H:

NOTES:

PHOTOS / SKETCHES:

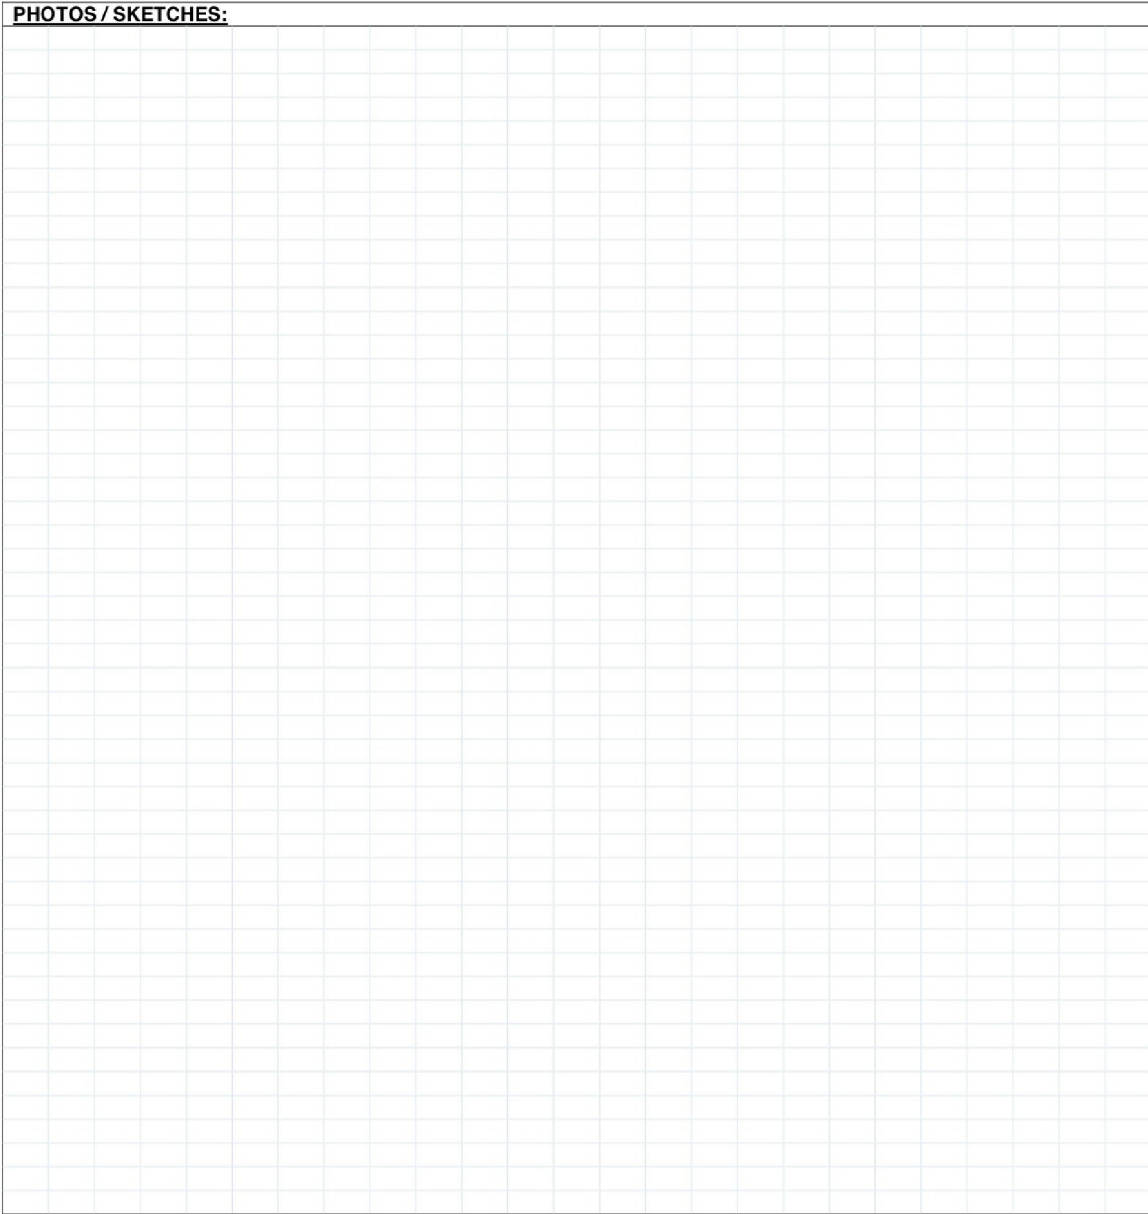

LOCATION:


ROOM SIZE L:

W:

H:

NOTES:

PHOTOS / SKETCHES:

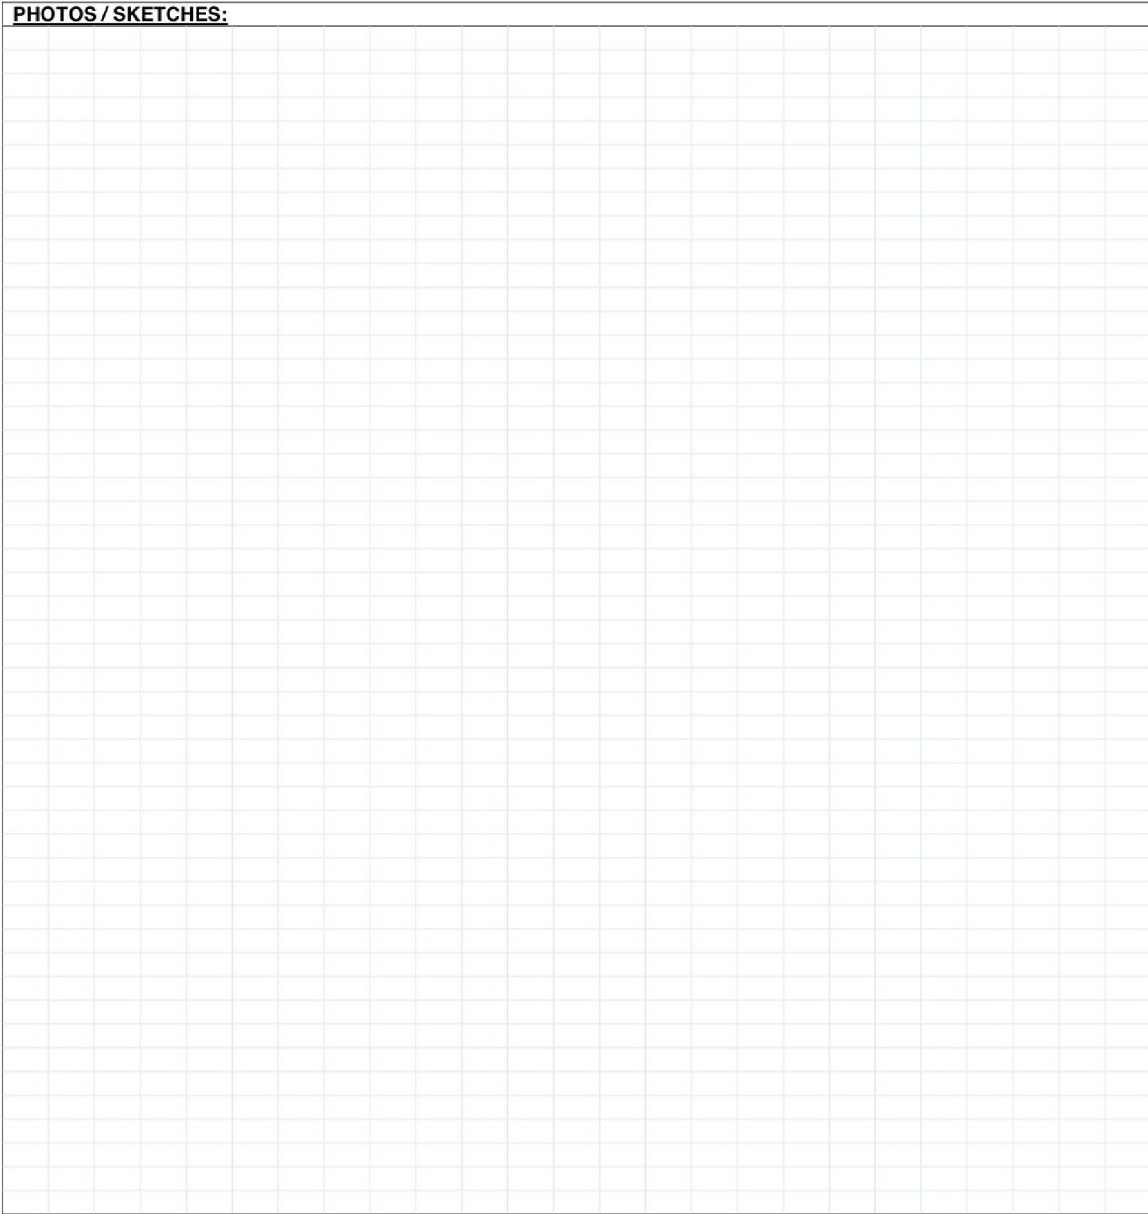

LOCATION:

ROOM SIZE L:

W:

H:

NOTES: