



0351



This report is a re-issue following amendments and supersedes original report P-356976 and is deemed authorised for issue by: Monika Witkowska

Asbestos Refurbishment Survey

for

**SLQR Trustee No 1 Limited and SLQR Trustee No 2 Limited
as Co Trustees of SLQR Unit Trust No 3**

at

**6th Floor Kingsway Building
1 Kemble Street
London
WC2B 4AN**



Survey Date: 19 December 2019

Project Reference: P-356976A

Environmental Essentials Limited

Head Office
Unit 3 Arlington Court
Cannel Row
Silverdale Enterprise Park
Newcastle-under-Lyme
Staffordshire
ST5 6SS

Tel: 0845 456 9953
www.environmentalessentials.co.uk

Contents

Section 1 – Executive Summary

Section 2 – Contract Details

Section 3 – Introduction

Section 4 – Exclusions and Caveats

Section 5 – Survey Methodology

Section 6 – Survey Results

Section 7 – Room Data

Section 8 – Survey Results Summary

APPENDIX A – Contract Information and Survey Scope

APPENDIX B – Certificate of Analysis

APPENDIX C – Plans

Report Re-Issue

This report is a re-issue of previously issued reports P-356976 and the changes between this and the previous reports are detailed below:

* Following internal review of report

Section 1 – Executive Summary

Any asbestos containing materials which have been identified during this survey are categorized below according to the recommendations made by Environmental Essentials Ltd. Where no items are listed in any of the categories, then no asbestos containing materials have been identified within the scope of the survey.

This report must be read in its entirety for a comprehensive understanding of the survey findings contained within.

ACMs recommended for removal:

Location No.	Location Name	Sample No.	Item / Position	Material
001	Kemble Street Staircase (Kingsway)	P-356976/002	Step nosings	Asbestos thermoplastic material
001	Kemble Street Staircase (Kingsway)	P-356976/003	Floor tiles (grey) & bitumen adhesive	Asbestos thermoplastic/adhesive
002	Kemble Street Lobby (Kingsway)	P-356976/004	Adhesive residue beneath carpet tiles	Asbestos bitumen
003	Open Plan Area (Kingsway)	P-356976/005	Ceiling above MMMF tiles	Asbestos insulating board
003	Open Plan Area (Kingsway)	P-356976/007	Window sills	Asbestos cement
003	Open Plan Area (Kingsway)	P-356976/008	Window sills	Asbestos thermoplastic/adhesive
003	Open Plan Area (Kingsway)	P-356976/As 004	Adhesive residue partially beneath floor screed	Asbestos bitumen
003	Open Plan Area (Kingsway)	P-356976/010	Wall lining beneath plasterboard lining	Asbestos insulating board
005	Kitchen (Kingsway)	P-356976/As 007	Window sills	Asbestos cement
005	Kitchen (Kingsway)	P-356976/As 004	Adhesive residue partially beneath modern linoleum	Asbestos bitumen
005	Kitchen (Kingsway)	P-356976/As 010	Wall lining	Asbestos insulating board

All works, whether licensed or non-licensed, must be undertaken in accordance with the Control of Asbestos Regulations, Approved Code of Practice L143 and HSE guidance documents.

ACMs recommended for remedial works:

No material in this category.

ACMs recommended for ongoing management:

No material in this category.

Section 1 – Executive Summary

Inaccessible Rooms / Areas



All areas were accessed within the scope of the survey.

Limited Access Areas

During the survey whilst individual rooms may have been accessed, the following elements or items within a room / area were inaccessible or had limited access (e.g. boxings / voids etc.). These areas should be presumed to contain asbestos until arrangements can be made for access and assessment.

Building	Location No.	Location Name	Reason/s for Limited Access
Space House	001	Kemble Street Staircase (Kingsway)	No access could be gained within window cavity void, assistance from window removal specialists required.
Space House	003	Open Plan Area (Kingsway)	No access could be gained within window cavity void, assistance from window removal specialists required.
Space House	005	Kitchen (Kingsway)	No access could be gained within window cavity void, assistance from window removal specialists required.

Section 2 – Contract Details

Site name and address:	6th Floor Kingsway Building, 1 Kemble Street, London, WC2B 4AN		
Client name and address:	SLQR Trustee No 1 Limited and SLQR Trustee No 2 Limited, as Co Trustees of SLQR Unit Trust No 3, 3rd Floor, 37 Esplanade, St Helier, Jersey, Channel Islands, JE1 1AD		
Client contact:	Clive Withers		
Type of survey:	Asbestos Refurbishment Survey		
Date of survey:	19 December 2019		
Project Manager:	Clive Morgan		
Lead surveyor(s):	Danny Webber	Signature:	
Report technically reviewed by:	Monika Witkowska	Signature:	
Report issue date:	03 January 2020		

Section 3 – Introduction

- 3.1 SLQR Trustee No 1 Limited and SLQR Trustee No 2 Limited as Co Trustees of SLQR Unit Trust No 3 commissioned Environmental Essentials Limited to undertake an Asbestos Refurbishment Survey of 6th Floor Kingsway Building, 1 Kemble Street, London, WC2B 4AN.
- 3.2 Site description:
One Kemble Street building and Kingsway building currently contains an existing property comprising 229,192ft². The site is located on Kingsway in the London Borough of Camden. The original development was completed in 1969 and received large-scale refurbishments in 1996 and 2003; it received Grade II listing by Historic England in 2015.
- 3.3 The purpose of the survey is to enable those responsible for the management of the site to compile the necessary assessments, ascertain any necessary restrictions on the operation of the site and make due provision for the management of asbestos containing materials (ACMs) identified as part of the duty holders ongoing obligations under the Control of Asbestos Regulations.
- 3.4 The scope of the survey was defined by Andrew Jones and Clive Withers as:

Refurbishment Survey of both 1 Kemble Street and 45-49 Kingsway ahead of the proposed refurbishment works. The full scale of the project was communicated by Clive Withers of Avison Young during the scoping visit. The scope of the refurbishment included a full strip out of internal wall structures (partition and blockwork) and ceilings (suspended/fixed) leaving the outer shell structure of the building. All existing Mechanical and Electrical Plant (MEP) is proposed to be removed apart from any services feeding the UKPN areas. All windows to the exterior of the properties are being replaced. Specified sections of the floor slab, particularly to the car park and ramp, are being re-constructed. Additional structures are being constructed to the roof of both buildings.
- 3.5 Full details of the scope can be found in Appendix A – Contract Information and Survey Scope
- 3.6 This report does not constitute an asbestos register or an asbestos management plan for the purpose of the duty to manage asbestos under regulation 4 of the Control of Asbestos Regulations 2012.

Section 4 – Exclusions and Caveats

- 4.1 As part of the planning stage for this survey, specific inclusions and exclusions may have been applied to the survey undertaken at this property. These will have been discussed and pre-agreed with the Client prior to commencement of the survey, and may serve as specific caveats within this survey report.

Please refer to the full Appendix A of this report for full details of areas / items which were included within the scope of this survey.

All areas excluded from the survey must be presumed to contain asbestos.

- 4.2 The measurements and extents in this report are approximate and should not be used for contractors to price abatement work. Where pricing work is to be undertaken it is the responsibility for the contractor to obtain the measurements ahead of submitting a quotation. It is recommended that the report shall be read in conjunction with a bill of quantities and technical specification to identify methods and full extent of the abatement works.

Section 5 – Survey Methodology

5.1 General Methodology

This survey was undertaken in accordance with the methods defined in HSG264 Asbestos: The survey guide, HSG248 Asbestos: The analysts' guide and Environmental Essentials' in-house procedures.

Survey types as defined within HSG264 as follows:

Management Survey - The standard survey to identify and assess the risks from asbestos associated with normal occupancy of a building whilst also considering routine maintenance activities.

Refurbishment Survey or Demolition Survey - These types of survey serve to identify all asbestos materials as far as reasonably practicable within the fabric of a building prior to any such works.

The objective of an asbestos survey is to locate, as far as is reasonably practicable, the location and extent of presumed or known asbestos containing materials. Samples of suspected ACMs may be taken and analysed in order to confirm or refute the surveyor's judgement.

Where a material has been sampled as part of this survey, materials with similar appearance used in the same way within the building may be strongly presumed to be the same material and will be recorded as cross references to the original sample (e.g. P-123456/As001 for a cross reference to sample P-123456/001).

Additionally, surveyors may strongly presume a material to be asbestos based upon their experience. Strongly presumed materials are recorded within this report with a prefix of SP followed by a unique number starting at 001 (e.g. the first strongly presumed item would be P-123456/SP001).

The survey may also involve presuming the presence of asbestos where there is insufficient evidence to confirm that it is not asbestos. These presumed ACMs will be recorded within this report with a prefix of P followed by a unique number starting at 001 (e.g. the first presumed item would be P-123456/P001).

5.2 Risk Assessment

During the course of the survey, Environmental Essentials will have risk assessed each material identified and assigned individual risk scores. Materials can be risk assessed using two separate scoring systems:

The material assessment considers the type and condition of ACMs and their ability to release fibres into the air. It comprises of four separate elements as follows:

- Product type
- Extent of damage and deterioration
- Surface treatment
- Asbestos type

A simple algorithm can be used to assess these four parameters during the survey. Each parameter is scored as high = 3, medium = 2, or low = 1; two categories allow a nil score.

Presumed or strongly presumed ACMs will be scored as containing crocidolite asbestos, unless analysis of similar samples from the building consistently show a different type or if there is a reasoned argument that another type of asbestos was used.

The value assigned to each of the four parameters is added together to give a total score of between 2 and 12 and highlights immediately the materials of high risk.

Those materials with a material assessment score of 10 or more should be regarded as an immediate high risk with a significant potential to release fibres if disturbed. Scores of between 7 and 9 are regarded as medium risk and between 5 and 6 a low risk. Scores of 4 or less are a very low risk. Non-asbestos materials are not assigned a risk score.

Section 5 – Survey Methodology

All management surveys will include a material assessment for asbestos containing materials identified. Unless requested by the Client or advised, materials identified within a demolition survey will not include a material assessment as it is anticipated that all materials will be removed from site.

The priority for asbestos management is determined by carrying out a further assessment called the priority assessment.

This assessment as described in detail within HSE guidance document HSG 227 is the responsibility of the duty holder and should be carried out by a person with a detailed knowledge of the site and the activities performed within.

Environmental Essentials' can assist in this process by undertaking a priority assessment during the course of a survey, however it is ultimately the responsibility of the duty holder to review this assessment to ensure it is correct using their knowledge of the operation and maintenance requirements of the premises.

The priority assessment addresses the likelihood of the asbestos material being disturbed as even asbestos materials in the poorest condition may only represent a risk to health if the fibres are disturbed and become airborne.

The priority assessment algorithm takes into account factors such as:

- Maintenance activities
- Likelihood of disturbance
- Human exposure potential
- Occupant activity

The combination of the material and priority assessments forms the total score for each particular material, which is used as the basis of an asbestos management plan. If a Client has not requested a priority assessment then the total assessment stated within the survey results will be reflective of the material assessment only.

The undertaking of priority assessments falls outside Environmental Essentials' scope of UKAS Accreditation.

Examples of the algorithms used when compiling material and priority assessments can be seen within Table 1 and Table 3 of this survey report.

5.3 Recommendations

The survey team will make a recommendation for each ACM identified and this will be based upon the initial material risk assessment. Further priority assessments may identify alternative actions and timescales to be considered.

Recommendations are a subjective assessment made by the survey team at that point in time based upon their knowledge of asbestos materials and management only. Environmental Essentials Ltd cannot account for further changes in site conditions and use. Recommendations made will be as specific as possible at that point in time however will not take into account the logistics of site operations or budgets available to the client.

5.4 Bulk Sample Analysis

The analysis of bulk samples has been undertaken by Environmental Essentials' approved analytical laboratory, which holds accreditation by UKAS as a testing laboratory. Certification for the analysis of samples taken during this survey is detailed within Appendix B.

Analysis of bulk samples was carried out in accordance with HSE Guidance HSG248 – The analysts' guide

Every attempt is made to ensure that when samples are taken they are representative of the material as a whole but some ACMs are not homogeneous and contain very small quantities of asbestos.

Section 5 – Survey Methodology

Table 1 Material Assessment Algorithm (from HSG264 Appendix 4)

	Score	Examples of scores
Product type (or debris from product)	1	Asbestos reinforced composites (plastics, resins, mastics, roofing felts, vinyl floor tiles, semi- rigid paint, decorative finishes and asbestos cement etc)
	2	Asbestos insulating board, mill boards, other low-density boards, textiles, gaskets, ropes and woven materials and asbestos paper
	3	Thermal insulation (e.g. pipe and boiler lagging), sprayed asbestos, loose asbestos, asbestos mattresses and packing.
Extent of damage/deterioration	0	Good condition: no visible damage
	1	Low damage: a few scratches or surface marks, broken edges on boards or tiles, etc.
	2	Moderate damage: significant breakage of materials or several small areas where material has been damaged exposing fibrous edges.
	3	High damage or deterioration of materials, sprays and thermal insulation. Visible asbestos contamination by debris or residues.
Surface treatment	0	Composite materials containing asbestos, reinforced plastics, resins, vinyl tiles
	1	Enclosed sprays or insulation, AIB (with exposed face encapsulated), cement sheets, etc.
	2	Unsealed AIB, encapsulated insulation and sprays.
	3	Unsealed insulation and sprays.
Asbestos type	1	Chrysotile
	2	Amphibole asbestos (excluding crocidolite)
	3	Crocidolite

Table 2 Accessibility categories


Rating	Definition
Easy	ACM is not obscured and can be reached without access equipment.
Medium	ACM is obscured by easily removable building materials or can only be reached form standard step ladders.
Difficult	ACM is obscured by fixed / difficult to remove building materials or requires access equipment other than standard step ladders.

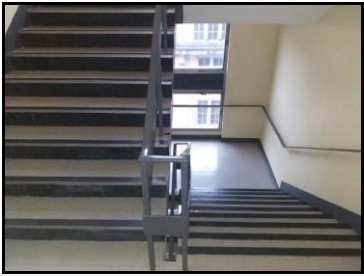
Section 5 – Survey Methodology

Table 3 Priority Assessment Algorithm (from HSG227 Appendix 3)


Assessment Factor		Score	Examples of score variables
Normal occupant activity	Main type of activity in area	0 1 2 3	Rare disturbance activity (e.g. little used store room) Low disturbance activities (e.g. office type activity) Periodic disturbance (e.g. industrial or vehicular activity which may contact ACMs) High levels of disturbance, (e.g. fire door with asbestos insulating board sheet in constant use)
	Secondary activities for area	As above	As above
Likelihood of disturbance	Location	0 1 2 3	Outdoors Large rooms or well ventilated areas Rooms up to 100m ² Confined spaces
	Accessibility	0 1 2 3	Usually inaccessible or unlikely to be disturbed Occasionally likely to be disturbed Easily disturbed Routinely disturbed
	Extent/amount	0 1 2 3	Small amounts or items (e.g. strings, gaskets) ≤10m ² or ≤10m pipe run >10m ² to ≤50m ² or >10m to ≤50m pipe run >50m ² or >50m pipe run
Human exposure potential	Number of occupants	0 1 2 3	None 1 to 3 4 to 10 >10
	Frequency of use of area	0 1 2 3	Infrequent Monthly Weekly Daily
	Average time area is in use	0 1 2 3	<1 hour >1 to <3 hours >3 to <6 hours >6 hours
Maintenance activity	Type of maintenance activity	0 1 2 3	Minor disturbance (e.g. possibility of contact when gaining access) Low disturbance (e.g. changing light bulbs in asbestos insulating board ceiling) Medium disturbance (e.g. lifting one or two asbestos insulating board ceiling tiles to access a valve) High disturbance (e.g. removing a number of asbestos insulating board ceiling tiles to replace a valve or for re-cabing)
	Frequency of maintenance activity	0 1 2 3	ACM unlikely to be disturbed for maintenance ≤1 per year >1 per year >1 per month


Section 6 – Survey Results

Building:	Space House	Floor:	Sixth Floor				
Location:	001 - Kemble Street Staircase (Kingsway)	Sample No / ID (Type):	P-356976/001 (Sampled)				
Surveyor:	Danny Webber	Survey date:	19/12/2019				
Sample Details							
	Item description:	Skirting board					
	Material description:	Vinyl product					
	Quantity / Extent:	20 m linear					
	Accessibility	Easy Access					
	Analysis:	No asbestos detected					
	Material identification:	Non-asbestos material					
Material Assessment Scoring:							
Product Type:	-	Condition:	-	Surface Treatment:	-	Asbestos Type:	-
Priority Assessment Scoring:							
Occupant Activity:	-	Disturbance:	-	Human Exposure:	-	Maintenance Activity:	-
Total Scores:							
Material Score:	-	Priority Score	-	Total Score:	0	Risk Rating:	N/A
Recommended action:	-						
Recommendation comments:	-						
Comments:	Material observed to continue from top to bottom of staircase.						


Building:	Space House	Floor:	Sixth Floor				
Location:	001 - Kemble Street Staircase (Kingsway)	Sample No / ID (Type):	P-356976/002 (Sampled)				
Surveyor:	Danny Webber	Survey date:	19/12/2019				
Sample Details							
	Item description:	Step nosings					
	Material description:	Thermoplastic product					
	Quantity / Extent:	18 Number					
	Accessibility	Easy Access					
	Analysis:	Chrysotile					
	Material identification:	Asbestos thermoplastic material					
Material Assessment Scoring:							
Product Type:	1	Condition:	1	Surface Treatment:	0	Asbestos Type:	1
Priority Assessment Scoring:							
Occupant Activity:	0	Disturbance:	2	Human Exposure:	0	Maintenance Activity:	0
Total Scores:							
Material Score:	3	Priority Score	2	Total Score:	5	Risk Rating:	Very Low
Recommended action:	Remove if likely to be disturbed by the refurbishment, otherwise monitor condition.						
Recommendation comments:	-						
Comments:	Material observed to continue from top to bottom of staircase.						


Section 6 – Survey Results

Building:	Space House	Floor:	Sixth Floor				
Location:	001 - Kemble Street Staircase (Kingsway)	Sample No / ID (Type):	P-356976/003 (Sampled)				
Surveyor:	Danny Webber	Survey date:	19/12/2019				
Sample Details							
	Item description:	Floor tiles (grey) & bitumen adhesive					
	Material description:	Thermoplastic product					
	Quantity / Extent:	16 m ²					
	Accessibility	Easy Access					
	Analysis:	Chrysotile					
	Material identification:	Asbestos thermoplastic/adhesive					
Material Assessment Scoring:							
Product Type:	1	Condition:	1	Surface Treatment:	0	Asbestos Type:	1
Priority Assessment Scoring:							
Occupant Activity:	0	Disturbance:	2	Human Exposure:	0	Maintenance Activity:	0
Total Scores:							
Material Score:	3	Priority Score	2	Total Score:	5	Risk Rating:	Very Low
Recommended action:	Remove if likely to be disturbed by the refurbishment, otherwise monitor condition.						
Recommendation comments:	-						
Comments:	Material observed to continue from top to bottom of staircase.						


Building:	Space House	Floor:	Sixth Floor				
Location:	002 - Kemble Street Lobby (Kingsway)	Sample No / ID (Type):	P-356976/004 (Sampled)				
Surveyor:	Danny Webber	Survey date:	19/12/2019				
Sample Details							
	Item description:	Adhesive residue beneath carpet tiles					
	Material description:	Bituminous products					
	Quantity / Extent:	4 m ²					
	Accessibility	Easy Access					
	Analysis:	Chrysotile					
	Material identification:	Asbestos bitumen					
Material Assessment Scoring:							
Product Type:	1	Condition:	1	Surface Treatment:	0	Asbestos Type:	1
Priority Assessment Scoring:							
Occupant Activity:	0	Disturbance:	2	Human Exposure:	0	Maintenance Activity:	0
Total Scores:							
Material Score:	3	Priority Score	2	Total Score:	5	Risk Rating:	Very Low
Recommended action:	Remove if likely to be disturbed by the refurbishment, otherwise monitor condition.						
Recommendation comments:	-						
Comments:	-						


Section 6 – Survey Results

Building:	Space House	Floor:	Sixth Floor				
Location:	003 - Open Plan Area (Kingsway)	Sample No / ID (Type):	P-356976/005 (Sampled)				
Surveyor:	Danny Webber	Survey date:	19/12/2019				
Sample Details							
	Item description:	Ceiling above MMMF tiles					
	Material description:	Insulating board					
	Quantity / Extent:	100 m ²					
	Accessibility	Difficult Access					
	Analysis:	Chrysotile					
	Material identification:	Asbestos insulating board					
Material Assessment Scoring:							
Product Type:	2	Condition:	1	Surface Treatment:	1	Asbestos Type:	1
Priority Assessment Scoring:							
Occupant Activity:	0	Disturbance:	2	Human Exposure:	0	Maintenance Activity:	0
Total Scores:							
Material Score:	5	Priority Score	2	Total Score:	7	Risk Rating:	Low
Recommended action:	Remove if likely to be disturbed by the refurbishment, otherwise monitor condition.						
Recommendation comments:	It is strongly presumed after discussions on site that asbestos packing material will also be present above.						
Comments:	Material located above windows between lighting trunking & windows.						


Building:	Space House	Floor:	Sixth Floor				
Location:	003 - Open Plan Area (Kingsway)	Sample No / ID (Type):	P-356976/006 (Sampled)				
Surveyor:	Danny Webber	Survey date:	19/12/2019				
Sample Details							
	Item description:	MMMF ceiling tile adhesive					
	Material description:	Bituminous products					
	Quantity / Extent:	600 m ²					
	Accessibility	Difficult Access					
	Analysis:	No asbestos detected					
	Material identification:	Non-asbestos material					
Material Assessment Scoring:							
Product Type:	-	Condition:	-	Surface Treatment:	-	Asbestos Type:	-
Priority Assessment Scoring:							
Occupant Activity:	-	Disturbance:	-	Human Exposure:	-	Maintenance Activity:	-
Total Scores:							
Material Score:	-	Priority Score	-	Total Score:	0	Risk Rating:	N/A
Recommended action:	-						
Recommendation comments:	-						
Comments:	-						


Section 6 – Survey Results

Building:	Space House	Floor:	Sixth Floor				
Location:	003 - Open Plan Area (Kingsway)	Sample No / ID (Type):	P-356976/007 (Sampled)				
Surveyor:	Danny Webber	Survey date:	19/12/2019				
Sample Details							
	Item description:	Window sills					
	Material description:	Cement product					
	Quantity / Extent:	82 m linear					
	Accessibility	Easy Access					
	Analysis:	Chrysotile					
	Material identification:	Asbestos cement					
Material Assessment Scoring:							
Product Type:	1	Condition:	1	Surface Treatment:	1	Asbestos Type:	1
Priority Assessment Scoring:							
Occupant Activity:	0	Disturbance:	3	Human Exposure:	0	Maintenance Activity:	0
Total Scores:							
Material Score:	4	Priority Score	3	Total Score:	7	Risk Rating:	Very Low
Recommended action:	Remove if likely to be disturbed by the refurbishment, otherwise monitor condition.						
Recommendation comments:	It is strongly presumed after discussions on site that asbestos packing material will also be present beneath.						
Comments:	-						


Building:	Space House	Floor:	Sixth Floor				
Location:	003 - Open Plan Area (Kingsway)	Sample No / ID (Type):	P-356976/008 (Sampled)				
Surveyor:	Danny Webber	Survey date:	19/12/2019				
Sample Details							
	Item description:	Window sills					
	Material description:	Thermoplastic floor tiles					
	Quantity / Extent:	Throughout m ²					
	Accessibility	Easy Access					
	Analysis:	Chrysotile					
	Material identification:	Asbestos thermoplastic/adhesive					
Material Assessment Scoring:							
Product Type:	1	Condition:	3	Surface Treatment:	0	Asbestos Type:	1
Priority Assessment Scoring:							
Occupant Activity:	0	Disturbance:	3	Human Exposure:	0	Maintenance Activity:	0
Total Scores:							
Material Score:	5	Priority Score	3	Total Score:	8	Risk Rating:	Low
Recommended action:	Remove if likely to be disturbed by the refurbishment, otherwise monitor condition.						
Recommendation comments:	Material is located throughout open plan area, predominantly beneath timber skirting boards around perimeter of building.						
Comments:	-						


Section 6 – Survey Results

Building:	Space House	Floor:	Sixth Floor				
Location:	003 - Open Plan Area (Kingsway)	Sample No / ID (Type):	P-356976/009 (Sampled)				
Surveyor:	Danny Webber	Survey date:	19/12/2019				
Sample Details							
	Item description:	Debris					
	Material description:	Insulating board					
	Quantity / Extent:	10 m ²					
	Accessibility	Easy Access					
	Analysis:	No asbestos detected					
	Material identification:	Non-asbestos material					
Material Assessment Scoring:							
Product Type:	-	Condition:	-	Surface Treatment:	-	Asbestos Type:	-
Priority Assessment Scoring:							
Occupant Activity:	-	Disturbance:	-	Human Exposure:	-	Maintenance Activity:	-
Total Scores:							
Material Score:	-	Priority Score	-	Total Score:	0	Risk Rating:	N/A
Recommended action:	-						
Recommendation comments:	-						
Comments:	-						


Building:	Space House	Floor:	Sixth Floor				
Location:	003 - Open Plan Area (Kingsway)	Sample No / ID (Type):	P-356976/010 (Sampled)				
Surveyor:	Danny Webber	Survey date:	19/12/2019				
Sample Details							
	Item description:	Wall lining beneath plasterboard lining					
	Material description:	Insulating board					
	Quantity / Extent:	18 m ²					
	Accessibility	Difficult Access					
	Analysis:	Chrysotile					
	Material identification:	Asbestos insulating board					
Material Assessment Scoring:							
Product Type:	2	Condition:	1	Surface Treatment:	1	Asbestos Type:	1
Priority Assessment Scoring:							
Occupant Activity:	0	Disturbance:	2	Human Exposure:	0	Maintenance Activity:	0
Total Scores:							
Material Score:	5	Priority Score	2	Total Score:	7	Risk Rating:	Low
Recommended action:	Remove if likely to be disturbed by the refurbishment, otherwise monitor condition.						
Recommendation comments:	-						
Comments:	-						


Section 6 – Survey Results

Building:	Space House	Floor:	Sixth Floor				
Location:	003 - Open Plan Area (Kingsway)	Sample No / ID (Type):	P-356976/As 004 (Cross Referenced)				
Surveyor:	Danny Webber	Survey date:	19/12/2019				
Sample Details							
	Item description:	Adhesive residue partially beneath floor screed					
	Material description:	Bituminous products					
	Quantity / Extent:	600 m ²					
	Accessibility	Easy Access					
	Analysis:	Chrysotile					
	Material identification:	Asbestos bitumen					
Material Assessment Scoring:							
Product Type:	1	Condition:	1	Surface Treatment:	0	Asbestos Type:	1
Priority Assessment Scoring:							
Occupant Activity:	0	Disturbance:	3	Human Exposure:	0	Maintenance Activity:	0
Total Scores:							
Material Score:	3	Priority Score	3	Total Score:	6	Risk Rating:	Very Low
Recommended action:	Remove if likely to be disturbed by the refurbishment, otherwise monitor condition.						
Recommendation comments:	-						
Comments:	-						


Building:	Space House	Floor:	Sixth Floor				
Location:	004 - Kimble Street Risers (Kingsway)	Sample No / ID (Type):	P-356976/011 (Sampled)				
Surveyor:	Danny Webber	Survey date:	19/12/2019				
Sample Details							
	Item description:	Pipework insulation					
	Material description:	Paper					
	Quantity / Extent:	6 m linear					
	Accessibility	Easy Access					
	Analysis:	No asbestos detected					
	Material identification:	Non-asbestos material					
Material Assessment Scoring:							
Product Type:	-	Condition:	-	Surface Treatment:	-	Asbestos Type:	-
Priority Assessment Scoring:							
Occupant Activity:	-	Disturbance:	-	Human Exposure:	-	Maintenance Activity:	-
Total Scores:							
Material Score:	-	Priority Score	-	Total Score:	0	Risk Rating:	N/A
Recommended action:	-						
Recommendation comments:	-						
Comments:	-						


Section 6 – Survey Results

Building:	Space House	Floor:	Sixth Floor				
Location:	005 - Kitchen (Kingsway)	Sample No / ID (Type):	P-356976/012 (Sampled)				
Surveyor:	Danny Webber	Survey date:	19/12/2019				
Sample Details							
	Item description:	Ceiling & floor packing at pipe penetrations					
	Material description:	Insulation					
	Quantity / Extent:	<1 m ²					
	Accessibility	Easy Access					
	Analysis:	No asbestos detected					
	Material identification:	Non-asbestos material					
Material Assessment Scoring:							
Product Type:	-	Condition:	-	Surface Treatment:	-	Asbestos Type:	-
Priority Assessment Scoring:							
Occupant Activity:	-	Disturbance:	-	Human Exposure:	-	Maintenance Activity:	-
Total Scores:							
Material Score:	-	Priority Score	-	Total Score:	0	Risk Rating:	N/A
Recommended action:	-						
Recommendation comments:	-						
Comments:	Material observed within riser.						

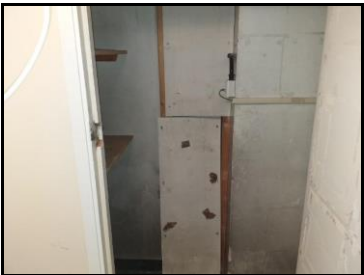
Building:	Space House	Floor:	Sixth Floor				
Location:	005 - Kitchen (Kingsway)	Sample No / ID (Type):	P-356976/013 (Sampled)				
Surveyor:	Danny Webber	Survey date:	19/12/2019				
Sample Details							
	Item description:	Riser panels					
	Material description:	Insulating board					
	Quantity / Extent:	1 m ²					
	Accessibility	Easy Access					
	Analysis:	No asbestos detected					
	Material identification:	Non-asbestos material					
Material Assessment Scoring:							
Product Type:	-	Condition:	-	Surface Treatment:	-	Asbestos Type:	-
Priority Assessment Scoring:							
Occupant Activity:	-	Disturbance:	-	Human Exposure:	-	Maintenance Activity:	-
Total Scores:							
Material Score:	-	Priority Score	-	Total Score:	0	Risk Rating:	N/A
Recommended action:	-						
Recommendation comments:	-						
Comments:	Material observed within cupboard.						


Section 6 – Survey Results

Building:	Space House	Floor:	Sixth Floor				
Location:	005 - Kitchen (Kingsway)	Sample No / ID (Type):	P-356976/As 004 (Cross Referenced)				
Surveyor:	Danny Webber	Survey date:	19/12/2019				
Sample Details							
	Item description:	Adhesive residue partially beneath modern linoleum					
	Material description:	Bituminous products					
	Quantity / Extent:	12 m ²					
	Accessibility	Easy Access					
	Analysis:	Chrysotile					
	Material identification:	Asbestos bitumen					
Material Assessment Scoring:							
Product Type:	1	Condition:	1	Surface Treatment:	0	Asbestos Type:	1
Priority Assessment Scoring:							
Occupant Activity:	0	Disturbance:	3	Human Exposure:	0	Maintenance Activity:	0
Total Scores:							
Material Score:	3	Priority Score	3	Total Score:	6	Risk Rating:	Very Low
Recommended action:	Remove if likely to be disturbed by the refurbishment, otherwise monitor condition.						
Recommendation comments:	-						
Comments:	-						

Building:	Space House	Floor:	Sixth Floor				
Location:	005 - Kitchen (Kingsway)	Sample No / ID (Type):	P-356976/As 006 (Cross Referenced)				
Surveyor:	Danny Webber	Survey date:	19/12/2019				
Sample Details							
	Item description:	MMMF ceiling tile adhesive					
	Material description:	Bituminous products					
	Quantity / Extent:	12 m ²					
	Accessibility	Difficult Access					
	Analysis:	No asbestos detected					
	Material identification:	Non-asbestos material					
Material Assessment Scoring:							
Product Type:	-	Condition:	-	Surface Treatment:	-	Asbestos Type:	-
Priority Assessment Scoring:							
Occupant Activity:	-	Disturbance:	-	Human Exposure:	-	Maintenance Activity:	-
Total Scores:							
Material Score:	-	Priority Score	-	Total Score:	0	Risk Rating:	N/A
Recommended action:	-						
Recommendation comments:	-						
Comments:	-						


Section 6 – Survey Results


Building:	Space House	Floor:	Sixth Floor				
Location:	005 - Kitchen (Kingsway)	Sample No / ID (Type):	P-356976/As 007 (Cross Referenced)				
Surveyor:	Danny Webber	Survey date:	19/12/2019				
Sample Details							
	Item description:	Window sills					
	Material description:	Cement product					
	Quantity / Extent:	3 m linear					
	Accessibility	Easy Access					
	Analysis:	Chrysotile					
	Material identification:	Asbestos cement					
Material Assessment Scoring:							
Product Type:	1	Condition:	1	Surface Treatment:	1	Asbestos Type:	1
Priority Assessment Scoring:							
Occupant Activity:	0	Disturbance:	3	Human Exposure:	0	Maintenance Activity:	0
Total Scores:							
Material Score:	4	Priority Score	3	Total Score:	7	Risk Rating:	Very Low
Recommended action:	Remove if likely to be disturbed by the refurbishment, otherwise monitor condition.						
Recommendation comments:	It is strongly presumed after discussions on site that asbestos packing material will also be present beneath.						
Comments:	-						

Building:	Space House	Floor:	Sixth Floor				
Location:	005 - Kitchen (Kingsway)	Sample No / ID (Type):	P-356976/As 010 (Cross Referenced)				
Surveyor:	Danny Webber	Survey date:	19/12/2019				
Sample Details							
	Item description:	Wall lining					
	Material description:	Insulating board					
	Quantity / Extent:	18 m ²					
	Accessibility	Easy Access					
	Analysis:	Chrysotile					
	Material identification:	Asbestos insulating board					
Material Assessment Scoring:							
Product Type:	2	Condition:	1	Surface Treatment:	1	Asbestos Type:	1
Priority Assessment Scoring:							
Occupant Activity:	0	Disturbance:	2	Human Exposure:	0	Maintenance Activity:	0
Total Scores:							
Material Score:	5	Priority Score	2	Total Score:	7	Risk Rating:	Low
Recommended action:	Remove if likely to be disturbed by the refurbishment, otherwise monitor condition.						
Recommendation comments:	-						
Comments:	-						

Section 7 – Room Data

This section contains details of the material construction of all rooms which were accessed during this survey. For those areas which were not accessed during the surveys, please refer to the no access areas in section 1.0.


Building Name:	Space House	Floor Level:	Sixth Floor
Location Number:	001	Location Description:	Kemble Street Staircase (Kingsway)
Surveyor:	Danny Webber	Survey Date:	19/12/2019
Room Data / Observations:			
		General Comments:	
		<p>Plaster skimmed concrete ceiling. Plaster skimmed masonry walls. Timber doors & frame. Metal windows. Metal radiator. Composite skirting board (sampled). Composite step nosings (sampled). Concrete floor beneath floor tiles (sampled).</p> <p>No access could be gained within window cavity void, assistance from window removal specialists required.</p>	

Building Name:	Space House	Floor Level:	Sixth Floor
Location Number:	002	Location Description:	Kemble Street Lobby (Kingsway)
Surveyor:	Danny Webber	Survey Date:	19/12/2019
Room Data / Observations:			
		General Comments:	
		<p>Plaster skimmed concrete ceiling. Plaster skimmed masonry walls. Timber doors & frames. Timber skirting board. Concrete floor beneath carpet tiles.</p>	

Section 7 – Room Data


Building Name:	Space House	Floor Level:	Sixth Floor
Location Number:	003	Location Description:	Open Plan Area (Kingsway)
Surveyor:	Danny Webber	Survey Date:	19/12/2019

Room Data / Observations:

	<p>General Comments:</p> <p>Concrete ceiling above meshed plaster above MMMF ceiling tiles. Foam & MMMF insulated pipework. Plaster skimmed masonry, plasterboard & cement (sampled) walls. Meshed plaster skim beam cladding with concrete beams & cast iron rainwater pipe within. Metal windows with composite sills (sampled). Timber doors & frames. Timber lining to fire extinguisher housing. Timber skirting board. Concrete floor.</p> <p>No access could be gained within window cavity void, assistance from window removal specialists required.</p>
---	---

Building Name:	Space House	Floor Level:	Sixth Floor
Location Number:	004	Location Description:	Kimble Street Risers (Kingsway)
Surveyor:	Danny Webber	Survey Date:	19/12/2019


Room Data / Observations:

	<p>General Comments:</p> <p>Concrete ceiling. Masonry walls. Timber doors & frames. MMMF insulated pipework (sampled). Concrete floor.</p>
---	--

Section 7 – Room Data

Building Name:	Space House	Floor Level:	Sixth Floor
Location Number:	005	Location Description:	Kitchen (Kingsway)
Surveyor:	Danny Webber	Survey Date:	19/12/2019

Room Data / Observations:

	<p>General Comments:</p> <p>Concrete (plaster skimmed above window) ceiling above meshed plaster above MMMF ceiling tiles. Foam & MMMF insulated pipework. Plaster skimmed masonry & cement (sampled) walls. Plasterboard boxing. Glass fibreboard riser panel (sampled). Metal windows with composite sills (sampled). Timber doors & frames. Plastic skirting board. Concrete floor partially beneath modern linoleum.</p> <p>No access could be gained within window cavity void, assistance from window removal specialists required.</p>
---	--

Section 8 – Sample Results Summary

Sample No. / ID (Approach*)	Location details	Item Description	Material description	Asbestos type	Extent	Material score	Priority score	Total score	Recommendation
P-356976/001 (S)	Space House - Sixth Floor - Kemble Street Staircase (Kingsway)	Skirting board	Non-asbestos material	No asbestos detected	20 m linear	0	-	0	-
P-356976/002 (S)	Space House - Sixth Floor - Kemble Street Staircase (Kingsway)	Step nosings	Asbestos thermoplastic material	Chrysotile	18 Number	3	2	5	Remove if likely to be disturbed by the refurbishment, otherwise monitor condition.
P-356976/003 (S)	Space House - Sixth Floor - Kemble Street Staircase (Kingsway)	Floor tiles (grey) & bitumen adhesive	Asbestos thermoplastic/adhesive	Chrysotile	16 m2	3	2	5	Remove if likely to be disturbed by the refurbishment, otherwise monitor condition.
P-356976/004 (S)	Space House - Sixth Floor - Kemble Street Lobby (Kingsway)	Adhesive residue beneath carpet tiles	Asbestos bitumen	Chrysotile	4 m2	3	2	5	Remove if likely to be disturbed by the refurbishment, otherwise monitor condition.
P-356976/005 (S)	Space House - Sixth Floor - Open Plan Area (Kingsway)	Ceiling above MMMF tiles	Asbestos insulating board	Chrysotile	100 m2	5	2	7	Remove if likely to be disturbed by the refurbishment, otherwise monitor condition.
P-356976/006 (S)	Space House - Sixth Floor - Open Plan Area (Kingsway)	MMMF ceiling tile adhesive	Non-asbestos material	No asbestos detected	600 m2	0	-	0	-
P-356976/007 (S)	Space House - Sixth Floor - Open Plan Area (Kingsway)	Window sills	Asbestos cement	Chrysotile	82 m linear	4	3	7	Remove if likely to be disturbed by the refurbishment, otherwise monitor condition.
P-356976/008 (S)	Space House - Sixth Floor - Open Plan Area (Kingsway)	Window sills	Asbestos thermoplastic/adhesive	Chrysotile	Through out m2	5	3	8	Remove if likely to be disturbed by the refurbishment, otherwise monitor condition.
P-356976/009 (S)	Space House - Sixth Floor - Open Plan Area (Kingsway)	Debris	Non-asbestos material	No asbestos detected	10 m2	0	-	0	-
P-356976/010 (S)	Space House - Sixth Floor - Open Plan Area (Kingsway)	Wall lining beneath plasterboard lining	Asbestos insulating board	Chrysotile	18 m2	5	2	7	Remove if likely to be disturbed by the refurbishment, otherwise monitor condition.
P-356976/011 (S)	Space House - Sixth Floor - Kimble Street Risers (Kingsway)	Pipework insulation	Non-asbestos material	No asbestos detected	6 m linear	0	-	0	-
P-356976/012 (S)	Space House - Sixth Floor - Kitchen (Kingsway)	Ceiling & floor packing at pipe penetrations	Non-asbestos material	No asbestos detected	<1 m2	0	-	0	-
P-356976/013 (S)	Space House - Sixth Floor - Kitchen (Kingsway)	Riser panels	Non-asbestos material	No asbestos detected	1 m2	0	-	0	-
P-356976/As 004 (X)	Space House - Sixth Floor - Open Plan Area (Kingsway)	Adhesive residue partially beneath floor screed	Asbestos bitumen	Chrysotile	600 m2	3	3	6	Remove if likely to be disturbed by the refurbishment, otherwise monitor condition.
P-356976/As 004 (X)	Space House - Sixth Floor - Kitchen (Kingsway)	Adhesive residue partially beneath modern linoleum	Asbestos bitumen	Chrysotile	12 m2	3	3	6	Remove if likely to be disturbed by the refurbishment, otherwise monitor condition.
P-356976/As 006 (X)	Space House - Sixth Floor - Kitchen (Kingsway)	MMMF ceiling tile adhesive	Non-asbestos material	No asbestos detected	12 m2	0	-	0	-

Section 8 – Sample Results Summary

Sample No. / ID (Approach*)	Location details	Item Description	Material description	Asbestos type	Extent	Material score	Priority score	Total score	Recommendation
P-356976/As 007 (X)	Space House - Sixth Floor - Kitchen (Kingsway)	Window sills	Asbestos cement	Chrysotile	3 m linear	4	3	7	Remove if likely to be disturbed by the refurbishment, otherwise monitor condition.
P-356976/As 010 (X)	Space House - Sixth Floor - Kitchen (Kingsway)	Wall lining	Asbestos insulating board	Chrysotile	18 m2	5	2	7	Remove if likely to be disturbed by the refurbishment, otherwise monitor condition.

*Key to approach: S = sampled material; X = Material cross referenced to a sample; P = presumed material (not sampled); SP = Strongly presumed material (not sampled)

APPENDIX A – CONTRACT INFORMATION AND SURVEY SCOPE

SURVEY CONTRACT INFORMATION AND SCOPE
--

Quotation number / Project number	P-356976
--	-----------------

Client	SLQR Trustee No 1 Limited and SLQR Trustee No 2 Limited as Co Trustees of SLQR Unit Trust No 3
Site	Space House
Site Address	6th Floor Kingsway Building 1 Kemble Street London WC2B 4AN

Site description	One Kemble Street building and Kingsway building currently contains an existing property comprising 229,192ft ² . The site is located on Kingsway in the London Borough of Camden. The original development was completed in 1969 and received large-scale refurbishments in 1996 and 2003; it received Grade II listing by Historic England in 2015.
Type of survey	Refurbishment Survey
Area of refurbishment (if applicable)	
Mobile Tracker version	Standard Tracker - Room led data

Client specific requirements

Information obtained from client:	
How was information obtained	Site visit
Occupancy of the site	Vacant The building will become fully vacant from the 24th December 2020.
Existing asbestos reports / records?	Yes Asbestos registers & survey reports are available on-site - should Environmental Essentials be successful these will be shared electronically to facilitate a comprehensive desktop study.
Historical refurbishment / demolition records	Yes Asbestos registers detail ACMs that have been removed

Assessments required	Material assessment only
Method of reinstatement (if applicable)	No re-instatement required other than to make safe any inspection points N/A
Departures from recognised methods	No

Scope of works (including proposed refurbishment where applicable)

Refurbishment Survey of both 1 Kemble Street and 45-49 Kingsway ahead of the proposed refurbishment works. The full scale of the project was communicated by Clive Withers of Avison Young during the scoping visit. The scope of the refurbishment included a full strip out of internal wall structures (partition and blockwork) and ceilings (suspended/fixed) leaving the outer shell structure of the building. All existing Mechanical and Electrical Plant (MEP) is proposed to be removed apart from any services feeding the UKPN areas. All windows to the exterior of the properties are being replaced. Specified sections of the floor slab, particularly to the car park and ramp, are being re-constructed. Additional structures are being constructed to the roof of both buildings.

Elements to be inspected			
All surveys			
Element	Usual inspection method (if applicable)	Included?	Comments
All areas within site boundary	Inspection of all areas within the site boundaries, including exterior elements and surrounding gardens / land.	Yes	
Beneath carpet or floor coverings (except laminate floors)	Management surveys - to be lifted in discrete locations where to do so will not cause damage and where the flooring can be safely replaced Refurbishment / demolition surveys – full inspection to all relevant areas.	Yes	
Beneath or behind fixtures and fittings – e.g. bath panels / kitchen units	Management surveys – inspection only where the item is screw fixed or can be easily removed and replaced without causing damage. Refurbishment / demolition surveys - removal of cladding panels / units or inspection hole created with appropriate tools.	Yes	
Within boxings or risers (not constructed of a suspect ACM).	Management surveys – inspection only where the boxing / access panel is screw fixed or can be easily removed and replaced without causing damage. Refurbishment / demolition surveys – full inspection either by unscrewing, use of existing access panels or inspection holes made with appropriate tools of suitable size to allow for adequate inspection..	Yes	Boxing's can be removed in their entirety to facilitate a full inspection. Boxing's within the tower (1 Kemble Street Building) to the perimeter walls (adjacent the windows) will be representatively inspected given their uniform nature and amount of boxing's present (i.e. a boxing to either side of each window).
Roof voids	Inspection from the access hatch if no flooring or crawl boards available	Yes	No roof voids identified during the walkthrough
Refurbishment surveys / demolition surveys (elements to be included in areas affected by the scope of the proposed works)			
Element	Usual inspection method (if applicable)	Included?	Comments
Solid wall cavities	Removal of vent covers/window sills. May involve removal of individual bricks in some cases.	Yes	
Partition wall cavities	Inspection holes created with appropriate tools and of suitable size to allow for adequate inspection.	Yes	Large sections of the partitions can be removed to provide a greater level of inspection
Above fixed ceilings / ceiling voids	Inspection holes created with appropriate tools. Inspection may also be possible via the removal of light fittings or removal of flooring within areas above.	Yes	Large sections of the ceilings can be removed to provide a greater level of inspection
Floor voids	Removal of floorboards or use of existing access points.	Yes	
Beneath window sills	Removal of window sills or inspection holes created with appropriate tools.	Yes	
Within fire doors	Removal of door furniture or inspection hole created with appropriate tools.	Yes	
Beneath fixed flooring materials (e.g. laminate / ceramic tiles)	Removal of flooring material.	Yes	
Behind fixed wall cladding / coverings / tiles	Removal of cladding / coverings / tiles.	Yes	Listed features, including mosaic tiles, are to be excluded; these are present to external walls and stairwells
Behind skirting and door frames	Removal of skirting and door frames.	Yes	
Beneath non-asbestos insulation to pipework / calorifiers etc.	Removal of non-asbestos insulation materials.	Yes	
Behind non asbestos external soffits / fascias	Removal of soffit / fascia. Inspection hole created with appropriate tools. Suitable inspection may be possible form within roof voids	Yes	
Sealed off or locked areas	Access gained using intrusive methods.	No	

where no key is available			
---------------------------	--	--	--

As part of the survey planning stage, the below elements were discussed with the client. Where the elements are indicated as not included, they are specifically excluded from the scope of the survey and should be presumed to contain asbestos until proven otherwise.			
Element	Usual inspection method (if applicable)	Included?	Comments
Work at height requiring specialist access equipment	Inspection via MEWP or scaffold as appropriate.	Yes	MEWP requirement for external high level areas, i.e. canopies, link bridges, etc.
Within electric switchgear, fuse boxes, plant and other associated services	Only accessed if a suitably qualified electrician is provided otherwise these items will not be inspected and are specifically excluded from the scope of the survey.	Yes	Client to supply a suitably qualified electrician to locally isolate and open up any suspect electrical units. 2 days have been allowed for, at the end of the programme, to walkthrough the building with an electrician to complete these inspections.
Within operational plant and machinery including boilers / calorifiers etc.	Only accessed if a suitably qualified engineer is provided otherwise these items will not be inspected and are specifically excluded from the scope of the survey.	Yes	Client to supply a suitably qualified mechanic to locally isolate and open up any suspect mechanical units, i.e. boilers. 2 days have been allowed for, at the end of the programme, to walkthrough the building with a mechanic to complete these inspections.
Access behind / above existing ACMs which would require the use of an asbestos removal contractor	Inspection will only be carried out if a licensed asbestos removal is provided otherwise these areas are specifically excluded from the scope of the survey.	No	Not known at this stage where ACMs are present and whether inspection is required behind/above (i.e. AIB ceiling tiles)
Lifts, lift shafts and lift machinery	Unless agreed with the client and a lift engineer is provided, lifts and shafts are specifically excluded from the scope of the survey. Lift machinery will be inspected externally where possible	Yes	Client to supply a lift engineer to facilitate inspection to the lift shafts and lift carriages. 2 days have been allowed to complete this element of the survey.
Internal elements of safes	Where not included and if there are no client specific requirements, all safes will be recorded as a no access item which should be therefore presumed to contain asbestos.	No	Not applicable
Intrusion through solid ceiling slab, floor slabs or solid walls.	Only accessed if suitable specialist support services are provided otherwise these items will not be inspected and are specifically excluded from the scope of the survey.	Yes	Specified slab areas are to be intrusively inspected with the assistance of other trades, i.e. LARC, Drilling Contractor, etc. 2 days have been allowed on the programme to facilitate this element of the survey.
Below external ground level	Only accessed if suitable specialist support services are provided otherwise these items will not be inspected and are specifically excluded from the scope of the survey.	No	Not applicable
Additional information			
Site specific inclusions - Windows - As the windows are being replaced, it has been recommended that at least 1 window from each building is removed during the survey to facilitate inspection where the frame meets the structure. There are also internal windows of a suspect age/type that have been recommended to be removed to facilitate inspection (i.e. to the light well areas). 4 windows have been allowed for with the cost of the refurbishment (2 external and 2 internal)			
Roof - Core inspections of the roof membrane layers to the two flat roof areas are to be undertaken. Specialist roofing contractor (supplied by the client) to re-instate the roof for waterproofing purposes.			
Site Specific exclusions - Access to the x2 light well areas within 1 Kemble Street Building is not possible due to no safe access points. No damage is to be caused to listed features of the building including the mosaic tiled surfaces to the interior and exterior of the building.			

Scope prepared by: Andrew Jones

Scope agreed with: Clive Withers

APPENDIX B – CERTIFICATE OF ANALYSIS



CERTIFICATE OF ANALYSIS

Project No: P-356976 **Page:** 1 of 2

Client: SLQR Trustee No 1 Limited and
SLQR Trustee No 2 Limited
as Co Trustees of SLQR Unit Trust
No 3
3rd Floor, 37 Esplanade
St Helier
Jersey
Channel Islands
JE1 1AD

Issue date: 24 December 2019

Site: 6th Floor Kingsway Building
1 Kemble Street
London
WC2B 4AN

Samples Taken: 19 December 2019

Sampled by: Danny Webber

Date analysed: 24 December 2019

Analysed by: Diane Thomas

Laboratory: Lab L1, Unit 3 Arlington Court, Silverdale Enterprise Park, Cannel Row, Staffordshire ST5 6SS

Key: chrysotile 'white asbestos', asbestos grunerite [amosite] 'brown asbestos', crocidolite 'blue asbestos'

The analysis detailed in this certificate was undertaken by polarised light microscopy in accordance with our in-house procedure based upon HSG248 Asbestos: The analysts' guide for sampling, analysis and clearance procedures.

For samples submitted by the Client or Client's representative Environmental Essentials Ltd cannot be held responsible for the representative nature of the samples or accuracy of the sample descriptions.

The description of the type of product is based on a visual examination of the material and is given for guidance purposes only. Environmental Essentials accepts no liability for any actions the Client may take based on the material type/s detailed on this certificate.

***Opinions and interpretations expressed herein are outside the scope of our UKAS accreditation**

This certificate may not be reproduced other than in full, except with the prior written approval of the issuing laboratory.

Authorised by: Monika Witkowska

Position: Technical Reviewer

Signed: 

Environmental Essentials Limited

Head Office
Unit 3 Arlington Court
Cannel Row
Silverdale Enterprise Park
Newcastle-under-Lyme
Staffordshire
ST5 6SS

Tel: 0845 456 9953 Fax: 0845 456 9954

M/Doc 53-23-070119-TM



CERTIFICATE OF ANALYSIS

Project No: P-356976

Page:

2 of 2

Sample Number	Location / Description	Analysis	Material identification*
P-356976/001	Sixth Floor - Kembles Street Staircase (Kingsway) - Skirting board	No asbestos detected	Non-asbestos material
P-356976/002	Sixth Floor - Kembles Street Staircase (Kingsway) - Step nosings	Chrysotile	Asbestos thermoplastic material
P-356976/003	Sixth Floor - Kembles Street Staircase (Kingsway) - Floor tiles (grey) & bitumen adhesive	Chrysotile	Asbestos thermoplastic/adhesive
P-356976/004	Sixth Floor - Kembles Street Lobby (Kingsway) - Adhesive residue beneath carpet tiles	Chrysotile	Asbestos bitumen
P-356976/005	Sixth Floor - Open Plan Area (Kingsway) - Ceiling above MMMF tiles	Chrysotile	Asbestos insulating board
P-356976/006	Sixth Floor - Open Plan Area (Kingsway) - MMMF ceiling tile adhesive	No asbestos detected	Non-asbestos material
P-356976/007	Sixth Floor - Open Plan Area (Kingsway) - Window sills	Chrysotile	Asbestos cement
P-356976/008	Sixth Floor - Open Plan Area (Kingsway) - Window sills	Chrysotile	Asbestos thermoplastic/adhesive
P-356976/009	Sixth Floor - Open Plan Area (Kingsway) - Debris	No asbestos detected	Non-asbestos material
P-356976/010	Sixth Floor - Open Plan Area (Kingsway) - Wall lining beneath plasterboard lining	Chrysotile	Asbestos insulating board
P-356976/011	Sixth Floor - Kimble Street Risers (Kingsway) - Pipework insulation	No asbestos detected	Non-asbestos material
P-356976/012	Sixth Floor - Kitchen (Kingsway) - Ceiling & floor packing at pipe penetrations	No asbestos detected	Non-asbestos material
P-356976/013	Sixth Floor - Kitchen (Kingsway) - Riser panels	No asbestos detected	Non-asbestos material
End of Report			


Environmental Essentials Limited

Head Office
Unit 3 Arlington Court
Cannel Row
Silverdale Enterprise Park
Newcastle-under-Lyme
Staffordshire
ST5 6SS

Tel: 0845 456 9953 Fax: 0845 456 9954

M/Doc 53-23-070119-TM

APPENDIX C – PLANS

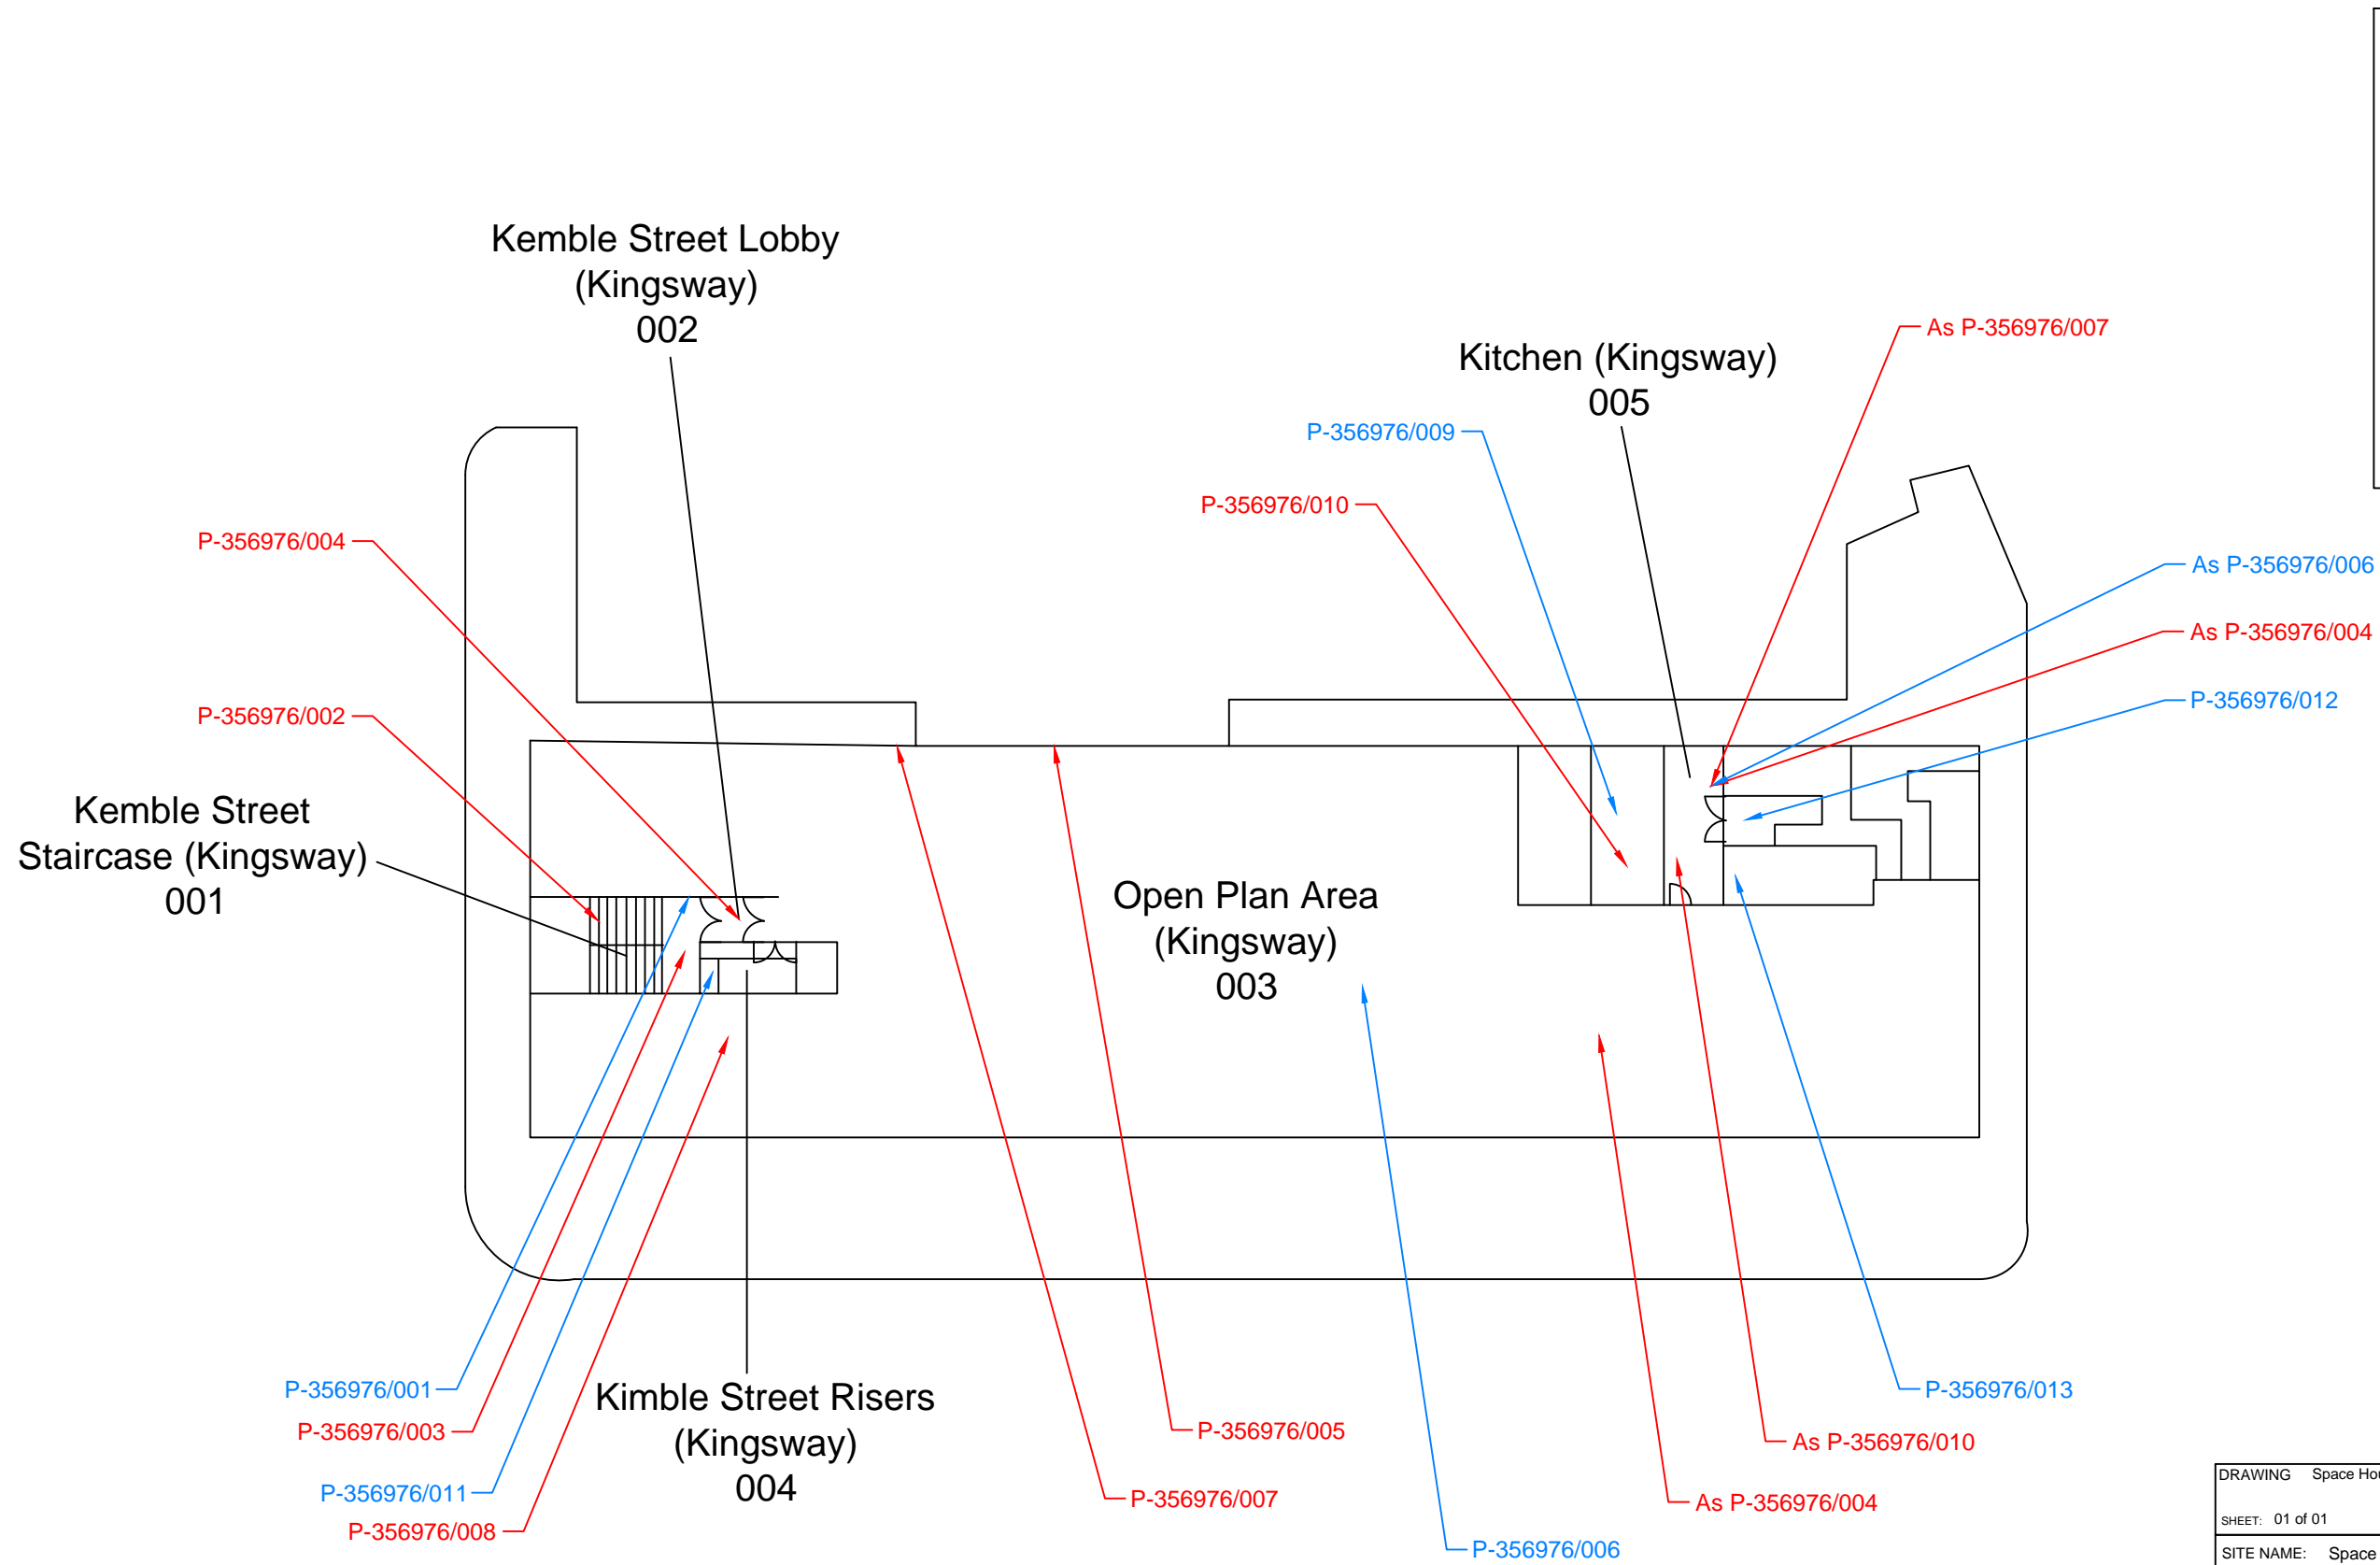

KEY

- ASBESTOS LOCATION
- SAMPLE LOCATION
- ASBESTOS REMOVED
- AREAS OF NO ACCESS
- ACCESS HATCH
- SPECIFIED AREAS
- WALL INTRUSION
- CEILING INTRUSION
- FLOOR INTRUSION

NOT TO SCALE

DRAWING Space House	
SHEET: 01 of 01	
SITE NAME: Space House	
Site Address: Space House 1 Kemble Street London WC2B 4AN	Project: P-356976 Survey Date: 19/12/19 Surveyors: DW Drawn By: TTS-RH
Client: <small>SLOR Trustee No 1 Limited and SLOR Trustee No 2 Limited as Co-Trustees of SLOR Unit Trust No 3</small>	



This plan uses colour coding and should therefore only be relied upon when printed in colour. The information on this plan should be read in conjunction with the original report for the project number detailed above.