







- 4. Existing drainage pipework to be stripped out. Sections of pipework assumed to be original.
- for connection of new rooflight.
- connection of new rooflight
- 8. Existing pitched roof to 1940s extension removed to allow for new flat roof.
- allow for thermal upgrades.

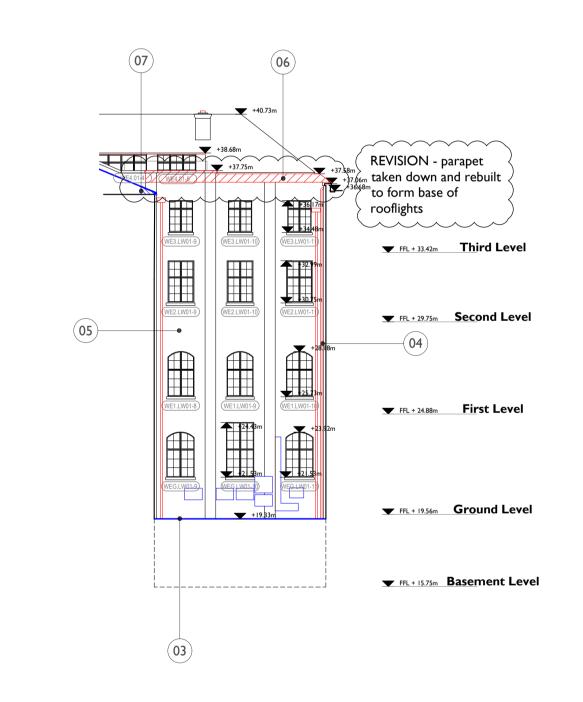

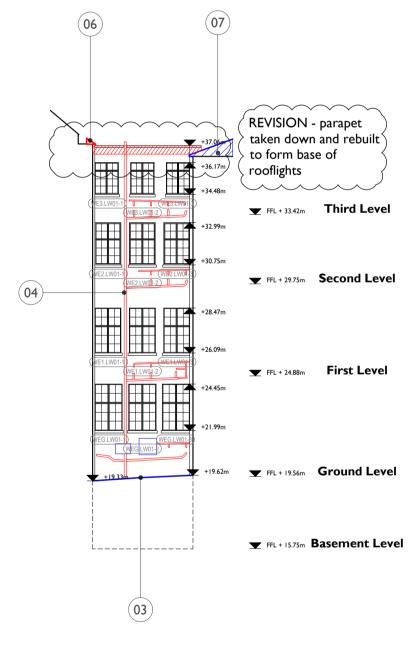





1. Existing windows to be retained and restored

2. Non original windows to be removed in order to insert new window into full opening to match original.

3. WCs to the base of South West Lightwell to be stripped out. Non-original asphalt roof structure to be removed. Extensive repairs to glazed brick at junctions required

5. Glazed brick facade retained and repaired. 6. Overhanging section of slate roof pitch to be removed to allow

7. Section of existing pitched roof removed to allow for


9. Existing services and plant stripped out of lightwells. 10. Roof finishes to section of existing pitched roof removed to Notes:

Drawings are based on survey data and may not accurately represent what is physically present.

All dimensions are to be verified on site before proceeding with the work.

All dimensions are in millimeters unless noted otherwise.

Purcell shall be notified in writing of any discrepancies.

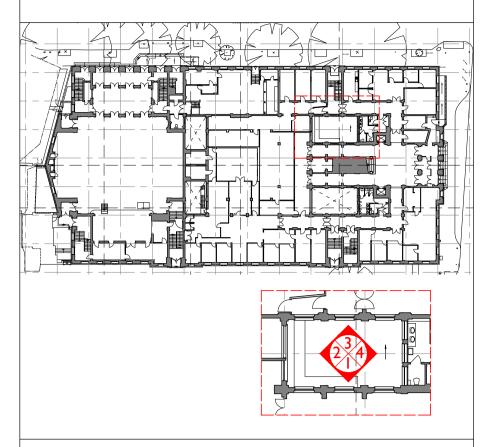

Demolitions & Alterations Key

Original fabric defined as that documented in Archive Drawings. Where date of fabric is unknown, it is assumed as original.	
\square	Original Fabric: Section of Wall/Slab to be Demolished
	Original Fabric: Item to be Demolished
	Overhead - 300mm wide opening to ceiling for high level concealed cable distribution - make good after installation
	Overhead: Whole bay of vaulted ceiling to be removed for cabling distribution and reinstated
\bigotimes	Original Fabric: High level opening in wall for services distribution
	Floor trenches in slab for cable distribution
MIH	Manhole: Opening in slab
	Non-Original Fabric: Section of Wall to be Demolished
	Non-Original Fabric: Item to be Demolished
WG.00-0	Window Number
(DG.00-0)	Door Number
00	Annotation Item
Drawings to be read in conjunction with:	
Internal Repairs & Builder's Works drawing series (93)000 for key spaces	
Conservation Strategy Report CTH-PUR-MP-00-SP-A-00005	

