



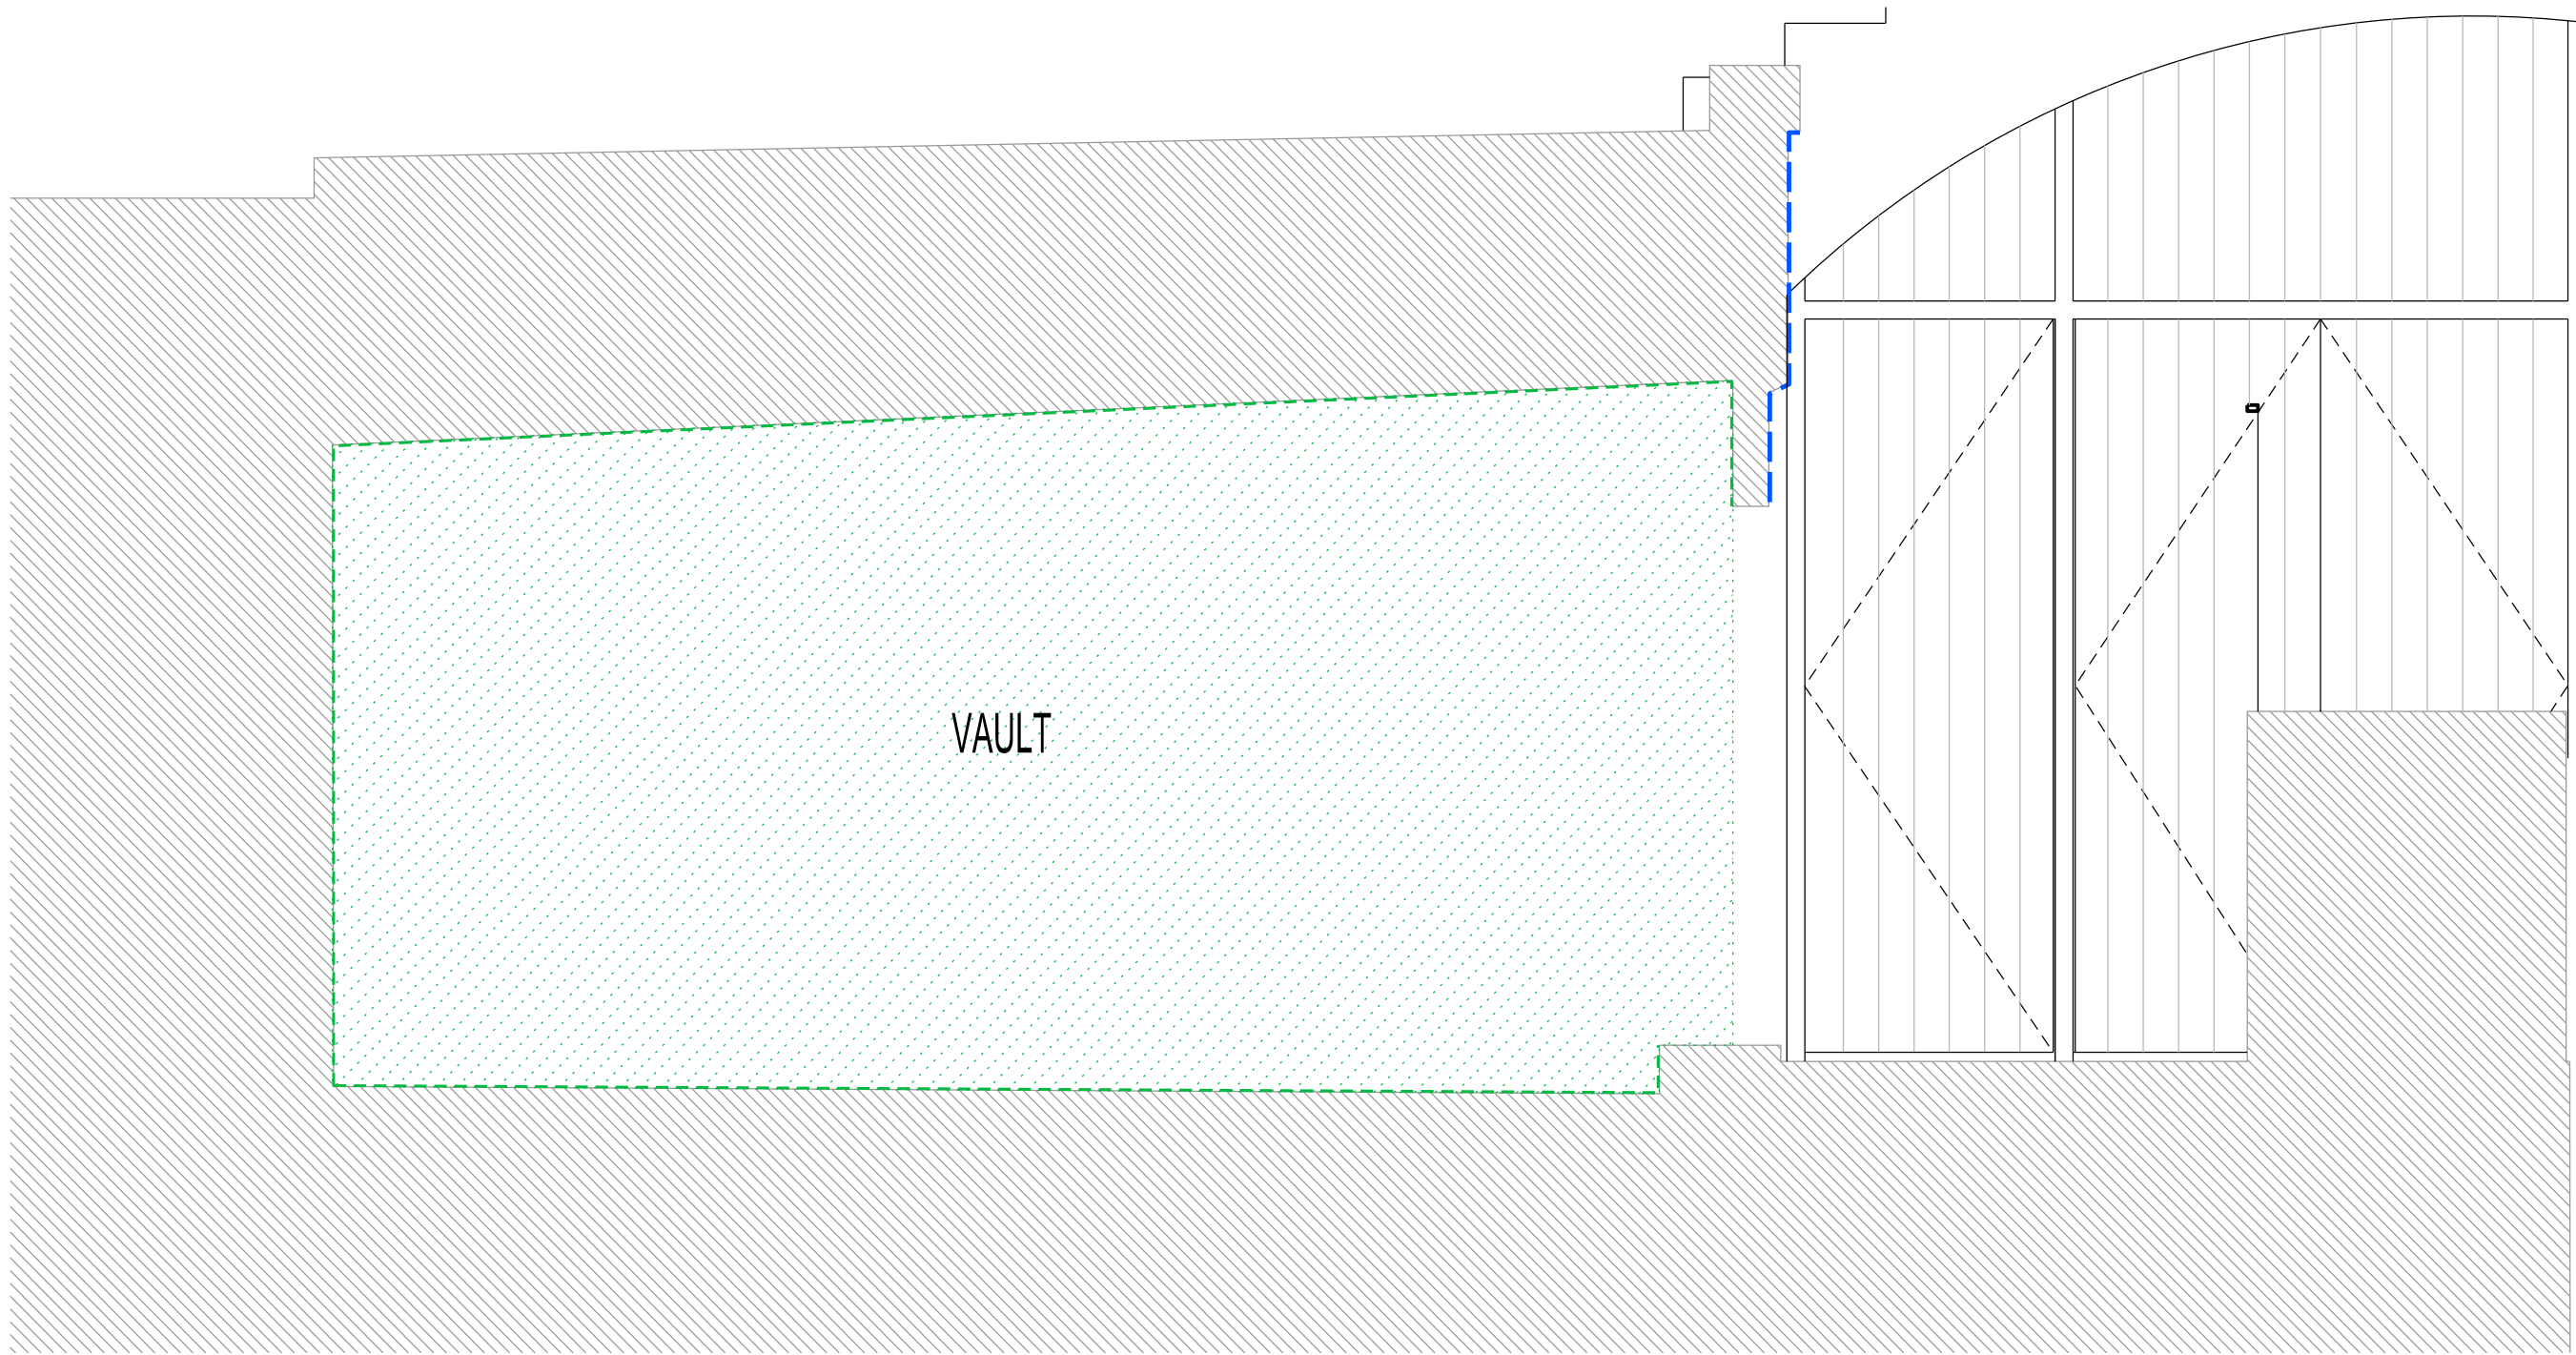


SECTION THROUGH VAULT

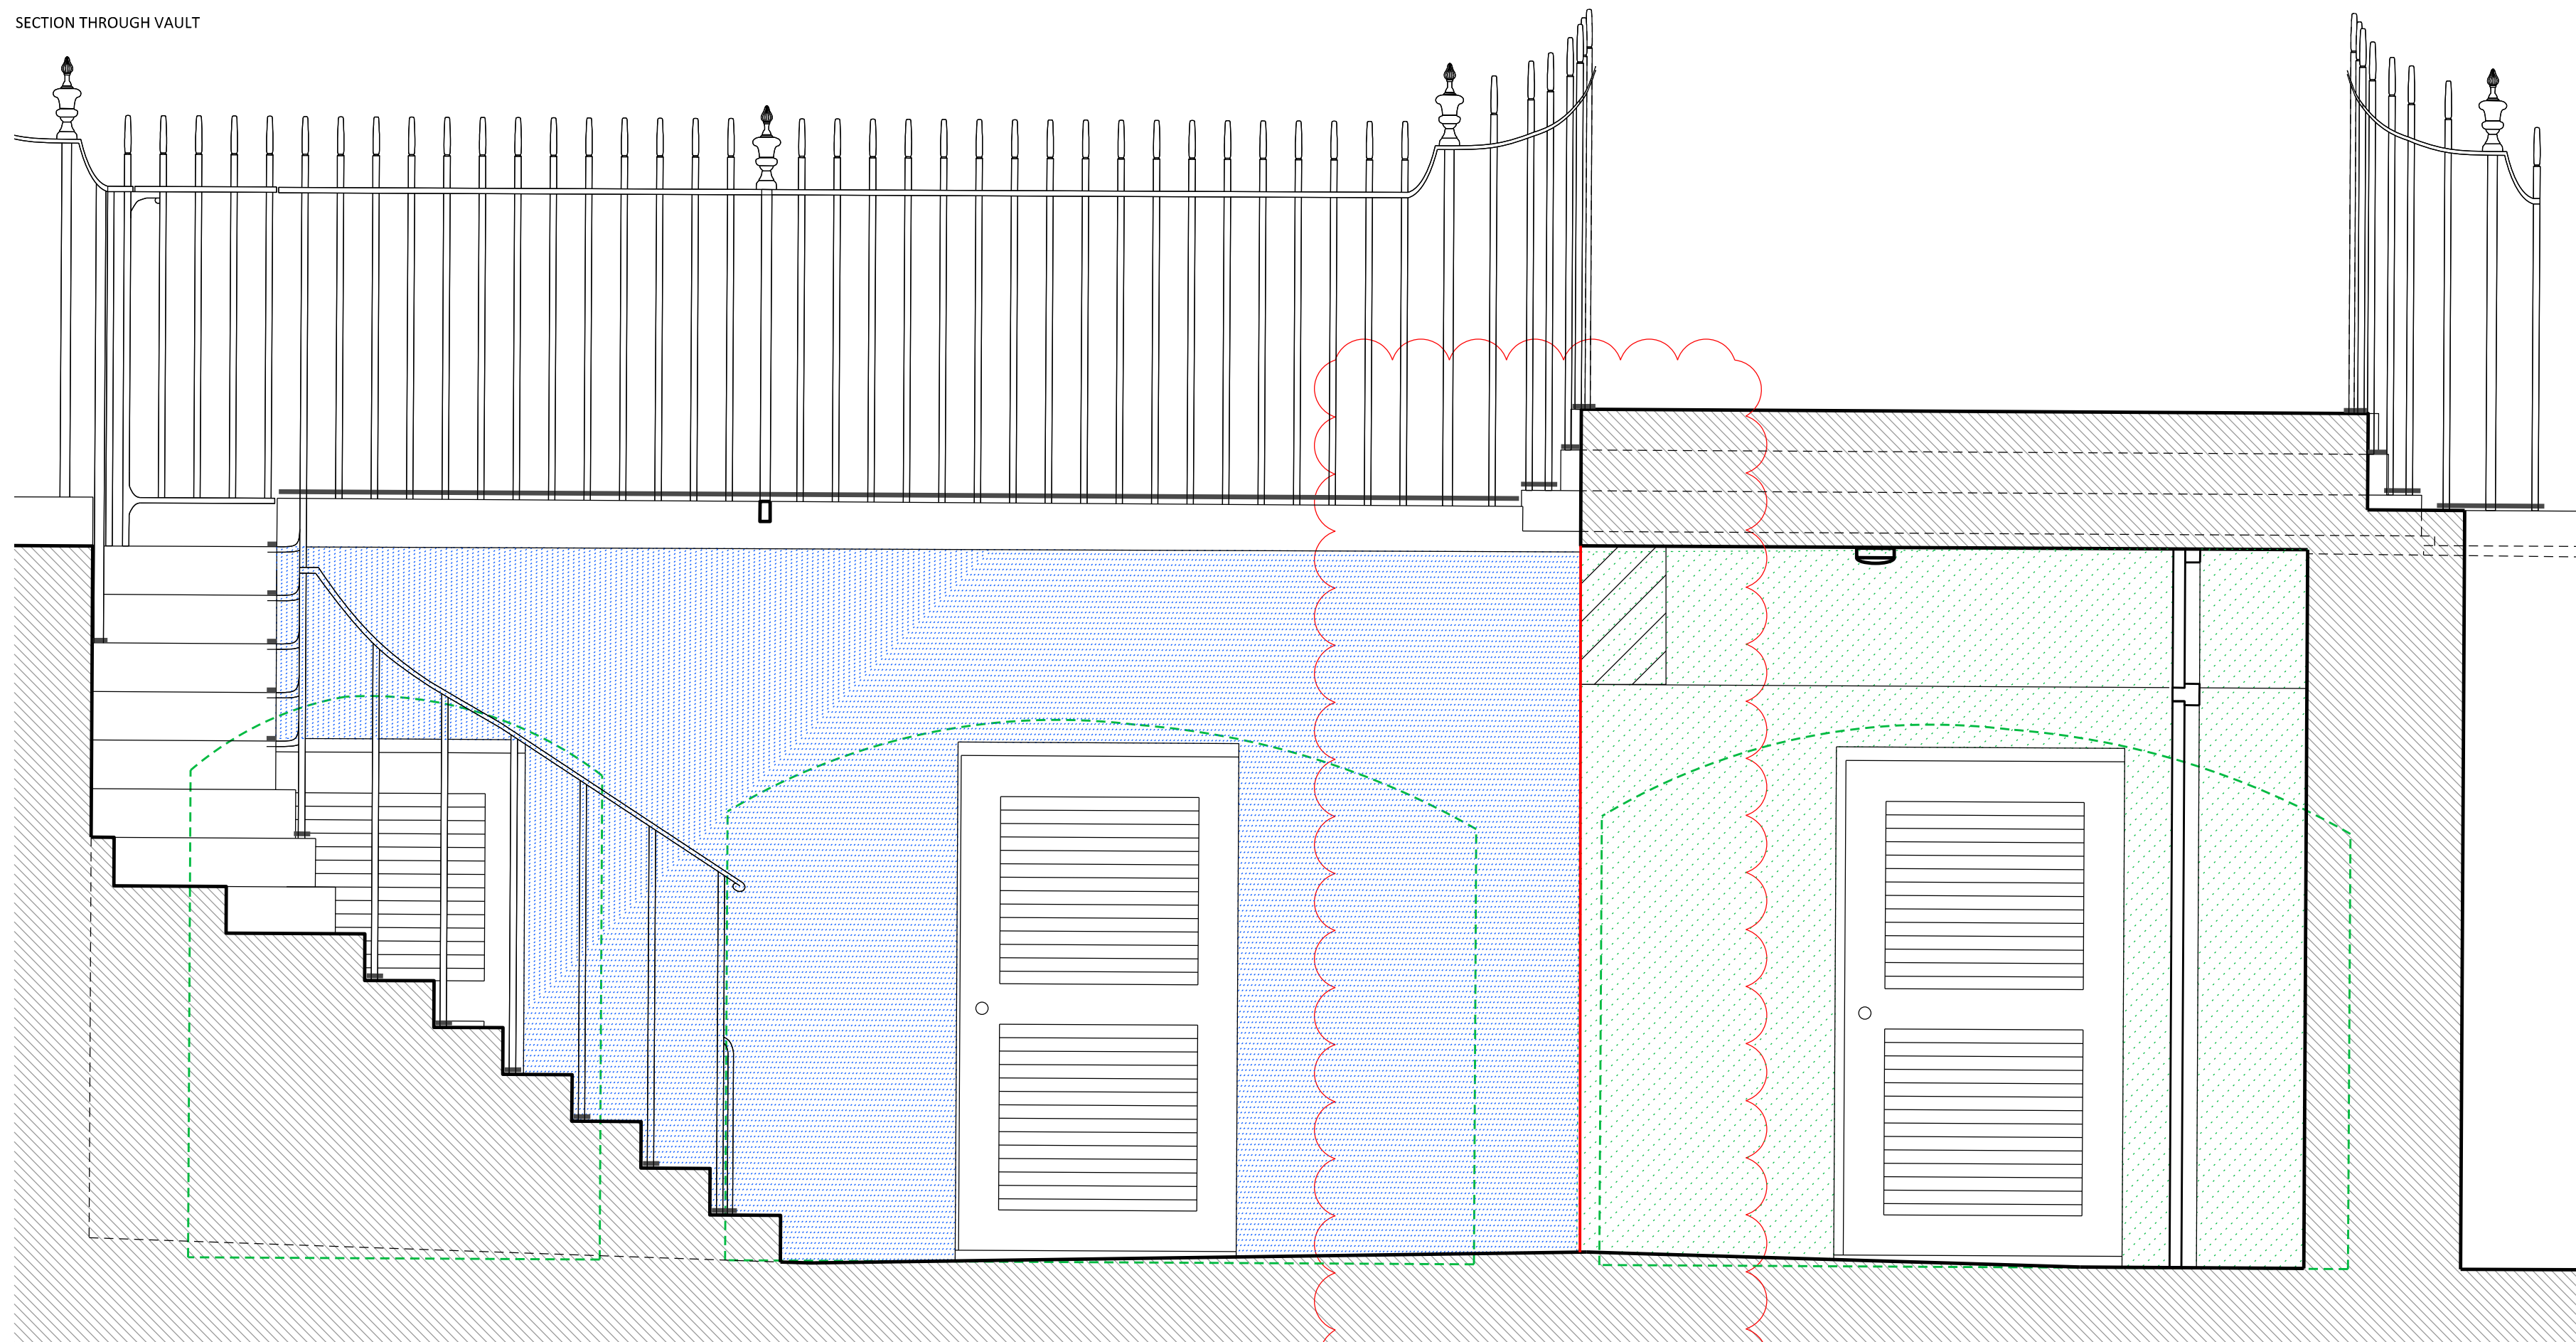

SECTION THROUGH LIGHT WELL

Rev B : Repair information updated

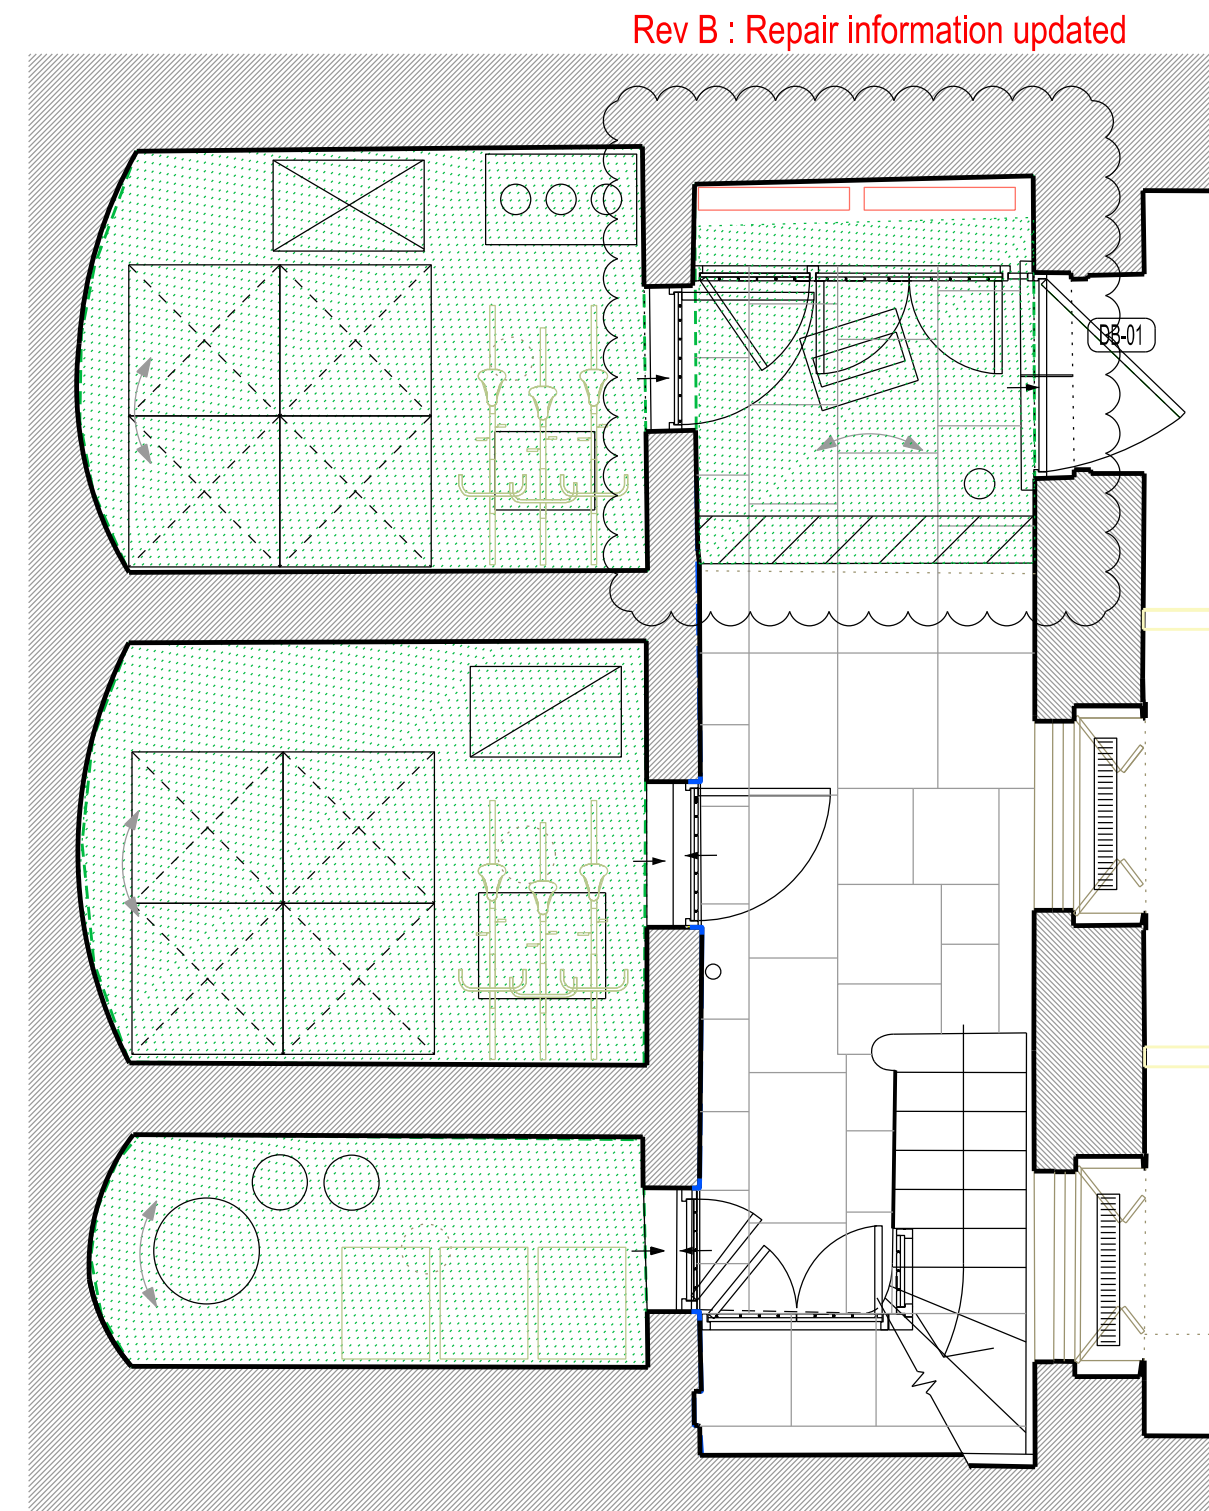

LIGHT WELL PLAN
1:50

Rev B : Repair information updated

- KEY
- NEW LIME RENDER
 - SIKA-1 WATERPROOF RENDERING TO WALLS AND CEILINGS
SIKA-1 SCREED TO FLOORS
 - SIKA RENDER TO BE REPAIRED LOCALLY
 - STAINLESS STEEL ANGLES (306) SCREWED INTO WALL WITH STAINLESS STEEL SCREWS TO SEPARATE SIKA RENDER AND LIME RENDER WITH 5MM GAP INBETWEEN.

Rev B : Repair information updated

- GENERALLY
- A. Cleaning and strip out render in bad condition or cementitious render.
- B. New lime render to light well wall. Use based on non-hydraulic lime putty plus pozzolan mortar.
Application:
Render coat: 1 Mature lime putty, 2.5 well-granded sand, 5kg/m³ hair, PFA TRASS 10%
Floating coat: 1 Mature lime putty, 2.5 well-granded sand, 3kg/m³ hair, PFA TRASS 10%
Finishing coat: 1 Mature lime putty, 2.5 well-granded sand, PFA TRASS 10%
- C. New Sika-1 waterproof rendering to walls and ceilings at vaults.
New Sika-1 screed to floors.



IMAGE 1



IMAGE 2

AS PROPOSED

BUILDING DESIGN PARTNERSHIP LTD SHALL HAVE NO RESPONSIBILITY FOR ANY USE MADE OF THIS DOCUMENT OTHER THAN FOR THAT WHICH IT WAS PREPARED AND ISSUED

ALL DIMENSIONS SHOULD BE CHECKED ON SITE.

DO NOT SCALE FROM THIS DRAWING.

ANY DRAWING ERRORS OR DIVERGENCES SHOULD BE BROUGHT TO THE ATTENTION OF BUILDING DESIGN PARTNERSHIP LTD AT THE ADDRESS SHOWN.

B-LBC APPLICATION	LC	AC	21.05.2020
A-LBC APPLICATION	MN	MB	14.12.2017
-LBC APPLICATION - DRAFT FOR COMMENTS	MN	MB	08.12.2017

REVISION DESCRIPTION	DRAWN	CHECKED	DATE	REVISION DESCRIPTION	DRAWN	CHECKED	DATE	REVISION DESCRIPTION	DRAWN	CHECKED	DATE	KEY PLAN	CLIENT LOGO	PROJECT TITLE	PROJECT NUMBER	DRAWING TITLE	SCALE BAY	DATE	REVISION
														42 BEDFORD SQUARE	P2005698	LIGHT WELL AND VAULTS ELEVATIONS AS PROPOSED	1:20	12.2017	B

BDP.

16 Brewhouse Yard
Clerkenwell
London, EC1V 4LJ
United Kingdom

T +44 (0)20 7812 8000
F +44 (0)20 7812 8399
www.bdp.com

(15)AE103