



section AA

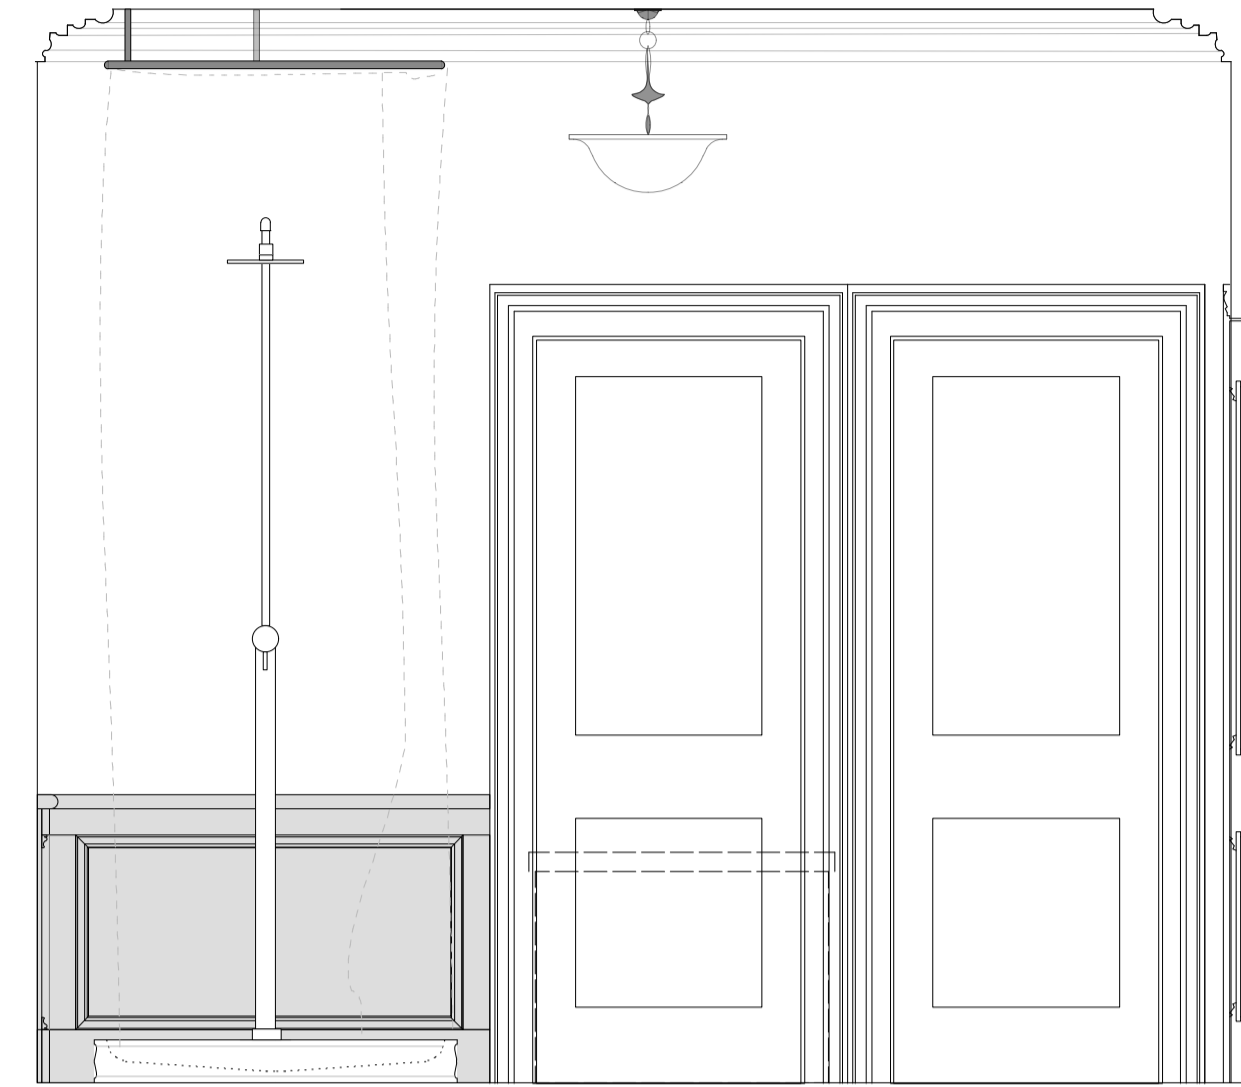

retained cupboard doors redecorated

elevation A

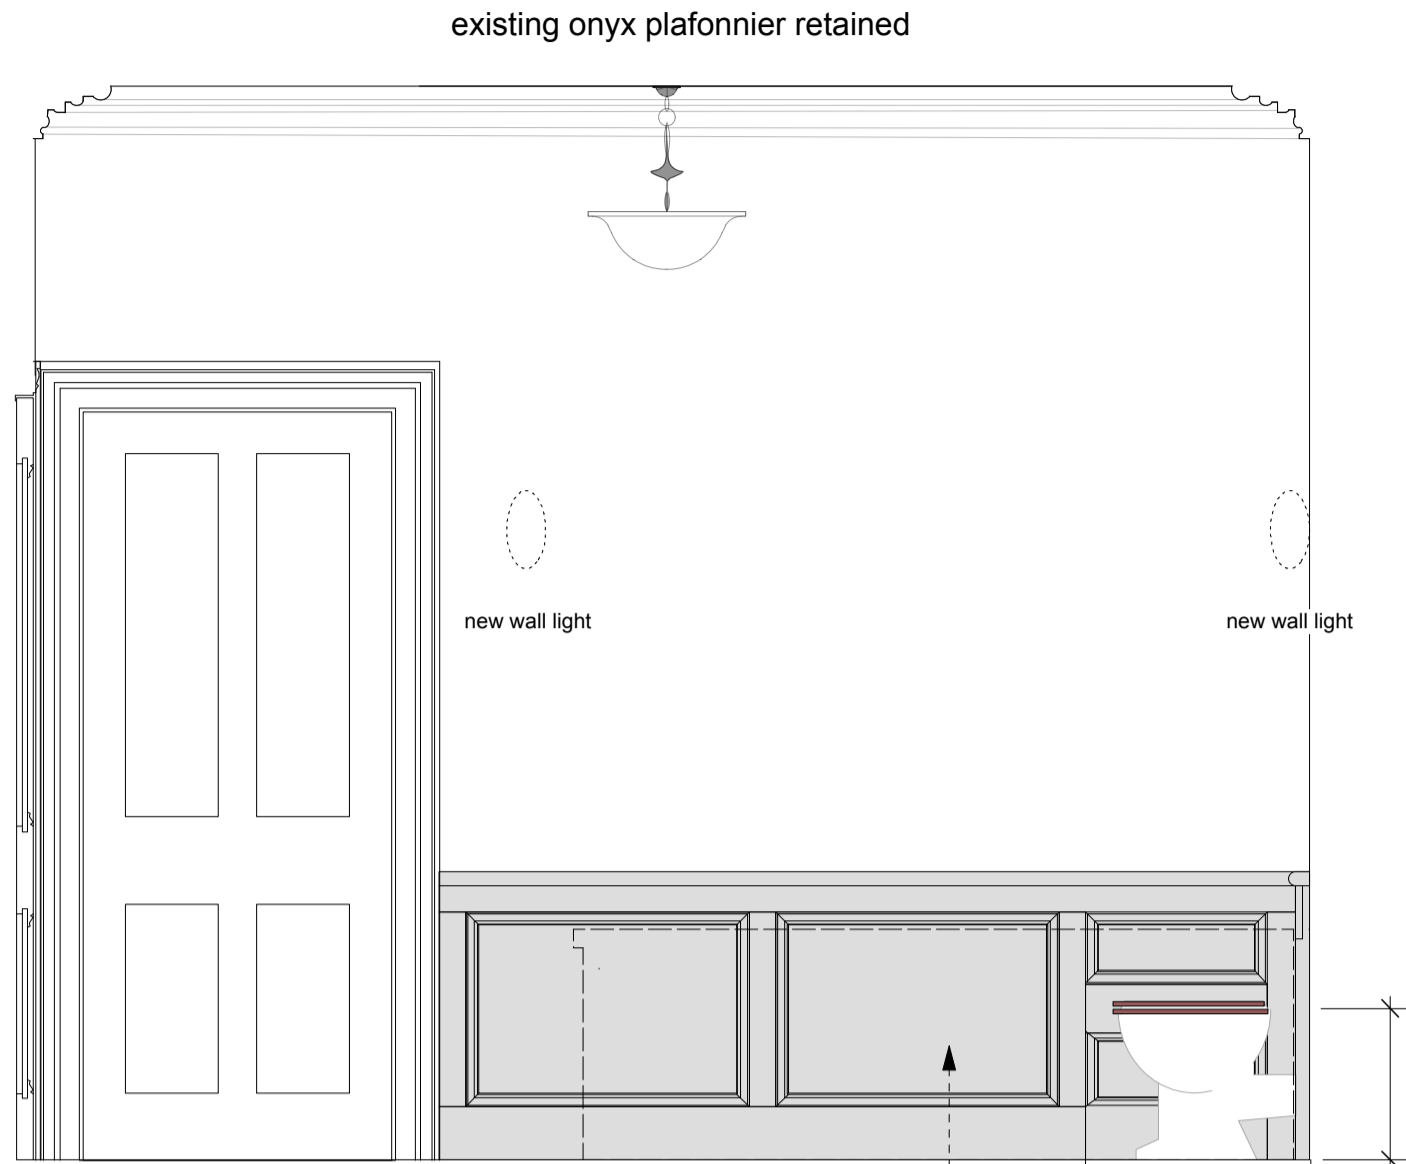


retained door redecorated

existing onyx plafonnier retained

new wall light


new wall light

additional paneling to match panel above

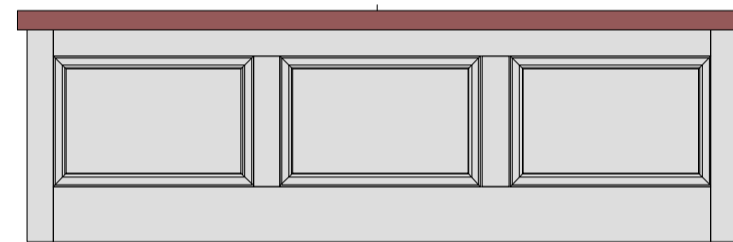

bath side

elevation B

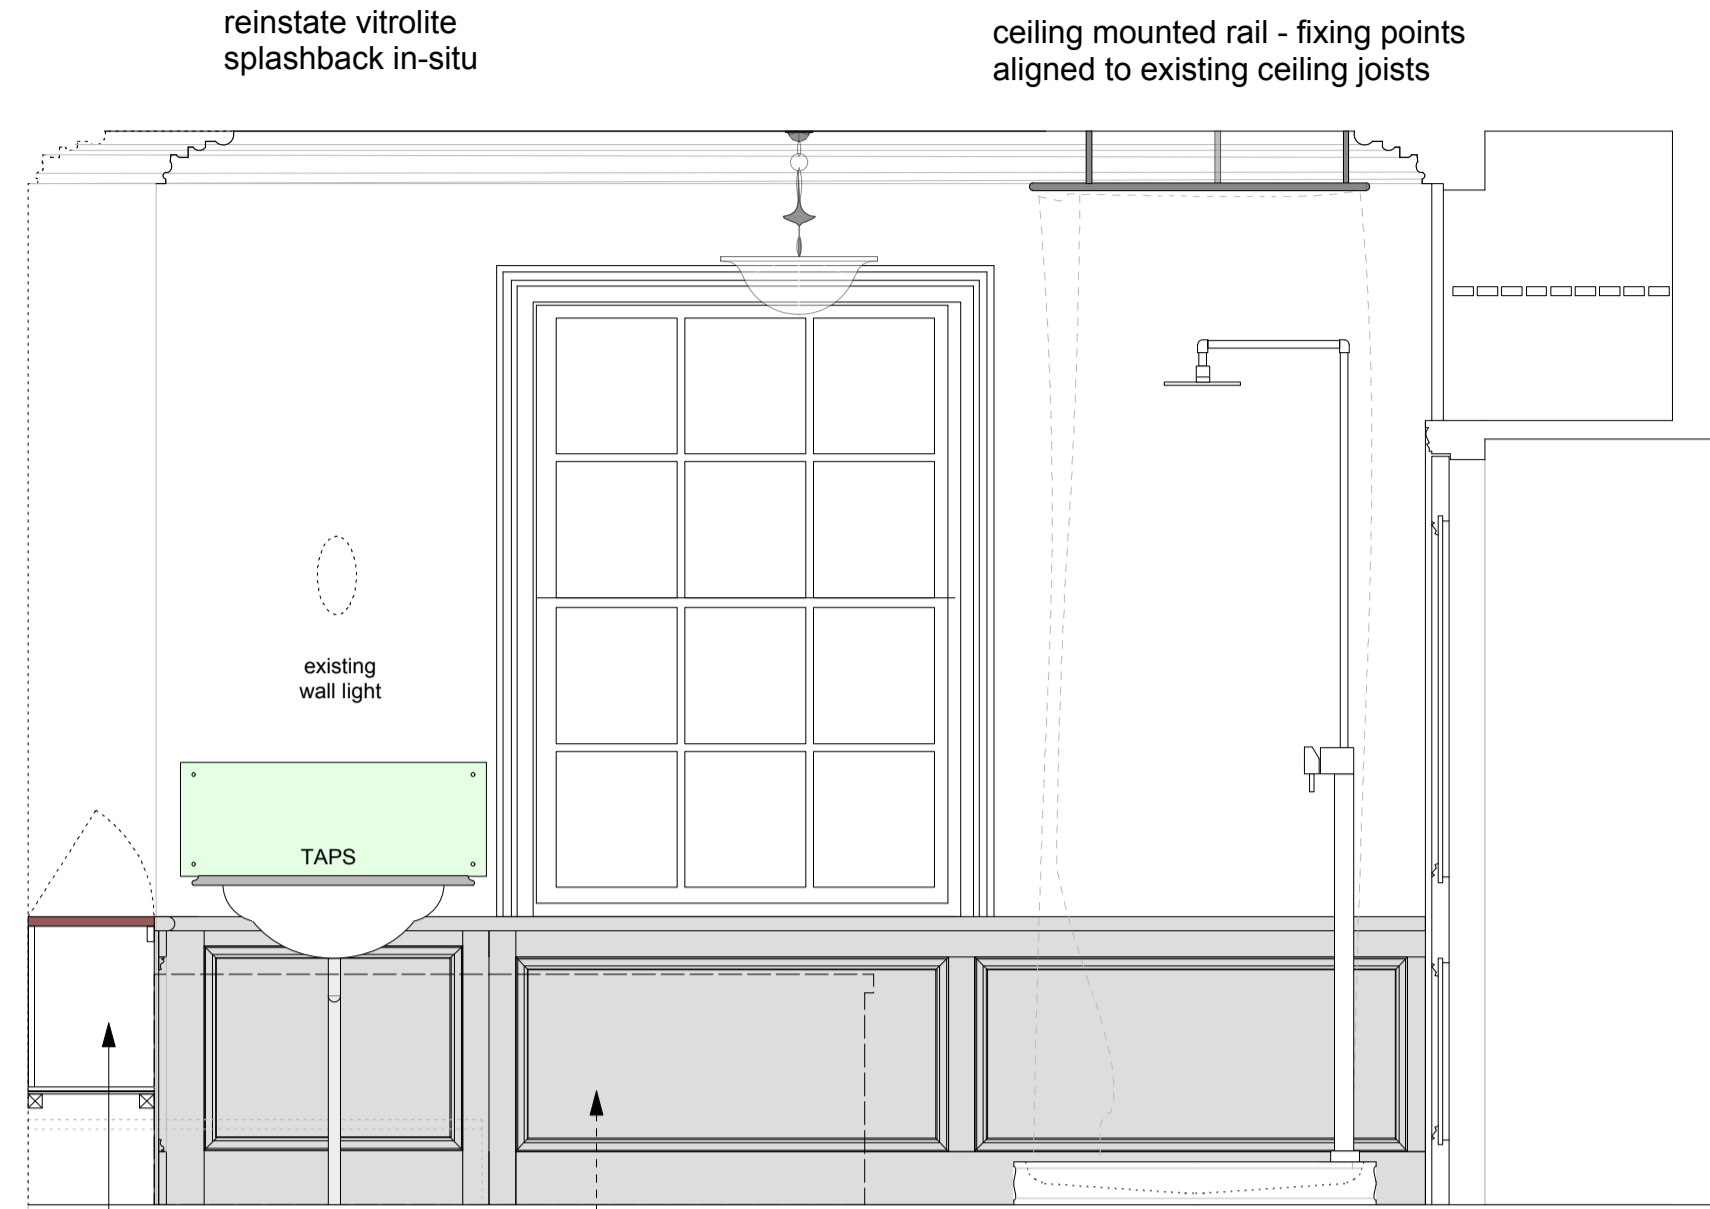

reinstated vitrolite splashback in-situ

ceiling mounted rail - fixing points aligned to existing ceiling joists


existing wall light

TAPS

hinged mahogany shelf for access to storage within dado paneling

relocate existing vanity unit panel to continue existing dado


marble floor standing shower tray and a tray-mounted floor-fed shower unit

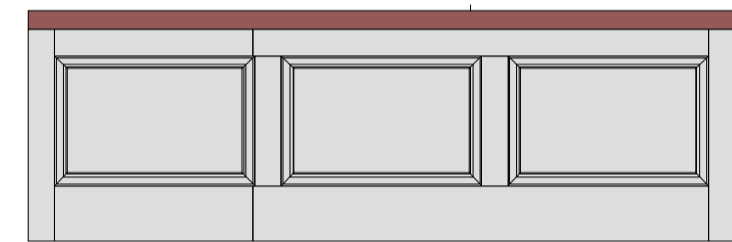

bath side

additional panel to match adjacent

elevation C

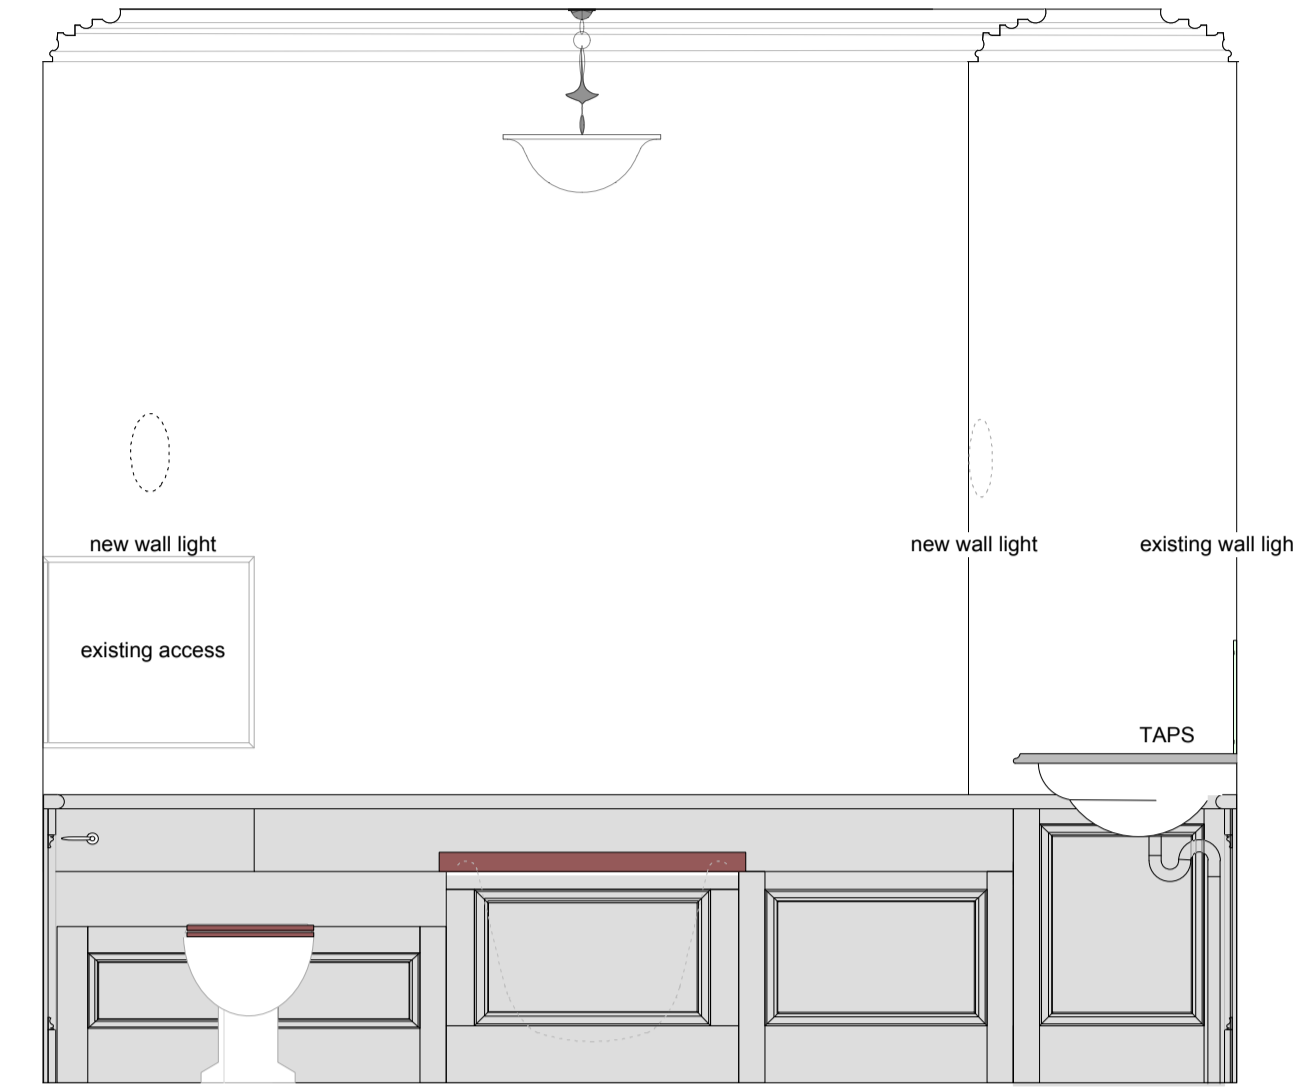

new wall light

existing access

new wall light


existing wall light

TAPS

relocate existing WC facing panel to continue dado

re-make existing bath end panel re-using mouldings replace MDF with ply to match side paneling

relocate existing vanity unit door panel to continue existing dado

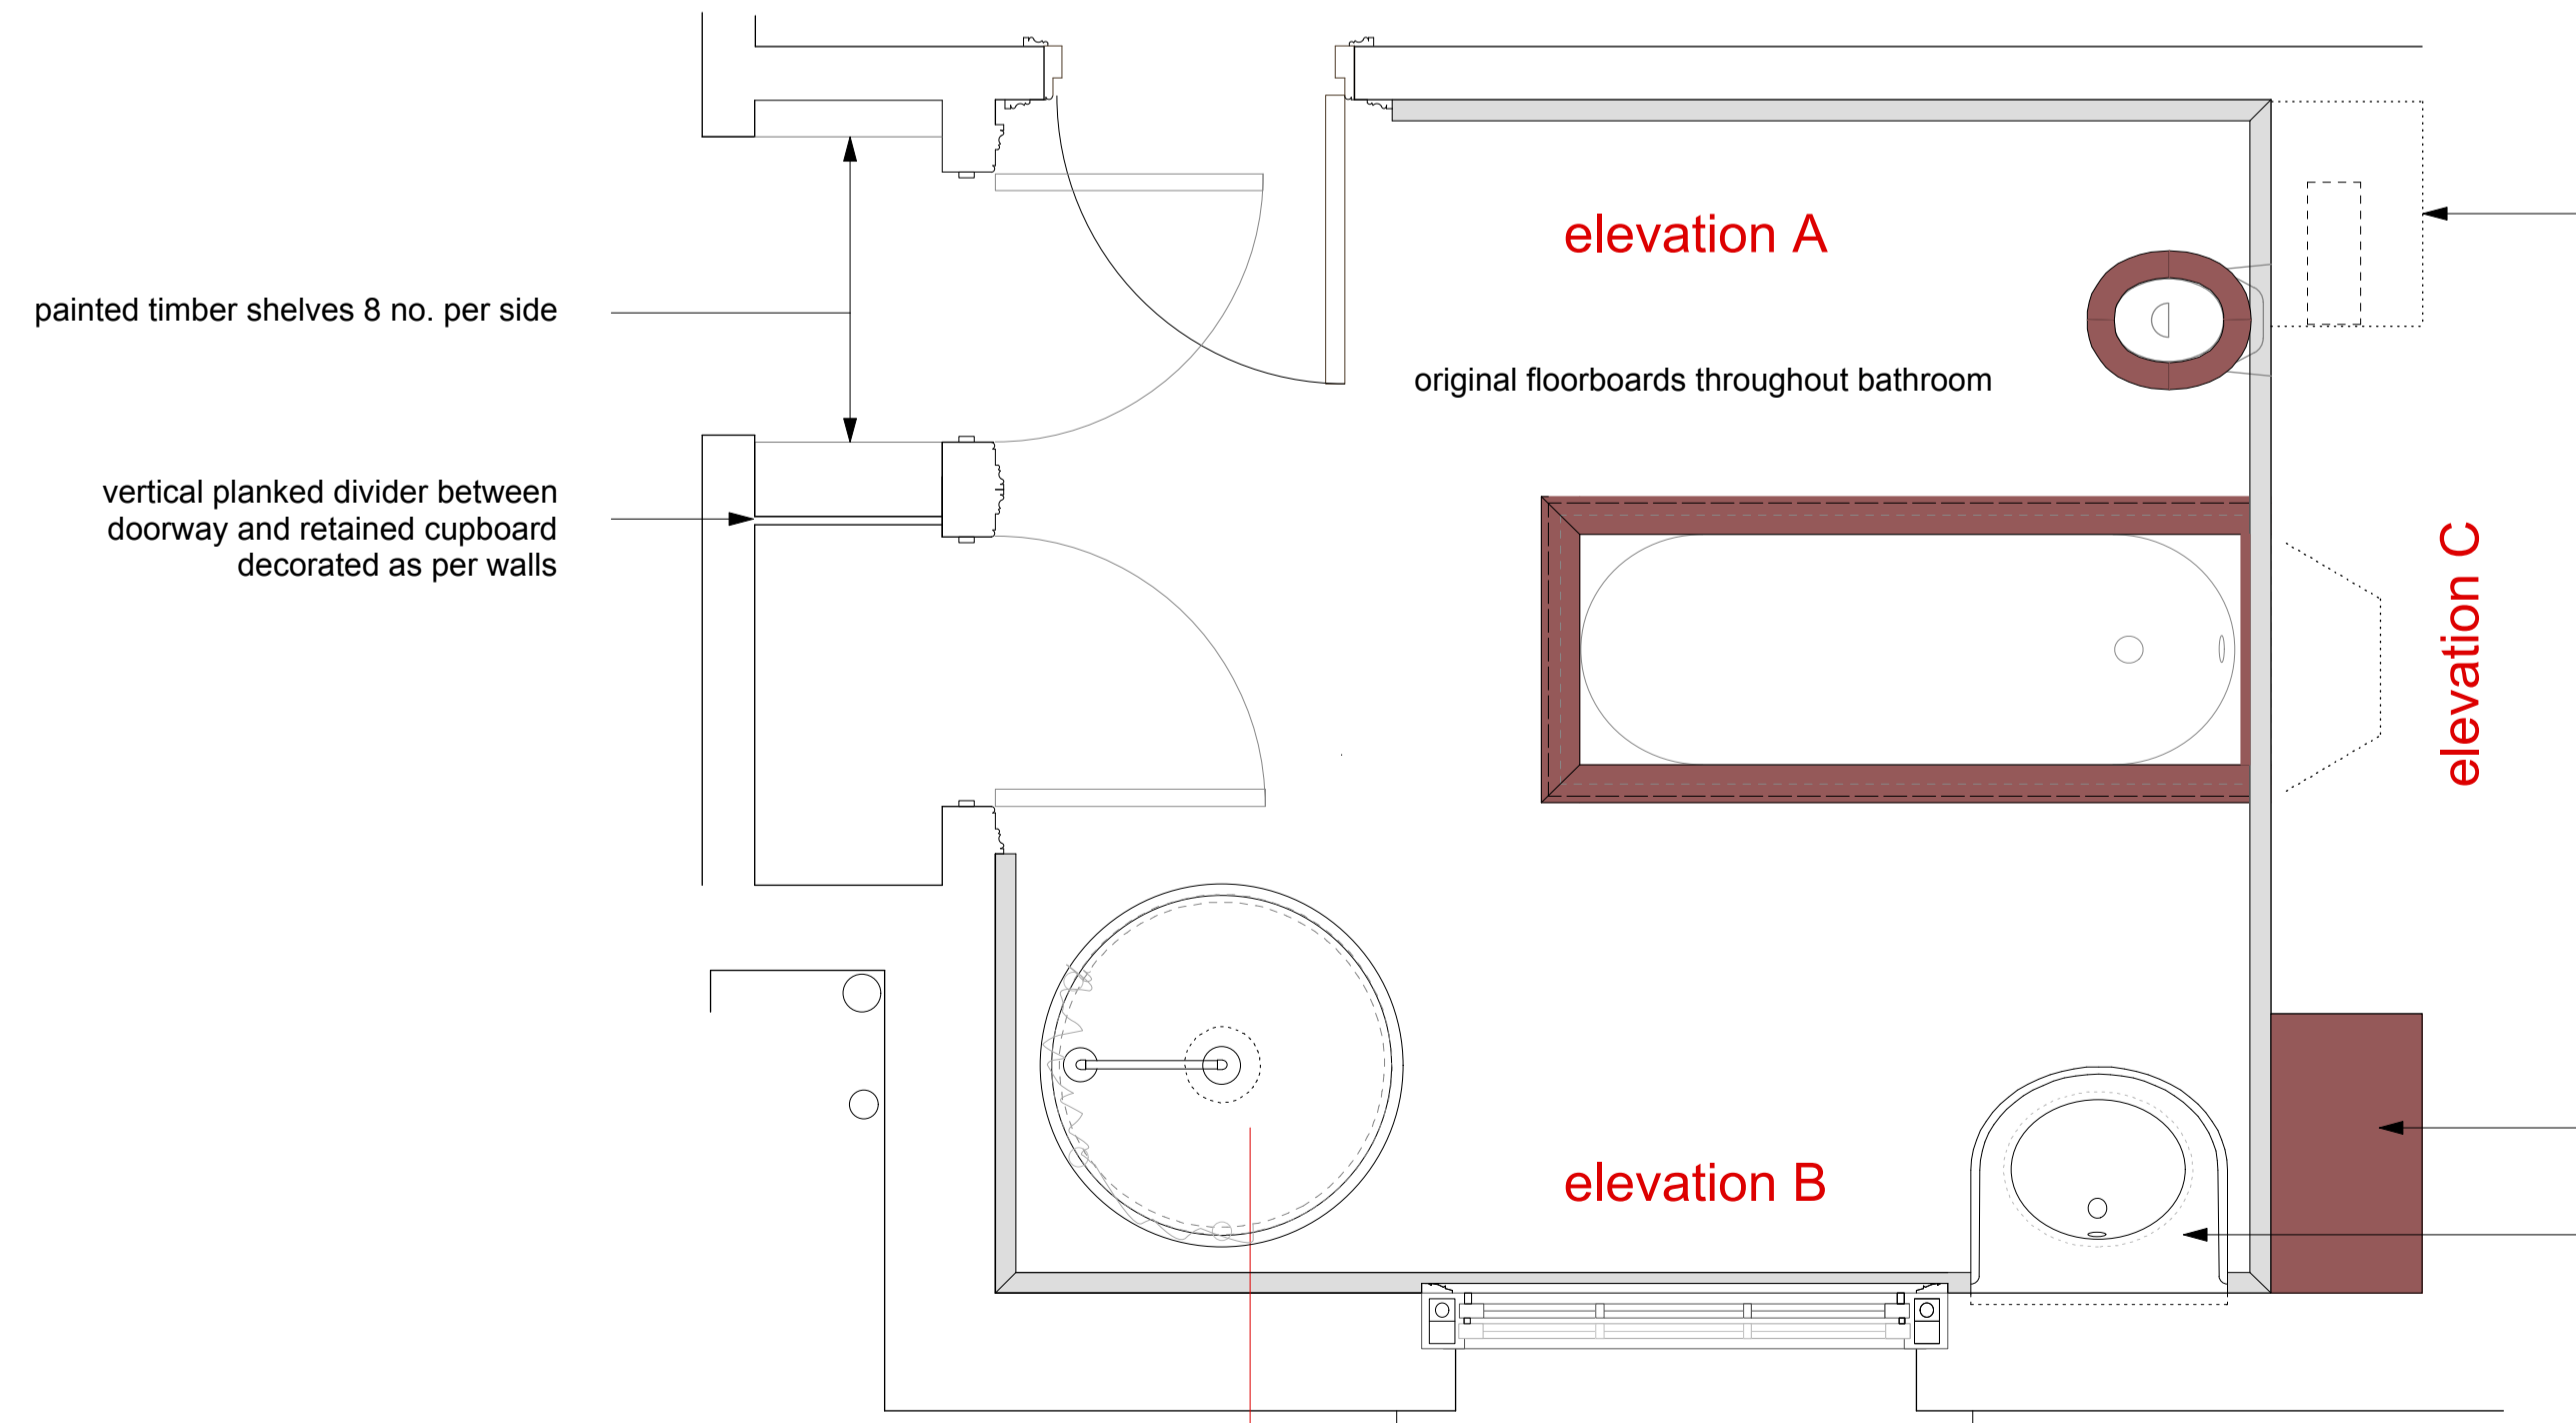

painted timber shelves 8 no. per side

vertical planked divider between doorway and retained cupboard decorated as per walls

elevation A

original floorboards throughout bathroom

elevation C

elevation B

Rockwool firestopping between every floor within riser

hinged mahogany shelf with storage below in original mahogany shelf location

reclaimed Shanks undermount basin re-made marble vanity top in original location, traditional chrome pipes and fittings

AA



illustration of shower components