



Level and Crack Monitoring

Our Ref:



Date of Issue:

26/08/2022

Provider Details



Monitoring Details

Instruction Date:	15/02/2021		
Number of visits	6	Visit Frequency (Wks)	8

Visit Dates (future dates are estimated)

Setup	1	2	3	4	5	6
17/03/21	12/05/21	07/07/21	01/09/21	27/10/21	22/12/21	16/02/22

Client Details

Insurance Co.:	
Client Ref:	
Client Name:	Sedgwick
Technical Mgr:	Gavin Catheline
Customer support	Andrew Peck
Tel:	
Email:	


Risk Address

Occupier:	Removed for data protection purposes
Address:	70 - 75 Auden Place
Address:	
Town:	LONDON
County:	
Post Code:	NW1 8ND
Contact Name	Removed for data protection purposes

Level and Crack Monitoring - Site Sketch

Our Ref: [REDACTED]

Date of Issue: 26/08/2022

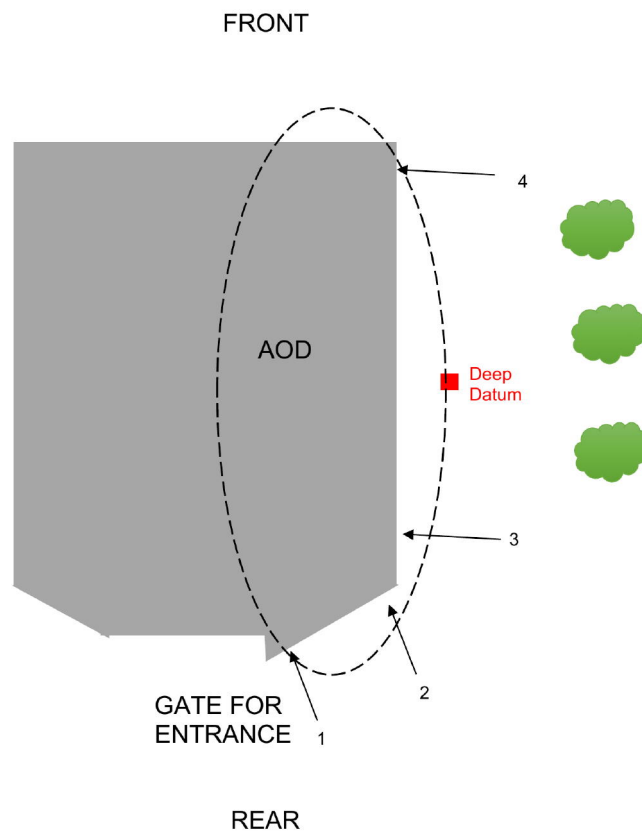



Level Monitoring - Reduced Levels (in metres)

Our Ref:


[REDACTED]

Date of Issue:

26/08/22

Reading Date	17/3/21	18/6/21	11/8/21	27/10/21	18/5/22	6/7/22	26/8/22					
Point / Reading	1	2	3	4	5	6	7	8	9	10	11	12
1	10.8844	10.8824	10.8828	10.8824	10.8827	10.8808	10.8777					
2	10.7960	10.7945	10.7959	10.7961	10.7959	10.7929	10.7815					
3	11.2411	11.2400	11.2408	11.2411	11.2412	11.2365	11.2280					
4	11.3191	11.3171	11.3174	11.3169	11.3175	11.3137	11.3025					
not used												
not used												
not used												
not used												
not used												
not used												
not used												
not used												
not used												
not used												
not used												
not used												
Tech Initials	IH	IH	NU	NU	BA	BA	BA					
Level S/N.	523149	523149	524016	522887	522888	521856	521856					

[illegible]

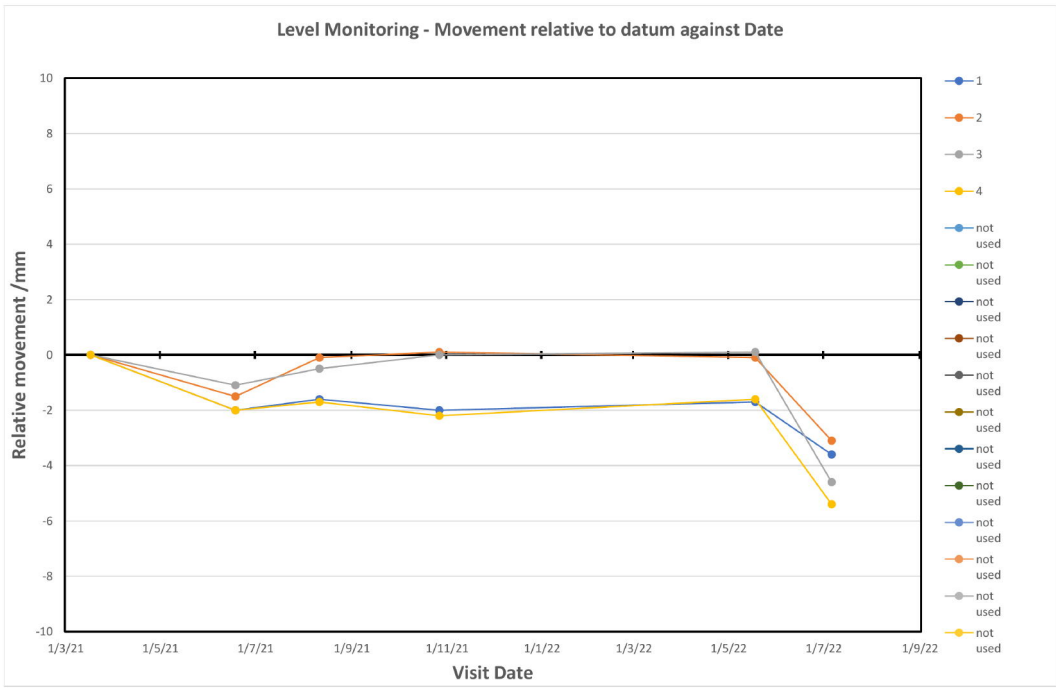

Stud locations

1	EXT rear LH below window
2	EXT rear RH below window
3	EXT front below window
4	
5	
6	

Additional instructions / notes

Crack Monitoring - Readings

Studs nos	Align-ment	Visit Date	17/03/21	Visit Date	18/05/21	Visit Date	11/06/21	Visit Date	27/10/21	Visit Date	18/05/22	Visit Date	06/07/22
		Reading	Current c/w	Reading	Current c/w	Reading	Current c/w	Reading	Current c/w	Reading	Current c/w	Reading	Current c/w
1	H	52.09	1.08	52.16	1.17	52.17	1.15	53.63	1.67	52.14	1.50	52.00	1.55
1	D	91.61	1.82	91.73	1.93	91.65	1.89	92.19	2.45	91.49	2.30	91.45	2.37
1	Check	103.82		103.83		103.85		103.82		103.88		103.94	
2	H	74.73	0.78	74.62	0.85	74.75	HL	75.13	HL	74.36	HL	75.67	2.12
2	D												
2	Check												
3	H	65.58	HL	65.63	HL	65.44	1.05	65.69	1.35	65.63	1.40	64.61	1.20
3	D												
3	Check												
4	H												
4	D												
4	Check												
5	H												
5	D												
5	Check												
6	H												
6	D												
6	Check												
Caliper nos		4549		449		439		449		9171		9171	
Technician		BH		BH		NJ		NJ		BA		BA	



1	EXT rear LH below window
2	EXT rear RH below window
3	EXT front below window
4	
5	
6	

--	--

[illegible]

Crack Monitoring - Movement Against Time

