




1.83 x 2.4m Georgian Woodford Shed-
Layout C with Georgian style windows
on floating concrete base to avoid tree root
disturbance

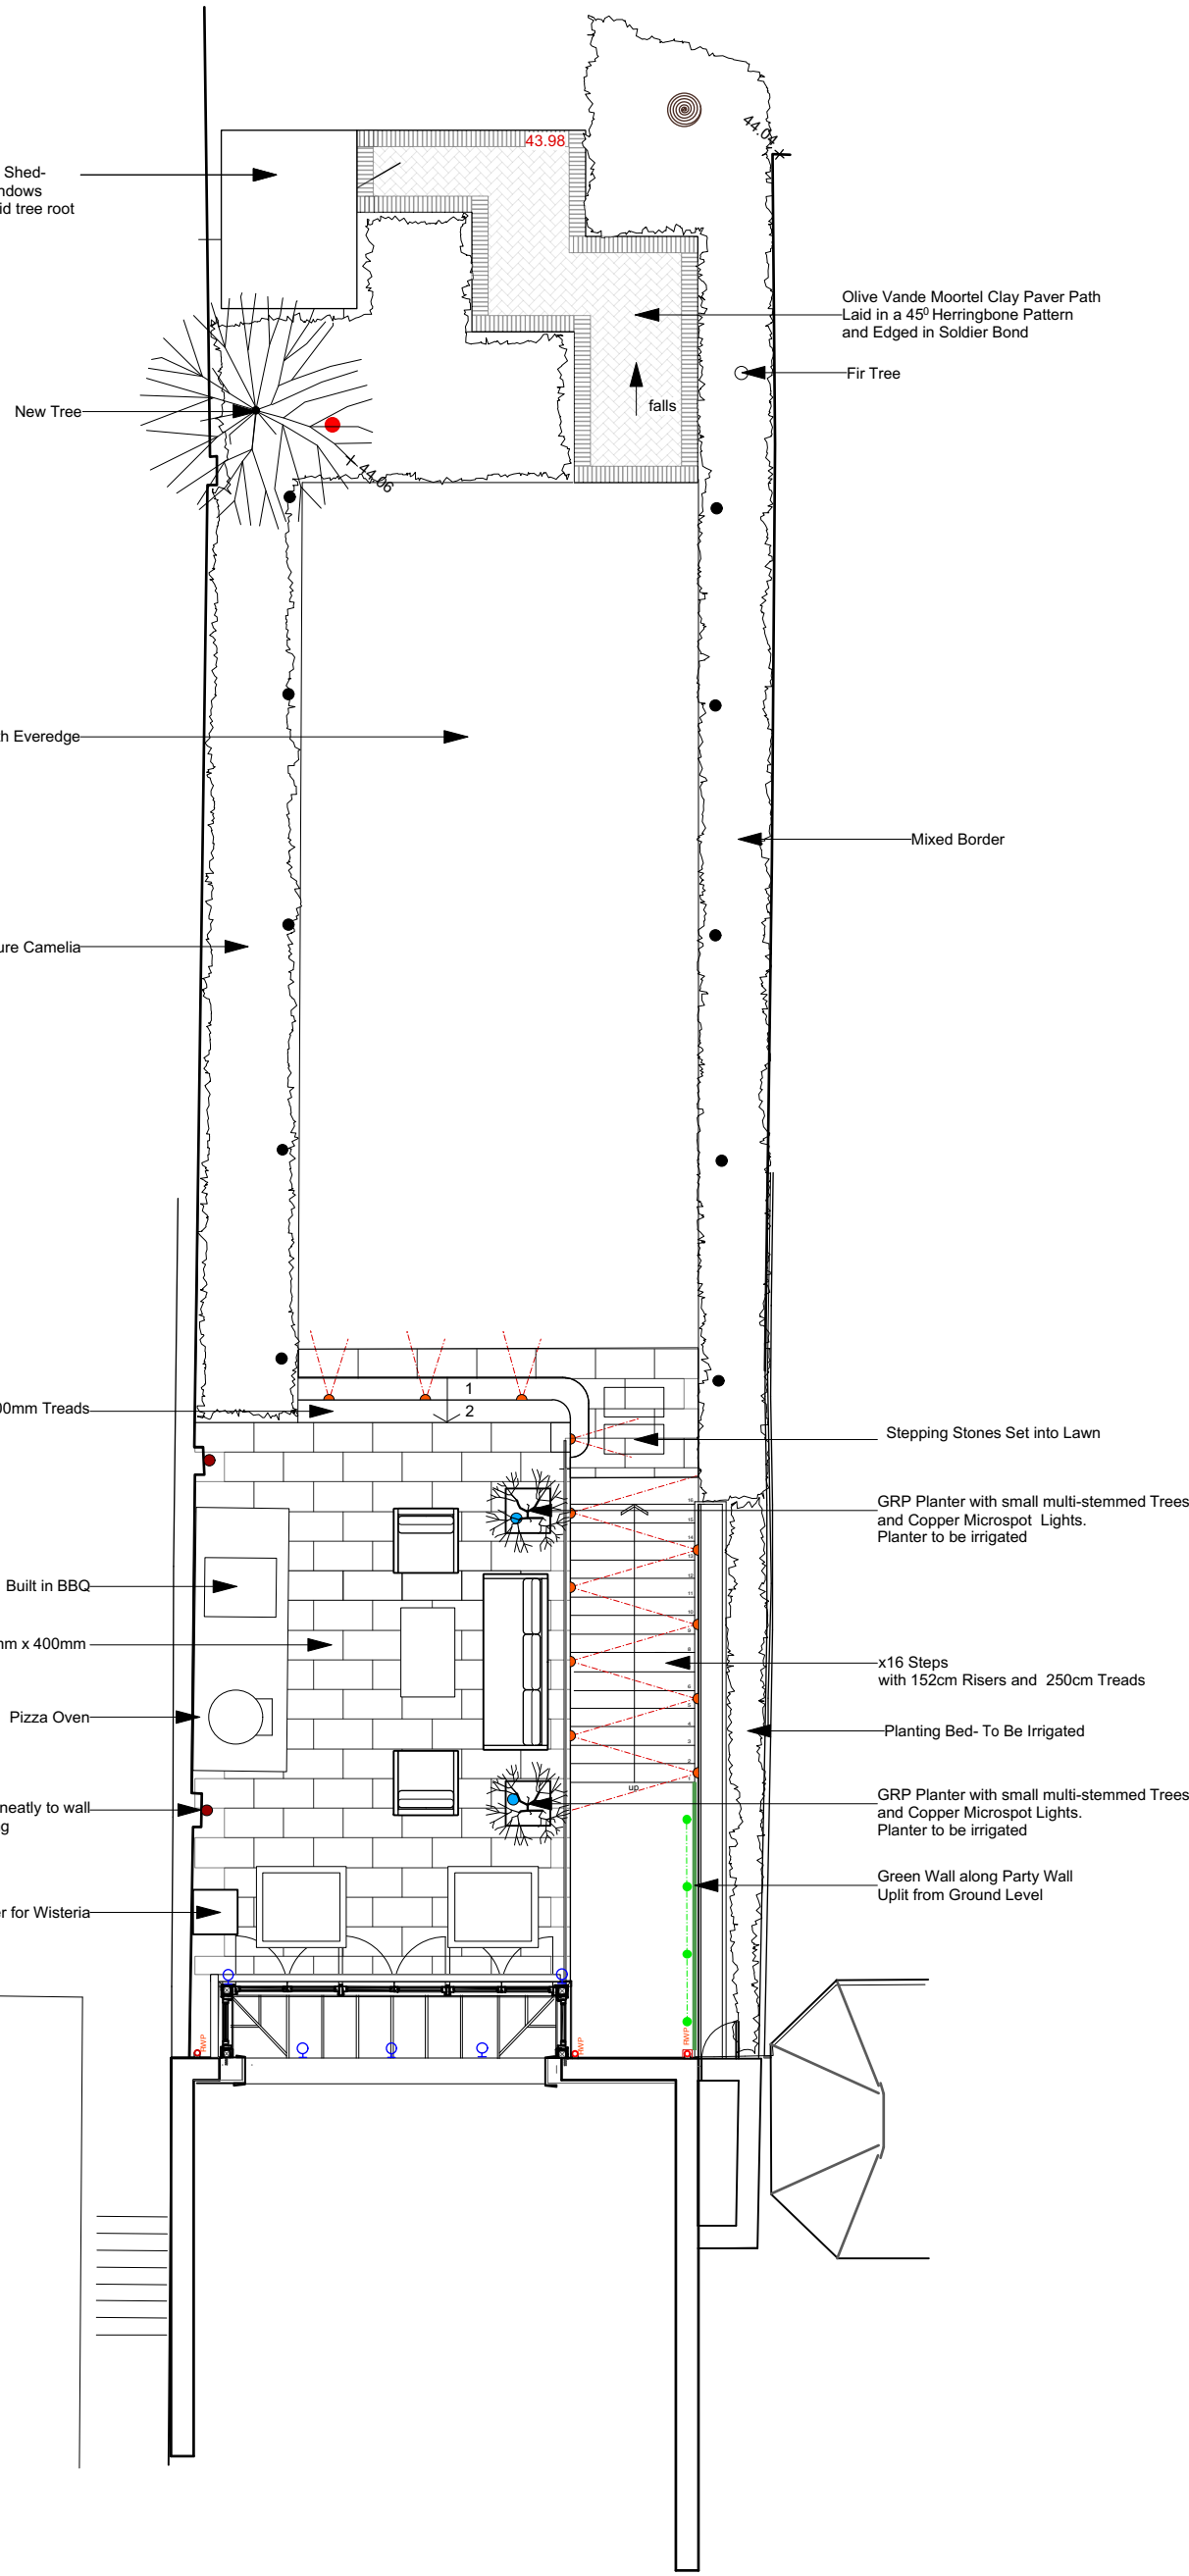

Olive Vande Moortel Clay Paver Path
Laid in a 45° Herringbone Pattern
and Edged in Soldier Bond

Fir Tree

falls

New Tree

Lawn Edged with Everedge

Sunny Shrub Border
including existing mature Camellia

Mixed Border

x2 Paved Steps
with 190mm Risers and 300mm Treads

Stepping Stones Set into Lawn

GRP Planter with small multi-stemmed Trees
and Copper Microspot Lights.
Planter to be irrigated


Built in BBQ

x16 Steps
with 152cm Risers and 250cm Treads

Porcelain Paving -Mandarin Stone - Hendra Creme 800mm x 400mm
laid in a staggered stretcher bond on pedestals

Pizza Oven

Planting Bed- To Be Irrigated

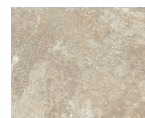

Hendra Creme Porcelain
800mm x 400mm x 20mm

Wires for lighting clipped neatly to wall
or housed in copper piping

GRP Planter with small multi-stemmed Trees
and Copper Microspot Lights.
Planter to be irrigated

Planter for Wisteria

Green Wall along Party Wall
Uplift from Ground Level


Light Fittings

-   4No. Elipta Taurus Spike Spotlight- 12v- Bronze Finished Brass Body- Fitted with 5w lamp- Warm White
-   Light Visuals LV-CU802 Spike Light- Solid Copper
-   Collingwood WL220CWBM27 Copper angled Wall Light 40° beam angle
-   Light Visuals LV-CU602R- Solid Copper Round Eyelid Step Light Centres positioned 400mm above step treads
-   13No. Elipta Compact Spike Spotlight- Black- 12v MR16 Lamps- Warm White. 5w for trees and 3W for flowerbeds
-   LuxR Modux Two Wall Washer in Copper Set into Paving. Distance from wall will be dependant on depth of green wall planting

KEY	
00.00	Proposed Levels
00.00	Existing Levels



Scale @ 1:100

 AMANDA BROUGHTON GARDEN DESIGN Tel: 020 8449 5781 • Mobile: 07899 828370 info@abroughtondesign.com • www.abroughtondesign.com	CLIENT NAME	MR & MRS MC DOUGAL
	JOB TITLE	REAR GARDEN
	TITLE	LANDSCAPING & LIGHTING PLAN
	SCALE	1:100 @ A2
	DATE	20.7.21
	DRAWING NO	3067/R/LAND/2

All Measurements To Be Checked On Site by Contractors Prior to Construction