



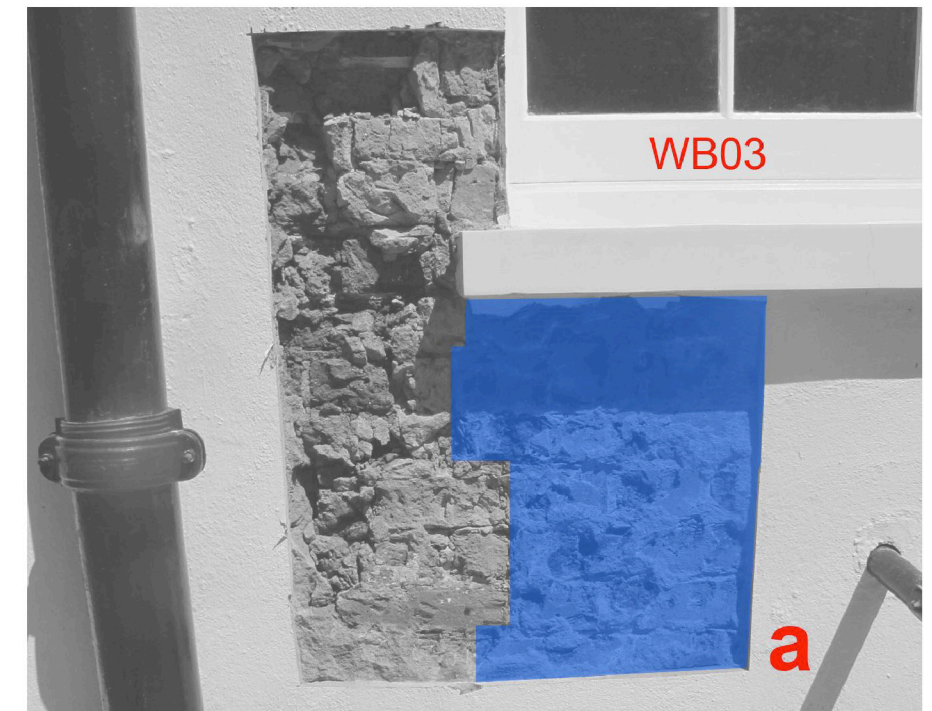

02. HISTORIC FABRIC OPENING UP AT WINDOW W B 0 3

Inspection area **c** and **d** reveals the original soldier arch above window **WB03** and original brick apron below. This confirms that there was no original door opening as found under **WB04** despite the **1936 Town Plans 1:1056 (2686) 4th Edition** surveying an external closet extension in this location. The original masonry fabric revealed in these areas together with the **WB04** area suggests the original brickwork was exposed, although now significantly damaged by the 20th Cen. Portland cement render coat to repair and leave exposed.

Inspection area **b1**, **b2** and **b3** reveals the 20th Cen. construction of the external terrace seating in concrete blockwork and Portland Cement render finish.

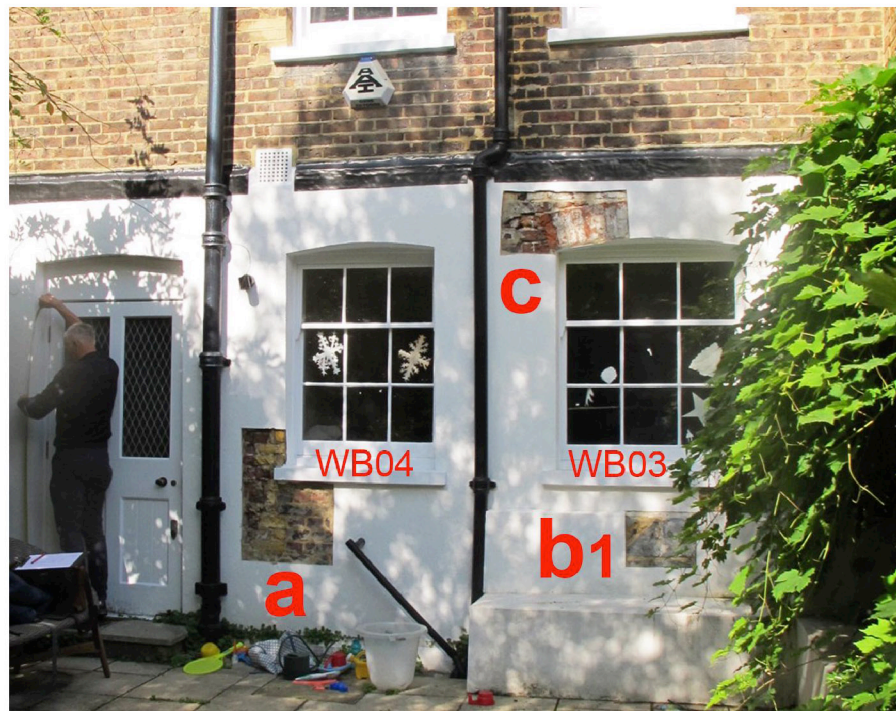

01. HISTORIC FABRIC OPENING UP AT WINDOW W B 0 4

Inspection area **a** below window **WB04** revealed evidence of an original door opening with the current brickwork apron highlighted in blue (far right image) likely to be 19th century alteration with the original brick to the left of the London Stock brick reveals the original structural opening. A closet extension in this location is recorded on the **1871 Publication / Town Plans 1:1056 (2686) - 1st Edition** as well as on drainage drawings submitted for planning approval in 1938 (ref: E6/1128/137054)