

W.03.13

NOTES :

Modern casement
Post condition
Studwall cuts across

1920s sash with horns. Historic modest panel behind radiator reflecting floor hierarchy. Medium to high significance.



W.02.16

NOTES :

Weighted sash
6 panel sashes
Shutter box non functioning
Concealed radiator below
OK condition
Manually operated blinds

Original window much painted over and repaired shutter boxes. No horns. Panelling below good architrave. Reasonable condition but much repair on LHS and RHS with definition lost. Highest Significance.




W.01.15

NOTES :

Weighted sash
6 over 9 panel sashes
Painted shutters
Manually operated blinds
Pipework through panels

FURTHER INSPECTION REQUIRED
Painted over shutters LH and RH sides that have lost definition through repair and overpainting. Highest significance.

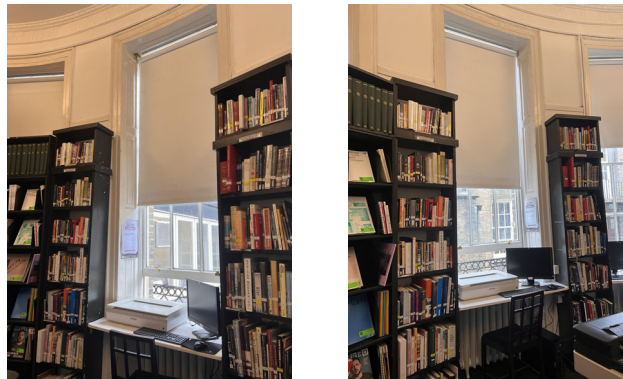

W.00.12

NOTES :



Weighted sash
6 panel sashes
OK condition
Manually operated blinds

Good quality historic window shutters painted shut with no lining below. New panel to side below cill with pipe fitting. High significance despite later alteration. Good glazing bars and probably original sashes. Highest significance.



W.B1.11

NOTES :

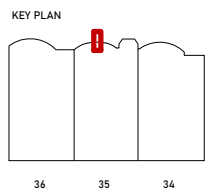

Rev	Date	Description	Author	Checker

Scale at A1 / A3

1:25 / 1:50



Drawing Name
Existing Internal Elevations Window Stack 16

Drawing Number Revision
BW125 - BW - ## - XX - DR - E3016

E - RL Mid
14460 mm

E - 03
12130 mm

E - 02
8810 mm

E - 01
4110 mm

E - 00a
0 mm

E - B1
-3190 mm

