

**W.03.18**

NOTES :

Modern casement  
Post condition  
Manually operated blinds  
3 panel sashes

1920s sash with horns. Historic  
modest panel behind radiator  
reflecting floor hierarchy.  
Medium to high significance.  
Bay rebuilt 1926.



**W.02.20**

NOTES :

Weighted sash  
6 panel sashes  
Shutter box non functioning  
OK condition  
Manually operated blinds

Rear bay rebuilt 1926 - 1926  
windows and shutter boxes  
matching rear bay on other  
levels.  
Low to medium significance.



**W.01.19**

NOTES :

Weighted sash  
6 over 9 panel sashes  
Painted shutters  
Manually operated blinds shut  
Pipework through panels

No shutters present only single panels  
with modest details.  
Likely to be 1920s fabric introduced after  
rear bay reconstructed. Windows with  
horns in a 1920s style.  
Medium significance.



**W.00.16**



NOTES :

No shutters present only single  
panels with modest details.  
Likely to be 1920s fabric  
introduced after rear bay  
reconstructed. Windows with  
horns in a 1920s style.  
Medium significance.



NOTES :

No windows

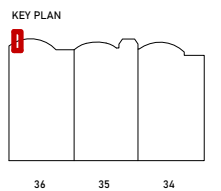

Rev	Date	Description	Author	Checker

Scale at A1 / A3

1:25 / 1:50



Drawing Name  
**Existing Internal Elevations  
Window Stack 21**

Drawing Number Revision  
**BW125 - BW - ## - XX - DR - E3021**

