



## VERTICAL CRACK REPAIR DETAIL (TYPICAL)

1:10

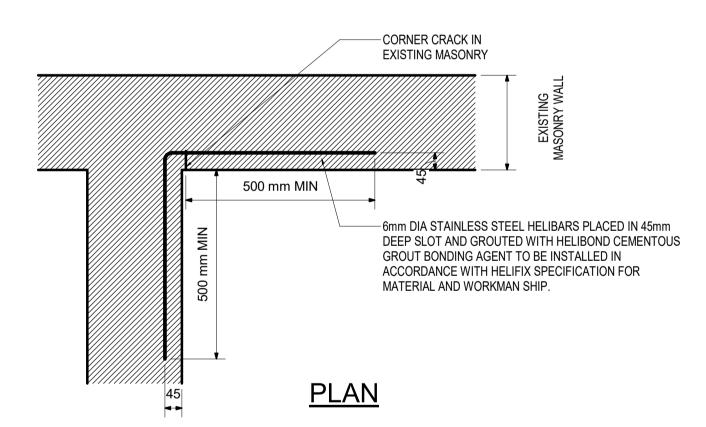


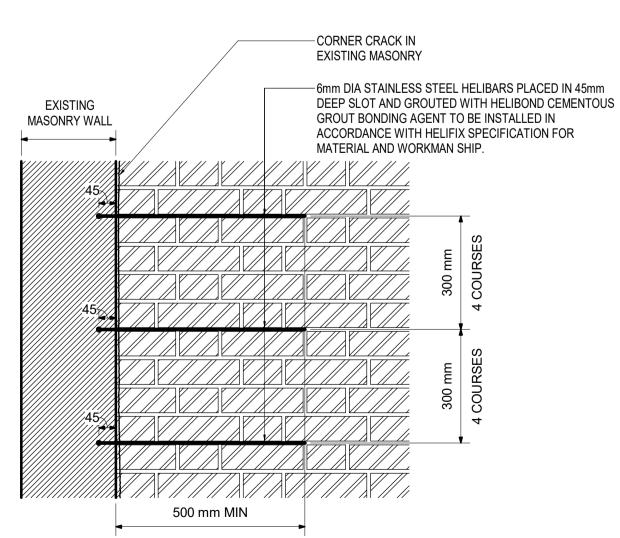


**ELEVATION** 

CORNER CRACK REPAIR DETAIL (TYPICAL)


-CRACK IN EXISTING MASONRY 6mm DIA STAINLESS STEEL HELIBARS PLACED IN 45mm DEEP SLOT AND GROUTED WITH HELIBOND CEMENTOUS GROUT BONDING AGENT TO BE INSTALLED IN ACCORDANCE WITH HELIFIX SPECIFICATION FOR MATERIAL AND WORKMAN SHIP. 500 mm MIN 500 mm MIN <u>PLAN</u>

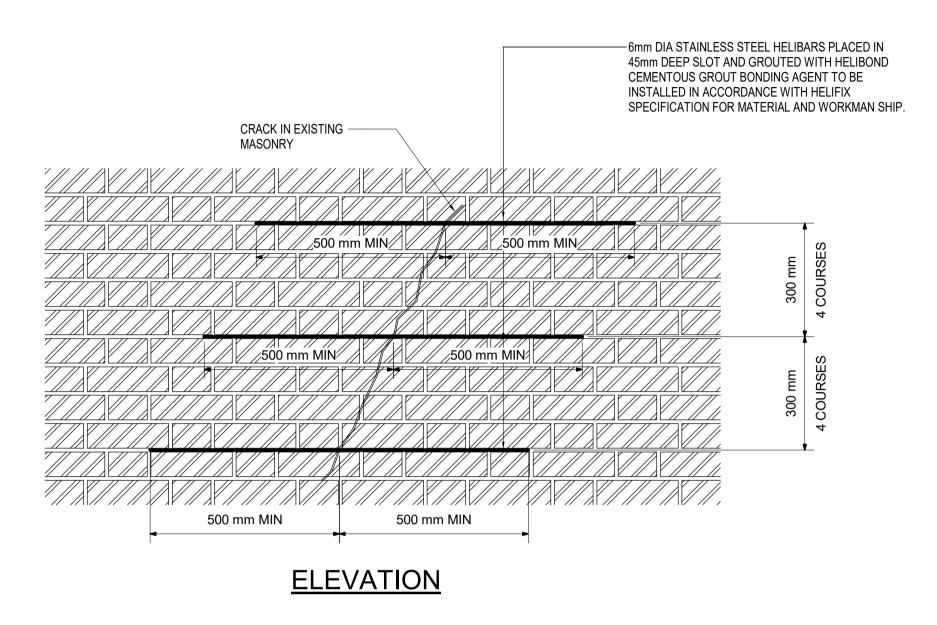

DIAGONAL CRACK REPAIR DETAIL (TYPICAL)

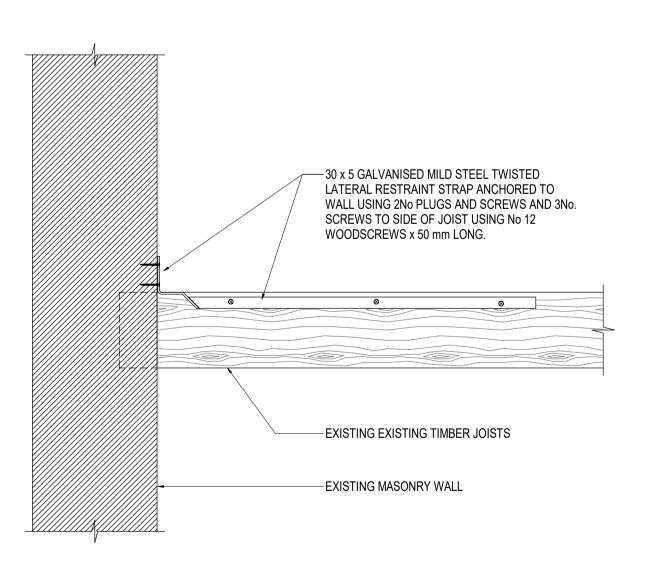

RESTRAINT TO EXISTING WALL PARALLEL TO JOISTS

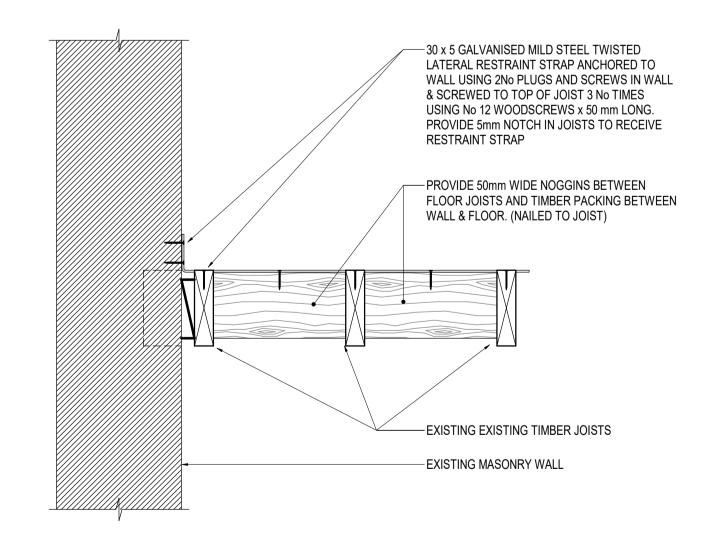

RESTRAINT TO EXISTING WALL PERPENDICULAR TO JOISTS

100 0 100 200 300 400 500 

## DISCLAIMER NOTES:


- THIS DOCUMENT IS COPYRIGHT OF THE ORIGINATOR AND MUST BE TREATED AS CONFIDENTIAL
- THIS DOCUMENT MUST NOT BE ALTERED, REPRODUCED OR DISTRIBUTED WITHOUT PRIOR WRITTEN CONSENT OF THE ORIGINATOR
  - THIS DOCUMENT MUST NOT BE ALTERED THE ORIGINATOR ACCEPTS NO RESPONSIBILITY FOR ANY DISCREPANCIES ARISING AS A RESULT OF THE ORIGINATORS
  - INFORMATION BEING ALTERED BY OTHERS ANY DISCREPANCY MUST BE REPORTED TO THE ORIGINATOR
  - DO NOT SCALE THIS DOCUMENT USE FIGURED DIMENSIONS ONLY
  - ALL DIMENSIONS MUST BE CHECKED ON SITE PRIOR TO COMMENCEMENT OF ANY RELATED WORKS
  - THIS DOCUMENT MUST BE READ IN CONJUNCTION WITH ALL SUPPORTING DOCUMENTS PRODUCED BY THE ORIGINATOR AND OTHER PROJECT DISCIPLINES
  - THE ORIGINATOR ACCEPTS NO RESPONSIBILITY FOR THE ACCURACY OF BACKGROUND INFORMATION PRODUCED BY THIRD PARTIES - THIS MUST BE TREATED AS INDICATIVE
  - USERS OF THIS DOCUMENT ARE RESPONSIBLE FOR CHECKING WHICH REVISION IS CURRENT
  - THE DOCUMENT STATUS "INFORMATION" OR "PRELIMINARY", INDICATES THAT THIS DRAWING IS FOR REFERENCE PURPOSES ONLY - THE ORIGINATOR WILL ACCEPT NO RESPONSIBILITY FOR THE COMPLETENESS OF INFORMATION UNDER THIS STATUS
  - THE DOCUMENT STATUS "RECORD" OR "AS BUILT" HAS BEEN PREPARED. IN PART. BASED UPON INFORMATION FURNISHED BY OTHERS. WHILE THIS INFORMATION IS BELIEVED TO BE RELIABLE, THE ORIGINATOR ASSUMES NO RESPONSIBILITY FOR THE ACCURACY OF THIS "RECORD" OR "AS BUILT" DOCUMENT OR FOR ANY ERRORS OR OMISSIONS THAT MAY HAVE BEEN INCORPORATED INTO IT AS A RESULT OF INCORRECT INFORMATION PROVIDED TO THE ORIGINATOR. THOSE RELYING ON THE "RECORD" OR "AS BUILT" DOCUMENT ARE ADVISED TO OBTAIN INDEPENDENT VERIFICATION OF ITS

## DRAWING NOTES:

**ACCURACY** 

SIGNIFICANT OR NON-OBVIOUS RISKS AND RISKS WHICH ARE DIFFICULT TO IDENTIFIED TO THE RIGHT WITH BRIEF ACCOMPANYING TEXT. FOR FURTHER

DETAILS OF THE PICKS IDENTIFIED BY ACCOMPANYING TEXT. DETAILS OF THE RISKS IDENTIFIED BY DESIGNERS, REFERENCE SHOULD BE MADE TO CDM HAZARD REGISTER.

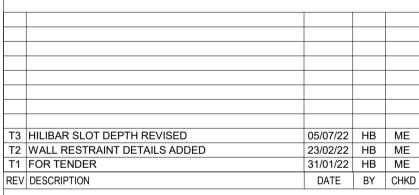

ORIGINATOR:



3 VALENTINE PLACE LONDON SE1 8QH

TEL: 020 7593 3400

WWW.RIDGE.CO.UK

LONDON BOROUGH OF CAMDEN

IN ASSOCIATION WITH: **JGPS** 

2 & 3 CHARRINGTON STREET LONDON NW1 1RS

CRACK REPAIR DETAILS IN MASONRY WALL

DRAWN BY: SCALE: 1:10 @ A1

PROPOSED DWG FOR TENDER

DATE:

18/01/22

CHECKED BY:

PROJECT: ORG: ZONE: LEVEL: TYPE: ROLE: NUMBER: REV: |5015544 | RDG | XX | XX | DT | S | 0201 | T3