



**Key**

- Existing Fabric - Unknown dimensions and composition
- Plot 1 Works
- Proposed
- Approximate location of existing fabric based on SES point cloud survey. Exact location to be determined on site.

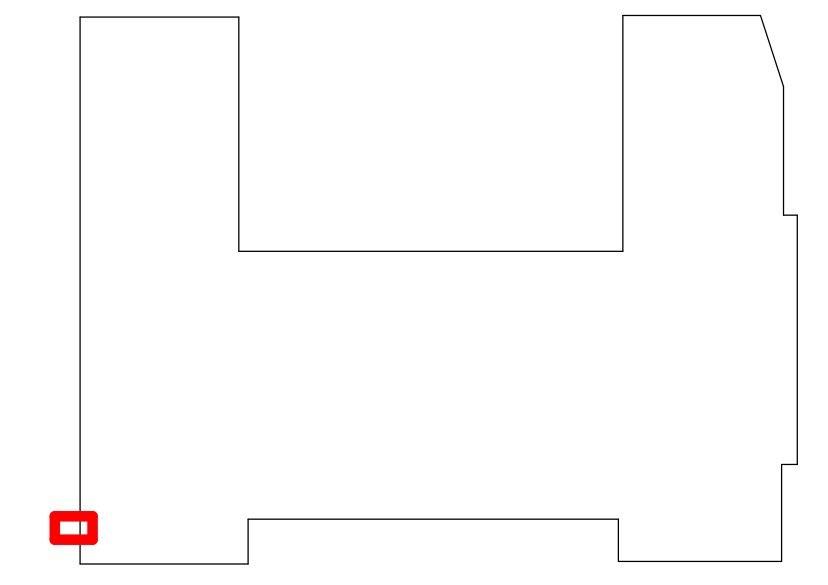


**Level 00 - External Detail Location**  
1 : 500

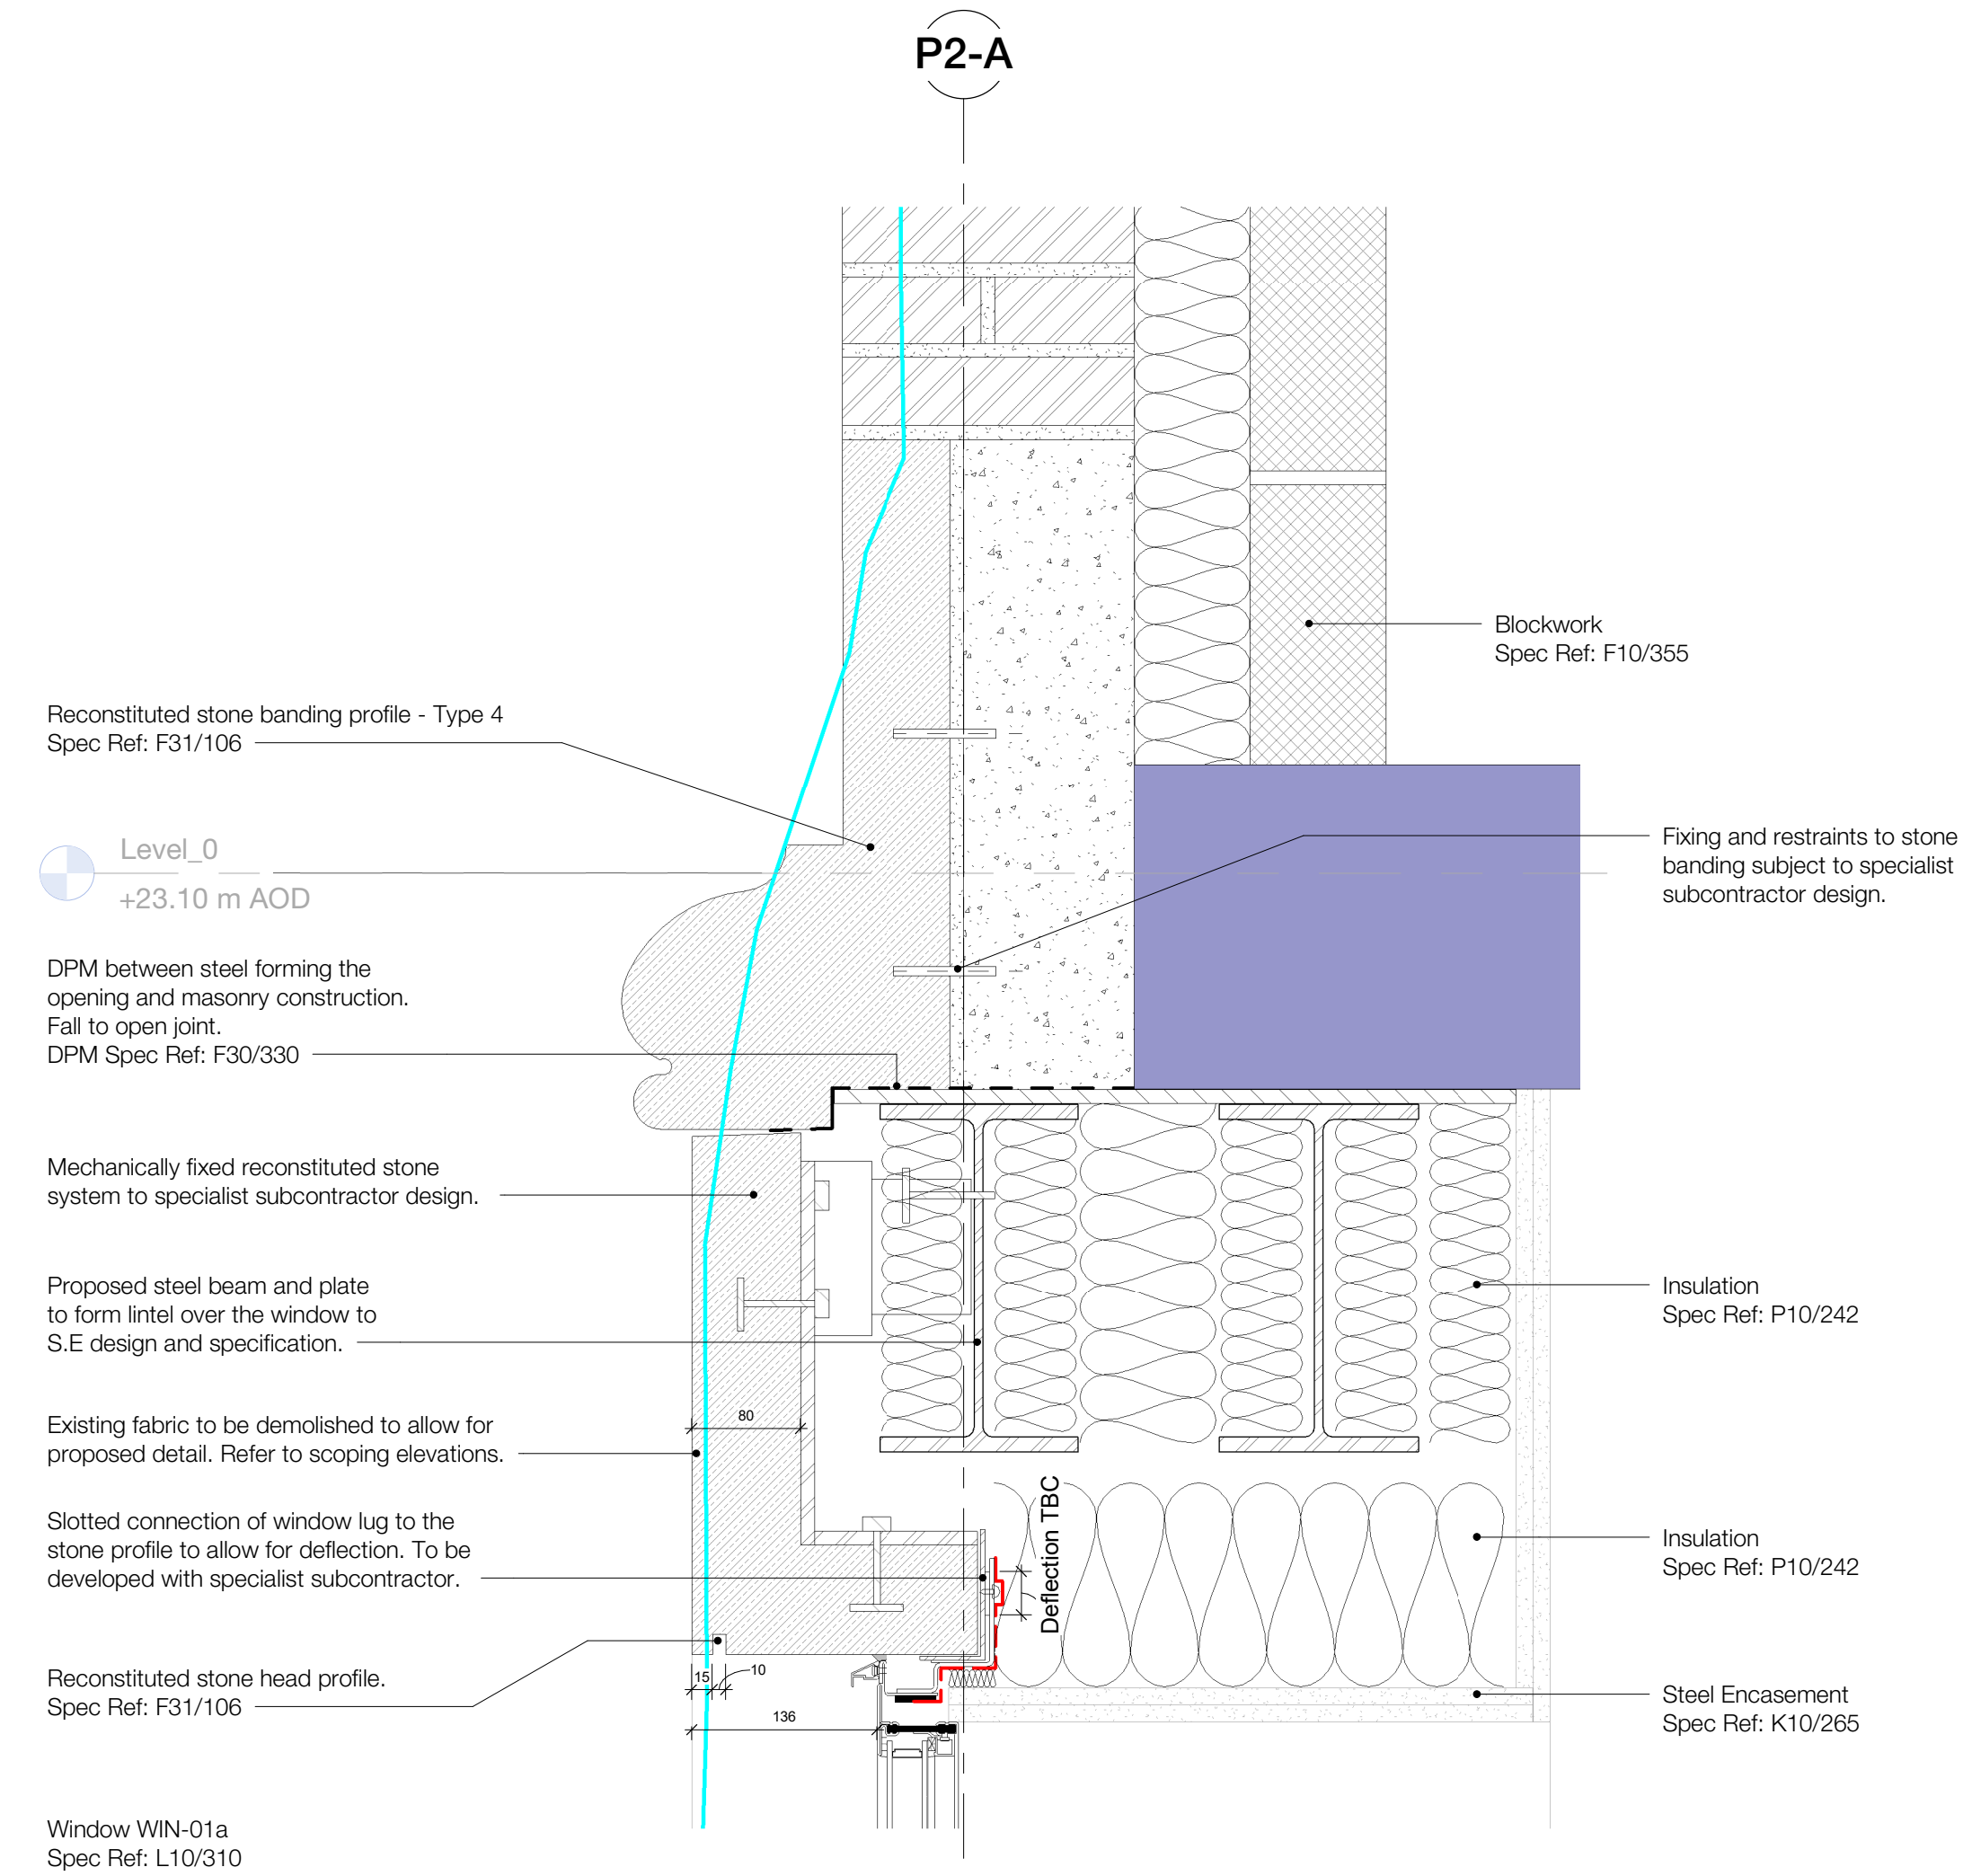


**1**  
1 : 5

**New Opening / Typical fixed window head in stone overlaid (stringcourse band - Type 4)**

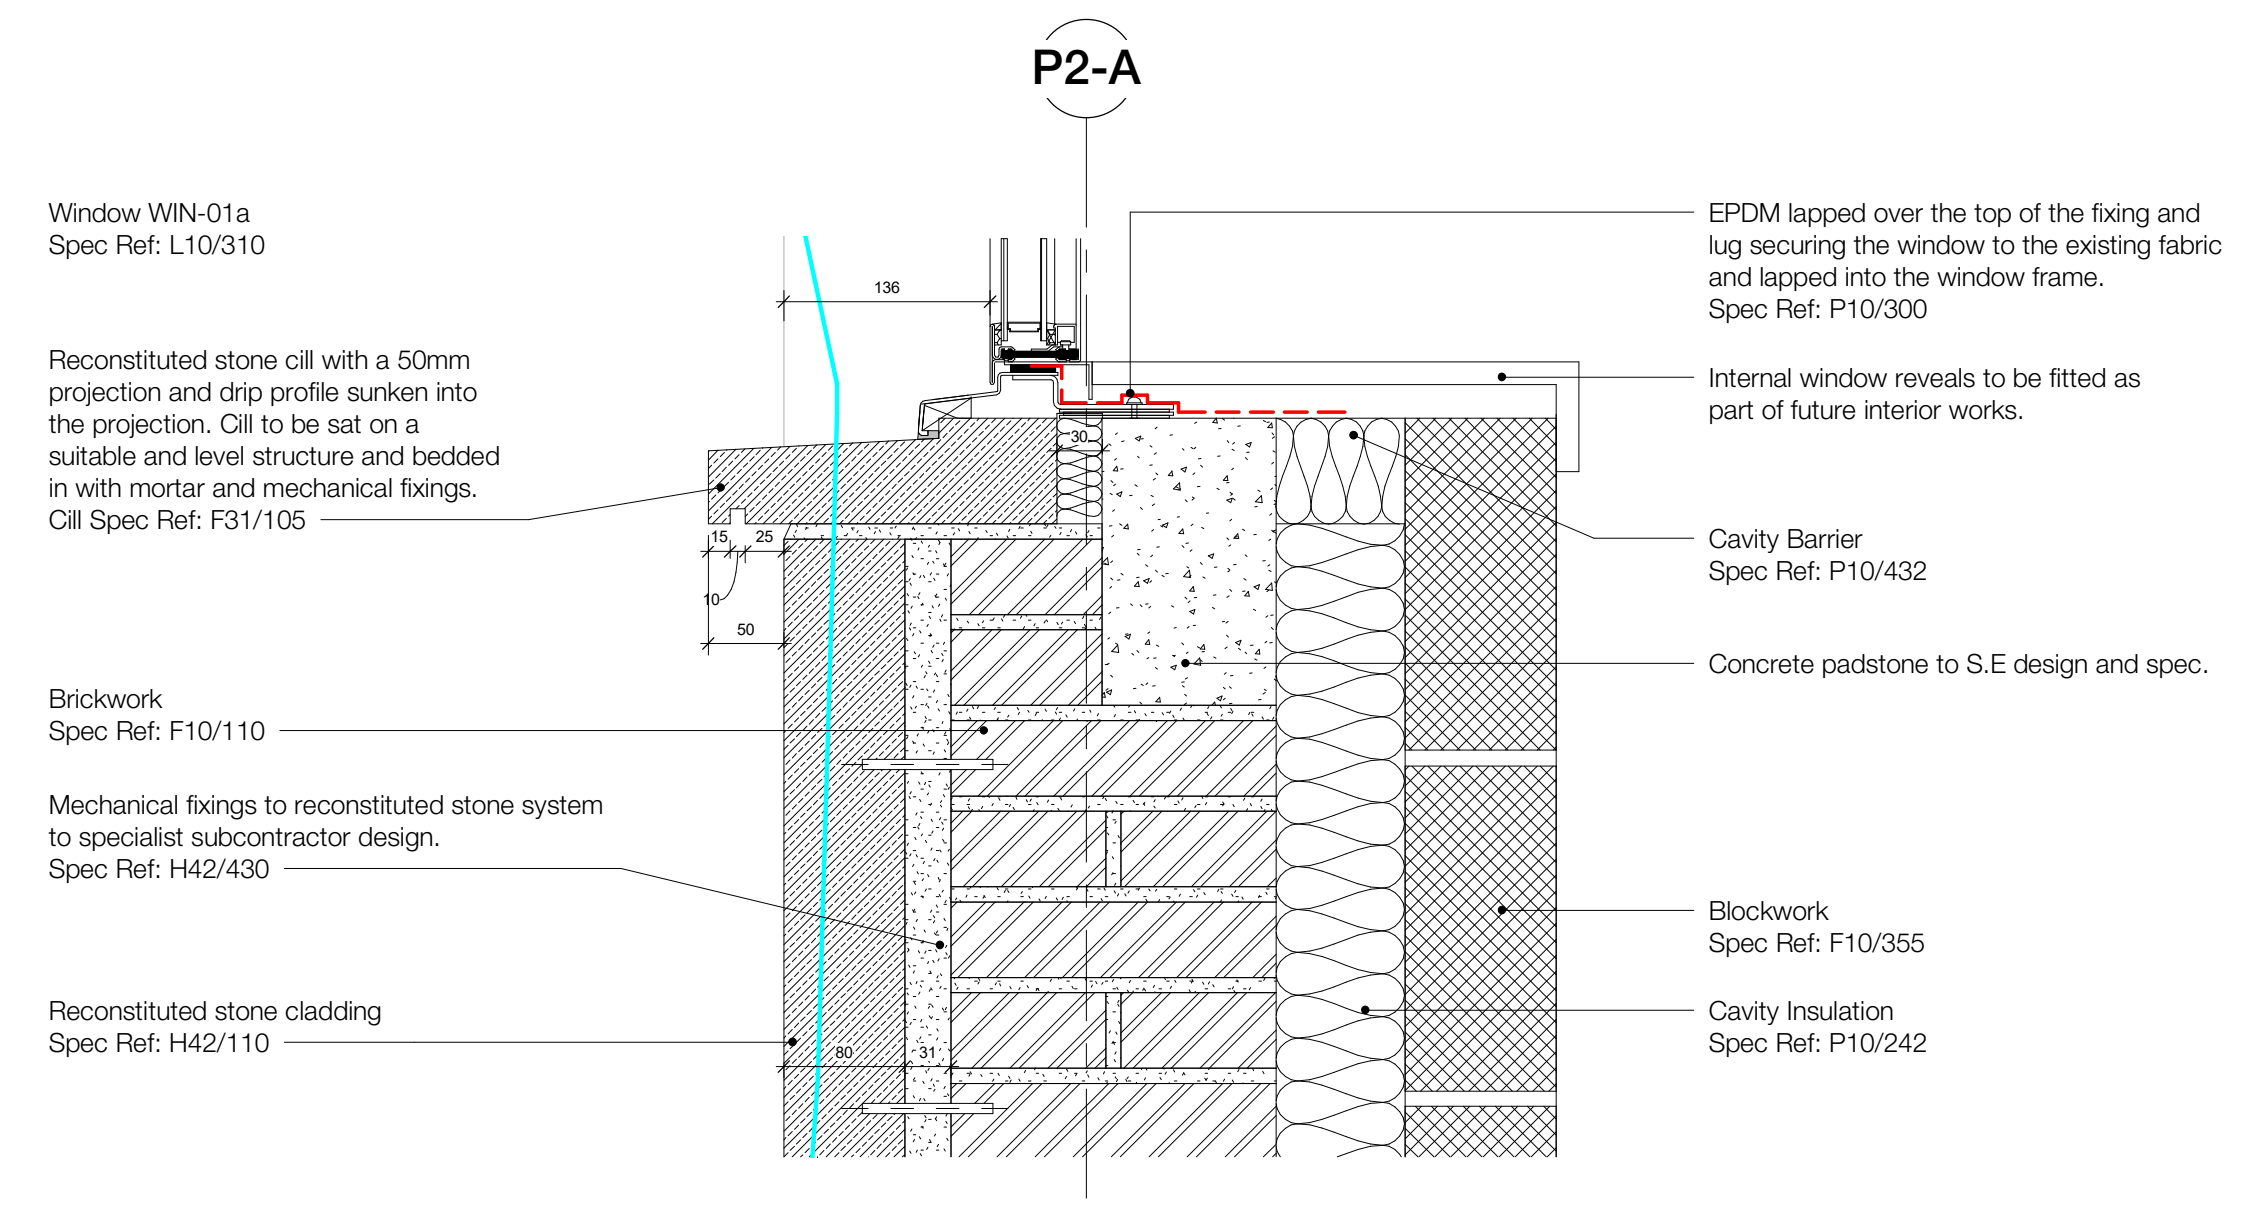

**2**  
1 : 5

**New Opening / Typical fixed window cill in stone overlaid**

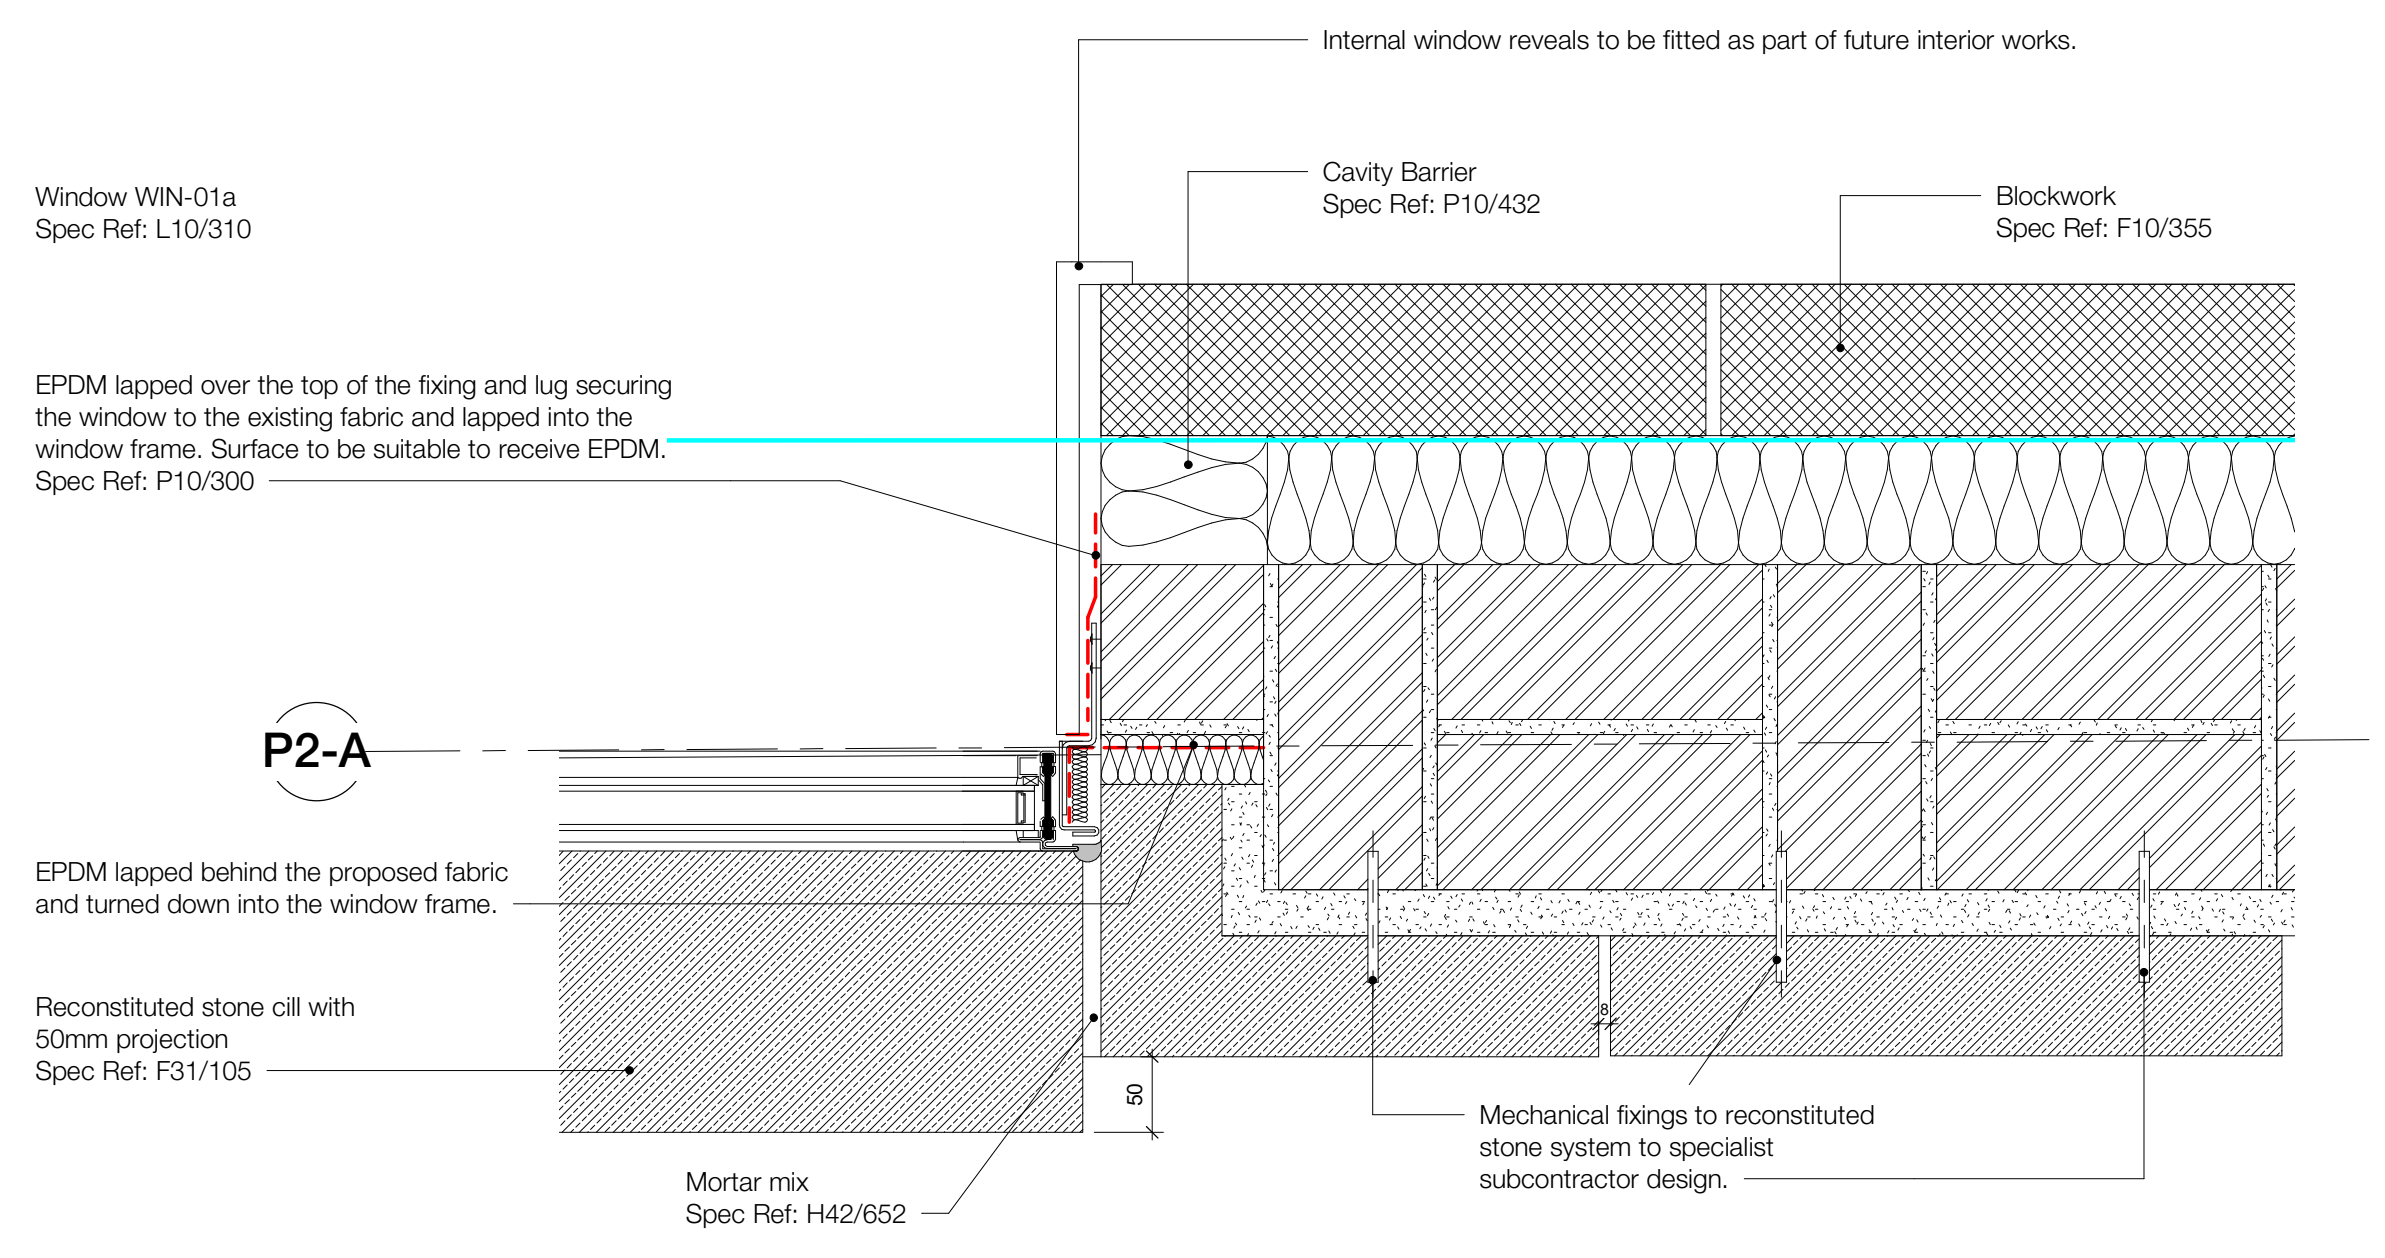

**3**  
1 : 5

**Plan - New Opening / Typical fixed window jamb in stone overlaid**

Rev	Description	Date
P01	Stage 04 Issue	16.02.24
P02	For Review & Comment	13.06.24
P03	For Review & Comment	10.07.24

Copyright Hawkins\Brown Architects  
No implied licence exists. This drawing should not be used to calculate areas for the purposes of valuation. Do not scale this drawing. All dimensions to be checked on the site by the contractor and such dimensions to be their responsibility. All work must comply with relevant British Standards and Building Regulations requirements. Drawing errors and omissions to be reported to the architect. To be read in conjunction with Architect's specification and other consultant information.

**Note**

Design package is based on measured survey data by SES received on 27.03.23 and the visual survey by HBA 'BEMP-HBA-P2-XX-RP-A-00-0001'. The limitations of the visual survey are set out within the report. Current information has been produced in the absence of a condition survey. There is the possibility that hidden issues of the building fabric may require adjustment to this design at a later stage. Designs should be read in conjunction with the heritage reports produced by Alan Baxter Associates.

Repairs and cleaning to heritage brickwork and Portland stone require condition survey and detailed inspection by a cleaning/repair specialist to establish the full scope and methodology of works. Input is required to determine extent of reusable facade materials, including material compatibility between new and old. Specialist subcontractor input is required to fully coordinate designs for curtain walling, windows and reconstituted Portland stone cladding. These inputs may have implications on detailed setting-out and other consultants' designs.

Current information represents design intent appropriate to this work stage and has not benefited from specialist subcontractor inputs noted above. Further co-ordination and technical development will be required following insight provided by others and prior to construction using specialist subcontractors and suppliers.

Scale @ A1	Date	Job Number	Project
As indicated	10/07/24	17056A	IoN/DRI Redevelopment Project
Drawn By	Checked By	Status	256 Grays Inn Road, London, WC1X 8LD
MM	JP	S3	
Drawing No.	Rev	Purpose of Issue	Drawing
BEMP-HBA-P2-ZZ-DR-A-31-1412	P03	For Review & Comment	New Window Type 3 (L01/Infill Area/North Facade)

159 St John Street  
London EC1V 4QJ  
mail@hawkinsbrown.com  
hawkinsbrown.com

**Hawkins\Brown**