

Images



Notes


Chimneys
Vegetation to be removed and flagging to be renewed where cracked or failing (NHL 5.0).

Chimney stacks and party walls above the roof line to be repointed where pointing is cracking and failing. Cracking tiles to be replaced where damaged or missing and like-for-like brick replacement for the occasional perished brick. Bed joint reinforcement introduced across minor cracking. Cement pointing to be replaced with hydraulic lime (NHL 3.5).



Pots replaced where found fractured.

Roofs
Minor running repairs to damaged leadwork and slating and localized re-wedging and repointing of flashing grooves. (NHL 3.5)

Access
Safety access harness wires, fixing points and ladders installed where shown to complete the installation.

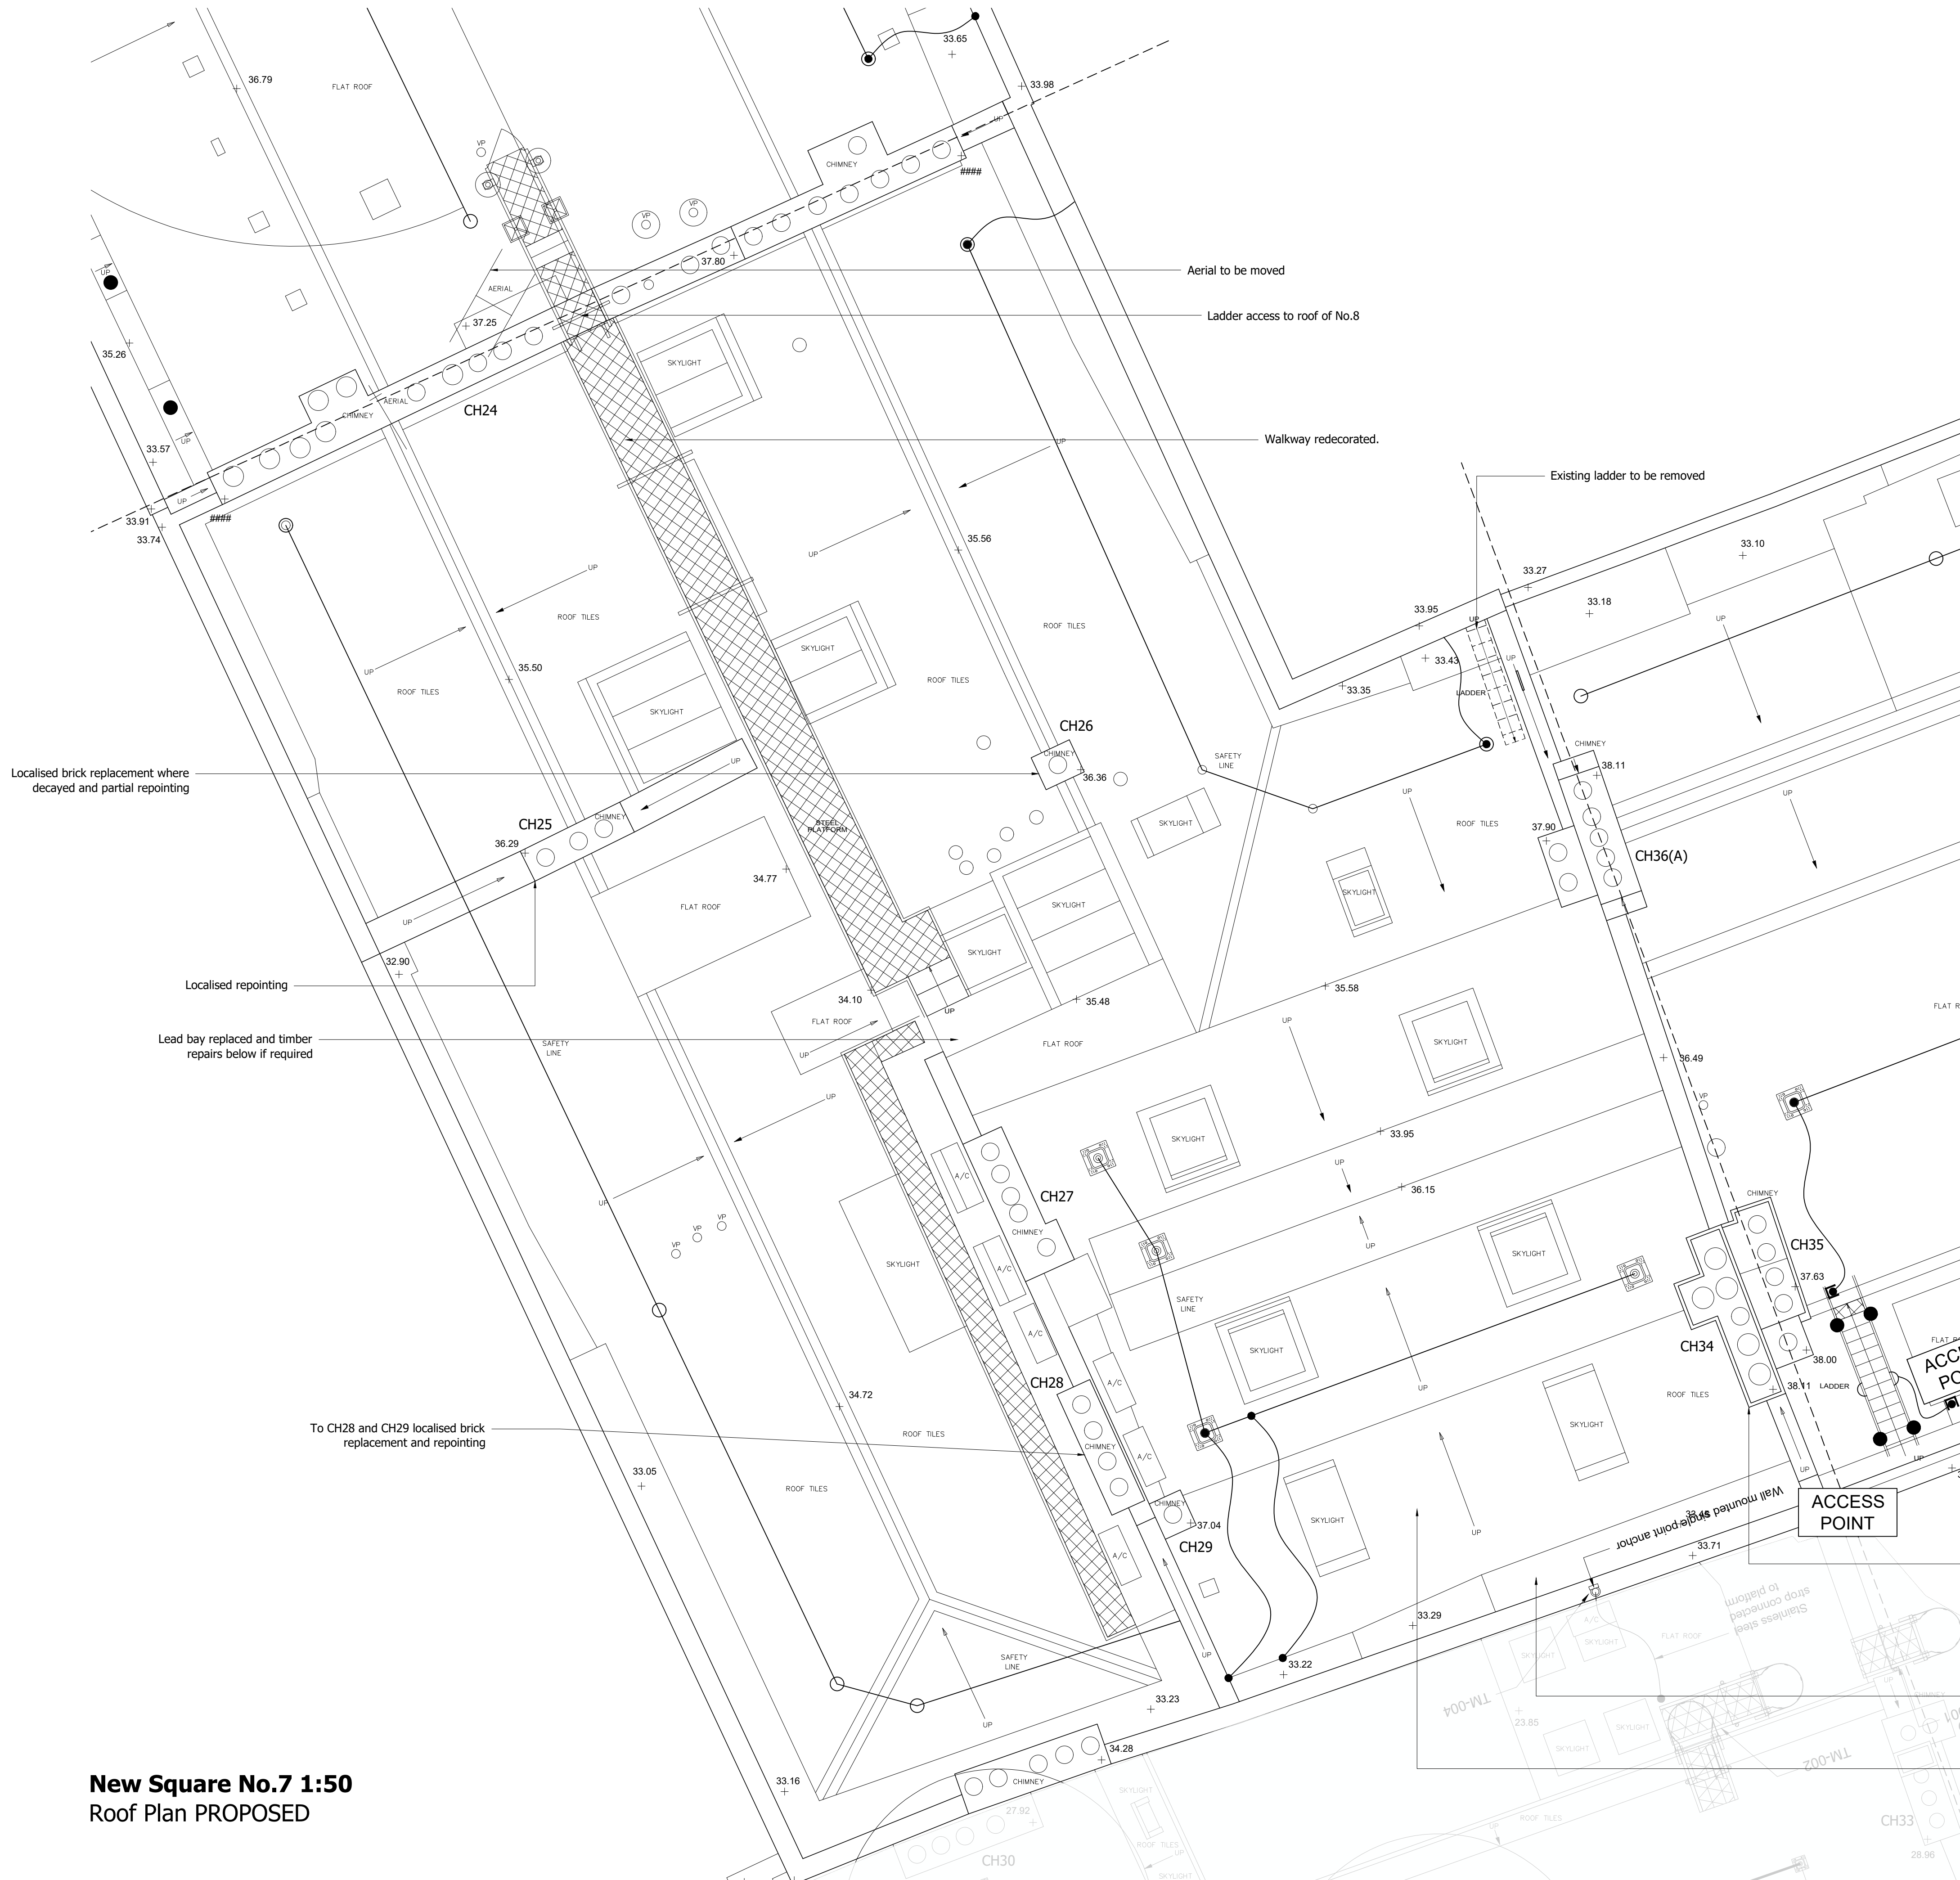

New Square No.7 1:50 Roof Plan PROPOSED

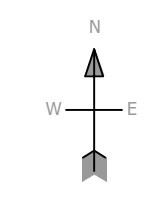

Drawn JW	Rev 0400	Notes For List B / Faculty and Tender	Job No LINCOLN'S INN - NEW SQUARE	
Proj No 207	Title WF7 Roof Plan PROPOSED	This document is copyright and the property of Chantry Conservation Architects Ltd. Any copies of this drawing, made by any method from any medium, must also include a copy of this legend. ©Chantry Conservation Architects Ltd		