

(B-01 FD20) Door no. Internal door.

(B-01 EXT) Door no. External grade door.

(smoke) smoke alarm in accordance with current regulations. including BS 5839 and BS5446. Interlinked smoke and heat detectors to have independant mains circuit. detectors to be located in circulation spaces within 7.5m of every habitable room, 300mm from walls and light fittings and not mounted over or adjacent to air conditioning, heaters, cooking areas. Sensor in ceiling mounted models between 25mm-600mm below ceiling

(heat) heat detector in accordance with current regulations including BS 5839 and BS5446. Interlinked smoke and heat detectors to have independant mains circuit. detectors to be located in circulation spaces within 7.5m of every habitable room, 300mm from walls and light fittings and not mounted over or adjacent to air conditioning, heaters, cooking areas. Sensor in ceiling mounted models between 25mm-150mm below ceiling

(bath) bathroom extraction. 15 l/s or to current regulations with 15 min over run. Routing to be agreed on site

(kit) kitchen extraction. 60 l/s or to current regulations. Routing to be agreed on site.


(boiler) Sedbuk Rated A boiler installed by corgi registered engineer. New heating to be fitted with thermostatic valves and all pipes to be insulated in accordance with current regulations.

--- drainage runs shown indicative only. TBC following on site investigations of existing drainage condition,


Historical fabric in need of repair. To be removed, carefully stored and put back. See additional notes for specific details

SERVICES
All electrical installations to be carried out by Part P certified Installer. In accordance with current regulations. Certification to be provided to Building Control Officer

All gas connections to be carried out by Corgi registered installer. Certification to be provided to Building Control Officer

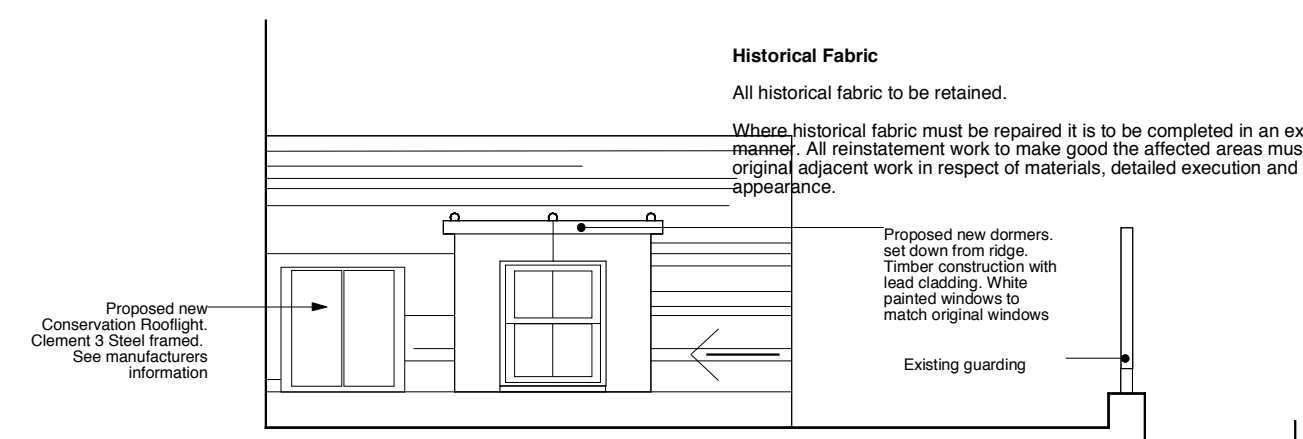

Rear roof elevation between roofs

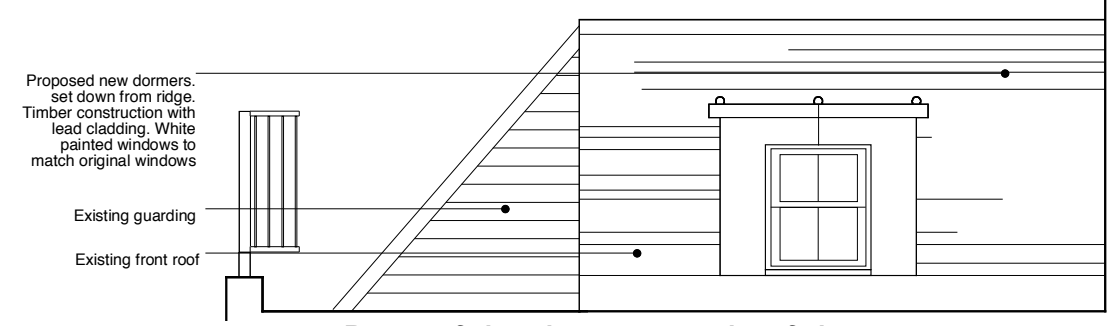

Rear roof elevation on external roof plane

Historical Fabric
All historical fabric to be retained.

Where historical fabric must be repaired it is to be completed in an exact like for like manner. All reinstatement work to make good the affected areas must match the original adjacent work in respect of materials, detailed execution and finished appearance.

General Notes
To be read in conjunction with all relevant documents
In the event of discrepancy notify the Architect immediately
This document is copyright of Hugh Cullum Architects Ltd

(): Issued for information (18.02.09/TN)
A: Conservation rooflight added (19.05.09/TN)
A: Issued for planning (20.05.2009/TN)

Issue Status
SK Information F Feasibility D Design
P Permissions S Scheme T Tender
C Construction E Existing Condition

HUGH CULLUM 85 Hampstead High St.
ARCHITECTS LTD Design Proposals
Bloomsbury Design Roof plan & Terrace elevations
61b Judd Street
London WC1H 9QT
t 020 7383 7647
f 020 7387 7645
mail@hughcullum.com

1:50@A3 February 2009
HA085-P.05(A)