




GRYPHON SURVEYS
 NEW NORTH HOUSE
 78 ONGAR ROAD
 BRENTWOOD, ESSEX
 CM15 9BB Tel: 01277 -212794
 www.gryphonsurveys.co.uk
 admin@gryphonsurveys.co.uk

**56 PARKWAY
 LONDON NW1
 BRICKCOURSE MONITORING RESULTS**

REF: G4972-M1

Station ID	REDUCED LEVEL (metres)							RANGE mm	O/A mm
	DATES OF MONITORING SURVEY								
	03/10/14	05/11/14	15/12/14	15/01/15	20/02/15	16/03/15	14/04/15		
1	10.0864	10.0856	10.0866	10.0872	10.0879	10.0882	10.0883	2.7	1.9
2	9.8966	9.8957	9.9042	9.9093	9.9122	9.9137	9.9137	18	17.1
3	9.9344	9.9329	9.9358	9.9384	9.9399	9.9407	9.9413	8.4	6.9
4	9.9428	9.9407	9.9409	9.9411	9.9423	9.9426	9.9434	2.7	0.6
5	9.7684	9.7659	9.7653	9.7653	9.7662	9.7664	9.7672	3.1	-1.2
6	9.8006	9.7988	9.7968	9.7961	9.7967	9.7970	9.7977	4.5	-2.9
TBM 1	10.0000	10.0000	10.0000	10.0000	10.0000	10.0000	10.0000		
TBM 2	9.7636	9.7622	9.7609	9.7607	9.7621	9.7627	9.7635		



Maximum
 Minimum

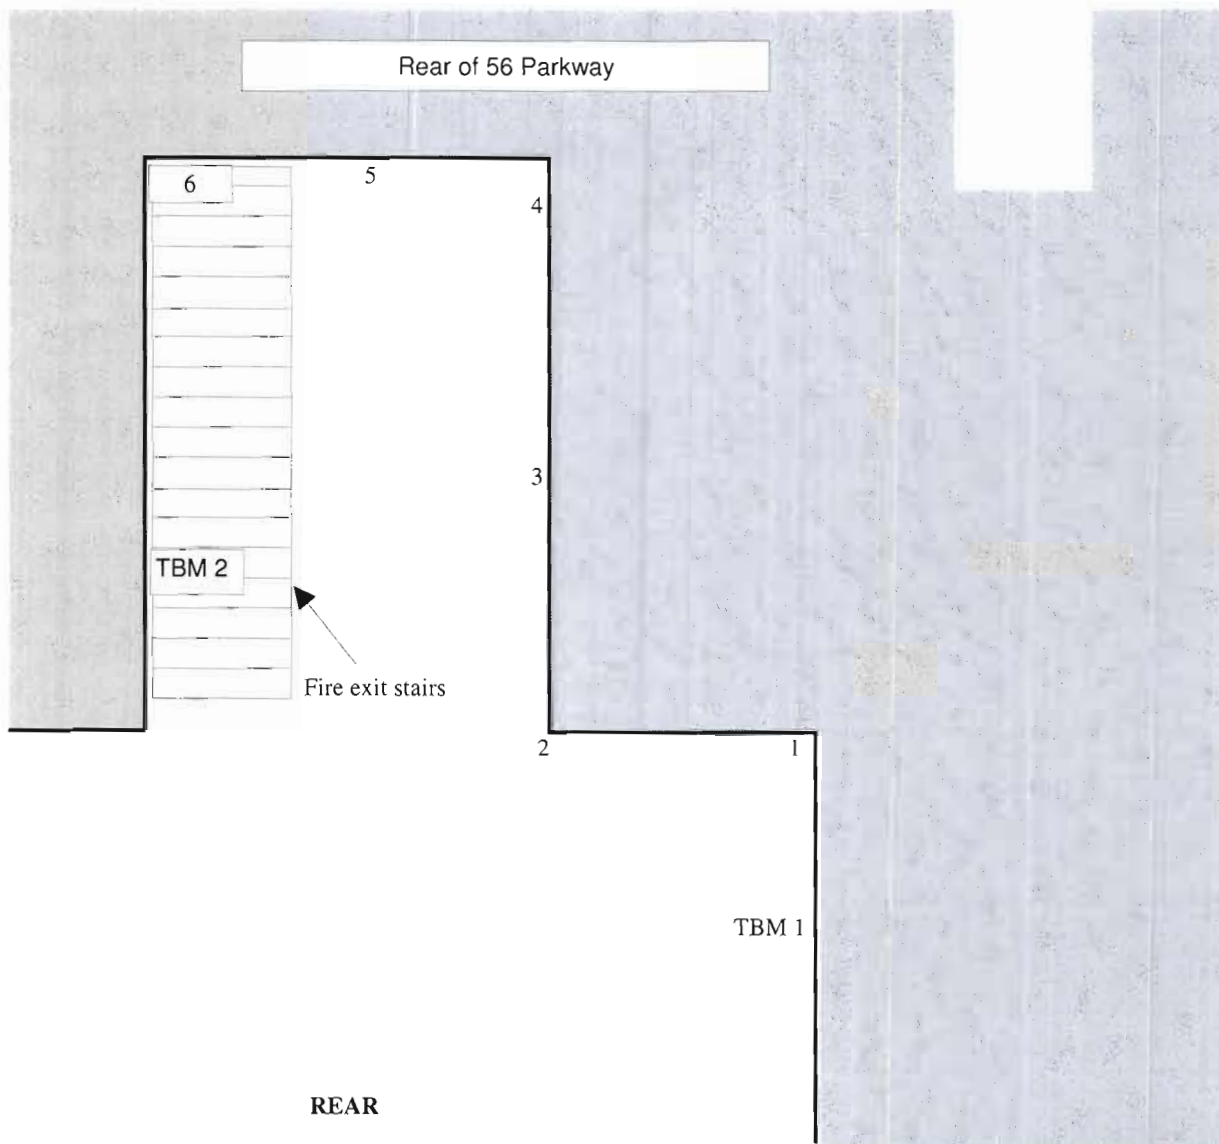



GRYPHON SURVEYS
NEW NORTH HOUSE
78 ONGAR ROAD
BRENTWOOD, ESSEX
CM15 9BB Tel: 01277 212794
www.gryphonsurveys.co.uk
admin@gryphonsurveys.co.uk

REF: G4972-M4

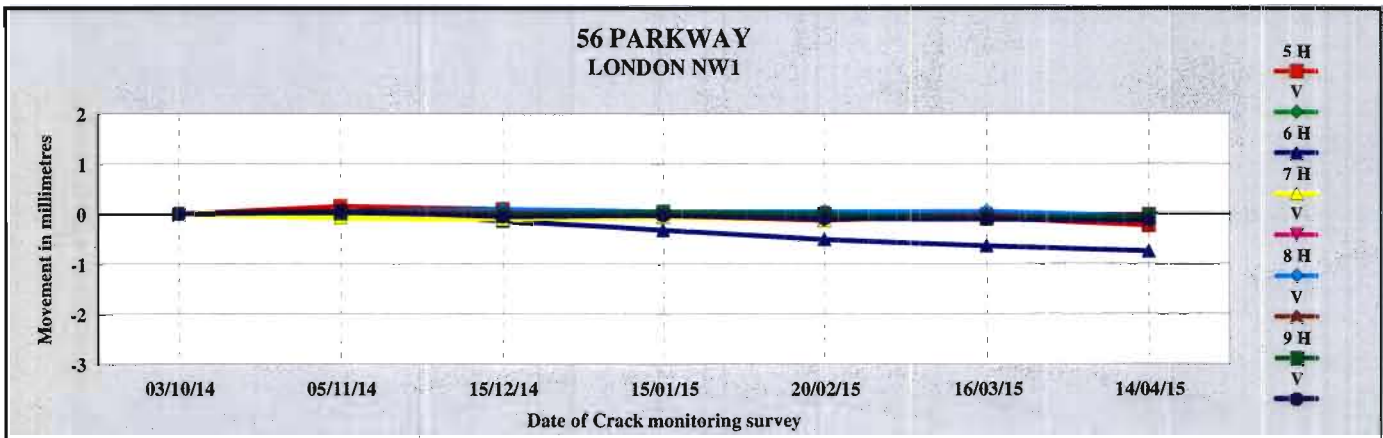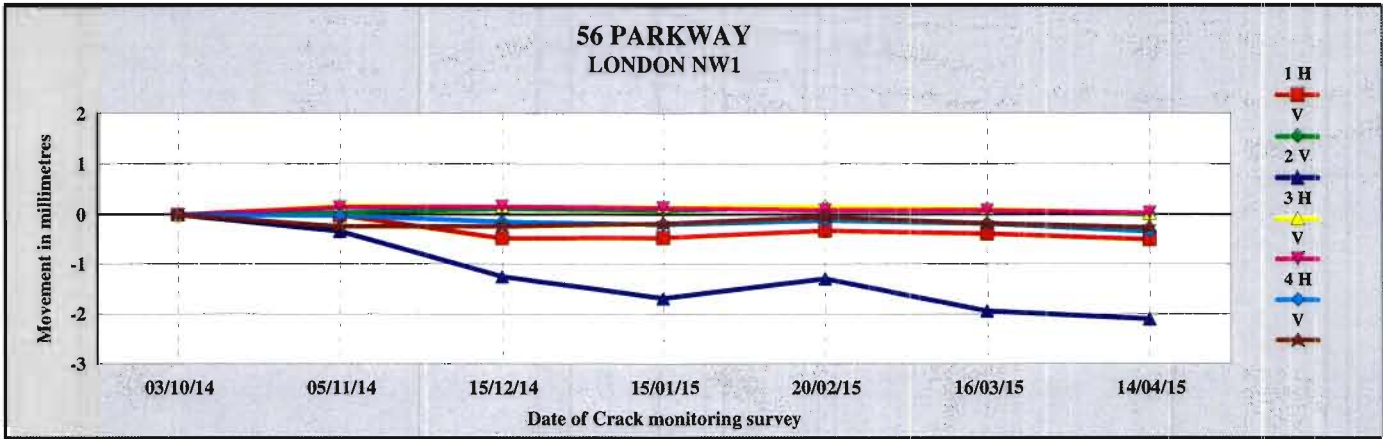



GRYPHON SURVEYS
 NEW NORTH HOUSE
 78 ONGAR ROAD
 BRENTWOOD, ESSEX
 CM15 9BB Tel:01277-212794
 www.gryphonsurveys.co.uk
 admin@gryphonsurveys.co.uk

**56 PARKWAY
 LONDON NW1**

CRACK MONITORING RESULTS

REF: G4972-M2

Crack ID	CRACK WIDTH (mm)							RANGE mm	O/A mm
	DATES OF MONITORING SURVEY								
	03/10/14	05/11/14	15/12/14	15/01/15	20/02/15	16/03/15	14/04/15		
1 H	99.78	99.77	99.31	99.32	99.46	99.40	99.28	0.50	-0.50
V	66.80	66.85	66.92	66.89	66.95	66.92	66.80	0.15	0.00
2 V	36.92	36.59	35.67	35.24	35.63	34.98	34.82	2.10	-2.10
3 H	53.64	53.84	53.81	53.81	53.81	53.77	53.66	0.20	0.02
V	79.62	79.77	79.79	79.75	79.71	79.71	79.66	0.17	0.04
4 H	66.52	66.50	66.38	66.32	66.40	66.34	66.18	0.34	-0.34
V	65.13	64.89	64.89	64.95	65.08	64.96	64.87	0.26	-0.26
5 H	68.83	68.99	68.92	68.88	68.85	68.75	68.60	0.39	-0.23
V	72.67	72.68	72.66	72.66	72.66	72.63	72.56	0.12	-0.11
6 H	81.12	81.15	80.98	80.80	80.61	80.48	80.38	0.77	-0.74
7 H	74.86	74.78	74.75	74.80	74.72	74.81	74.77	0.14	-0.09
V	90.12	90.15	90.13	90.09	89.99	90.11	90.10	0.16	-0.02
8 H	69.99	70.04	70.08	70.04	70.03	70.04	69.94	0.14	-0.05
V	47.26	47.30	47.27	47.27	47.21	47.22	47.15	0.15	-0.11
9 H	65.93	65.94	65.89	65.98	65.92	65.83	65.88	0.15	-0.05
V	51.96	52.01	51.90	51.93	51.86	51.85	51.81	0.20	-0.15
	Minimum								
	Maximum								

Crack locations

1. Ext rear addition cracking between gable and flank wall
2. Ext rear above office window
3. Int front of office lhs wall
4. Int first floor top rh corner of entrance door
5. Int first floor rh wall of stairs to 2nd floor
6. Int opposite crack 6
7. Internal second floor stairwell rhs wall to rear
8. Int second floor kitchen rear wall
9. Int second floor bedroom front rhs



GRYPHON SURVEYS
NEW NORTH HOUSE
78 ONGAR ROAD
BRENTWOOD, ESSEX
CM15 9BB Tel:01277-212794
www.gryphonsurveys.co.uk
admin@gryphonsurveys.co.uk

REF: G4972-M3

