
# **Arboricultural Report**

Impact Assessment & Planting Scheme








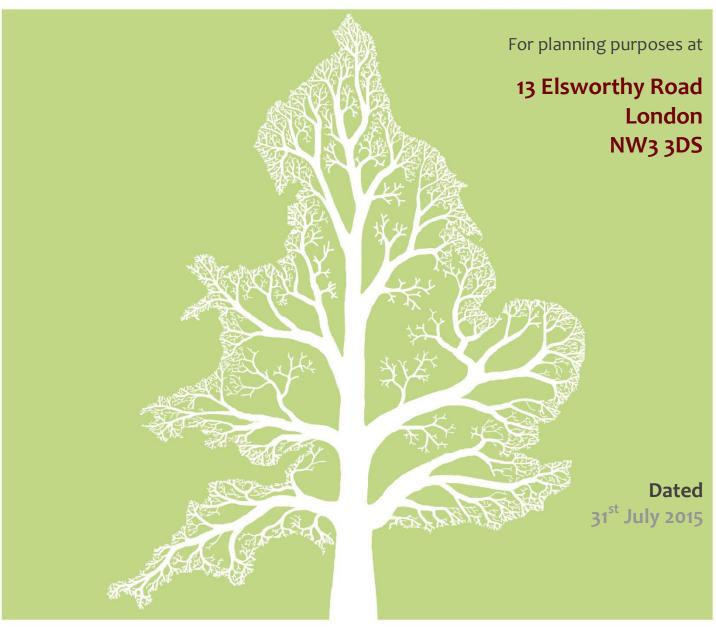


# **Overview**

This report presents the results of a tree survey to British Standard 5837 (2012). It is designed to accompany a planning application for development proposals at 13 Elsworthy Road. Guidance is given within the Appendices to help the reader interpret our findings. The Tree Data Schedule and all drawings are included in Appendix 6.

This section of the report provides an overview and summary of our findings. The report author will gladly assist with any queries that may arise. His contact details can be found within the footer sections throughout the report.

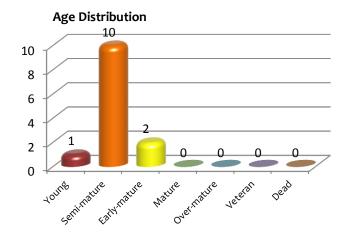

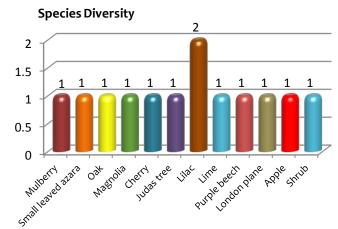

#### **Executive Summary.**

- The condition of all trees on site has been assessed and a Retention Category allocated for each tree. Tree locations, canopy spreads and Root Protection Areas are plotted on a Tree Constraints Plan within Appendix 6. Data specific to each tree is recorded in a Tree Data Schedule, also in Appendix 6. Photographs of the site may be viewed in Section 8.
- The majority of trees surveyed were deemed to be in an acceptable condition though some remedial works have been recommended to ensure the tree population is maintained in an acceptable condition (Sections 3 and 4).
- It is proposed to extend the existing building to the rear. Relevant details are shown on the accompanying plans.
- In order to facilitate the development, it is proposed to remove three Retention Category C trees. These are all small trees and are hidden from public vantage points. Consequently the impact of tree removal on local amenity shall be minimal.
- No pruning works are required to facilitate the proposal.
- No hard surfacing is proposed in RPAs.
- No foundations are proposed within areas where roots are anticipated to proliferate.
- Adequate space has been allowed between the proposal and all trees such that no future pressure to overlyprune or remove trees shall occur as a consequence of the proposal.

These points are further discussed in Sections 4 and 5.

#### **Contact Details**

Local Authority: London Borough of Camden

LA Contact: Rav Curry

Report Author: Ivan Button (Crown Consultants Ltd). Tel. 01422 316660


#### **Tree Protection Status**

We are informed that:


- The site is within the Elsworthy Conservation Area.
- There are no TPOs affecting trees within the site though there is a protected tree adjacent to the site.

See Section 4 for further details.

#### **Recommended Works**

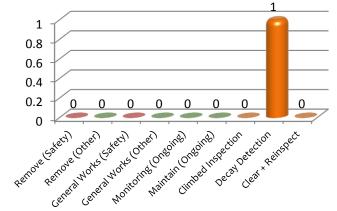

#### Site Location: 13 Elsworthy Road, London

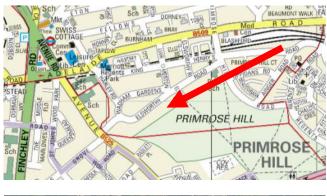






Extent of the survey


Trees surveyed as individual specimens: 12 groups: 1 hedges: 0


shrubs: o woodlands: o

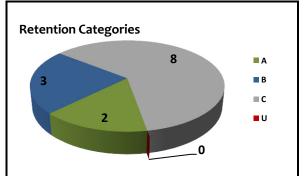

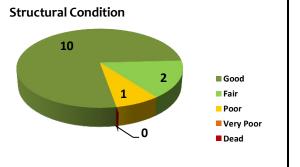

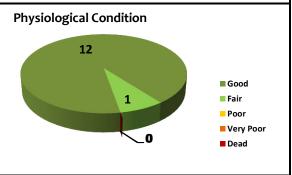

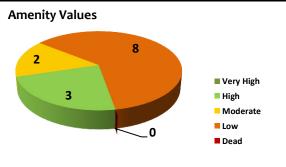

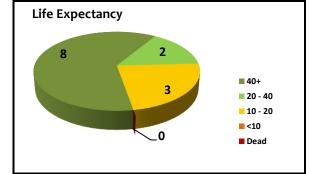

Crown Ref: 09320A Site: 13 Elsworthy Road, London

Author: Ivan Button Date: 31<sup>st</sup> July 2015

# **Contents**

1.	Introduction	3
1.1.	Instruction	3
1.2.	Scope and Purpose of the Report	3
1.3. 1.4.	References	
	Drawings	
2.	Site Overview	
2.1.	Brief Description (Existing Layout)	4
2.2.	Soils	
3∙	Tree Survey and Data Schedule	
3.1.	Survey Details	5
3.2.	Data Schedule	5
3.3.		
4.	Vegetation Overview (independent of proposals)	
4.1.	Preliminary Management Recommendations	
4.2.	Work Priority and Future Inspections	6
4.3.	Tree Protection Status – Site Specific	
4.4. 4.5.	Tree Protection – General Notes	
5.	Arboricultural Impact Assessment	9
5.1.	Overview	9 9
5.2. 5.3.	Tree Removal	9 9
5.4.	Mitigation Planting Impact on Tree Canopies	10
5.5.	Impact on Tree Roots	
5.6.	Demolition Activities	
5.7.	Hazardous Materials	
5.8.	Boundary Treatments	10
5.9.	Impact of Retained Trees on the Development	11
5.10.	Summary	11
5.11.	Arboricultural Method Statement	11
6.	Tree Works Schedule	12
6.1.	Tree Works Specification	12
7.	Planting Scheme	13
8.	Photographs	
9.	Signature	17
9.	Signature	
	ndix 1: BS 5837: 2012 – Guidance Notes	
Appe	ndix 2: Explanation of Tree Data & Glossary	20
	ndix 3: Survey Methodology	
Appei	ndix 4: Author's Qualifications	24
	ndix 5: Further Information	
Annei	ndix 6: Tree Data Schedule and Site Plan(s)	26

Crown Ref: 09320A Site: 13 Elsworthy Road, London

Author: Ivan Button Date: 31<sup>st</sup> July 2015

## 1. Introduction

#### 1.1. Instruction

1.1.1. We are instructed by Christian Clemares of Xul Architecture to undertake an Arboricultural Survey at 13 Elsworthy Road and produce our findings in a report. We are also instructed to assess the likely impact of development proposals and produce a planting scheme to mitigate against tree removal.

### 1.2. Scope and Purpose of the Report

1.2.1. This report is designed to accompany a planning application for development proposals at the above site. Its purpose is to assist and inform the planning process. It is produced according to the guidance and recommendations within BS 5837: 2012 - Trees in Relation to Design, Demolition and Construction.

#### 1.3. References

1.3.1. We have liaised with Xul Architecture throughout the writing of this report in order to attain an adequate understanding of the project to enable us to carry out an accurate assessment of the proposals.

#### 1.4. Drawings

- 1.4.1. We have been supplied with a measured plan of the site with tree positions already plotted. Where applicable, additional trees have been plotted according to measurements taken on site.
- 1.4.2. The *Tree Constraints Plan* shows the existing layout. For each tree the stem location is indicated and scaled according to its diameter, the canopy is indicated according to measurements taken along the four cardinal points of the compass. Root protection areas (RPAs) are indicated which are calculated according to the guidelines within BS 5837 (2012).
- 1.4.3. The *Impact Assessment Plan* indicates the tree constraints with the proposals overlaid. Where applicable, this plan shows where works are proposed in Root Protection Areas and which trees are to be pruned or removed. This plan accompanies the Impact Assessment which is to be found in Section 5.
- 1.4.4. The *Tree Protection Plan* shows the protection measures that are to be installed during the construction phase.
- 1.4.5. The *Planting Plan* shows the locations of trees that are to be planted as part of the post-construction planting scheme. This plan accompanies the Planting Scheme which is to be found in Section 7.

Crown Ref: 09320A Site: 13 Elsworthy Road, London

Author: Ivan Button Date: 31<sup>st</sup> July 2015

## 2. Site Overview

## 2.1. Brief Description (Existing Layout)

- 2.1.1. The site co-ordinates are 51.541403° -0.163634° and the altitude is approximately 54m above sea level. (Co-ordinates may be pasted or typed into the following site: <a href="http://maps.google.co.uk/">http://maps.google.co.uk/</a> where maps, satellite imagery and street views may be accessed).
- 2.1.2. Our survey covered the area indicated in Figure 1.



Figure 1 Extent of the survey (image is not current).

- 2.1.3. The site comprises a semi-detached house with gardens to front and rear.
- 2.1.4. Our survey area encompassed all trees within the site and any trees close to it that could potentially be affected by works within the site.
- 2.1.5. The Tree Constraints Plan and Tree Data Schedule should be referred to for descriptions and locations of all trees.
- 2.1.6. Photographs of the site are included in Section 8.

#### 2.2. Soils

2.2.1. Geological maps (<a href="http://mapapps.bgs.ac.uk/geologyofbritain/home.html">http://mapapps.bgs.ac.uk/geologyofbritain/home.html</a> ) indicate that the underlying geology of the area is clay (London Clay) with no recorded superficial deposits. This means that soils throughout the site are likely to be susceptible to compaction and the root systems are likely to be relatively shallow.

Crown Ref: 09320A Site: 13 Elsworthy Road, London

Author: Ivan Button Date: 31<sup>st</sup> July 2015

# 3. Tree Survey and Data Schedule

This page is largely generic. Tree officers and other persons familiar with arboricultural reports may go straight to the following section and refer to the tree data in Appendix 6.

## 3.1. Survey Details

- 3.1.1. A ground level survey was undertaken on the 25<sup>th</sup> May 2015. The survey was conducted by Ivan Button. No climbed inspections or specialist decay detection were undertaken. Only trees with a stem diameter over 75mm were included, which lie within the site boundary or relatively close to it.
- 3.1.2. Where applicable, trees with significant defects have been highlighted and appropriate remedial works have been recommended. However, this report should not be seen as a substitute for a full *Safety Survey* or *Management Plan* which are specifically designed to minimise risk and liability associated with responsibility for trees.
- 3.1.3. Wherever possible, dimensions are obtained using diameter tapes, logger's tapes, distometers and clinometers. Where obstacles prevent accurate measurement, dimensions are estimated. Trees on privately owned third party are surveyed from the best available vantage point and observations relating to the condition of these trees should be treated accordingly. All height measurements should be regarded as approximate.

#### 3.2. Data Schedule

- 3.2.1. The findings of the survey are presented in The Tree Data Schedule which is provided as a separate document as well as being appended to the end of this document within Appendix 6.
- 3.2.2. The Schedule includes scaled tree images based on measurements recorded for stem diameter, crown spread, crown height and overall height. Their purpose is to indicate, at a glance, the relative dimensions of each tree.
- 3.2.3. A definition of the Retention Categories can be found in Appendix 1. All other terms used within the Tree Data Schedule are defined and explained in Appendix 3.

### 3.3. RPA calculation - Single Stems & Multiple Stems

3.3.1. For single stemmed trees, the RPA is calculated according to the following formula:

RPA radius = 12 x stem diameter (measures at 1.5m above ground level)

- 3.3.2. Where a tree has more than one stem, the equivalent-single-stem diameter is usually recorded. This is calculated by adding the squares of the stems and then finding the square root of this total. The radius of the Root Protection Area is then calculated by multiplying the equivalent-stem-diameter by 12.
- 3.3.3. Occasionally this method is not appropriate (e.g. for coppiced specimens where there are numerous stems). In such cases the diameter at ground level may be recorded or a stem diameter which would provide a suitable Root Protection Area calculation. The form of the tree is recorded in the notes section.

Crown Ref: 09320A Site: 13 Elsworthy Road, London

Author: Ivan Button Date: 31<sup>st</sup> July 2015

# 4. Vegetation Overview (independent of proposals)

This section summarises all the recommendations within the Tree Data Schedule regardless of whether trees are to be retained, felled or pruned to facilitate the proposed development. It does not specify works that may be required to facilitate the development proposals. The protection status of the trees is also reported in this section.

## 4.1. Preliminary Management Recommendations

- 4.1.1. The following recommendations are made in order to maintain the trees in an acceptable condition:
- 4.1.2. The purple beech, T9, requires further inspection with specialist decay detection equipment in order to accurately assess the extent of decay present at approximately 3m above ground level.
- 4.1.3. All other trees were deemed to be in an acceptable condition.

## 4.2. Work Priority and Future Inspections

4.2.1. The table below suggests a schedule for completing the works recommended in the Tree Data Schedule based on the perceived risk:

Work Priority	Definition	Tree Number
Urgent	As soon as possible	None
Very High	Within 1 Month	None
High	Within 3 Months	T9
Moderate	Within 1 year	None
Low	Within 3 years	None

4.2.2. The table below suggests a schedule of future inspections based on the condition and location of each tree:

Inspection	Tree Number
Frequency	
(years)	
0.5	Т9
1	None
1.5	None
3	T1, T2, T3, T4, T5, T6, T7, G8, T10, T11, T12, T13

4.2.3. The trees should be inspected sooner if there is a noticeable decline in their condition, or following extreme weather events.

Crown Ref: 09320A Site: 13 Elsworthy Road, London

Author: Ivan Button Date: 31<sup>st</sup> July 2015

## 4.3. Tree Protection Status – Site Specific

- 4.3.1. On 23<sup>rd</sup> May 2015, we were informed, by Rav Curry of London Borough of Camden that:
  - The site is within the Elsworthy Conservation Area.
  - There are no tree preservation orders affecting trees within the site.
  - There is a tree preservation order affecting a beech tree within the front garden of number eleven. We understand this to be the purple beech, T9.

## 4.4. Tree Protection – General Notes

- 4.4.1. Before undertaking works to trees protected by a tree preservation order, consent needs to be obtained from the local authority which will provide application forms and advice to potential applicants. The removal of dead wood is exempt.
- 4.4.2. Where the works are proposed for reasons of safety or ill health, a report from a suitably qualified arborist will usually be required. Trees that are dead, dangerous or dying are technically exempt from protection, though it would be prudent to give the local authority 5 days' notice of intention and take photographs before undertaking works without prior consent being granted. Unauthorised works to protected trees may result in a criminal prosecution and a large fine (unlimited).
- 4.4.3. Where trees are located in a conservation area, works are not permitted without first giving the local authority 6 weeks' notice of intention. During this time the local authority may elect to create a tree preservation order or to inform the applicant that they have no objection to the proposed works. If the local authority does not respond within 6 weeks, then the intended work may be undertaken. Note: the local authority cannot refuse consent for works to trees within a conservation area; they may only create a tree preservation order if they wish to have further control over what works are undertaken.
- 4.4.4. Where planning permission is granted and tree works have been approved as part of the planning consent, no further application is required in respect of protected trees and no further notice is required in respect of trees within a conservation area.

Crown Ref: 09320A Site: 13 Elsworthy Road, London

Author: Ivan Button Date: 31<sup>st</sup> July 2015

## 4.5. Species Present – Additional Information

4.5.1. The table below contains general information about the tree *species* (rather than the actual tree *specimens*) included in the survey. Its purpose is to assist readers who are unfamiliar with the characteristics of the various species.

Species	Typical Height at Maturity (m)	Typical Canopy Spread at Maturity (m)	General Notes
Apple	6	8	Deciduous tree native across Europe and W. Asia. Hundreds of cultivars available due to its popular fruit. Flowers white, pink or red in spring. Some species will self pollinate. Most species have a relatively untidy habit. Older specimens are susceptible to a variety of rusts, moulds and cankers. Excellent habitat tree.  Visit <a href="http://www.pfaf.org/user/Plant.aspx?LatinName=Malus+domestica">http://www.pfaf.org/user/Plant.aspx?LatinName=Malus+domestica</a> for more info.
Cherry	8	10	Many cultivars available, bred for their abundance of spring flowers, edible cherries or ornamental bark (e.g. Tibetan Cherry). Usually white or pink flowering, often in very early spring. Usually with a single bole to around 2.5m and multi-stemmed thereafter. Most varieties have excellent autumn colour.
Lime	25	12	Very common street tree. Several species exist; the one most often found in woods is 'common lime' which produces a mass of suckers at the stem base, making it very cheap to propagate. Limes have non-symmetrical heart shaped leaves which are much loved by aphids (hence the sticky honeydew on cars parked beneath). Limes are tolerant of heavy pruning and are often managed as pollards. Old limes tend to support a lot of small dead branches.  Visit <a href="http://www.pfaf.org/user/Plant.aspx?LatinName=Tilia+x+europaea">http://www.pfaf.org/user/Plant.aspx?LatinName=Tilia+x+europaea</a> for more info.
London Plane	30	20	Deciduous tree arisen in cultivation probably as a cross between the Oriental Plane and the American Buttonwood. Has attractive bark which peels off in small plates leaving a multiple-coloured flecked pattern. Very common as a street tree, especially throughout London where it dominates the streetscape. Often managed as a pollard in order to constrain its large size to more manageable proportions, especially where there are clay soils and adjacent buildings. Somewhat susceptible to the decay fungus Innonotus hispidus. Visit <a href="http://en.wikipedia.org/wiki/Platanus">http://en.wikipedia.org/wiki/Platanus</a> for more info.
Magnolia	7	8	Small tree or large shrub, favoured for its large, ornamental flowers. About 80 species and numerous cultivars are available, both deciduous and evergreen. Leaves always untoothed and sometimes very large. Large silky flower buds and berries dangling from unusual 'knobbly cucumber' fruits.
Mulberry	6	8	Small fruit tree of uncertain origin, common throughout folklore which suggests its prevalence in England in former times. Often leaning with older specimens gnarled and collapsing. Produces delicious but tart raspberry like fruits. The fruits soon deteriorate so it is not suitable for planting over a pathway due to the mess beneath the canopy in late summer.  Visit <a href="http://www.pfaf.org/user/Plant.aspx?LatinName=Morus+nigra">http://www.pfaf.org/user/Plant.aspx?LatinName=Morus+nigra</a> for more info.
Oak	22	18	Deciduous, long lived tree native and common throughout Europe with very durable timber. Excellent habitat tree - provides food and shelter for thousands of native species. Can be very attractive as a mature open grown specimen though not particularly ornamental, having no autumn colour or showy flowers. Responds well to pruning.  Visit <a href="http://www.pfaf.org/user/Plant.aspx?LatinName=Quercus+robur">http://www.pfaf.org/user/Plant.aspx?LatinName=Quercus+robur</a> for more info.
Purple Beech	27	20	Purple variety of the common beech, also called Copper Beech. A majestic tree with grey bark and purple leaves. The best forms are grafted though this species does occasionally appear in the wild.  Visit <a href="https://en.wikipedia.org/wiki/Fagus_sylvatica">https://en.wikipedia.org/wiki/Fagus_sylvatica</a> for more info.

4.5.2. The figures quoted regarding typical height and canopy spread should be treated as approximate. Actual heights and spreads vary according to several environmental factors such as soil conditions, climate and presence of competing vegetation. The figures quoted are not the maximum dimensions that the species may attain.

Crown Ref: 09320A Site: 13 Elsworthy Road, London

Author: Ivan Button Date: 31<sup>st</sup> July 2015

# 5. Arboricultural Impact Assessment

#### 5.1. Overview

5.1.1. It is proposed to extend the existing building to the rear. Relevant details are shown on the accompanying plans. The footprint of the proposed extension is indicated in pale green.

5.1.1. The table below summarises the potential impact on trees due to various activities.

Activity	Trees Potentially Affected
Tree Removal: Retention Category A	None
Tree Removal: Retention Category B	None
Tree Removal: Retention Category C	T5, T6, T7
Tree Removal: Retention Category U	None
Tree Pruning	None
RPA: Foundations	None
RPA: New Surface	None
RPA: Underground Services	None
RPA: Change of Ground Levels	None
RPA: Soil Compaction	None

5.1.2. Other potentially damaging activities often associated with construction sites include demolition or the careless use of plant machinery, hazardous materials, or fires.

#### 5.2. Tree Removal

- 5.2.1. All trees to be removed are indicated on the Tree Removal Plan and are listed below:
- 5.2.2. **Retention Category A:** It is proposed to retain all Retention Category A trees.
- 5.2.3. **Retention Category B:** It is proposed to retain all Retention Category B trees.
- **Retention Category C:** It is proposed to remove the following Retention Category C trees: T5, T6 and T7.
- 5.2.5. These are relatively small trees. T5 is a 4m tall cherry with a low wide spreading habit. T6 is a 6m tall Judas tree which has been planted so close to the existing property that its canopy is already pressed against the building walls despite having such a large growth potential. T7 is a lilac which is more of a shrub than a tree. They are located within a rear garden and are not visible from public vantage points. Consequently they are considered to have a low amenity value. Their removal shall not have a significant impact on the visual amenity of the locality and they are not considered to be a material planning consideration.
- 5.2.6. **Retention Category U:** Our survey did not identify any Retention Category U trees.

Details specific to each tree can also be found in the Tree Data Schedule.

Crown Ref: 09320A Site: 13 Elsworthy Road, London

Author: Ivan Button Date: 31<sup>st</sup> July 2015

## 5.3. Mitigation Planting

5.3.1. It is proposed to plant two new trees within the rear garden. These are a Tibetan cherry and a Hybrid cockspur thorn.. The species have been selected in order to provide year round interest throughout the seasons. They are hardy species, suitable for an urban environment and will not outgrow their location. No perceived nuisance is expected from any of these trees.

## 5.4. Impact on Tree Canopies

5.4.1. The canopies of all retained trees are located sufficiently far from proposed building works and sufficiently high over access routes throughout the site that they shall not be impacted upon by any construction activity. Consequently no pruning works are required to facilitate construction activity or access throughout the site.

#### 5.5. Impact on Tree Roots

- 5.5.1. No building works or ground disturbance is proposed within the Root Protection Area of any retained tree.
- 5.5.2. **Foundations:**
- 5.5.3. No foundations are proposed within the Root Protection Area of any retained tree.
- 5.5.4. **New Surfaces:**
- 5.5.5. No new surfaces are proposed within the Root Protection Areas of any trees.
- 5.5.6. **Underground Services:**
- 5.5.7. No underground services are to be installed through any Root Protection Areas.
- 5.5.8. Changes in Ground Levels:
- 5.5.9. No changes to ground levels are proposed over Root Protection Areas.
- 5.5.10. **Soil Compaction:**
- 5.5.11. No works are proposed close to the Root Protection Areas of any retained trees.

#### 5.6. Demolition Activities

5.6.1. There are no structures that require demolition or significant surfaces that require removal close to retained trees.

#### 5.7. Hazardous Materials

5.7.1. All hazardous materials (including cement and petrochemical products) will need to be controlled according to COSHH regulations in order to ensure there is no detrimental impact on tree health. Provision shall need to be made to ensure that cement and cement run-off are contained outside of all Root Protection Areas.

#### 5.8. Boundary Treatments

5.8.1. No changes are proposed to the existing boundary features.

Crown Ref: 09320A Site: 13 Elsworthy Road, London

Author: Ivan Button Date: 31<sup>st</sup> July 2015

## 5.9. Impact of Retained Trees on the Development

5.9.1. Adequate space has been allowed between all retained trees and the proposal. Consequently the proposal shall not result in increased pressure to remove or prune any of the retained trees.

#### 5.10. Summary

- 5.10.1. In order to facilitate the development, it is proposed to remove three Retention Category C trees. These are all small trees and are hidden from public vantage points. Consequently the impact of tree removal on local amenity shall be minimal.
- 5.10.2. No pruning works are required to facilitate the proposal.
- 5.10.3. No hard surfacing is proposed in RPAs.
- 5.10.4. No foundations are proposed within areas where roots are anticipated to proliferate.
- 5.10.5. Adequate space has been allowed between the proposal and all trees such that no future pressure to overly-prune or remove trees shall occur as a consequence of the proposal.

### 5.11. Arboricultural Method Statement

5.11.1. Given that there are no trees or Root Protection Areas that grow within the site or extend within it, it is considered that an Arboricultural Method Statement should not be required to support this planning application.

Crown Ref: 09320A Site: 13 Elsworthy Road, London

Author: Ivan Button Date: 31<sup>st</sup> July 2015

# 6. Tree Works Schedule

## 6.1. Tree Works Specification

6.1.1. The following table specifies the tree works which will be required prior to the commencement of construction activity:

Tree Reference	Action Required	Notes
T5, T6, T7	Remove.	Stumps of trees within the RPAs of retained trees shall be removed with a stump grinder NOT a mechanical excavator.

6.1.2. Additional works: Any recommendations specified in the Tree Data Schedule (but not replicated in the above table) are intended to maintain the tree population in an acceptable condition. They are made for reasons of good arboricultural practice regardless of development proposals. However, they do not form part of this planning application. Where these trees are protected by a tree preservation order or are in a conservation area, consent must be sought from the local authority. Only the works listed in the table above form part of this planning application whereby no additional consent will be required if planning permission is granted.

Crown Ref: 09320A Site: 13 Elsworthy Road, London

Author: Ivan Button Date: 31<sup>st</sup> July 2015

# 7. Planting Scheme

## 7.1. Tree Planting Schedule

7.1.1. It is proposed to plant two new trees in the locations indicated on the accompanying Proposed Planting Plan ref CCL/09320A/PPP. And specified below:

Ref No	Species		N°	Size	
N1	Tibetan Cherry	Prunus serrula	1	Standard	8-10cm girth, 2.5-3m height
N <sub>2</sub>	Hybrid Cockspur Thorn	Crataegus x lavalle 'Carrierei'	1	Standard	8-10cm girth, 2.5-3m height

## 7.2. Tree Planting Specification

- 7.2.1. All stock shall be healthy and conform to BS 3936: 1992. Nursery Stock. Part 1: Specification for Trees and Shrubs. All stock to be materially undamaged, sturdy, vigorous, of balanced shape and without elongated shoots. Trees to be selected with a single, straight, stout stem and good graft union
- 7.2.2. All species are to be true to type, no substitutes are to be made without the written consent of the Local Planning Authority.
- 7.2.3. Any approved planting operations within the RPAs of retained trees are to be undertaken using hand tools only. No tracked / wheeled machinery to be used. No chemicals of any description to be used. No topsoil stripping, lowering or raising of ground levels (including the spreading of topsoil prior to seeding or turfing).
- 7.2.4. Ground which has been lightly compacted during construction is to be cultivated to a depth of 300mm. A minimum area of 1m x 1m for each tree.
- 7.2.5. Where chemical contamination or heavy compaction has occurred, or where the soil is determined to be relatively shallow or infertile, an appropriate amount of soil is to be removed and replaced with quality topsoil compliant with BS 3882. A minimum area 2m x 2m x 0.5m deep is to be replaced for each tree. Prior to backfilling with topsoil, bases and sides of all excavation to be de-compacted/loosened with a garden fork or spade.
- 7.2.6. Otherwise, a planting hole slightly larger than the root ball/ root spread shall be excavated by hand. The edge of the planting hole shall be roughened with a spade and the base dug over to a depth of 150mm to improve drainage.
- 7.2.7. The planting hole shall be backfilled with the same soil material and firmed to prevent air pockets.
- 7.2.8. Trees shall be planted with stem base at ground level, Standard trees shall be single staked at 30 50cm above ground level and attached with adjustable and flexible tree ties. Stakes shall be driven into the ground such that they avoid the root ball. Stakes to be of tanalised timber with a minimum diameter of 75mm for Standard trees.

Crown Ref: 09320A Site: 13 Elsworthy Road, London

Author: Ivan Button Date: 31<sup>st</sup> July 2015

- 7.2.9. Minimum area of 1.5m diameter around each tree to remain vegetation free. Seasoned woodchip or medium grade bark mulch to be installed to a depth of 100mm within this area to deter weed competition.
- 7.2.10. Trees to be planted late October to late March and well watered in immediately after planting.

#### 7.3. Aftercare

- 7.3.1. Trees to be regularly watered during the first growing season and during prolonged dry spells for at least two further seasons.
- 7.3.2. Following is a guide to watering requirements, though in practice these are heavily dependent upon climatic conditions:
  - All trees watered 3 times per month April through to September inclusive. During
    October, November and March the frequency may be reduced to 2 times per
    month. During December, January and February the frequency may be reduced to
    once per month.
  - At each watering session heavy standards should receive 20 gallons, standards should receive 15 gallons and light standards should receive 10 gallons. This equates to approximately 10 minutes, 7.5 minutes and 5 minutes from a domestic hose at moderate pressure.
  - The entire area beneath the canopy should be watered.
  - After 2 years the trees should only require watering during periods of extended dry weather.
- 7.3.3. Tree ties to be checked annually and repaired / adjusted as required.
- 7.3.4. Stakes to be removed after 2 3 growing seasons.
- 7.3.5. Any trees which fail to become established are to be removed and replaced with a new tree of the same species and specification as the original.

PDF readers select page-width for detail & page-view for scrolling Arboricultural Report to BS 5837: 2012 for: Xu

Xul Architecture

Crown Ref: 09320A Site: 13 Elsworthy Road, London

31<sup>st</sup> July 2015 Author: Ivan Button Date:

#### **Photographs** 8.

Refer to the Tree Constraints Plan for photo locations





Photo 2.



Photo 3.



Photo 4.



Photo 5.



Photo 6.



PDF readers select page-width for detail & page-view for scrolling Arboricultural Report to BS 5837: 2012 for: Xu

Xul Architecture

Crown Ref: 09320A Site: 13 Elsworthy Road, London

Ivan Button 31<sup>st</sup> July 2015 Author: Date:

Photo 7.



Photo 8.



Photo 9.



Photo 10.



Photo 11.



Photo 12.



PDF readers select page-width for detail & page-view for scrolling

Arboricultural Report to BS 5837: 2012 for: Xul Architecture

Crown Ref: 09320A Site: 13 Elsworthy Road, London

Author: Ivan Button Date: 31<sup>st</sup> July 2015

# 9. Signature

This report represents a true and factual account of the trees and potential impact of development along with proposed new tree planting at

13 Elsworthy Road London NW3 3DS

Signed

Ivan Button N.C.H. (Arb), FDSc (Arb), BSc (Hons), P.G.C.E., M. Arbor. A.

on behalf of

# **Crown Consultants Ltd**

**Dated** 31<sup>st</sup> July 2015



Crown Ref: 09320A Site: 13 Elsworthy Road, London

Author: Ivan Button Date: 31<sup>st</sup> July 2015

# Appendix 1: BS 5837: 2012 – Guidance Notes

This Standard prescribes the principles to be applied to achieve a satisfactory juxtaposition of trees and structures. It sets out to assist those concerned with trees in relation to design, demolition and construction to form balanced judgements.

It acknowledges the positive contribution trees may offer to a site, as well as the negative aspects of retaining inappropriate trees. It addresses the negative impacts that construction activity may have upon trees and offers mitigation strategies to minimise these impacts.

The Standard suggests a three stage approach to ensure best practice is followed when developing close to trees:

## A1.1 Stage 1: Survey of Existing Trees

This identifies the existing trees on and adjacent to the site. Data is recorded for each tree and is presented in a Tree Data Schedule. Each tree is allocated a **Retention Category** according to its size, amenity value, condition and safe useful life expectancy. The categories are allocated independently of development proposals. Our interpretation of the Retention Categories is explained below:

#### A1.1.1 Retention Categories

**A Category:** Trees of high quality and amenity value. Usually, mature trees with a significant life expectancy which would enhance any development. Retention of these trees is strongly encouraged.

**B Category:** Trees of moderate quality and amenity value. Usually these are maturing trees or younger trees with exceptional form. Retention of these trees is desirable though the removal of occasional specimens may be acceptable.

**C Category:** Trees of low quality or small specimens with a relatively low amenity value. These trees are not considered to be a material planning constraint and their removal will generally be seen as acceptable in order to facilitate development.

**U Category:** Trees of such low quality that their removal is recommended regardless of development proposals.

A1.1.2 Occasionally trees are borderline and do not fall neatly into one of the categories A, B or C. In such cases we apply a superscript (+/-) such that:

 $\mathbf{C}^{\dagger}$  Indicates borderline C/B, though Category C is deemed to be most appropriate.

**B** Indicates borderline C/B, though Category B is deemed to be most appropriate.

A1.1.3 The British Standard suggests that each of the A, B and C categories may be further subdivided (A1, A2, A3, B1, B2, B3 etc) such that subcategory 1 denotes mainly arboricultural values, subcategory 2 denotes mainly landscape values and subcategory 3 denotes mainly cultural values (including conservation). Multiple subcategories may be used.

Our experience suggests that these subdivisions lack clarity and can be confusing. Within this report subcategories are **not** denoted. Where appropriate, the use of phrases such as 'Part of a formal group', or 'Has a high ecological value', or 'Offers good screening to the site' are incorporated into the observation section of the Tree Data Schedule. We believe this conveys all relevant landscape and cultural information without any confusion.

A1.1.4 **Tree Constraints Plan (TCP).** This indicates the position, crown spread, Retention Category and Root Protection Area of each tree. It is used to inform where development may proceed without causing damage to trees.

Crown Ref: 09320A Site: 13 Elsworthy Road, London

Author: Ivan Button Date: 31<sup>st</sup> July 2015

A1.1.5 Root Protection Area (RPA). This is the area around each tree likely to contain the majority of roots. It should ideally remain undisturbed to avoid a detrimental impact on tree health. For single stemmed trees It is calculated according to the formula "radius of RPA" = "12 x stem diameter". For multiple-stemmed trees a more complex formula is used which may occasionally produce an RPA which seems inappropriately large relative to the trees canopy. This shape can then be modified to take into account site factors which influence rooting activity, e.g. foundations, soil type or impermeable surfaces. Where development works are proposed within the RPA they should be undertaken in a sympathetic manner to minimise root disturbance.

A1.1.5 **Shade Constraints.** The previous Standard (BS 5837 2005) suggested that shade constraints should be indicated on the TCP. This are denoted as a circle-segment drawn northwest to due east with a radius equal to the height of the tree. These do not represent the actual shade pattern which varies through the seasons. Rather, they indicate the area most shaded by the tree throughout the course of the year. Ideally habitable room windows should be located outside of these shade constraints. Where we consider it appropriate, we will include shade constraints information on our Impact Assessment Plan or Proposed Layout Plan.

### A1.2 Stage 2: Arboricultural Impact Assessment

After the initial survey and the production of the Tree Constraints Plan, arborists and designers are encouraged to work together to establish a design proposal with minimal impact on the high quality trees. An assessment should be made of all possible impacts including the impact that the trees may have upon the proposal. The arborist may recommend mitigation strategies to minimise these impacts and help achieve a more harmonious juxtaposition between buildings and trees.

## A1.3 Stage 3: Arboricultural Method Statement

This type of report specifies the measures necessary to protect trees against damage from construction activity. The Method Statement should be written in a manner that it may be conditioned and enforced by the local authority upon granting of planning permission. The site manager should be familiar with all aspects of the Method Statement and should ensure that all persons working on the site are aware of those aspects which appertain to their work. This includes service installation engineers and operators of plant machinery.

Site: 13 Elsworthy Road, London Crown Ref: 09320A

31<sup>st</sup> July 2015 Author: Ivan Button Date:

# **Appendix 2: Explanation of Tree Data & Glossary**

This section explains the terms used in the Tree Data Schedule (see Section 3 and Appendix 6).

#### **General Observations** A4.1

A4.1.1 Numbering System: Each item of vegetation has its own unique number prefixed by a letter such that T1=Tree 1, G2=Group 2, H3=Hedge 3 and

W4=Woodland 4, S5=Shrub 5.

A4.1.2 Age Categories:

> Young Usually less than 10 years old.

Semi-Mature Significant future growth to be expected, both in height and crown spread (typically below 30% of life expectancy). Early-Mature Full height almost attained. Significant growth may be expected in terms of crown spread (typically 30-60% of life expectancy). Full height attained. Crown spread will increase but growth increments will be slight (typically 60% or more of life expectancy).

A level of maturity whereby significant management may be required in order to keep the tree in a safe condition. As for veteran except management is not considered worthwhile. Veteran

Over Mature

Common names and Latin names are given. Species: A4.1.3

Height: Measured from ground level to the top of the crown.

A4.1.5 Stem Diameter: Taken at 1.5m above ground level where possible. On multi-stemmed trees this measurement may be taken at ground level,

though usually an indication of the number of stems and average diameter is given, e.g. 3 x 30cm

A4.1.6 Crown Height: Measured from ground level to the height at which the main crown begins. Where the crown is unbalanced it is measured on the side deemed to be most relevant. This is usually the side facing the area of anticipated development.

A4.1.7 Tree Diagram: This scaled drawing is computer generated based on measurements taken for stem diameter, crown height and spread, and

overall height. It is designed to help the reader rapidly assess the data. It is not an accurate representation of the form of the

Crown Spread: Measured N, E, S & W, taken from the centre of the stem and usually rounded up to the nearest metre.

If a tree's position is considered to be relevant it will be commented upon (e.g. overhanging a children's play area). Tree form A4.1.9 Observations:

and pruning history are also recorded along with an account of any significant defects. Defects and descriptive terms are dealt

with in more detail at the end of this section.

Recommendations: A4.1.10 Usually based on any defects observed and intended to ensure that the tree is in an acceptable condition.

Priority Scale: Depending upon the threat posed by the tree, and the likelihood of failure, recommendations should be carried out according to A4.1.11

the following priority scale:

Urgent To be carried out as soon as possible. Very High . To be carried out within 1 month. High Moderate To be carried out within 3 months To be carried out within 1 year. To be carried out within 3 years

A4.1.12 Inspection Frequency: An interval of 6 months, 1 year, 1.5 years or 3 years is allocated before the next inspection is due. Wherever practical,

consideration should be given to seasonal changes so that deciduous trees are not always surveyed in winter when they have no

leaves, or in summer when leaves may obscure branches within the upper crown.

An indication of growth rate and the tree's ability to cope with stresses: Vigour: A4.1.13

> High Having above average vigour. Moderate Having average vigour. Iow Having below average vigour.

Very Low Tree is struggling to survive and may be dying.

Physiological Condition: A4.1.14

> Good Healthy and with no symptoms of significant disease.

Fair Disease present or vigour is impaired

Significant disease present or vigour is extremely low. Poor

Very Poor Tree is dying.

Structural Condition: A4.1.15

Good Having no significant structural defects.

Some defects observed though no high priority works are required. Poor Significant defects found. Tree requires monitoring or remedial works.

Very Poor Major defects which will usually require significant remedial works or tree removal.

A4.1.16 **Amenity Value:** 

Very High Exceptional specimen, observable by a large number of people. Attractive specimen, observable by a significant number of people. High

One of the above factors is not applicable Moderate Low Unattractive specimen or largely hidden from view.

Life Expectancy: The estimated number of years before the tree may require removal. Classified as (<10), (10-20), (20-40), or (40+). A4.1.17

A4.1.18 Retention Category: These are explained in detail in Appendix 1.

#### A4.2 **Evaluation of Defects**

A4.2.1 Cavities, wounds, deadwood etc are all evaluated as follows:

Such that structural integrity is, or will become, compromised and the tree is, or will inevitably become, hazardous. Maior

Significant A defect that may over time become a major defect, though not necessarily so. This will depend on the vigour of the tree and its

ability to deal with decay etc.

A defect that is not likely to compromise the tree's structural integrity.

Crown Ref: 09320A Site: 13 Elsworthy Road, London

Author: Ivan Button Date: 31<sup>st</sup> July 2015

# **General Glossary**

Adaptive growth	In tree biomechanics, the process whereby wood formation is influenced both in quantity and quality by the action of
Aerobic	gravitational forces and mechanical stresses on the cambial zone.
Anaerobic	Conditions in which oxygen is freely available, or to biomechanical processes that depend on the presence of oxygen.  A condition marked by the absence of oxygen; Generally such areas are unsuitable for normal life and growth of plant tissues.  These sites tend to be populated by bacteria capable of surviving low oxygen conditions often associated with Slime Flux.
Arboriculture	The culture and management of trees as groups and individuals primarily for amenity and other non-forestry purposes.
Arborist	A person possessing the technical competence through experience and related training to provide management of trees or
	other woody plants in a landscape setting. Generally involved with the development or management of trees for visual amenity or land management rather than the growth of trees for product or profit.
Barrier zone	A layer within an annual increment of wood which contains abnormal xylem cells, laid down by the cambium in response to wounding or other trauma.
Body language	In trees, the outward display of growth responses and or deformation in response to mechanical stress.
Bole	Or Trunk, the main stem of a tree below its first major branch.
Bracket	A type of fruiting body produced by various fungal species, plate like to hoof like in shape and often a one sided attachment to the wood or bark.
Branch bark ridge	A ridged area located at the union of a branch to a trunk or stem.
Branch Collar	Trunk tissue that forms around the base of a branch between the main stem and the branch, or between a main branch and a lateral branch. As a branch decreases in vigour or begins to die, the collar usually becomes more pronounced and completely encircles the branch.
Brown Rot	Form of decay where cellulose is degraded, while lignin is only modified.
Buttress Root	Roots that emerge from the base of the tree stem, normally large and well developed that rapidly reduce in diameter to create
	the Root Plate this offers structural support for the tree. Buttress roots divide rapidly forming the connection between the stem
Cabling Bracing	and the transport roots. Installing cables within the crown of a tree to prevent collapse.
Callus	Undifferentiated cells often formed at the edges of recent injuries. This tissue quickly becomes differentiated, forming cells of
	the type characteristic of that position on the tree (e.g. forming wood, bark, roots, etc.) see wound response tissue.
Cambium	A thin layer of actively growing and dividing cells, located between the xylem (sapwood) and bark of a plant; the part
Canany	responsible for radial growth of a tree stem or branch. The topmost layer of twigs and foliage in a woodland, tree or group of trees.
Canopy Canker	A localised area of dead bark and cambium on a stem or branch, caused by fungal or bacterial organisms, characterised by
cac.	woundwood development on the periphery. This may be annual or perennial.
Cavity	An open and exposed area of wood, where the bark is missing and internal wood has been decayed and dissolved.
Chlorotic	Also Chlorosis. A condition of the plant marked by yellowing of normally green foliage, often indicating nutrient deficiency or
Clinometer	plant dysfunction.  Devices that measures vertical angles, and provides direct height measurements of objects by triangulation.
Co-dominant	Are forked branches or trunks of nearly the same size in diameter and lacking a normal branch union.
stems/trunk	, ·
Compacted soils	Soils in which the air-space (oxygen space) has been reduced or eliminated, reducing water infiltration and percolation, reducing root presence and inhibiting new root development.
Compartmentalisati on	The physiological process that creates the chemical and mechanical boundaries that act to limit the spread of disease and decay organisms.
Compression	Localized buckling of fibres and other longitudinal elements produced by compression of wood along the grain; compression
Failure Compression	failures sometimes develop in standing trees.  The ability of a material or structure to resist failure when subjected to compressive loading; measurable in trees using special
Strength	drilling devices
Compression Wood	Abnormal wood formed on the lower side of branches and curved stems, with physical properties different from normal wood.
Conservation Area	In Great Britain, designated areas of architectural or historical interest, in which there are special procedures for planning applications. Additionally tree works cannot generally be undertaken without prior notification (Currently 6 weeks) to the
Core Sample	relevant local planning authority. See also Tree Preservation Orders.  A sample of wood extracted from a trunk or branch, using an increment borer tool. The resulting core can be analysed for
	characteristics of growth, wood strength, structure, decay, and for species identification.
Crotch	The union of two or more branches; the auxiliary zone between branches.
Crown	The upper canopy of a tree, including upper trunk, scaffold branches, secondary branches, stems and leaves.
Crown lifting / raising	Crown Lift The removal of the lowest branches, usually to a given height. It allows more residual light and greater clearance underneath for vehicles etc.
Crown reduction	The reduction of a tree's height or spread while preserving its natural shape.
Crown thinning	The removal of some of the density of a tree's crown, usually 5-25% allowing more light through its canopy and reducing wind resistance.
Deadwood (noun)	Deadwood is often present within the crown or on the stems of trees. It may be an indication of ill health, however, it may also
	indicate natural growth processes. If a target is present beneath the tree, deadwood may fall and cause injury or damage and should be removed, otherwise deadwood can remain intact for conservation purposes (insects, fungi, birds etc.).
Deadwood (verb)	The removal of dead branches from a tree's canopy, usually of a specified size (in diameter).
Decay	Progressive deterioration of organic tissues, usually caused by fungal or bacterial organisms, resulting in loss of cell structure,
Dosny Data at	strength, and function. In wood, the loss of structural strength.
Decay Detection	The assessment of decay within a tree has been traditionally difficult, but recent advances have made it possible to achieve accurate representations of the internal section of a tree in both 2D and 3D, removing doubt over the condition of the tree and allowing accurate management decisions.
Defect	In relation to tree hazards, any feature of a tree which detracts from the uniform distribution of mechanical stress, or which makes the tree mechanically unsuited to its environment.
Defoliation	
	The losing of plants foliage.

Crown Ref: 09320A Site: 13 Elsworthy Road, London

Author: Ivan Button Date: 31<sup>st</sup> July 2015

	extreme cases can result in Stag Heading.
Dripline	A projected line on the ground that corresponds to the spread of branches in the canopy; the farthest spread of branches.
Epicormic shoots	Fast growing, weakly attached shoots/branches that often grow as a response to stress factors upon a tree or branch removal.
Failure	In connection with tree hazards, a partial or total fracture within the wood tissue or loss of cohesion between roots and soil. (It total failure affected parts will snap or tear away completely, Partial failure there is a crack or deformation, which results in an altered distribution of mechanical stress.
Feeder Roots	Fine fibrous Water and nutrient absorbing roots located in the outer root system.
Flush-Cut	In trees and shrubs, a pruning cut close to the parent stem, which removes the branch bark ridge.
Foliage	The live leaves or needles of the tree; the plant part primarily responsible for photosynthesis.
Formative pruning	The trimming of a tree to remove weaknesses and irregularities which may lead to problems. The formative pruning operation
. отв	is aimed at reducing the potential for future weaknesses or problems within the tree's crown.
Gall	An abnormal, disorganized growth of plant tissues, caused by parasitic or infectious organisms such as insects, fungi, bacteria, or viruses.
Girdling	In woody plants, any form of damage that destroys the bark and / or the Cambium all the way around the stem, branch or root, normally resulting in death of the damaged section.
Girdling Root	In woody plants, a root that grows across the buttress, or across other roots, eventually causing constriction of the radial growth.
Growth Increment	The incremental growth added as new annual ring develops each season over existing wood. This is seen as (growth) rings in cross-sections of wood.
Hazard beam	An upwardly curved branch in which strong internal stresses may occur without the compensatory formation of extra wood (longitudinal splitting may occur in some cases).
Heartwood	Inner non functioning tissues that provide structural support to trunk.
Heave	In relation to shrinkable clay soils, expansion due to rewetting of a volume of soil previously subjected to the removal or water by plant / trees following felling or root severance. Also in relation to root growth, the lifting of pavements and other structure by radial expansion. Also in relation to tree stability, the lifting of one side of a wind rocked root plate.
Herbicide	A chemical compound that causes the death of a plant.
Included Bark	Bark that becomes embedded in a crotch between branch and trunk or between co-dominant stems, usually found in narrow or tight crotches, and causes a weak structure.
Increment Borer	A tool that cuts and extracts a narrow cylinder of wood from a tree for analysis of the wood tissue and growth increments.
Leader	The primary terminal shoot or trunk of a tree.
Limb	A large lateral branch growing from the main trunk or from another larger branch.
Lion Tailing	Often the result of poor pruning practices; the main leader or branches are largely devoid of side branches, growth is restricted to the end of branches and is likely to suffer damage through end loading.
Lopping	In trees, a general term that related to the removal of branches from a tree.
Monitoring	Due to the relative life span of trees in relation to our own, long-term monitoring provides a valuable insight to the health of trees, identifying decline and or stabilisation and or improvement.
Mulch	A material laid over the root system of a tree to help conserve moisture within the soil. Additionally it may help control the development of weeds close to the tree.
Mycelium	A mass of growing filaments (hyphae) formed by fungi.
Mycorrhizae	The symbiotic relationship between roots and certain beneficial fungi. Mycorrhizae are the combined root / fungal growth.
Occluding tissue	The general tern of wood, cambium and bark that develop around the site of a wound on a woody plant
Pathogen	A microorganism that causes diseases within another organism.
Phloem	The principle conductive tissue that the products of Photosynthesis are transported around the plant
Photosynthesis	The process were light energy is used to create energy (Carbohydrate) for use within the plant.
Pollard	A term for a pollarded tree.
Pollard head	The swollen section of branch / stem that forms behind the pollarding cut.
Pollarding	The complete or partial removal of the crown of a young tree so as to encourage the development of numerous branches either for amenity or historically as fodder, repeated management is required cyclically to maintain the feature
Prune or Pruning	Selective removal of woody plant parts of any size, using saws, Loppers, Secateurs, or other pruning tools.
Reaction Wood	Wood with distinctive anatomical characteristics, formed in parts of leaning or crooked stems and in branches to provide additional strength / support. In hardwoods, tension wood usually forms. In conifers, compression wood is usually found.
Reaction Zone	A zone normally darker than surrounding wood that denoted the boundary often a defensive one between functional sapwood and dysfunctional or decaying wood.  The mistage of leaving the first leaville from the original good.
Re-grading	The raising or lowering of a soil profile from its original grade.
Remedial pruning	The removal of old stubs, deadwood, epicormic growth, rubbing or crossing branches and other unwanted items from the tree crown.
Resistograph	Invasive decay detection technique whereby the resistance offered by the timber to a spinning probe is measured and plotted.
Rib	In tree body language, a long narrow, axial protuberance which often over lays a crack.
Ring Barking	Artificial Girdling of the stem, to result in the death of a tree. May be used in habitat creation were the retention of dead standing trees is required.
Rod Bracing /	Traditionally, this has relied upon the Installation of steel rods or bolts through the stems or limbs, to reduce twisting or
Bolting Root Barriers	splitting of the wood. The installation of such features does require legal interpretation.  Both Buildings and services can benefit from the installation of root barriers to protect a soil volume from the ingress of roots.
Root Collar	The basal area of the tree; transition zone from trunk to root. Also sometimes called trunk flare.
Root Plate	The primary support area for the tree; an area of the root system close to the base that structurally anchors the tree to the soil.
Root Rot	Either a general term for decay within the wood of the lower stem / buttress roots, or a disease in which the fine roots are killed.
Root System	The portion of the tree containing the root organs, including buttress roots, transport roots, and fine absorbing roots; all underground parts of the tree.
Root Zone	The area and volume of soil around the tree in which roots are expected. May extend to three or more times the branch spread of the tree, or several times the height of the tree.
Sail Area	That area or the tree subjected to wind load.
Jan Area	mat area of the tree subjected to wind load.



Crown Ref: 09320A Site: 13 Elsworthy Road, London

Author: Ivan Button Date: 31<sup>st</sup> July 2015

Sapwood	Xylem wood tissue, usually light in colour, representing the outer growth rings of the wood. Usually living, reactive wood tiss in a healthy tree. See heartwood
Scaffold limbs / scaffold Branches	The branches that from the main network framework of the crown of a tree.
Senescent	A decline in growth and vigour due to age or stress factors.
Shrub	A woody plat that branches at or close to the ground level and so does not have a single stem.
Slime Flux	Relating to a toxic condition from the spreading of bacteria or their products from a source of infection; characterized by malodorous gases, or salt deposits upon the bark. If these products enter the sap stream, localised vessel necrosis can result, usually associated with anaerobic conditions.
Soft Rot	A kind of wood decay, were a fungi degrades cellulose within the cell wall, without causing overall degradation.
Soil Compaction	The compression of soil, causing a reduction of pore space and an increase in the density of the soil. Air is squeezed out and nutrients become locked. Tree roots cannot grow in compacted soil.
Sonic Decay	Non invasive method whereby sound waves are passed through the tree and the speed is measured. Slow speeds indicate dec
Detection	and a tomography picture representing the inner stem is produced.
Stag Heading	In a tree, a state of dieback were dead branches protrude beyond the current living crown.
Stress	In plant physiology, conditions were one or more physiological functions Are not working within normal parameters.
Stump Grinding	The removal of a tree stump using a specialist grinding machine.
Subsidence	In relation to vegetation, the removal of water by plant growth resulting in localised shrinkage in the soil volume.
Sucker	Same as sprout.
Suppressed	Trees which are dominated by surrounding vegetation and whose crown development is restricted from above.
Systemic	Affecting the whole plant or organism. A systemic compound is carried throughout the entire plant to all parts through the vascular system.
Target	Any person or object within reach of a falling tree or part of a tree that may be injured or damaged.
Target Pruning	The pruning of a branch were the wound affects only branch material, often result in a target shaped wound.
Tension Wood	Reaction wood typically formed on the upper side of limbs or curved stems; characterized by lack of cell wall lignifications (higher ratios of cellulose to lignin).
Tight Union / Tight Crotch	Also, narrow crotch. A crotch with a narrow angle between branches, often having included bark.
Tomography	The comparison of sound or stress waves through the tree allows the creation of a 2D or 3D representation of the internal structure of a stem or branch section and highlights areas of damage. Virtually non-injurious.
Topography	The configuration of surface features, including the vertical and horizontal relationships of the ground and other features.
Topping	Cutting large limbs back severely, without regard to form or habit of the tree. Cuts are usually made between lateral branch nodes. This practice is extremely injurious to trees, and promotes decay and structural weakness within the crown.
Tree	A woody plant that typically has a single stem, at maturity has a height of a least 4 metres and a stem diameter at breast heig of at least 75mm.
Tree Preservation Order	In Great Britain, an order made by the local planning authority, were consent must be gained before undertaking all but exen works to a tree.
Trunk Flare	The basal area of the trunk that flares or widens, and merges with the main roots. See root collar
Veteran Tree	Veteran trees are often found in large parks or estates and commonly affected by extensive decay or have been subject to extensive works. These trees are retained for historical importance and often pose greater risk than normal, which is general justified. They need careful management and often propping or bracing to support them, some require fencing to limit acces
Vigour	Active, healthy growth of plants: ability to respond to stress factors.
Visual Tree	An assessment of the mechanical condition of trees based upon their 'body language'. Trees are dynamic and respond to faul
Assessment (VTA)	decay / environmental factors in various ways, these responses can be indicative of structural integrity.
Wetwood	An infection caused by bacteria living inside the plant tissues. The bacteria ferment the plant fluids, resulting in death of near cells, and often causing exudations of fluid from the bark, often referred to as a Slime Flux.
White Rot	A kind if wood decay were a fungi attacks the lignin within the wood matrix
Wind loading	Forces placed upon tree canopy, branches, trunk and roots of a tree under windy conditions.
Wind Throw	The failure of a tree due to wind loading.
Witches Broom	A deformed or unusual growth of twigs from adventitious buds, caused by insects, disease, or dieback of twigs and buds.
Wood	Secondary Xylem; the main structural support and water conducting tissue of trees and shrubs.
Wound Response Tissue	Also Occluding Tissue, Wound Wood or Callus. Differentiated wood tissue that grows around the margins of a wound or injur
Wound Wood	Wood with atypical features, formed in the vicinity of a wound and a term to describe the occluding tissues around a wound
Xylem	Plant tissues with special function of translocation of water and dissolved nutrients.

Crown Ref: 09320A Site: 13 Elsworthy Road, London

Author: Ivan Button Date: 31<sup>st</sup> July 2015

# **Appendix 3: Survey Methodology**

- A2.1 Ground level visual surveys are carried out using the *Visual Tree Assessment* technique described by Mattheck and Broeler (1994) and endorsed by the Arboricultural Association (LANTRA Professional Tree Inspection course, 2007).
- A2.2 Structural condition is assessed by inspecting the stem and scaffold branches from all angles looking for weak branch junctions or symptoms of decay. Particular attention is paid to the stembase. Cavities are explored using a metal probe in order to assess the extent of any decay. If this is not possible further inspection is recommended in the form of a climbed inspection or using specialist decay detection equipment.
- A2.3 The physiological condition is assessed by inspecting the stem, branches and foliage for symptoms of disease. The overall vigour of the tree is also taken into account.
- A2.4 Where significant defects are observed, recommendations are made according to a scale of priority in order to reduce the likelihood of structural failure. The position of the tree and its potential targets are taken into account.
- A2.5 Measurements are obtained using a diameter tape, clinometer, distometer and loggers tape. Where this is not practical measurements are estimated.
- A2.6 Some trees are surveyed as groups, though this is usually avoided close to areas likely to be developed.
- A2.7 Finally, a Retention Category is allocated as described in Appendix 1.1.1.

# **Appendix 4: Author's Qualifications**

Qualifications & Experience of Ivan Button N.C.H. (Arb), FDSc (Arb), BSc (Hons), P.G.C.E., M. Arbor. A.

#### Construction

Between 1983 and 1995 Ivan worked primarily within the construction industry and received training in a broad range of practical building skills and general construction principles. During this time he obtained a BSc (Hons) at Leeds University followed by a P.G.C.E at The University of Wales.

#### Arboriculture

He obtained a NCH (Arboriculture) at the University of Lincoln and became a member of the Arboricultural Association. He then worked for an Arboricultural Consultancy for one year before establishing a tree surgery and landscaping business in 1998. In 2005 Ivan commenced full time employment with a leading Arboricultural Association approved consultancy and soon adopted a senior role responsible for five consultants.

He obtained a FDSc in arboriculture at the University of Lancashire, which he passed with distinction and is now a Director and Principal Consultant of Crown Consultants Ltd. He is accredited as a LANTRA *Professional Tree Inspector*. A qualification produced in association with the Arboricultural Association and generally recognised as appropriate for all levels of tree inspection.

He is a member of the Consulting Arborist Society and is listed within their areas of professional expertise for QTRA and as an expert witness.

Ivan is a professional member of the Arboricultural Association and the International Society of Arboriculture.

He is a licensed Quantified Tree Risk Assessment user.

Ivan has undertaken professional expert witness training and has been registered as a Sweet and Maxwell Checked Expert Witness since 2008.

Throughout 2009 acted as the principal Tree Officer for Barnsley Metropolitan Borough Council.

Ivan has produced several hundred Arboricultural Reports for the purposes of Development, Safety, Management, Mortgage, Subsidence, Mitigation and Litigation.

Crown Ref: 09320A Site: 13 Elsworthy Road, London

Author: Ivan Button Date: 31<sup>st</sup> July 2015

# **Appendix 5: Further Information**

#### **Building Near Trees - General**

National Joint Utilities Group publication # 10 (1995), Guidelines for the Planning, Installation and Maintenance of Utility Services in Proximity to Trees. Downloadable at www.njug.demon.co.uk/pdf/NJUG%20Publication10.pdf

NHBC Standards Chapter 4.2., Trees and Buildings.

Horticulture LINK project 212. (University of Cambridge, 2004), Controlling Water Use of Trees to Alleviate Subsidence Risk.

#### Tree Planting and aftercare

See www.trees.org.uk/leaflets.php# for downloadable leaflets on selecting a garden tree, planting, aftercare and veteran tree management.

#### **British Standards**

BS 5837: 2012. Trees in Relation to Design, Demolition and Construction – Recommendations.

Bs 3998: 2010. Recommendations for Tree Work.

BS 3936: 1992. Nursery Stock. Part 1: Specification for Trees and Shrubs.

BS 3936: 1992. Nursery Stock. Part 10: Specification for Groundcover Plants.

BS 4043: 1989. Transplanting Root-balled Trees.

BS 8004: 1986. Foundations.

BS 8103: 1995. Structural design of Low-Rise Buildings.

BS 8206: 1992. Lighting for Buildings.

BS 8545:2014. Trees: From nursery to independence in the landscape – Recommendations

BS 3882: 2007. Topsoil.

BS 4428: 1989. General Landscaping Operations (excluding hard surfaces).

#### Permission to do Works to Protected Trees / Tree Law

Forestry Commission (Edinburgh, 2003), Tree Felling – Getting Permission. Country Services Division - Forestry Commission. Downloadable at www.forestry.gov.uk/website/pdf.nsf/pdf/wgsfell.pdf/\$FILE/wgsfell.pdf

Transport and the Regions (Department of the Environment, 2000), Tree Preservation Orders, A Guide to the Law and Good Practice. Downloadable at www.communities.gov.uk/publications/planningandbuilding/tposguide

C. Mynors, The Law of Trees, Forests and Hedgerows (Sweet and Maxwell, London, 2002)

Communities and Local Government website with numerous downloadable documents, from:

http://www.communities.gov.uk/planningandbuilding/planning/treeshighhedges/

#### **Lighting Levels**

P.J. Littlefair, B.R.E. 209: Site layout planning for daylight and sunlight A guide to good practice. B.R.E. Bookshop, London.

British Standards Institution. Code of practice for day lighting. British Standard BS 8206: Part 2 (1992).

Chartered Institution of Building Services Engineers. Applications manual: Window Design (London, 1987).

NBA Tectonics. A study of passive solar housing estate layout. ETSU Report S-1126. Harwell, Energy Technology Support Unit (1988).

I.P. Duncan; D. Hawkes, Passive solar design in non-domestic buildings. ETSU Report S-1110. Harwell, Energy Technology.

P. J. Littlefair, Measuring Daylight, BRE Information Paper 23/93 f3.50. (Advises on measuring daylight under the real sky or an artificial sky, allowing for the changing nature of sky light).

#### **High Hedges**

Communities and Local Government website with numerous downloadable documents, from: http://www.communities.gov.uk/planningandbuilding/planning/treeshighhedges/

#### **Tree Specific Websites**

www.crowntrees.co.uk Crown Consultants site containing useful information

www.trees.org.uk Arboricultural Association

www.rfs.co.uk Royal Forestry Society of England, Wales and N. Ireland

www.treehelp.Info The Tree Advice Trust www.woodland-trust.org.uk The Woodland Trust www.treecouncil.org.uk The Tree Council

Crown Ref: 09320A Site: 13 Elsworthy Road, London


Author: Ivan Button Date: 31<sup>st</sup> July 2015

# Appendix 6: Tree Data Schedule and Site Plan(s)

The Tree Data Schedule and all plans accompanying this report follow this page. They are also provided as separate documents for ease of printing and referring between when viewing on a screen.

Reference G = Group H = Hedge	Age & Species	Height (m)	Crown Ht (m)	Diameter (cm)	Crown Spread (m) N	Scaled Tree Diagram (m)	Recommendations (Independent of any development proposals)		Vigour Physiological	Amenity Value Life
Ref		Hei	Crow	Diame	W E	9 0 9		Priority Inspect Freq (yrs)	Condition Structural Condition	
T1	Early-Mature <b>Mulberry</b>	9	3	46	5.5 5.5 5	[25]	Position: Situated within the rear garden. Form: Twin stemmed at 0.5m becoming 3 stemmed at 1.2 metres. History: Occasional pruning wounds due to crown lifting.  Defects: No significant defects.	No action required.	Moderate Good	Moderate 20-40
	Morus nigra.					0	Other: In raised planter. Actual stem diameters 27, 29 and 24 cm.	n/a 3	Good	В
T2	Semi-Mature Small Leaved Azara	7.5	4	20	3 1 3	[25	Position: Situated within the rear garden. Form: Single stemmed and vertical with a compact crown. History: No evidence of significant pruning.	No action required.	Moderate Fair	Low 40+
	Azara microphylla.				3.5	0	Defects: No significant defects.	n/a 3	Good	C
	Semi-Mature  Oak				7	[25	Position: Situated on third party land. Form: Multi-stemmed at 2.5m with a well-formed crown.	No action required.	Moderate	High
Т3	Quercus robur.	23	5	75	9 9.5 8		History: Occasional pruning wounds due to crown lifting, (healing well).  Defects: No significant defects observed.  Other: Limited inspection, dimensions estimated.	n/a 3	Good Good	40+ <b>A</b>
	Semi-Mature					[25]	Position: Situated within the rear garden.	.,,u	High	Low
T4	Magnolia	6	3	18	2 2	_	Form: Twin-stemmed at 0.5m with a compact crown.  History: Occasional pruning wounds due to crown reduction.  Defects: No significant defects.	No action required.	Good	40+
	Magnolia sp.				3	0	Other: Actual stem diameters 13cm and 13cm.	n/a 3	Fair	С
Т5	Semi-Mature  Cherry	4	1.6	34	3 4 2.5	[25]	Position: Situated within the rear garden. Form: Multi-stemmed at 2m with a low, wide spreading habit. History: Multiple pruning wounds due to crown lifting (healing well).  Defects: No significant defects.	No action required.	Moderate Good	Low 40+
	Prunus sp.					0		n/a 3	Good	C
Т6	Semi-Mature  Judas Tree	6	3	24	3.5	[25]	Position: Situated within the rear garden. Form: Multi-stemmed at 1m with a balanced crown. History: Occasional pruning wounds due to crown lifting (now healed).  Defects: No significant defects.	No action required.	Moderate Good	Low 20-40
	Cercis siliquastrum.				3.5	0	Other: In raised planter.	n/a 3	Good	C
Т7	Semi-Mature Lilac	2.5	1.5	11	2 0 4	T25	Position: Situated within the rear garden. Form: Twin-stemmed at 1m with an unbalanced crown. Heavy lean. History: No evidence of significant pruning.	No action required.	Moderate Good	Low 10-20
	Syringa vulgaris.				1	0	Defects: No significant defects.  Other: Actual stem diameters 7 and 8 cm.	n/a 3	- Fair	C

Reference G = Group H = Hedge	Age & Species	Height (m)	Crown Ht (m)	<b>Diameter</b> (cm)	Crown Spread (m) N	Scaled Tree Diagram (m)	Notes	Recomme (Independe development	nt of any	Physiological	Amenity Value Life
Ref G.E.		Hei	Crow	Diam	W E	9 0 9		Priority	Inspect Freg (yrs)	Condition Structural Condition	
G8	Semi-Mature <b>Lime</b> Tilia sp.	av 15	av 4.5	av 35	av 4 4 3	25	Position: Situated on third party land.  Form: Row of 3 similar sized specimens. All single stemmed.  History: No evidence of significant pruning.  Defects: No significant defects.	No action		High Good Good	Moderate 40+
Т9	Early-Mature  Purple Beech  Fagus sylvatica 'purpurea'.	16	7	75	each 7 4 7 6	[25]	Position: Situated on third party land.  Form: Single stemmed and vertical with a well-formed crown.  History: Multiple pruning wounds due to crown lifting.  Defects: Major cavity at 3 metres.	n/a  Decay de  requi  High			High
T10	Semi-Mature  Lilac  Syringa vulgaris.	3	1.5	9	2 2.5 0	0	Position: Situated within the front garden.  Form: Multi-stemmed at 1.5m with a compact crown.  History: No evidence of significant pruning.  Defects: No significant defects.	No action	required.	Moderate Good Good	40+ C
T11	Semi-Mature  London Plane  Platanus x hispanica.	13	6	56	4 3 4.5 4	[25]	Position: Street tree.  Form: Multi-stemmed at 4m with a well-formed crown.  History: Recently heavily reduced.  Defects: No significant defects.	No action	required.	High Good Good	High 40+
T12	Young  Apple  Malus sp.	3.5	2	14	2 1 1 2.5	[25 - - - -	Position: Situated within the front garden.  Form: Multi-stemmed at 2m with a compact crown.  History: No evidence of significant pruning.  Defects: No significant defects.	No action	required.	Moderate Good Good	40+ C
T13	Semi-Mature Shrub Species not identified.	4.5	2	20	2.5	[25 - - - 0	Position: Situated within the front garden.  Form: Multi-stemmed at ground level with a balanced crown. Shrub.  History: No evidence of significant pruning.  Defects: No significant defects.	No action	required.	Moderate Good Good	10-20 C

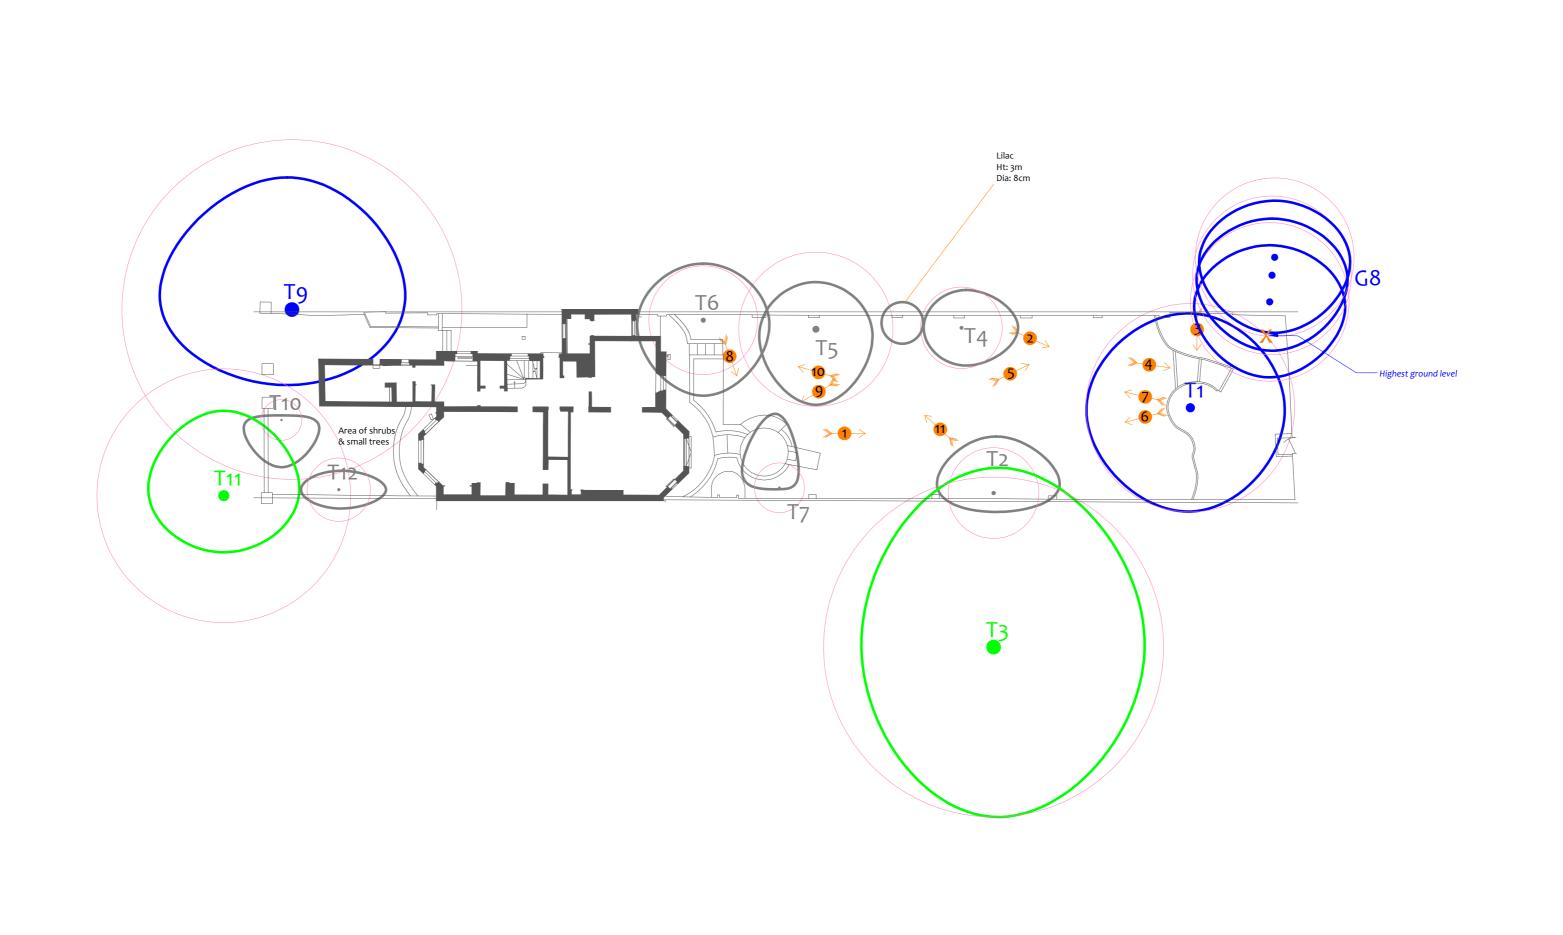



# Tree Constraints Plan

(Existing Layout)



Photo 1



Photo 2




Photo 3

See the accompanying report for more photographs

	Tuna Daf	Canadaa	11-1-4-4 ()			
	Tree Ref.	Species	Height (m)	Radius (m)	m²	Square (m)
	T1	Mulberry	9	5.5	96	9.8
	T2	Small Leaved Azara	7.5	2.4	18	4.3
	T3	Oak	23	9.0	254	16.0
	T4	Magnolia	6	2.2	15	3.8
	T5	Cherry	4	4.1	52	7.2
	T6	Judas Tree	6	2.9	26	5.1
	T7	Lilac	2.5	1.3	5	2.3
	G8	Lime	15	4.2	55	7.4
	T9	Purple Beech	16	9.0	254	16.0
	T10	Lilac	3	1.1	4	1.9
/	T11	London Plane	13	6.7	142	11.9
	T12	Platanus X Hispanica	3.5	1.7	9	3.0
	T13	Shrub	4.5	2.4	18	4.3

Drawing No:	CCL 09320A	/ TCP Rev:	
Title:	Tree Constraints Plan		
	(Existing Layout)		
Site: 13 Elsworthy Road NW3 3DS			
0	5	10m	

Scale: 1:200

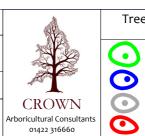

**≫-12**→

Tree Retention Categories
Stems & canopies shown

Category A tree Category B tree Category C tree

Category U tree

0

Trees of high quality with an estimated life expectancy of 40+ years. Usually large trees with significant presence or smaller trees with excellent form. Retention of these trees is highly desirable.

Trees of moderate quality with a life expectancy of 20+ years.
Usually maturing trees, or younger trees with good form. Retention of these trees is desirable though less than Category A trees Unremarkable trees of low quality and merit. Individual specimens are not considered to be a material planning consideration.


Trees unsuitable for retention due to their very poor condition.


Tree Constraints Plan

	BS 5837 Root Protection Area (radius = 12xstem diameter					
	Root Protection Area needing amendment due to site conditions, e.g. presence of exising road or building.	2/4				
Root Protection Area having been amended to account for for site conditions						
T1 = Tree	e No 1 G2 = Group No 2 H3 = Hedge No 3					

Canopy spreads are sometimes measured to an approximate N defined by site features. Often more accurate, especially where rows of trees are not aligned N-S or E-W.

MN = Measured North:

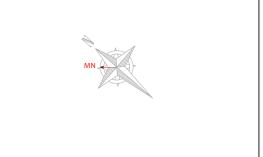




(Existing Layout with Proposals Overlaid)

Two Retention Category C trees to remove (T5, T6) and one Retention Category C shrub (T7 - lilac).

The proposed rear extension shall have no further impact on retained trees since it shall be located well beyond all RPAs and canopies

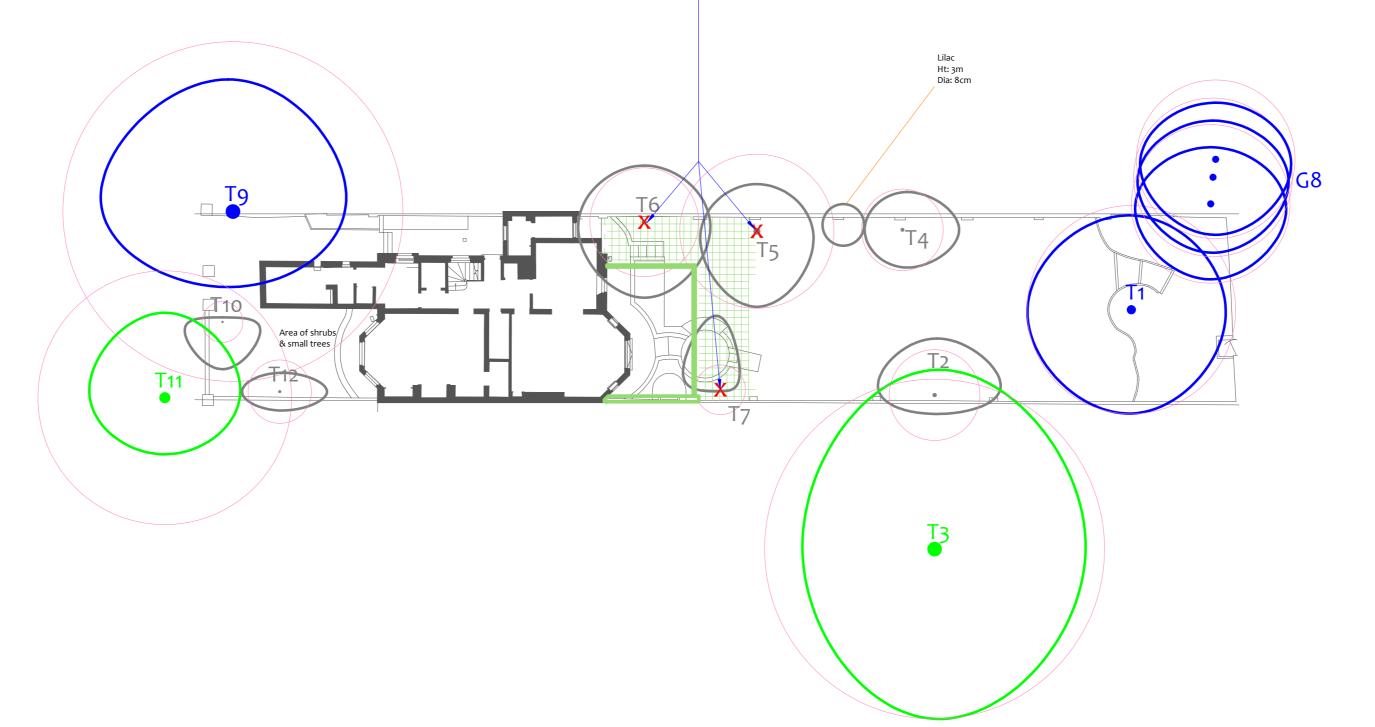

	Tree Ref.	Species	Height (m)	Root Pr	otecti	on Area
	Hee Kei.	Species	neight (III)	Radius (m)	m²	Square (m)
	T1	Mulberry	9	5.5	96	9.8
	T2	Small Leaved Azara	7.5	2.4	18	4.3
	T3	Oak	23	9.0	254	16.0
	T4	Magnolia	6	2.2	15	3.8
	T5	Cherry	4	4.1	52	7.2
	T6	Judas Tree	6	2.9	26	5.1
	T7	Lilac	2.5	1.3	5	2.3
es	G8	Lime	15	4.2	55	7.4
N	T9	Purple Beech	16	9.0	254	16.0
	T10	Lilac	3	1.1	4	1.9
ally	T11	London Plane	13	6.7	142	11.9
	T12	Platanus X Hispanica	3.5	1.7	9	3.0
	T13	Shrub	4.5	2.4	18	4.3

Drawing No:	CCL 09320A	/ IAP Rev: 1
Title:	Impact Assess (Existing Layout with Pr	
Site:	13 Elsworth NW3 3I	•
0	5	10m


Scale: 1:200








Category C tree Category U tree






Impact Assessment Plan

	BS 5837 Root Protection Area (radius = 12xstem diameter)					
	l .		_	nendment due to site ng road or building.		
	Root Prote for for site			n amended to account	)	
T1 = Tree	No 1	G2 =	Group No 2	H3 = Hedge No 3	F	

,	Tree to be removed to facilitate the proposal Tree to be removed due to its low quality	Canopy spreads are some measured to an approximate defined by site features. Often more accurate, esp. where rows of trees are n aligned N-S or E-W.
4	Proposed pruning	


MN = Measured North:

ot Protection Area needing amendment due to site	1		carropy spreads are sometimes	
nditions, e.g. presence of exising road or building.		Tree to be removed to		T9
iditions, e.g. presence of existing road of ballating.	X	facilitate the proposal	defined by site features.	T10
ot Protection Area having been amended to account		Tree to be removed	Often more accurate, especially where rows of trees are not	T11
for site conditions	X	due to its low quality	aligned N-S or E-W.	
		. ,		T12
1 $G_2 = Group No_2 + H_3 = Hedge No_3$		Proposed pruning		T13

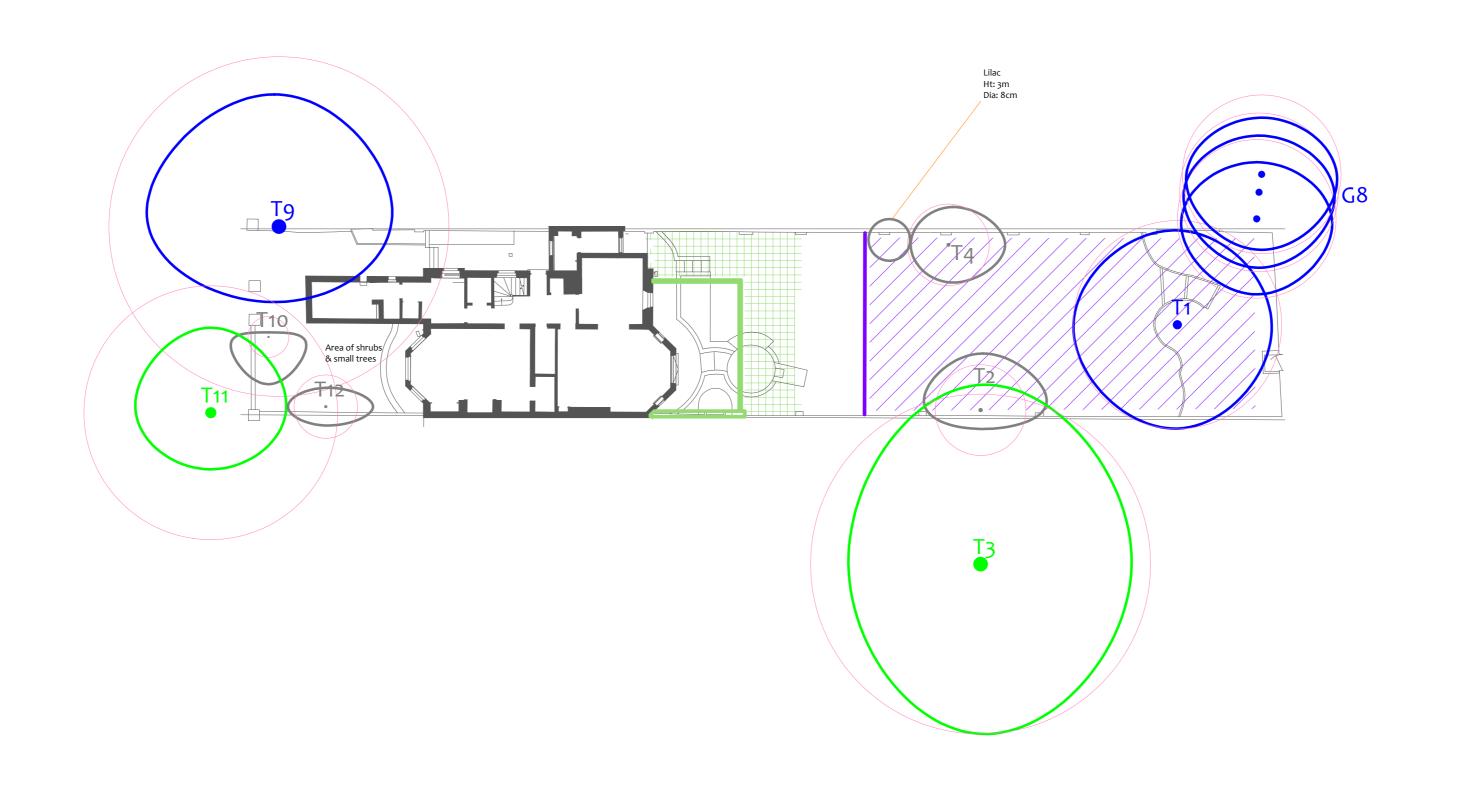



# Tree Protection Plan

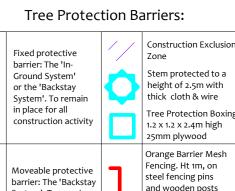

and wooden posts To remain in place throughout all construction activity


The 'Back Stay System'


in place except when


approved works are


being undertaken in

the Restricted Zone

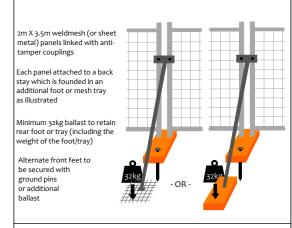



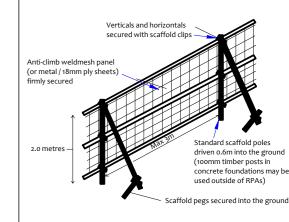



Within this area the following restrictions shall apply:


No excavation or land regrading whatsoever.


No storage of materials, rubble, soil or spoil.

No fires within the exclusion zone or within 10m of any tree canopy.

No site cabins or other temporary structures.

No discaharge of polluted water, cement or chemicals of any kind. No use of any machinery, or passage or parking of vehicles. No tree works without council consent.




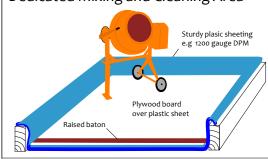

Drawing No:	CCL 09320A	/ IPP Rev: 1
Title:	Tree Protecti	ion Plan
Site:	13 Elsworthy NW3 3D	
o L	5	10m
Scale: 1:200		Paper Size: A2









Category U tree


0





Trees unsuitable for retention due to their very poor condition.


Tree Protection Plan	

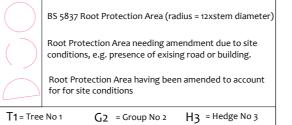


Canopy spreads are sometimes measured to an approximate N defined by site features. Often more accurate, especially where rows of trees are not

MN = Measured North:

aligned N-S or E-W.

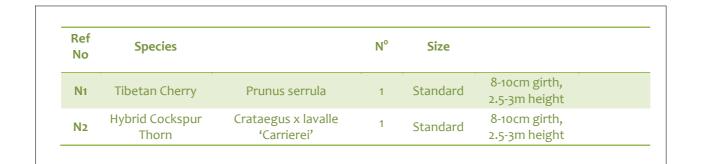

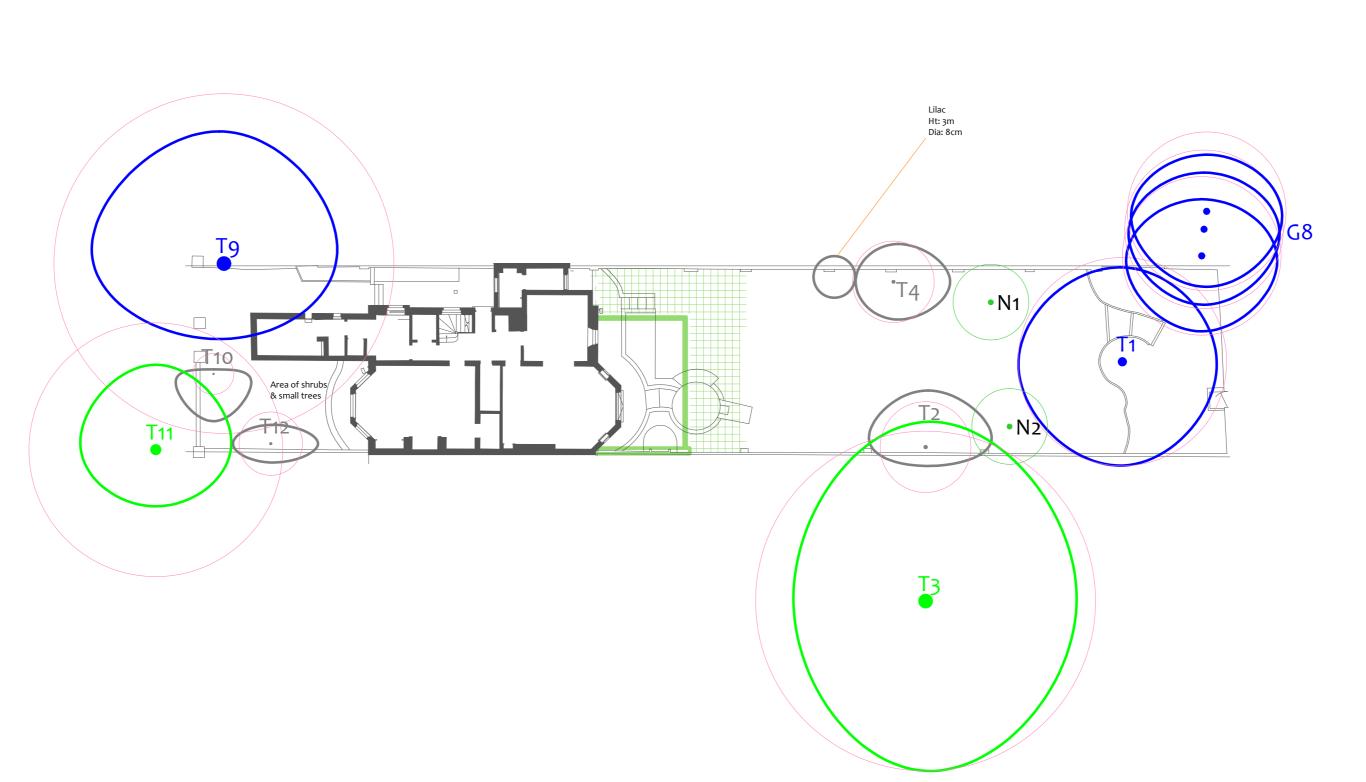



# Proposed Planting Plan (Tree Planting)

ree ker.	Species	neight (m)	Radius (m)	m²	Square (m)
1	Mulberry	9	5.5	96	9.8
2	Small Leaved Azara	7.5	2.4	18	4.3
3	Oak	23	9.0	254	16.0
4	Magnolia	6	2.2	15	3.8
5	Cherry	4	4.1	52	7.2
6	Judas Tree	6	2.9	26	5.1
7	Lilac	2.5	1.3	5	2.3
<del>3</del> 8	Lime	15	4.2	55	7.4
9	Purple Beech	16	9.0	254	16.0
10	Lilac	3	1.1	4	1.9
11	London Plane	13	6.7	142	11.9
12	Platanus X Hispanica	3.5	1.7	9	3.0

Root Protection Area


4.5 2.4 18 4.3

Drawing No:	CCL 09320A	/ PPP Rev: 1
Title:	Proposed Tree	Planting Plan
Site:	13 Elsworthy Road NW3 3DS	
0	5	10m


Scale: 1:200









0







Proposed	Planting Plan

	bs yesy noot rotection and radius = 12xstem diameter)	V.
	Root Protection Area needing amendment due to site conditions, e.g. presence of exising road or building.	
	Root Protection Area having been amended to account for for site conditions	CROWN
T1= Tree	e No 1 G2 = Group No 2 H3 = Hedge No 3	Arboricultural Consultan 01422 316660

er)	A.V.	Proposed Tree Planting		
:	CROWN	• N1	Proposed new tree reference N1, showin future canopy at 2m radius	

N1	Proposed new tree reference N1, showing future canopy at 2m radius

are not considered to be a material planning consideration.	
Trees unsuitable for retention due to their very poor condition.	