




**TYPE 1
REPAIR OF EXISTING RC LINTEL**

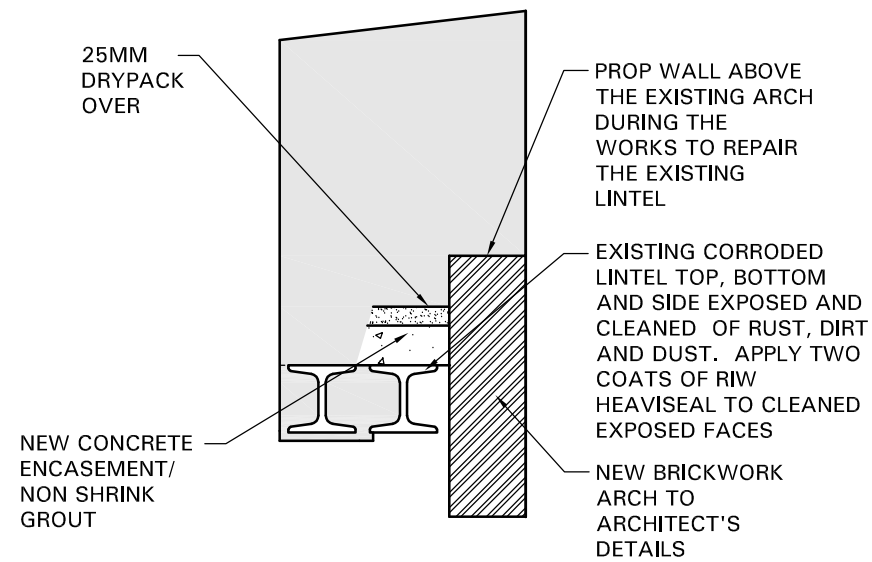

**TYPE 2
REPAIR OF EXISTING OUTER
LINTELS THAT HAVE MINOR
CORROSION**

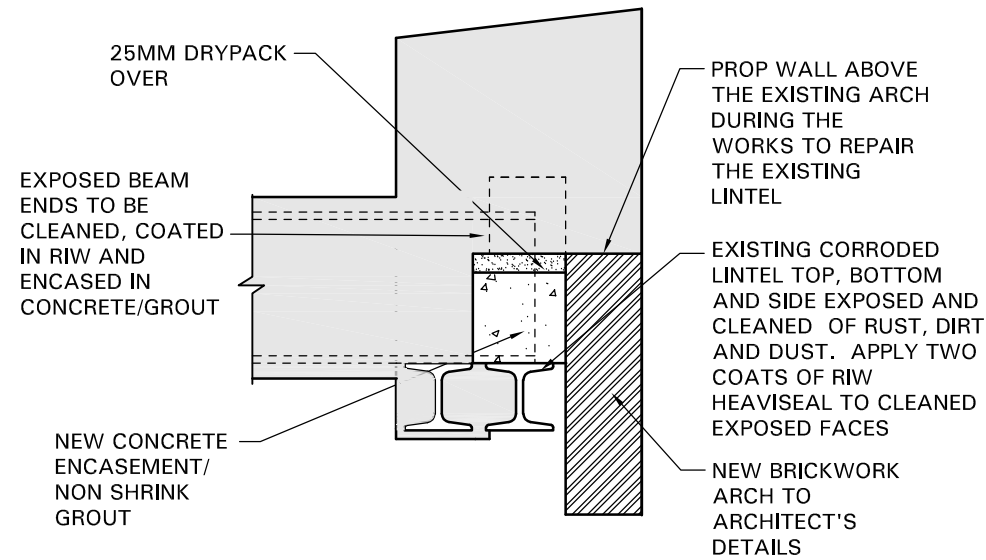

**TYPE 3A
REPAIR OF EXISTING OUTER
LINTELS THAT HAVE MINOR
CORROSION
WHERE FLOOR JOISTS/BEAMS
BEAR ONTO LINTEL**

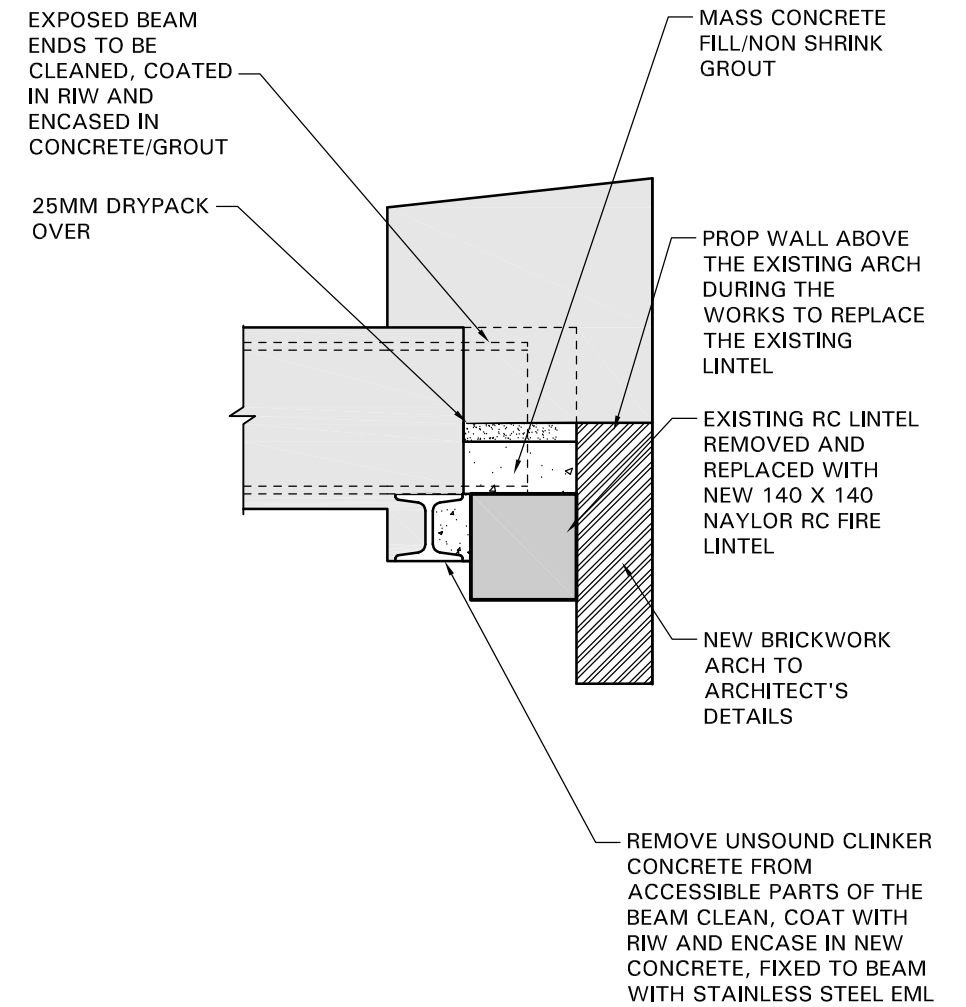

**TYPE 3B
REPLACEMENT LINTEL
FOR SEVERELY CORRODED
EXISTING OUTER LINTELS
WHERE FLOOR JOIST BEARING
ONTO LINTEL**

				Job 14/06/17 REAR FACADE WORKS	Title TYPICAL LINTEL REPAIRS		MBP Michael Barclay Partnership consulting engineers 105-109 Strand London WC2R 0AA T 020 7240 1191 F 020 7240 2241 E london@mbp-uk.com www.mbp-uk.com
C2	20/11/18	DETAIL 2 ADDED	JC	Scale 1:10	Date JUN 17	By JC	
C1	15/11/18	DETAILS AMENDED FOLLOWING OPENING UP	JC	Drawing Number 7222 / 300		Revision C2	
T1	19/06/17	TENDER ISSUE	JC	Status CONSTRUCTION			
P1	14/06/17	PRELIMINARY ISSUE	JC				
Rev	Date	Description	By				