


Lege




Remove and reform new mortar bead to rear elevation windows

Light clean to stone and brickwork to clause C40/215. Trial sample 3 number @ 1m2 each to be provided for approval to clause C40/230.

Brickwork stitch replacement to clause C41/365

Specialist two coat render repairs to internal face of lightwell retaining wall comprising undercoat two part hydraulic lime to 5 part sharp and top coat of 1 part hydraulic lime and 3 part sharp sand.

Cut out damaged slate DPC and replace with new natural slate bedded and pointed in 1:1:6 mortar to existing details

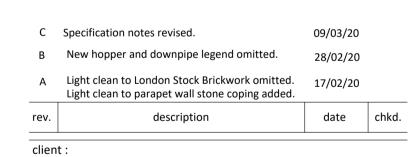

UCL

The Slade School of Fine Art
Gower St, London, WC1E 8BT
External Refurbishment

drawing ti

drg no: 200-07

Front and Rear Elevations
Proposed Elevation Repairs

Fulkers Bailey Russell

london I gravesend I brighton | bristol I leeds I reading I manchester info@fulkers.co.uk // www.fulkers.co.uk // 01474 369175

drawn:SL	chkd :	date:Jan 2020
status: Planning		scale: 1:100 @ A1
proj no : 19-23	06	

rev no: C