
BS 5837 Arboricultural Report

Impact Assessment & Method Statement







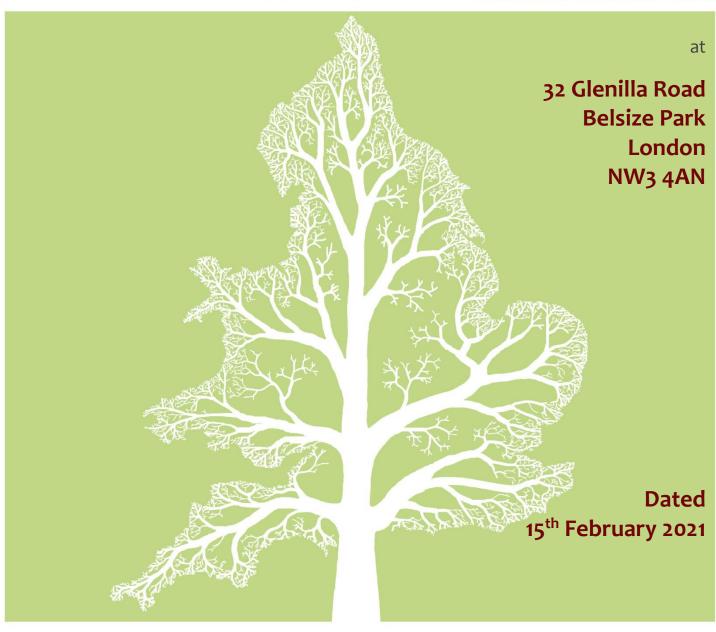

Crown Ref: 09302 Site: 32 Glenilla Road, Belsize Park

Author: Ivan Button Date: 15th Febuary 2021

Contents

| 1. | Introduction | 3 |
|--------|--|----|
| 1.1. | Instruction | 3 |
| 1.2. | Scope and Purpose of the Report | 3 |
| 1.3. | References | 3 |
| 1.4. | Drawings | 3 |
| 1.4. | Di awings | |
| 2. | Site Overview | 4 |
| | Site Overview | |
| 2.1. | Brier Description (Existing Layout) | 4 |
| 2.2. | Soils | 4 |
| _ | Tree Comies and Data Cabadula | - |
| 3. | Tree Survey and Data Schedule | 5 |
| 3.1. | Survey Details | 5 |
| 3.2. | Data Schedule | 5 |
| 3.3. | RPA calculation - Single Stems & Multiple Stems | 5 |
| | | |
| 4. | Vegetation Overview (independent of proposals) | 6 |
| 4.1. | Preliminary Management Recommendations | 6 |
| 4.2. | Future Inspections | 6 |
| 4.3. | Tree Protection Status – Site Specific | 6 |
| | Tree Protection – General Notes | 6 |
| 4.4. | | |
| 4.5. | Species Present – Additional Information | 7 |
| - | Arboricultural Impact Accommont | 8 |
| 5. | Arboricultural Impact Assessment | |
| 5.1. | Overview | 8 |
| 5.2. | Tree Removal | 8 |
| 5.3. | Mitigation Planting | 9 |
| 5.4. | Impact on Tree Canopies | 9 |
| 5.5. | Impact on Tree Roots | 9 |
| 5.6. | Impact on Tree Roots | 10 |
| 5.7. | Hazardous Materials | 10 |
| 5.8. | Cabins and Site Facilities | 10 |
| 5.9. | Counts and site requireds Boundary Treatments | 10 |
| 5.10. | Bunitary i reading its son the Development | 10 |
| | | |
| 5.11. | Summary | 10 |
| 6 | Mathad Statement | 12 |
| 6. | Method Statement | |
| | Section A: Introduction and Overview | 12 |
| 6.1. | Definition of Terms | 12 |
| 6.2. | Tree Protection Barriers - Overview | 12 |
| 6.3. | Planning Status | 12 |
| 6.4. | Planning Status | 13 |
| 6.5. | Timing of Operations | 13 |
| 0.5. | Section B: Restrictions on Activities - Specific Zones | 14 |
| | Section II. residentian Torons | 14 |
| 6.6. | Construction Exclusion Zones | |
| 6.7. | Restricted Activity Zone A | 14 |
| 6.8. | Restricted Activity Zone B | 15 |
| | Section C: Restrictions on Activities – Throughout the Site | 15 |
| 6.9. | Installation of New Access Drives | 15 |
| 6.10. | Canopy Protection | 15 |
| 6.11. | Site Hoarding | 15 |
| 6.12. | Fence Posts | 16 |
| 6.13. | Demolition and Initial Ground Works | 16 |
| 6.14. | Underground Services | 16 |
| 6.15. | Lighting, Bollards, CCTV and associated Cables | 16 |
| | Use of Heavy Plant | 17 |
| 6.16. | Ose of Heavy Frant Siting of Cabins and Storage of Materials | |
| 6.17. | Siting of Cabins and Storage of Materials | |
| 6.18. | Pedestrian Paving | 17 |
| 6.19. | Hazardous Materials | 17 |
| | Section D: Post-Construction Phase | 18 |
| 6.20. | Removal of Tree Protection Barriers | 18 |
| 6.21. | Landscaping | 18 |
| | | |
| 7. | Site Inspection | 18 |
| 7.1. | Site Inspection Inspection Schedule | 18 |
| | | |
| 8. | Tree Works Schedule | 19 |
| 8.1. | Tree Works Specification | |
| | | |
| 9. | Tree Protection Barriers Detailed Specification | 20 |
| 9.2. | The In-Ground System | 20 |
| | The in critoria systell | 20 |
| 9.3. | The Back-Stay System | |
| 9.4. | The Barrier-Mesh System | 21 |
| 9.5. | Notices | 21 |
| 10. | Ground Protection Measures Detailed Specification | 22 |
| 11. | Photographs | 23 |
| | | |
| 12. | Signature | 25 |
| | · | |
| | | |
| Append | ndix 1: BS 5837: 2012 – Guidance Notes | 26 |
| Append | ndix 2: Explanation of Tree Data & Glossary | 28 |
| | | |
| Append | ndix 3: Survey Methodology | 32 |
| Append | ndix 4: Author's Qualifications | 32 |
| | | |
| | ndix 5: Further Information | 33 |
| Append | ndix 6: Tree Data Schedule and Site Plans | 34 |

Crown Ref: 09302 Site: 32 Glenilla Road, Belsize Park

Author: Ivan Button Date: 15th Febuary 2021

1. Introduction

1.1. Instruction

1.1.1. We are instructed by Adam Khan Architects to undertake an Arboricultural Survey at 32 Glenilla Road and produce our findings in a report. We are also instructed to assess the likely impact of development proposals and produce a Method Statement detailing how trees shall be protected from the proposed construction activity.

1.2. Scope and Purpose of the Report

- 1.2.1. This report is designed to accompany a planning application for development proposals at the above site. Its purpose is to assist and inform the planning process. It is produced according to the guidance and recommendations within BS 5837: 2012 Trees in Relation to Design, Demolition and Construction.
- 1.2.2. The Method Statement should be viewed as a *Heads of Terms* Method Statement which specifies the general principles to be adopted during construction and demolition. However, specific construction activities proposed within Root Protection Areas may need to be agreed in more detail if requested by the local authority at the reserved matters stage (for an outline planning applications) or via planning conditions.

1.3. References

1.3.1. We have liaised with the project architect throughout the writing of this report in order to attain an adequate understanding of the project to enable us to carry out an accurate assessment of the proposals and to specify suitable tree protection measures.

1.4. Drawings

- 1.4.1. The tree locations shown on the accompanying plans which are reproduced in Appendix 6 are based on a measured plan of the site supplied to Crown Consultants. This plan had the tree positions already plotted. Where applicable, additional trees have been plotted by us according to measurements taken on site.
- 1.4.2. The *Tree Constraints Plan* shows the existing layout. For each tree the stem location is indicated and scaled according to its diameter, the canopy is indicated according to measurements taken along the four cardinal points of the compass. Root protection areas (RPAs) are indicated which are calculated according to the guidelines within BS 5837 (2012).
- 1.4.3. The *Impact Assessment Plan* indicates the tree constraints with the proposals overlaid. Where applicable, this plan shows where works are proposed in Root Protection Areas and which trees are to be pruned or removed. This plan accompanies the Impact Assessment which is to be found in Section 5.
- 1.4.4. The *Tree Protection Plan* shows the protection measures that are to be installed during the construction phase. This plan accompanies the Method Statement which is to be found in Section o.

Crown Ref: 09302 Site: 32 Glenilla Road, Belsize Park

Author: Ivan Button Date: 15th Febuary 2021

2. Site Overview

2.1. Brief Description (Existing Layout)

- 2.1.1. The site co-ordinates are 51.548377° -0.167804° and the altitude is approximately 67m above sea level. (Co-ordinates may be pasted or typed into the following site: http://maps.google.co.uk/ where maps, satellite imagery and street views may be accessed).
- 2.1.2. Our survey covered the area indicated in Figure 1.



Figure 1 Extent of the survey (image is not current).

- 2.1.3. The site comprises a detached building with a small garden to front and rear.
- 2.1.4. Our survey area encompassed all trees within the site and any trees close to it that could potentially be affected by works within the site.
- 2.1.5. The Tree Constraints Plan and Tree Data Schedule should be referred to for descriptions and locations of all trees.
- 2.1.6. Photographs of the site are included in Section 11.

2.2. Soils

2.2.1. Geological maps (http://mapapps.bgs.ac.uk/geologyofbritain/home.html) indicate that the underlying geology of the area is clay (London Clay) with no recorded superficial deposits. This means that soils throughout the site are likely to be susceptible to compaction and the root systems are likely to be relatively shallow.

Crown Ref: 09302 Site: 32 Glenilla Road, Belsize Park

Author: Ivan Button Date: 15th Febuary 2021

3. Tree Survey and Data Schedule

This page is largely generic. Tree officers and other persons familiar with arboricultural reports may go straight to the following section and refer to the tree data in Appendix 6.

3.1. Survey Details

- 3.1.1. A ground level survey was undertaken on the 2nd May 2015. The survey was conducted by Ivan Button. No climbed inspections or specialist decay detection were undertaken. Only trees with a stem diameter over 75mm were included, which lie within the site boundary or relatively close to it.
- 3.1.2. Where applicable, trees with significant defects have been highlighted and appropriate remedial works have been recommended. However, this report should not be seen as a substitute for a full *Safety Survey* or *Management Plan* which are specifically designed to minimise risk and liability associated with responsibility for trees.
- 3.1.3. Wherever possible, dimensions are obtained using diameter tapes, logger's tapes, distometers and clinometers. Where obstacles prevent accurate measurement, dimensions are estimated. Trees on privately owned third party are surveyed from the best available vantage point and observations relating to the condition of these trees should be treated accordingly. All height measurements should be regarded as approximate.

3.2. Data Schedule

- 3.2.1. The findings of the survey are presented in The Tree Data Schedule which is provided as a separate document as well as being appended to the end of this document within Appendix 6.
- 3.2.2. The Schedule includes scaled tree images based on measurements recorded for stem diameter, crown spread, crown height and overall height. Their purpose is to indicate, at a glance, the relative dimensions of each tree.
- 3.2.3. A definition of the Retention Categories can be found in Appendix 1. All other terms used within the Tree Data Schedule are defined and explained in Appendix 3.

3.3. RPA calculation - Single Stems & Multiple Stems

3.3.1. For single stemmed trees, the RPA is calculated according to the following formula:

RPA radius = 12 x stem diameter (measures at 1.5m above ground level)

- 3.3.2. Where a tree has more than one stem, the equivalent-single-stem diameter is usually recorded. This is calculated by adding the squares of the stems and then finding the square root of this total. The radius of the Root Protection Area is then calculated by multiplying the equivalent-stem-diameter by 12.
- 3.3.3. Occasionally this method is not appropriate (e.g. for coppiced specimens where there are numerous stems). In such cases the diameter at ground level may be recorded or a stem diameter which would provide a suitable Root Protection Area calculation. The form of the tree is recorded in the notes section.

Crown Ref: 09302 Site: 32 Glenilla Road, Belsize Park

Author: Ivan Button Date: 15th Febuary 2021

4. Vegetation Overview (independent of proposals)

This section summarises all the recommendations within the Tree Data Schedule regardless of whether trees are to be retained, felled or pruned to facilitate the proposed development. It does not specify works that may be required to facilitate the development proposals. The protection status of the trees is also reported in this section.

4.1. Preliminary Management Recommendations

4.1.1. The trees were all deemed to be in an acceptable condition and no significant defects were observed. Consequently, no remedial works have been recommended.

4.2. Future Inspections

4.2.1. The table below suggests a schedule of future inspections based on the condition and location of each tree:

| Inspection | Tree Number |
|------------|---|
| Frequency | |
| (years) | |
| 0.5 | None |
| 1 | None |
| 1.5 | None |
| 3 | T1, T2, T3, T4, T5, T6, T7, T8, T9, T10 |

4.2.2. The trees should be inspected sooner if there is a noticeable decline in their condition, or following extreme weather events.

4.3. Tree Protection Status – Site Specific

- 4.3.1. On 5th May 2015, we were informed, by Tony Young of London Borough of Camden that:
 - The site is within the Belsize Park Conservation Area.
 - There are no tree preservation orders affecting trees within the site.
 - There are no tree preservation orders immediately adjacent to the site.

4.4. Tree Protection – General Notes

- 4.4.1. Where trees are located in a conservation area, works are not permitted without first giving the local authority 6 weeks' notice of intention. During this time the local authority may elect to create a tree preservation order or to inform the applicant that they have no objection to the proposed works. If the local authority does not respond within 6 weeks, then the intended work may be undertaken. Note: the local authority cannot refuse consent for works to trees within a conservation area; they may only create a tree preservation order if they wish to have further control over what works are undertaken.
- 4.4.2. Where planning permission is granted and tree works have been approved as part of the planning consent, no further application is required in respect of protected trees and no further notice is required in respect of trees within a conservation area.

Crown Ref: 09302 Site: 32 Glenilla Road, Belsize Park

Author: Ivan Button Date: 15th Febuary 2021

4.5. Species Present – Additional Information

4.5.1. The table below contains general information about the tree *species* (rather than the actual tree *specimens*) included in the survey. Its purpose is to assist readers who are unfamiliar with the characteristics of the various species.

| Species | Typical Height at Maturity (m) | Typical Canopy Spread at Maturity (m) | General Notes |
|-------------------|--|---|--|
| Apple | 6 | 8 | Deciduous tree native across Europe and W. Asia. Hundreds of cultivars available due to its popular fruit. Flowers white, pink or red in spring. Some species will self pollinate. Most species have a relatively untidy habit. Older specimens are susceptible to a variety of rusts, moulds and cankers. Excellent habitat tree. Visit https://www.pfaf.org/user/Plant.aspx?LatinName=Malus+domestica for more info. |
| Beech | 25 | 18 | Deciduous tree native to W and S Europe. Does not have resilient heartwood, therefore typically lives for 100 - 150 years before decay may cause structural failure if unmanaged. Can be an extremely attractive tree at maturity due to its size and majesty. Young branches may retain their foliage through winter as is evidenced in beech hedges. Visit http://www.pfaf.org/user/Plant.aspx?LatinName=Fagus+sylvatica for more info. |
| Cherry | 8 | 10 | Many cultivars available, bred for their abundance of spring flowers, edible cherries or ornamental bark (e.g. Tibetan Cherry). Usually white or pink flowering, often in very early spring. Usually with a single bole to around 2.5m and multi-stemmed thereafter. Most varieties have excellent autumn colour. |
| Elder | 8 | 8 | Deciduous tree native throughout Europe, N Africa and W Asia. Untidy, shrubby habit. Very fast growing. Covered in dense creamy flowers and deep red berries which are excellent for making wine. Visit http://www.pfaf.org/user/Plant.aspx?LatinName=Sambucus+nigra for more info. |
| Holly | 16 | 12 | Evergreen tree native across Western Europe. Many cultivars available, often with variegated leaves. Females produce bright red berries. Good wildlife value. Visit https://www.pfaf.org/user/Plant.aspx?LatinName=llex+aquifolium for more info. |
| Lawson Cypress | 40 | 10 | Erect, narrowly conical evergreen tree native to Southwest Oregon and N. W. California. Introduced to Britain in the 1850's and now a common tree in gardens and parks. Makes an excellent dense hedge. Many varieties are available including golden and miniature varieties. Easily distinguished from Leyland cypress by the presence of small cones. Visit https://www.pfaf.org/user/Plant.aspx?LatinName=Chamaecyparis+lawsoniana for info. |
| Sycamore | 25 | 16 | Deciduous tree native to S. Europe, widely naturalised in the UK. Often regarded as a weed species due to its invasive nature and ability to tolerate most conditions. Responds well to pruning. Not a good tree to park beneath in summer due to the sticky sap secreted by aphids. Visit https://www.pfaf.org/user/Plant.aspx?LatinName=Acer+pseudoplatanus for more info |

4.5.2. The figures quoted regarding typical height and canopy spread should be treated as approximate. Actual heights and spreads vary according to several environmental factors such as soil conditions, climate and presence of competing vegetation. The figures quoted are not the maximum dimensions that the species may attain.

Crown Ref: 09302 Site: 32 Glenilla Road, Belsize Park

Author: Ivan Button Date: 15th Febuary 2021

5. Arboricultural Impact Assessment

5.1. Overview

5.1.1. It is proposed to demolish the existing buildings and construct a pair of semi-detached residences. These shall occupy four floors including a basement and rooms within the roof space. A sunken garden shall provide light to the basement.

5.1.1. The table below summarises the potential impact on trees due to various activities.

| Activity | Trees Potentially Affected |
|------------------------------------|--|
| Tree Removal: Retention Category A | None |
| Tree Removal: Retention Category B | None |
| Tree Removal: Retention Category C | T1, T2, T5, T7, T8, T9, T10 |
| Tree Removal: Retention Category U | None |
| Tree Pruning | Т6 |
| RPA: Foundations | T3 |
| RPA: New Surface | None |
| RPA: Underground Services | None |
| RPA: Change of Ground Levels | None |
| RPA: Soil Compaction | T3, T4 and T6 (preventable by installing tree protection measures) |

- 5.1.2. Other potentially damaging activities often associated with construction sites include demolition or the careless use of plant machinery, hazardous materials, or fires.
- 5.1.3. All of the above potential impacts are considered in detail throughout this section. Section 6 specifies the measures proposed to minimise all possible potential risks of damage to the retained trees.

5.2. Tree Removal

- 5.2.1. All trees to be removed are indicated on the Tree Removal Plan and are listed below:
 - Retention Category A: Our survey did not identify any Retention Category A trees.
 - Retention Category B: Our survey did not identify any Retention Category B trees.
 - **Retention Category C:** It is proposed to remove the following Retention Category C trees: T1, T2, T5, T7, T8, T9 and T10.

These are all relatively small trees – the tallest being a 12m tall Lawson cypress (T1) which is located within the rear garden where it is hidden from public vantage points. T2 is a 6m tall cherry which is also located close to the rear of the site. T5 is a young beech located at the rear of the site. T7 and T8 are Elder shrubs. T9 and T10 are 3.5m tall apple trees. None of these trees/shrubs are protected by a tree preservation order or considered worthy of special protection, or are considered to be a material planning consideration.

• Retention Category U:

Our survey did not identify any Retention Category U trees.

5.2.2. Details specific to each tree can also be found in the Tree Data Schedule.

Crown Ref: 09302 Site: 32 Glenilla Road, Belsize Park

Author: Ivan Button Date: 15th Febuary 2021

5.3. Mitigation Planting

5.3.1. The site offers some opportunity for the planting of small additional new trees as part of a post development landscaping scheme.

5.4. Impact on Tree Canopies

- 5.4.1. The semi-mature sycamore growing on third party land (T6), will require some minor pruning of the overhanging branches to improve lighting levels in the rear garden. We recommend the lower overhanging branches are crown lifted and the upper overhanging branches are reduced back to a distance of 4.5 5m beyond the boundary.
- 5.4.2. The canopies of all other retained trees are located sufficiently far from proposed building works and sufficiently high over access routes throughout the site that they shall not be impacted upon by any construction activity. Restrictions are placed on activities throughout the site to ensure that no canopies are accidentally damaged see Section 6.10.

5.5. Impact on Tree Roots

5.5.1. No building works or ground disturbance is proposed within the Root Protection Area of any retained tree.

5.5.2. **Foundations:**

- 5.5.3. The foundations for the new basement will extend into to the very edge of the theoretical Root Protection Area of T3. However, only circa 1% of the Root Protection Areas shall be affected (see the Impact Assessment Plan), so the potential impact is considered to be negligible.
- 5.5.4. In order to ensure that the basement does not impact on more than the RPA than is necessary, is it proposed to install the basement in a manner that does not disturb any of the soils beyond the footprint of the basement. This may be done via contiguous piling, sheet piling, pinning or any similar method which restricts excavation to the basement footprint.
- 5.5.5. **New Surfaces:**
- 5.5.6. No new surfaces are proposed within the Root Protection Areas of any trees.
- 5.5.7. **Underground Services:**
- 5.5.8. No underground services are to be installed through any Root Protection Areas.
- 5.5.9. Changes in Ground Levels:
- 5.5.10. No changes to ground levels are proposed over Root Protection Areas.
- 5.5.11. **Soil Compaction:**
- 5.5.12. The majority of tree roots lie within the upper soil horizons. This is because the availability of oxygen decreases with depth and roots need to breathe to stay alive. In addition, nutrients are more readily available in the form of organic matter close to the soil surface.
- 5.5.13. Healthy soils contain about 25% air space between solid particles. Increased loading of the soils caused by construction activity causes air to



Crown Ref: 09302 Site: 32 Glenilla Road, Belsize Park

Author: Ivan Button Date: 15th Febuary 2021

be squeezed out as the soil becomes compacted preventing roots from breathing. Even an increase in pedestrian activity may cause some soil compaction.

In order to minimise any negative impact due to soil compaction, or contamination, on the roots of T3, T4 and T6, it will be necessary to ensure that a suitable load spreading surface is in place at all times during the demolition and construction phases. Where applicable, existing hard surfaces may be retained; otherwise ground protection measures shall be installed as specified in Section 10. This shall be fully in accordance with industry best practice as specified in BS 5837 (Section 6.2.3).

5.6. Demolition Activities

The tree protection measures specified within Section o should be installed prior to the commencement of all demolition activities (including soil stripping) to prevent any detrimental impact on tree health. Where this is not practicable, demolition of structures within Construction Exclusion Zones shall be undertaken very early on in the demolition phase and the protective barriers installed immediately thereafter.

5.7. Hazardous Materials

5.7.1. All hazardous materials (including cement and petrochemical products) will need to be controlled according to COSHH regulations in order to ensure there is no detrimental impact on tree health. Provision shall need to be made to ensure that cement and cement run-off are contained outside of all Root Protection Areas.

5.8. Cabins and Site Facilities

- 5.8.1. Consideration should be given to the location of any site welfare facilities in terms of potential impact on trees. Where it is proposed to install cabins or site facilities in Root Protection Areas, the appointed arborist should be consulted and approval obtained from the local authority.
- 5.8.2. There is limited room for the siting of cabins and storage of materials / spoil during the construction phase so the logistics of the development shall need to be well organised to ensure that there is adequate space outside of the Tree Protection Zones for construction activity.

5.9. Boundary Treatments

5.9.1. If it is proposed to amend any boundary features over RPAs, the appointed arborist should be consulted and if necessary, approval obtained from the local authority.

5.10. Impact of Retained Trees on the Development

5.10.1. No tree canopies shall be closer to the proposal than they are to the existing building so the proposal shall not result in an increase in the perceived nuisance afforded by the trees.

5.11. Summary

- 5.11.1. In order to facilitate the development, it is proposed to remove seven Retention Category C trees which are located throughout the site. These are all relatively small trees and most are hidden from public vantage points. Consequently the impact of tree removal on local amenity shall be minimal.
- 5.11.2. Minor pruning works are recommended to the overhanging branches of T6 to increase lighting levels in the rear garden.
- 5.11.3. No hard surfacing is proposed in RPAs.



Crown Ref: 09302 Site: 32 Glenilla Road, Belsize Park

Author: Ivan Button Date: 15th Febuary 2021

5.11.4. Foundations are proposed within the Root Protection Area of T3. However, the small extent of RPA affected coupled with the sympathetic foundation design shall ensure no detrimental impact on this tree. A suitable load spreading surface shall need to be maintained throughout the Restricted Activity Zone.

- 5.11.5. Tree protection measures are specified throughout Section <u>6</u> that will ensure no negative impact on retained trees due to construction activity.
- 5.11.6. Adequate space has been allowed between the proposal and all trees such that no future pressure to overly-prune or remove trees shall occur as a consequence of the proposal.

Crown Ref: 09302 Site: 32 Glenilla Road, Belsize Park

Author: Ivan Button Date: 15th Febuary 2021

6. Method Statement

Section A: Introduction and Overview

6.1. Definition of Terms

- 6.1.1. Some terms used within the Arboricultural Method Statement have very specific meanings. These are defined below:
- 6.1.2. **Root Protection Area (RPA).** This is a theoretical area of ground around a tree where the roots are likely to proliferate. Ground disturbance in this area should be minimised in order to avoid significant impact on tree health. RPAs are indicated on all plans accompanying this report as a pink line.
- 6.1.3. **Construction Exclusion Zone (CEZ).** These zones are created to protect roots and canopies form inadvertent damage by construction activity see Section <u>6.6.</u> -Construction Exclusion Zones. They are usually fenced off by protective barriers throughout the entire construction phase. No works are permitted in these zones other than minor landscaping works which do not require a change in ground level. Where practicable the entire Root Protection Area and the area beneath the tree canopy shall be treated as a Construction Exclusion Zone. These zones are hatched purple on the Tree Protection Plan.
- 6.1.4. **Restricted Activity Zone (RAZ).** It is not always possible to create a Construction Exclusion Zone over the entire RPA. This is because access may be required or some works may be proposed within the RPA. In such circumstances a Restricted Activity Zone is created where limitations are placed on construction activity. Ground protection measures may be specified or the Restricted Activity Zone may be fenced off throughout part of the construction phase. See the legend on the Tree Protection Plan to identify these zones.

6.2. Tree Protection Barriers - Overview

6.2.1. The Tree Protection Plan indicates the location of all proposed tree protection barriers according to the following legend and overview:

| Symbol on Tree Protection Plan | Barrier type See Section 9 | Location |
|-----------------------------------|---|--|
| | In-Ground System or Back-Stay System | Around the Construction Exclusion Zones, close to where construction activity is proposed. As indicated on the Tree Protection Plan. |
| | Back-Stay System | N/A |

- 6.2.2. The barriers shall be installed prior to the commencement of any construction activity including soil stripping and delivery of materials. A detailed specification of the barriers can be found in Section \underline{o} .
- 6.2.3. The tree protection plan also indicates where ground protection measures shall be installed as specified in sections <u>6.7</u> onwards (Restricted Activity Zones) and Section <u>10</u>–Ground Protection Measures.

6.3. Planning Status

6.3.1. Tree protection measures specified within this report should be agreed with the local authority so that they may be conditioned upon planning consent.

Crown Ref: 09302 Site: 32 Glenilla Road, Belsize Park

Author: Ivan Button Date: 15th Febuary 2021

6.3.2. The site manager must be familiar with all aspects of this Method Statement and should liaise with the author of this report for clarification, or regarding any unforeseen issues where trees may be impacted upon.

6.3.3. A copy of this Method Statement shall be available on-site at all times. All personnel working on the site shall be made aware of any sections appertaining to their work. This includes short term contractors and persons responsible for deliveries and installation of services.

6.4. Overview of Protection Measures

6.4.1. Below is a list of potential arboricultural impacts and a summary of the proposed protection measures:

| Reference | Comments | Potential Impact | Protection measures |
|--------------------------------|---|---|---|
| T3, T4, T5, T6 | Access is required over the Root Protection Area. | Compaction and contamination adjacent to proposed works. | Restricted Zone A created and ground protection measures to be installed before commencement, and maintained throughout the project. Construction exclusion zone to be created over remainder of Root Protection Area. See Section 6.7 for all restrictions that apply. |
| Т3 | Basement to be installed in RPA. | Excessive root severance if excavation extends significantly into the Root Protection Area. | Soils beyond the basement footprint to be retained undisturbed. To ensure this, contiguous piling, sheet piling, pinning, or a similar method shall be adopted. |
| All other retained trees | No works proposed in Root Protection Areas. | Compaction and contamination from general construction activity. | Protective fencing installed as specified in Section of and Construction Exclusion Zone created where appropriate. No works permitted in Exclusion Zone. |

6.4.2. The above measures are described in more detail throughout the remainder of this section.

6.5. Timing of Operations

6.5.1. Activity within the site shall be phased according to the following chronology:

| Order | Phase | Activity |
|-------|-----------------------|---|
| 1st. | Pre- | Undertake all specified tree pruning and removal (see Section of Tree Works Schedule). |
| 2nd. | Construction | Install the tree protection barriers (see Tree Protection Plan and Section <u>o</u> -Tree Protection Barriers.) |
| 3rd. | Phase | Install ground protection measures or retain existing hard surface (see Tree Protection Plan and Section 10 -Ground Protection Measures) |
| | Prote | ection measures confirmed acceptable by the local authority |
| 4th. | Construction | Demolish existing structures and remove existing surfaces where applicable. |
| 5th. | Phase | Install new buildings, hard surfaces and services taking into account restricted activities as specified in Sections <u>6.6</u> onwards |
| 6th. | Post- | Remove protective barriers (fencing and ground protection measures as applicable). |
| 7th. | Construction Phase | Undertake restricted landscaping operations within Root Protection Areas, including boundary treatments, pedestrian surfaces, decking and any proposed tree planting. |

Crown Ref: 09302 Site: 32 Glenilla Road, Belsize Park

Author: Ivan Button Date: 15th Febuary 2021

Section B: Restrictions on Activities – Specific Zones

6.6. Construction Exclusion Zones

- 6.6.1. Within Construction Exclusion Zones (shaded purple on the Tree Protection Plan) the following restrictions shall apply:
 - Fencing shall be erected and maintained throughout the entire project as indicated on the Tree Protection Plan and specified in Section <u>o</u> -Tree Protection Barriers.
 - No construction activity whatsoever shall occur.
 - No tree works, other than those specified in this report shall be undertaken.
 - No alterations of ground levels or conditions.
 - No chemicals or cement washings permitted.
 - No excavation whatsoever.
 - No temporary structures.
 - No spoil shall be stored.
 - No fires shall be permitted.
 - All hazardous materials (including non-essential cement products) shall be forbidden.
- Any hard surfaces that require removal shall be removed prior to the installation of the protective fencing or following all other major construction activity and the removal of the fencing. Surfaces shall be removed using hand tools or mechanical excavators operating from outside the Construction Exclusion Zone and marshalled by the appointed arborist.
- 6.6.3. Ground disturbance shall be limited to a depth of 100mm or the depth of any hard surfacing and the associated sub-base.

6.7. Restricted Activity Zone A

- 6.7.1. Within this zone (indicated on the Tree Protection Plan) trees roots are likely to be present and access will be required to facilitate construction. The following restrictions shall apply:
 - Removal of existing structures such as, walls, steps and hard surfaces shall be undertaken using hand tools or a mechanical excavator operating from outside the Restricted Activity Zone and carefully marshalled by an appointed arborist.
 - No new permanent or temporary structures shall be erected without written approval from the local authority.
 - A suitable load spreading surface shall be installed and/or maintained as specified in Section 10 Ground Protection Measures. This shall remain in place throughout the entire construction phase.
 - Existing ground levels shall be retained undisturbed or raised by no more than 150mm. Ground levels may only be raised using granular topsoil (not rich in clay) or where new surfacing is proposed.
 - No excavation shall occur in this zone without consulting the appointed arborist and obtaining approval from the local authority.
 - Storage of materials shall be limited to that which is required for the task in hand. Heavy materials that require storage for more than two days shall be stored outside the Restricted Zone.
 - No machinery in excess of 2.5m tall shall pass through or operate in this zone unless carefully marshalled in order to avoid damage to branches.

Crown Ref: 09302 Site: 32 Glenilla Road, Belsize Park

Author: Ivan Button Date: 15th Febuary 2021

6.8. Restricted Activity Zone B

- 6.8.1. Within this zone (indicated on the Tree Protection Plan) it is proposed to excavate for the basement. Either contiguous piling (or sheet piling) shall be installed along the edge of the basement, or an alternative method shall be adopted which does not disturb soils beyond the footprint of the basement (e.g. pinning). A typical method of pinning would be to excavate to a specified depth (e.g. 1m), install shuttering and then cast the concrete basement walls. Then to excavate short sections beneath this wall and cast deeper concrete. Then to excavate in between these deeper sections and infill with concrete. In this manner excavation may continue to any specified depth without disturbing soils beyond the footprint of the build.
- 6.8.2. The specific method adopted will vary between contractors. However, the following restrictions will apply and must be adhered to:
 - No excavation or ground disturbance shall occur beyond the footprint of the basement.
 - Where a small excavator is used, it shall operate from within the footprint of the basement.

Section C: Restrictions on Activities - Throughout the Site

6.9. Installation of New Access Drives

6.9.1. Any new access drives shall not pass through any Root Protection Areas therefore no restrictions on their design or installation are required from an arboricultural perspective.

6.10. Canopy Protection

- 6.10.1. In order to protect tree canopies the following restrictions shall apply throughout the site:
 - No machinery in excess of 2.5m shall pass beneath the canopy of any tree without being carefully marshalled in order to ensure that no branches are damaged.
 - If materials require installation or delivery beneath tree canopies, this shall be done without the use of overhead cranes.
 - If materials are to be installed or delivered close to tree canopies (but not beneath them) and a crane is required, they shall be carefully marshalled in order to ensure that branches are not accidentally damaged.

6.11. Site Hoarding

- 6.11.1. If site hoarding shall be installed over the Root Protection Area of any tree, the following restrictions shall apply:
 - Ground levels shall be maintained as existing.
 - Post holes shall not exceed 300mm x 300mm.
 - No post hole shall be excavated within 1.5m of any tree stem.
 - Post holes shall be excavated using hand tools or by a post-hole auger attached to plant machinery sited outside the Root Protection Area(s).
 - Roots in excess of 25mm shall be retained wherever possible.
 - Roots in excess of 10mm shall be pruned with sharp secateurs.

Crown Ref: 09302 Site: 32 Glenilla Road, Belsize Park

Author: Ivan Button Date: 15th Febuary 2021

- Pruning shall be minimal and only undertaken where absolutely necessary to facilitate the site hoarding. It shall be undertaken by a reputable tree surgeon working to BS 3998 (2010).
- Cement products shall be mixed away from Root Protection Areas (see Section 6.19 -Hazardous Materials).
- 6.11.2. Site hoarding may be installed in place of the specified tree protection measures subject to the approval of the local authority with regard to its location and specification.

6.12. Fence Posts

- 6.12.1. If permanent fencing is to be installed within Root Protection Areas, the following restrictions shall apply:
 - All post holes shall be excavated by hand and kept as narrow as possible (maximum diameter 300mm).
 - Exploratory post holes shall be dug before committing to post / panel positions. If any roots in excess of 25mm are encountered they are to remain intact and the post hole shall be relocated slightly. The fencing system must permit such flexibility (i.e. where fixed panel widths are used, all post holes must be excavated before committing to the final location).
 - Any roots in excess of 10mm which are severed shall be neatly pruned back with secateurs. This will encourage healing and reduce the likelihood of infection.
- 6.12.2. Walls shall be avoided over Root Protection Areas unless their foundations may be spanned over roots using a beam system.
- 6.12.3. Hedges may be planted within Root Protection Areas using hand tools to minimise excavation.

6.13. Demolition and Initial Ground Works

6.13.1. No demolition, removal of surfaces, or soil stripping shall commence until the protective fencing and ground protection measures are installed to the satisfaction of the local authority.

6.14. Underground Services

6.14.1. No underground services shall pass through any part of the *Construction Exclusion Zones* or *Restricted Activity Zones* unless done so in a manner detailed in a specific Method Statement and approved by the local authority.

6.15. Lighting, Bollards, CCTV and associated Cables

- 6.15.1. If any of the above are to be installed close to tree canopies or within Root Protection Areas of retained trees; installation methods shall be detailed in a specific Method Statement and approved by the local authority. Consideration should be given to the following:
 - Pruning of branches to enable sufficient clearance for light and views. Branches should be removed to the *branch collar* as per British Standard 3998 (2010).
 - Post holes must be excavated by hand or using an appropriate sized auger. No other form of mechanical excavation may be used.
 - Cables should be routed in a direction directly away from the tree. It will not be acceptable to excavate a trench across any Root Protection Areas.

Crown Ref: 09302 Site: 32 Glenilla Road, Belsize Park

Author: Ivan Button Date: 15th Febuary 2021

6.16. Use of Heavy Plant

- 6.16.1. All machinery operatives are to be made aware of any Construction Exclusion Zones and Restricted Activity Zones that apply to this site (see the Tree Protection Plan and Section 6.6 onwards).
- 6.16.2. All machinery operatives are to respect these zones and ensure that no damage occurs to trees due to the careless use of machinery.

6.17. Siting of Cabins and Storage of Materials


- 6.17.1. Cabins and heavy building materials may be located or stored anywhere outside of Construction Exclusion Zones and Restricted Activity Zones.
- 6.17.2. Any proposal to install cabins or materials within these zones shall be agreed in writing with the local authority prior to installation.
- 6.17.3. It may be acceptable to locate site cabins such that they act as a tree protection barrier and replace the specified protective fencing. Where this is being considered, written approval must be sought from the local authority.

6.18. Pedestrian Paving

6.18.1. If it is proposed to install new pedestrian surfaces over Root Protection Areas, excavation shall be limited to the removal of existing turf/vegetation plus an additional 50mm. Excavation shall be undertaken using hand tools only. Porous materials are preferred but not essential if the new surface covers less than 10% of the Root Protection Area. Paving with a thickness of 50mm bedded on mortar, or sand, bearing directly onto the ground, with a finished surface level with existing ground levels will be acceptable. No retaining kerbs shall be used.

6.19. Hazardous Materials

6.19.1. Any mixing of cement based materials shall take place Construction outside the Exclusion Zones and Restricted Activity Zones. Where cement is to be mixed considerable distances from trees and water run-off cannot enter Root Protection Areas, then no further special measures required. Otherwise, provision shall be

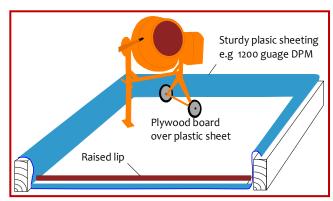

made to ensure that the mixing area is contained so that no water run-off enters the Root Protection Area of any trees (see diagram for example). Mixers and barrows shall be cleaned within this area.

6.19.2. All other chemicals hazardous to tree health, including petrol and diesel, shall be stored in suitable containers as specified by current COSHH Regulations, and kept away from Root Protection Areas.

Crown Ref: 09302 Site: 32 Glenilla Road, Belsize Park

Author: Ivan Button Date: 15th Febuary 2021

Section D: Post-Construction Phase

6.20. Removal of Tree Protection Barriers

- 6.20.1. This will be done after all major construction work is complete. Vehicular access will not be permitted within the Construction Exclusion Zones.
- 6.20.2. The local authority tree officer shall be made aware that the fencing is to be removed.

6.21. Landscaping

- 6.21.1. No machinery used within landscaping operations shall operate within the Root Protection Areas of retained trees.
- 6.21.2. Ground levels shall not be altered within Root Protection Areas without consultation and approval from the local authority.

7. Site Inspection

7.1. Inspection Schedule

- 7.1.1. In order to ensure that the trees are adequately protected it shall be necessary to confirm that the tree protection barriers are installed correctly and that a suitable load spreading surface is in place over the Restricted Activity Zone. This will be done by the local authority tree officer or an appointed arborist who will provide the tree officer with a copy of inspection details.
- 7.1.2. The following inspection schedule is suggested though the local authority may specify additional supervision where deemed necessary.

| Inspection | Attendees | Comments |
|--|---|---|
| Pre- Start To occur prior to any works taking place on the site. | N/A. | Site manager to study this Method Statement & contact the appointed arborist to agree all protection measures. |
| Pre-Construction Meeting After tree works completed & tree protection barriers / ground protection measures installed. Prior to any other activity, inc. demolition & soil stripping. | Site manager, appointed arborist and/or local authority tree officer. * | Tree protection fencing locations & specification checked. Additional ground protection measures checked. Further protection measures / restrictions agreed. |
| Intermediate Reporting Throughout the entire project. At least once per month. | N/A. | Site manager to liaise with the appointed arborist regarding any issues which may affect trees. General site photos indicating tree protection measures to be provided monthly. |
| Post-Construction Meeting Post major construction activity but prior to removal of fencing & landscaping operations. | Site manager, appointed arborist and/or local authority tree officer. | Retained trees inspected. Further landscaping operations and restrictions to be agreed. |

^{*} Where agreed with the L.A. it may be acceptable to supply photographs of the fencing to avoid the necessity for a site visit.



Crown Ref: 09302 Site: 32 Glenilla Road, Belsize Park

Author: Ivan Button Date: 15th Febuary 2021

8. Tree Works Schedule

8.1. Tree Works Specification

8.1.1. The following table specifies the tree works which will be required prior to the commencement of construction activity:

| Tree Reference | Action Required | Notes |
|--------------------------------|-----------------|---|
| T1, T2, T5, T7, T8, T9, T10 | Remove. | Stumps of trees within the RPAs of retained trees shall be removed with a stump grinder NOT a mechanical excavator. |

Crown Ref: 09302 Site: 32 Glenilla Road, Belsize Park

Author: Ivan Button Date: 15th Febuary 2021


Tree Protection Barriers

Detailed Specification

9.1.1. The purpose of tree protection barriers is to keep construction activity away from Restricted Activity Zones or Construction Exclusion Zones. They should be appropriate to the nature and proximity of activity within the site. The barriers should be erected prior to the commencement of all activity including demolition, soil stripping and delivery of materials and demolition (except where existing structures require demolition to enable the barriers to be installed). Barrier systems are specified below and should be installed according to the legend on the Tree Protection Plan.

9.2. The In-Ground System

- 9.2.1. This system may be installed where indicated by a solid purple line on the Tree Protection Plan. It should be robust enough to withstand occasional knocks by plant machinery and, once installed, shall remain in place throughout the entire construction phase.
- 9.2.2. Vertical scaffold poles are driven into the ground, onto which are affixed horizontal scaffold poles and diagonal bracing struts. Weldmesh panels (or similar - e.g. Heras type fencing panels, or 18mm+ plywood boards) are secured to this scaffold framework using sturdy clips e.g. standard scaffold clips. The system illustrated in the diagram to the right and is based on BS 5837 guidelines.

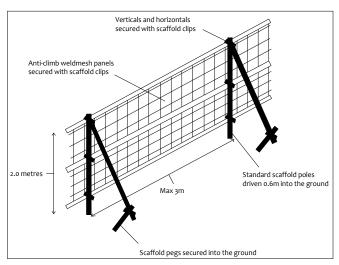


9.3. The Back-Stay System

9.3.1. This system may be installed where indicated by a solid or dashed purple line on the Tree Protection Plan. It is more practical over existing hard surfaces or where the fencing needs to be moved to enable permitted activities within a Restricted Activity Zone. This

system should be able to withstand occasional knocks by machinery and should not be relocated except with the consent of the site manager and the approval of the local authority.

9.3.2. Within this system, weldmesh fencing panels (minimum height 2m) are affixed into rubber or concrete feet and clipped together with anti-tamper couplers. Where topography permits, two couplers should be used, spaced at least 1m apart. Alternate panels should be

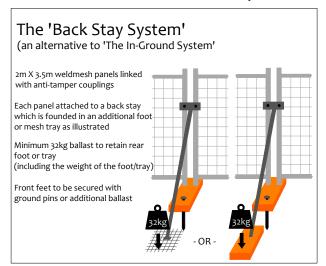

Crown Ref: 09302 Site: 32 Glenilla Road, Belsize Park

Author: Ivan Button Date: 15th Febuary 2021

attached to a diagonal back stay connected to an additional foot or baseplate secured with ground pins or additional ballast. Where ground pins are not used, the total weight of the foot/plate plus ballast should total not less than 32kg.


- 9.3.3. Alternatively, timber struts may be used to affix the panels to existing walls using brackets and screws where the fence panels are sufficiently close for this to be effective.
- 9.3.4. Where it is not possible to install diagonal struts (such as very close to a hedge) then the front feet shall be secured using ground pins or ballast.

9.4. The Barrier-Mesh System

9.4.1. Where indicated by a thick red line (solid or dashed) on the Tree Protection Plan, it shall be acceptable to install a less robust system than those specified above. This is because of the nature of construction activity or its distance from tree protection areas. The purpose of such a system shall be to demarcate the protection zone. It is not intended that such fencing will withstand knocks by

construction machinery.

9.4.2. In this system, high visibility plastic safety fencing, 1m high, minimum grade 140g/m2, is secured onto alternate wooden posts and fencing pins. Wooden posts to be located at 5m intervals, minimum dimensions 75mm.

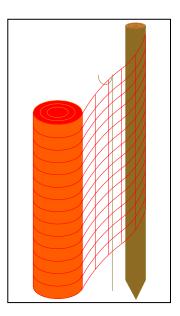

9.5. Notices

9.5.1. Suitable weather-proof notices should be displayed to identify tree protection zones. They should state the purpose of the fencing and that it should not be moved, or traversed, other than by authorised personnel.

Crown Ref: 09302 Site: 32 Glenilla Road, Belsize Park


Author: Ivan Button Date: 15th Febuary 2021

10. Ground Protection Measures

Detailed Specification

- 10.1.1. Where indicated on the Tree Protection Plan (Restricted Activity Zone), soils containing roots may be subject to compaction due to general construction activity (including pedestrian activity and use of plant machinery). In order to minimise compaction, it is proposed to ensure that a suitable load-spreading surface is in place at all times.
- Any existing hard surfacing may be retained and reinforced (where applicable and adequate), otherwise suitable new ground protection measures shall be installed. The ground protection shall need to be able to adequately spread the load of construction traffic. Where existing hard surfacing is to be retained, it shall not be necessary to install additional ground protection measures. However, the hard surfacing must be firm enough to spread the load of any traffic passing overhead.

framework secure.

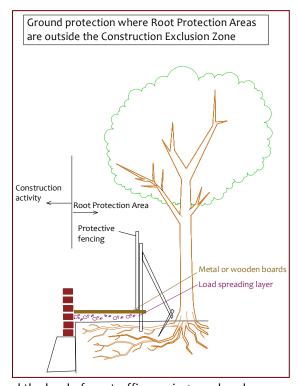

- 10.1.3. Where only pedestrian traffic will occur, the ground protection measures may be as simple as timber boards, or scaffold planks installed directly onto a geotextile fabric on the ground. The ground should first be made even by raking, or by adding a few centimetres of sand or woodchip. Alternatively the boards may be supported by a scaffold framework. The scaffold may be founded on poles driven into the ground and/or onto blocks (to raise the scaffold) with additional couplings to make the
- 10.1.4. Where only light vehicles are to operate (e.g. barrows, trolleys or occasional cars), thick wooden boards or scaffold planks should also suffice, though at least 150m of compressible woodchip will need to be installed first to help spread the load. Sturdier systems are specified below:
- 10.1.5. Where cars will regularly park or heavier vehicles/plant machinery will occasionally operate, sturdier ground protection measures will be required such as metal road plates, or purpose built synthetic road mats over a compression resistant layer such as 150mm of woodchip or 100mm of a 3D cellular confinement system in-filled with 7–40mm angular gravel (e.g. CellwebTM).
- 10.1.6. A temporary concrete slab may also be considered as a suitable load spreading platform. Where a pile driver needs to operate, a concrete slab may be the preferred option.
- 10.1.7. Where existing structures need to be removed, this shall be done with temporary ground protection measures in place to enable this to be achieved without compacting soils.
- 10.1.8. The ground protection measures shall be installed and approved before commencement of demolition and construction activity and before the arrival of plant machinery or materials. They shall remain in place until all heavy construction activity is complete or until they are due to be replaced with a new hard surface.

PDF readers select page-width for detail & page-view for scrolling Arboricultural Report to BS 5837: 2012 for: Ad

Adam Khan Architects

Crown Ref: 09302 Site: 32 Glenilla Road, Belsize Park

Author: Ivan Button Date: 15th Febuary 2021

Photographs 11.

Refer to the Tree Constraints Plan for photo locations

Photo 1.



Photo 2.



Photo 3.



Photo 4



Photo 5.



Photo 6.





Crown Ref: 09302 Site: 32 Glenilla Road, Belsize Park

Author: Ivan Button Date: 15th Febuary 2021

Photo 7.



Photo 9.



Photo 11.



Photo 8.



Photo 10.



Photo 12.



Crown Ref: 09302 Site: 32 Glenilla Road, Belsize Park

15th Febuary 2021 Author: Ivan Button Date:

Signature 12.

This report represents a true and factual account of the trees and potential impact of development along with proposed protection measures at

> 32 Glenilla Road **Belsize Park** London NW₃ 4AN

> > Signed

Ivan Button N.C.H. (Arb), FDSc (Arb), BSc (Hons), P.G.C.E., M. Arbor. A.

on behalf of

Crown Consultants Ltd

Dated

15th February 2021



Tree consultants throughout England and Wales

Crown Ref: 09302 Site: 32 Glenilla Road, Belsize Park

Author: Ivan Button Date: 15th Febuary 2021

Appendix 1: BS 5837: 2012 – Guidance Notes

This Standard prescribes the principles to be applied to achieve a satisfactory juxtaposition of trees and structures. It sets out to assist those concerned with trees in relation to design, demolition and construction to form balanced judgements.

It acknowledges the positive contribution trees may offer to a site, as well as the negative aspects of retaining inappropriate trees. It addresses the negative impacts that construction activity may have upon trees and offers mitigation strategies to minimise these impacts.

The Standard suggests a three stage approach to ensure best practice is followed when developing close to trees:

A1.1 Stage 1: Survey of Existing Trees

This identifies the existing trees on and adjacent to the site. Data is recorded for each tree and is presented in a Tree Data Schedule. Each tree is allocated a **Retention Category** according to its size, amenity value, condition and safe useful life expectancy. The categories are allocated independently of development proposals. Our interpretation of the Retention Categories is explained below:

A1.1.1 Retention Categories

A Category: Trees of high quality and amenity value. Usually, mature trees with a significant life expectancy which would enhance any development. Retention of these trees is strongly encouraged.

B Category: Trees of moderate quality and amenity value. Usually these are maturing trees or younger trees with exceptional form. Retention of these trees is desirable though the removal of occasional specimens may be acceptable.

C Category: Trees of low quality or small specimens with a relatively low amenity value. These trees are not considered to be a material planning constraint and their removal will generally be seen as acceptable in order to facilitate development.

U Category: Trees of such low quality that their removal is recommended regardless of development proposals.

A1.1.2 Occasionally trees are borderline and do not fall neatly into one of the categories A, B or C. In such cases we apply a superscript (+/-) such that:

C⁺ Indicates borderline C/B, though Category C is deemed to be most appropriate.

B Indicates borderline C/B, though Category B is deemed to be most appropriate.

A1.1.3 The British Standard suggests that each of the A, B and C categories may be further subdivided (A1, A2, A3, B1, B2, B3 etc) such that subcategory 1 denotes mainly arboricultural values, subcategory 2 denotes mainly landscape values and subcategory 3 denotes mainly cultural values (including conservation). Multiple subcategories may be used.

Our experience suggests that these subdivisions lack clarity and can be confusing. Within this report subcategories are **not** denoted. Where appropriate, the use of phrases such as 'Part of a formal group', or 'Has a high ecological value', or 'Offers good screening to the site' are incorporated into the observation section of the Tree Data Schedule. We believe this conveys all relevant landscape and cultural information without any confusion.

A1.1.4 **Tree Constraints Plan (TCP).** This indicates the position, crown spread, Retention Category and Root Protection Area of each tree. It is used to inform where development may proceed without causing damage to trees.

Crown Ref: 09302 Site: 32 Glenilla Road, Belsize Park

Author: Ivan Button Date: 15th Febuary 2021

A1.1.5 **Root Protection Area (RPA).** This is the area around each tree likely to contain the majority of roots. It should ideally remain undisturbed to avoid a detrimental impact on tree health. For single stemmed trees It is calculated according to the formula "radius of RPA" = "12 x stem diameter". For multiple-stemmed trees a more complex formula is used which may occasionally produce an RPA which seems inappropriately large relative to the trees canopy. This shape can then be modified to take into account site factors which influence rooting activity, e.g. foundations, soil type or impermeable surfaces. Where development works are proposed within the RPA they should be undertaken in a sympathetic manner to minimise root disturbance.

A1.1.5 **Shade Constraints.** The previous Standard (BS 5837 2005) suggested that shade constraints should be indicated on the TCP. This are denoted as a circle-segment drawn northwest to due east with a radius equal to the height of the tree. These do not represent the actual shade pattern which varies through the seasons. Rather, they indicate the area most shaded by the tree throughout the course of the year. Ideally habitable room windows should be located outside of these shade constraints. Where we consider it appropriate, we will include shade constraints information on our Impact Assessment Plan or Proposed Layout Plan.

A1.2 Stage 2: Arboricultural Impact Assessment

After the initial survey and the production of the Tree Constraints Plan, arborists and designers are encouraged to work together to establish a design proposal with minimal impact on the high quality trees. An assessment should be made of all possible impacts including the impact that the trees may have upon the proposal. The arborist may recommend mitigation strategies to minimise these impacts and help achieve a more harmonious juxtaposition between buildings and trees.

A1.3 Stage 3: Arboricultural Method Statement

This type of report specifies the measures necessary to protect trees against damage from construction activity. The Method Statement should be written in a manner that it may be conditioned and enforced by the local authority upon granting of planning permission. The site manager should be familiar with all aspects of the Method Statement and should ensure that all persons working on the site are aware of those aspects which appertain to their work. This includes service installation engineers and operators of plant machinery.

32 Glenilla Road, Belsize Park Crown Ref: 09302 Site:

Author: Ivan Button Date: 15th Febuary 2021

Appendix 2: Explanation of Tree Data & Glossary

This section explains the terms used in the Tree Data Schedule (see Section 3 and Appendix 6).

General Observations A4.1

Numbering System: Each item of vegetation has its own unique number prefixed by a letter such that T1=Tree 1, G2=Group 2, H3=Hedge 3 and A4.1.1

W4=Woodland 4, S5=Shrub 5.

A4.1.2 Age Categories:

> Usually less than 10 years old. Young

Semi-Mature Significant future growth to be expected, both in height and crown spread (typically below 30% of life expectancy). Early-Mature $Full\ height\ almost\ attained.\ Significant\ growth\ may\ be\ expected\ in\ terms\ of\ crown\ spread\ (typically\ 30-60\%\ of\ life\ expectancy).$ Mature Full height attained. Crown spread will increase but growth increments will be slight (typically 60% or more of life expectancy).

Veteran A level of maturity whereby significant management may be required in order to keep the tree in a safe condition.

Over Mature As for veteran except management is not considered worthwhile.

Common names and Latin names are given. A4.1.3

Height: Measured from ground level to the top of the crown.

A4.1.5 Stem Diameter: Taken at 1.5m above ground level where possible. On multi-stemmed trees this measurement may be taken at ground level,

though usually an indication of the number of stems and average diameter is given, e.g. 3 x 30cm.

A4.1.6 Crown Height: Measured from ground level to the height at which the main crown begins. Where the crown is unbalanced it is measured on the

side deemed to be most relevant. This is usually the side facing the area of anticipated development.

Tree Diagram: This scaled drawing is computer generated based on measurements taken for stem diameter, crown height and spread, and A4.1.7

overall height. It is designed to help the reader rapidly assess the data. It is not an accurate representation of the form of the

Crown Spread: Measured N, E, S & W, taken from the centre of the stem and usually rounded up to the nearest metre

Observations: If a tree's position is considered to be relevant it will be commented upon (e.g. overhanging a children's play area). Tree form and pruning history are also recorded along with an account of any significant defects. Defects and descriptive terms are dealt

with in more detail at the end of this section.

Recommendations A4.1.10 Usually based on any defects observed and intended to ensure that the tree is in an acceptable condition.

Priority Scale: Depending upon the threat posed by the tree, and the likelihood of failure, recommendations should be carried out according to A4.1.11

the following priority scale:

Urgent To be carried out as soon as possible. Very High . To be carried out within 1 month. High To be carried out within 3 months. Moderate To be carried out within 1 year. To be carried out within 3 years

Inspection Frequency: A4.1.12

An interval of 6 months, 1 year, 1.5 years or 3 years is allocated before the next inspection is due. Wherever practical, consideration should be given to seasonal changes so that deciduous trees are not always surveyed in winter when they have no

leaves, or in summer when leaves may obscure branches within the upper crown.

An indication of growth rate and the tree's ability to cope with stresses: Vigour: A4.1.13

High Having above average vigour. Moderate Having average vigour. Having below average vigour.

Verv Low Tree is struggling to survive and may be dying.

Physiological Condition: A4.1.14

> Good Healthy and with no symptoms of significant disease.

Fair Disease present or vigour is impaired

Significant disease present or vigour is extremely low. Poor

Very Poor Tree is dying.

Structural Condition: A4.1.15

Good Having no significant structural defects.

Some defects observed though no high priority works are required. Poor Significant defects found. Tree requires monitoring or remedial works.

Very Poor Major defects which will usually require significant remedial works or tree removal.

A4.1.16 **Amenity Value:**

Very High Exceptional specimen, observable by a large number of people. Attractive specimen, observable by a significant number of people. High

Moderate One of the above factors is not applicable Low Unattractive specimen or largely hidden from view.

A4.1.17 Life Expectancy: The estimated number of years before the tree may require removal. Classified as (<10), (10-20), (20-40), or (40+).

Retention Category: These are explained in detail in Appendix 1. A4.1.18

A4.2 **Evaluation of Defects**

A4.2.1 Cavities, wounds, deadwood etc are all evaluated as follows:

Such that structural integrity is, or will become, compromised and the tree is, or will inevitably become, hazardous.

Significant A defect that may over time become a major defect, though not necessarily so. This will depend on the vigour of the tree and its

ability to deal with decay etc.

Minor A defect that is not likely to compromise the tree's structural integrity.

Crown Ref: 09302 Site: 32 Glenilla Road, Belsize Park

Author: Ivan Button Date: 15th Febuary 2021

General Glossary

| Adaptive growth | In tree biomechanics, the process whereby wood formation is influenced both in quantity and quality by the action of |
|--------------------------|---|
| Aquabia | gravitational forces and mechanical stresses on the cambial zone. |
| Aerobic Anaerobic | Conditions in which oxygen is freely available, or to biomechanical processes that depend on the presence of oxygen. A condition marked by the absence of oxygen; Generally such areas are unsuitable for normal life and growth of plant tissues. |
| Arboriculturo | These sites tend to be populated by bacteria capable of surviving low oxygen conditions often associated with Slime Flux. |
| Arboriculture Arborist | The culture and management of trees as groups and individuals primarily for amenity and other non-forestry purposes. A person possessing the technical competence through experience and related training to provide management of trees or |
| Albolist | other woody plants in a landscape setting. Generally involved with the development or management of trees for visual amenity or land management rather than the growth of trees for product or profit. |
| Barrier zone | A layer within an annual increment of wood which contains abnormal xylem cells, laid down by the cambium in response to wounding or other trauma. |
| Body language | In trees, the outward display of growth responses and or deformation in response to mechanical stress. |
| Bole | Or Trunk, the main stem of a tree below its first major branch. |
| Bracket | A type of fruiting body produced by various fungal species, plate like to hoof like in shape and often a one sided attachment to the wood or bark. |
| Branch bark ridge | A ridged area located at the union of a branch to a trunk or stem. |
| Branch Collar | Trunk tissue that forms around the base of a branch between the main stem and the branch, or between a main branch and a lateral branch. As a branch decreases in vigour or begins to die, the collar usually becomes more pronounced and completely encircles the branch. |
| Brown Rot | Form of decay where cellulose is degraded, while lignin is only modified. |
| Buttress Root | Roots that emerge from the base of the tree stem, normally large and well developed that rapidly reduce in diameter to create the Root Plate this offers structural support for the tree. Buttress roots divide rapidly forming the connection between the stem and the transport roots. |
| Cabling Bracing | Installing cables within the crown of a tree to prevent collapse. |
| Callus | Undifferentiated cells often formed at the edges of recent injuries. This tissue quickly becomes differentiated, forming cells of the type characteristic of that position on the tree (e.g. forming wood, bark, roots, etc.) see wound response tissue. |
| Cambium | A thin layer of actively growing and dividing cells, located between the xylem (sapwood) and bark of a plant; the part responsible for radial growth of a tree stem or branch. |
| Canopy | The topmost layer of twigs and foliage in a woodland, tree or group of trees. |
| Canker | A localised area of dead bark and cambium on a stem or branch, caused by fungal or bacterial organisms, characterised by |
| Cavity | woundwood development on the periphery. This may be annual or perennial. An open and exposed area of wood, where the bark is missing and internal wood has been decayed and dissolved. |
| Chlorotic | Also Chlorosis. A condition of the plant marked by yellowing of normally green foliage, often indicating nutrient deficiency or plant dysfunction. |
| Clinometer | Devices that measures vertical angles, and provides direct height measurements of objects by triangulation. |
| Co-dominant | Are forked branches or trunks of nearly the same size in diameter and lacking a normal branch union. |
| stems/trunk | |
| Compacted soils | Soils in which the air-space (oxygen space) has been reduced or eliminated, reducing water infiltration and percolation, reducing root presence and inhibiting new root development. |
| Compartmentalisati on | The physiological process that creates the chemical and mechanical boundaries that act to limit the spread of disease and decay organisms. |
| Compression | Localized buckling of fibres and other longitudinal elements produced by compression of wood along the grain; compression |
| Failure | failures sometimes develop in standing trees. |
| Compression Strength | The ability of a material or structure to resist failure when subjected to compressive loading; measurable in trees using special drilling devices |
| Compression Wood | Abnormal wood formed on the lower side of branches and curved stems, with physical properties different from normal wood. |
| Conservation Area | In Great Britain, designated areas of architectural or historical interest, in which there are special procedures for planning applications. Additionally tree works cannot generally be undertaken without prior notification (Currently 6 weeks) to the |
| Core Sample | relevant local planning authority. See also Tree Preservation Orders. A sample of wood extracted from a trunk or branch, using an increment borer tool. The resulting core can be analysed for |
| | characteristics of growth, wood strength, structure, decay, and for species identification. |
| Crotch Crown | The union of two or more branches; the auxiliary zone between branches. The upper canopy of a tree, including upper trunk, scaffold branches, secondary branches, stems and leaves. |
| Crown lifting / | Crown Lift The removal of the lowest branches, usually to a given height. It allows more residual light and greater clearance |
| raising | underneath for vehicles etc. |
| Crown reduction | The reduction of a tree's height or spread while preserving its natural shape. |
| Crown thinning | The removal of some of the density of a tree's crown, usually 5-25% allowing more light through its canopy and reducing wind resistance. |
| Deadwood (noun) | Deadwood is often present within the crown or on the stems of trees. It may be an indication of ill health, however, it may also indicate natural growth processes. If a target is present beneath the tree, deadwood may fall and cause injury or damage and should be removed, otherwise deadwood can remain intact for conservation purposes (insects, fungi, birds etc.). |
| Deadwood (verb) | The removal of dead branches from a tree's canopy, usually of a specified size (in diameter). |
| Decay | Progressive deterioration of organic tissues, usually caused by fungal or bacterial organisms, resulting in loss of cell structure, strength, and function. In wood, the loss of structural strength. |
| Decay Detection | The assessment of decay within a tree has been traditionally difficult, but recent advances have made it possible to achieve accurate representations of the internal section of a tree in both 2D and 3D, removing doubt over the condition of the tree and |
| Defect | allowing accurate management decisions. In relation to tree hazards, any feature of a tree which detracts from the uniform distribution of mechanical stress, or which makes the tree mechanically unsuited to its environment. |
| Defoliation | makes the tree mechanically unsuited to its environment. The losing of plants foliage. |
| | |

Crown Ref: 09302 Site: 32 Glenilla Road, Belsize Park

Author: Ivan Button Date: 15th Febuary 2021

| | extreme cases can result in Stag Heading. |
|----------------------------|---|
| Dripline | A projected line on the ground that corresponds to the spread of branches in the canopy; the farthest spread of branches. |
| Epicormic shoots | Fast growing, weakly attached shoots/branches that often grow as a response to stress factors upon a tree or branch removal. |
| Failure | In connection with tree hazards, a partial or total fracture within the wood tissue or loss of cohesion between roots and soil. (In total failure affected parts will snap or tear away completely, Partial failure there is a crack or deformation, which results in an altered distribution of mechanical stress. |
| Feeder Roots | Fine fibrous Water and nutrient absorbing roots located in the outer root system. |
| Flush-Cut | In trees and shrubs, a pruning cut close to the parent stem, which removes the branch bark ridge. |
| Foliage | The live leaves or needles of the tree; the plant part primarily responsible for photosynthesis. |
| Formative pruning | The trimming of a tree to remove weaknesses and irregularities which may lead to problems. The formative pruning operation is aimed at reducing the potential for future weaknesses or problems within the tree's crown. |
| Gall | An abnormal, disorganized growth of plant tissues, caused by parasitic or infectious organisms such as insects, fungi, bacteria, or viruses. |
| Girdling | In woody plants, any form of damage that destroys the bark and / or the Cambium all the way around the stem, branch or root, normally resulting in death of the damaged section. |
| Girdling Root | In woody plants, a root that grows across the buttress, or across other roots, eventually causing constriction of the radial growth. |
| Growth Increment | The incremental growth added as new annual ring develops each season over existing wood. This is seen as (growth) rings in cross-sections of wood. |
| Hazard beam | An upwardly curved branch in which strong internal stresses may occur without the compensatory formation of extra wood (longitudinal splitting may occur in some cases). |
| Heartwood Heave | Inner non functioning tissues that provide structural support to trunk. In relation to shrinkable clay soils, expansion due to rewetting of a volume of soil previously subjected to the removal or water |
| | by plant / trees following felling or root severance. Also in relation to root growth, the lifting of pavements and other structure by radial expansion. Also in relation to tree stability, the lifting of one side of a wind rocked root plate. |
| Herbicide Included Bark | A chemical compound that causes the death of a plant. Bark that becomes embedded in a crotch between branch and trunk or between co-dominant stems, usually found in narrow or tight crotches, and causes a weak structure. |
| Increment Borer | A tool that cuts and extracts a narrow cylinder of wood from a tree for analysis of the wood tissue and growth increments. |
| Leader | The primary terminal shoot or trunk of a tree. |
| Limb | A large lateral branch growing from the main trunk or from another larger branch. |
| Lion Tailing | Often the result of poor pruning practices; the main leader or branches are largely devoid of side branches, growth is restricted to the end of branches and is likely to suffer damage through end loading. |
| Lopping Monitoring | In trees, a general term that related to the removal of branches from a tree. Due to the relative life span of trees in relation to our own, long-term monitoring provides a valuable insight to the health of |
| Montoning | trees, identifying decline and or stabilisation and or improvement. |
| Mulch | A material laid over the root system of a tree to help conserve moisture within the soil. Additionally it may help control the development of weeds close to the tree. |
| Mycelium | A mass of growing filaments (hyphae) formed by fungi. |
| Mycorrhizae | The symbiotic relationship between roots and certain beneficial fungi. Mycorrhizae are the combined root / fungal growth. |
| Occluding tissue | The general tern of wood, cambium and bark that develop around the site of a wound on a woody plant |
| Pathogen | A microorganism that causes diseases within another organism. |
| Phloem | The principle conductive tissue that the products of Photosynthesis are transported around the plant |
| Photosynthesis | The process were light energy is used to create energy (Carbohydrate) for use within the plant. |
| Pollard | A term for a pollarded tree. |
| Pollard head Pollarding | The swollen section of branch / stem that forms behind the pollarding cut. The complete or partial removal of the crown of a young tree so as to encourage the development of numerous branches either for amenity or historically as fodder, repeated management is required cyclically to maintain the feature |
| Prune or Pruning | Selective removal of woody plant parts of any size, using saws, Loppers, Secateurs, or other pruning tools. |
| Reaction Wood | Wood with distinctive anatomical characteristics, formed in parts of leaning or crooked stems and in branches to provide additional strength / support. In hardwoods, tension wood usually forms. In conifers, compression wood is usually found. |
| Reaction Zone | A zone normally darker than surrounding wood that denoted the boundary often a defensive one between functional sapwood and dysfunctional or decaying wood. |
| Re-grading | The raising or lowering of a soil profile from its original grade. |
| Remedial pruning | The removal of old stubs, deadwood, epicormic growth, rubbing or crossing branches and other unwanted items from the tree' crown. |
| Resistograph | Invasive decay detection technique whereby the resistance offered by the timber to a spinning probe is measured and plotted. |
| Rib Ring Barking | In tree body language, a long narrow, axial protuberance which often over lays a crack. Artificial Girdling of the stem, to result in the death of a tree. May be used in habitat creation were the retention of dead |
| Rod Bracing / | standing trees is required. Traditionally, this has relied upon the Installation of steel rods or bolts through the stems or limbs, to reduce twisting or |
| Bolting Root Barriers | splitting of the wood. The installation of such features does require legal interpretation. Both Buildings and services can benefit from the installation of root barriers to protect a soil volume from the ingress of roots. |
| Root Collar | The basal area of the tree; transition zone from trunk to root. Also sometimes called trunk flare. |
| Root Plate | The primary support area for the tree; an area of the root system close to the base that structurally anchors the tree to the soil. |
| Root Rot | Either a general term for decay within the wood of the lower stem / buttress roots, or a disease in which the fine roots are killed. |
| Root System | The portion of the tree containing the root organs, including buttress roots, transport roots, and fine absorbing roots; all underground parts of the tree. |
| Root Zone | The area and volume of soil around the tree in which roots are expected. May extend to three or more times the branch spread of the tree, or several times the height of the tree. |
| Sail Area | That area or the tree subjected to wind load. |

PDF readers select page-width for detail & page-view for scrolling

Arboricultural Report to BS 5837: 2012 for: Adam Khan Architects

Crown Ref: 09302 Site: 32 Glenilla Road, Belsize Park

Author: Ivan Button Date: 15th Febuary 2021

| Sapwood | Xylem wood tissue, usually light in colour, representing the outer growth rings of the wood. Usually living, reactive wood tiss in a healthy tree. See heartwood |
|---------------------------------------|---|
| Scaffold limbs / scaffold Branches | The branches that from the main network framework of the crown of a tree. |
| Senescent | A decline in growth and vigour due to age or stress factors. |
| Shrub | A woody plat that branches at or close to the ground level and so does not have a single stem. |
| Slime Flux | Relating to a toxic condition from the spreading of bacteria or their products from a source of infection; characterized by malodorous gases, or salt deposits upon the bark. If these products enter the sap stream, localised vessel necrosis can result, usually associated with anaerobic conditions. |
| Soft Rot | A kind of wood decay, were a fungi degrades cellulose within the cell wall, without causing overall degradation. |
| Soil Compaction | The compression of soil, causing a reduction of pore space and an increase in the density of the soil. Air is squeezed out and nutrients become locked. Tree roots cannot grow in compacted soil. |
| Sonic Decay | Non invasive method whereby sound waves are passed through the tree and the speed is measured. Slow speeds indicate dec |
| Detection | and a tomography picture representing the inner stem is produced. |
| Stag Heading | In a tree, a state of dieback were dead branches protrude beyond the current living crown. |
| Stress | In plant physiology, conditions were one or more physiological functions Are not working within normal parameters. |
| Stump Grinding | The removal of a tree stump using a specialist grinding machine. |
| Subsidence | In relation to vegetation, the removal of water by plant growth resulting in localised shrinkage in the soil volume. |
| Sucker | Same as sprout. |
| Suppressed | Trees which are dominated by surrounding vegetation and whose crown development is restricted from above. |
| Systemic | Affecting the whole plant or organism. A systemic compound is carried throughout the entire plant to all parts through the vascular system. |
| Target | Any person or object within reach of a falling tree or part of a tree that may be injured or damaged. |
| Target Pruning | The pruning of a branch were the wound affects only branch material, often result in a target shaped wound. |
| Tension Wood | Reaction wood typically formed on the upper side of limbs or curved stems; characterized by lack of cell wall lignifications (higher ratios of cellulose to lignin). |
| Tight Union / Tight Crotch | Also, narrow crotch. A crotch with a narrow angle between branches, often having included bark. |
| Tomography | The comparison of sound or stress waves through the tree allows the creation of a 2D or 3D representation of the internal structure of a stem or branch section and highlights areas of damage. Virtually non-injurious. |
| Topography | The configuration of surface features, including the vertical and horizontal relationships of the ground and other features. |
| Topping | Cutting large limbs back severely, without regard to form or habit of the tree. Cuts are usually made between lateral branch nodes. This practice is extremely injurious to trees, and promotes decay and structural weakness within the crown. |
| Tree | A woody plant that typically has a single stem, at maturity has a height of a least 4 metres and a stem diameter at breast height of at least 75mm. |
| Tree Preservation Order | In Great Britain, an order made by the local planning authority, were consent must be gained before undertaking all but exem works to a tree. |
| Trunk Flare | The basal area of the trunk that flares or widens, and merges with the main roots. See root collar |
| Veteran Tree | Veteran trees are often found in large parks or estates and commonly affected by extensive decay or have been subject to extensive works. These trees are retained for historical importance and often pose greater risk than normal, which is generall justified. They need careful management and often propping or bracing to support them, some require fencing to limit access |
| Vigour | Active, healthy growth of plants: ability to respond to stress factors. |
| Visual Tree | An assessment of the mechanical condition of trees based upon their 'body language'. Trees are dynamic and respond to fault |
| Assessment (VTA) | decay / environmental factors in various ways, these responses can be indicative of structural integrity. |
| Wetwood | An infection caused by bacteria living inside the plant tissues. The bacteria ferment the plant fluids, resulting in death of nearl cells, and often causing exudations of fluid from the bark, often referred to as a Slime Flux. |
| White Rot | A kind if wood decay were a fungi attacks the lignin within the wood matrix |
| Wind loading | Forces placed upon tree canopy, branches, trunk and roots of a tree under windy conditions. |
| Wind Throw | The failure of a tree due to wind loading. |
| Witches Broom | A deformed or unusual growth of twigs from adventitious buds, caused by insects, disease, or dieback of twigs and buds. |
| Wood | Secondary Xylem; the main structural support and water conducting tissue of trees and shrubs. |
| Wound Response Tissue | Also Occluding Tissue, Wound Wood or Callus. Differentiated wood tissue that grows around the margins of a wound or injur |
| Wound Wood | Wood with atypical features, formed in the vicinity of a wound and a term to describe the occluding tissues around a wound |
| Xylem | Plant tissues with special function of translocation of water and dissolved nutrients. |

Crown Ref: 09302 Site: 32 Glenilla Road, Belsize Park

Author: Ivan Button Date: 15th Febuary 2021

Appendix 3: Survey Methodology

- A2.1 Ground level visual surveys are carried out using the *Visual Tree Assessment* technique described by Mattheck and Broeler (1994) and endorsed by the Arboricultural Association (LANTRA Professional Tree Inspection course, 2007).
- A2.2 Structural condition is assessed by inspecting the stem and scaffold branches from all angles looking for weak branch junctions or symptoms of decay. Particular attention is paid to the stembase. Cavities are explored using a metal probe in order to assess the extent of any decay. If this is not possible further inspection is recommended in the form of a climbed inspection or using specialist decay detection equipment.
- A2.3 The physiological condition is assessed by inspecting the stem, branches and foliage for symptoms of disease. The overall vigour of the tree is also taken into account.
- A2.4 Where significant defects are observed, recommendations are made according to a scale of priority in order to reduce the likelihood of structural failure. The position of the tree and its potential targets are taken into account.
- A2.5 Measurements are obtained using a diameter tape, clinometer, distometer and loggers tape. Where this is not practical measurements are estimated.
- A2.6 Some trees are surveyed as groups, though this is usually avoided close to areas likely to be developed.
- A2.7 Finally, a Retention Category is allocated as described in Appendix 1.1.1.

Appendix 4: Author's Qualifications

Qualifications & Experience of Ivan Button N.C.H. (Arb), FDSc (Arb), BSc (Hons), P.G.C.E., M. Arbor. A.

Construction

Between 1983 and 1995 Ivan worked primarily within the construction industry and received training in a broad range of practical building skills and general construction principles. During this time he obtained a BSc (Hons) at Leeds University followed by a P.G.C.E at The University of Wales.

Arboriculture

He obtained a NCH (Arboriculture) at the University of Lincoln and became a member of the Arboricultural Association. He then worked for an Arboricultural Consultancy for one year before establishing a tree surgery and landscaping business in 1998. In 2005 Ivan commenced full time employment with a leading Arboricultural Association approved consultancy and soon adopted a senior role responsible for five consultants.

He obtained a FDSc in arboriculture at the University of Lancashire, which he passed with distinction and is now a Director and Principal Consultant of Crown Consultants Ltd. He is accredited as a LANTRA *Professional Tree Inspector*. A qualification produced in association with the Arboricultural Association and generally recognised as appropriate for all levels of tree inspection.

He is a member of the Consulting Arborist Society and is listed within their areas of professional expertise for QTRA and as an expert witness.

Ivan is a professional member of the Arboricultural Association and the International Society of Arboriculture.

He is a licensed Quantified Tree Risk Assessment user.

Ivan has undertaken professional expert witness training and has been registered as a Sweet and Maxwell Checked Expert Witness since 2008.

Throughout 2009 acted as the principal Tree Officer for Barnsley Metropolitan Borough Council.

Ivan has produced several hundred Arboricultural Reports for the purposes of Development, Safety, Management, Mortgage, Subsidence, Mitigation and Litigation.

Crown Ref: 09302 Site: 32 Glenilla Road, Belsize Park

Author: Ivan Button Date: 15th Febuary 2021

Appendix 5: Further Information

Building Near Trees - General

National Joint Utilities Group publication # 10 (1995), Guidelines for the Planning, Installation and Maintenance of Utility Services in Proximity to Trees. Downloadable at www.njug.demon.co.uk/pdf/NJUG%20Publication10.pdf

NHBC Standards Chapter 4.2., Trees and Buildings.

Horticulture LINK project 212. (University of Cambridge, 2004), Controlling Water Use of Trees to Alleviate Subsidence Risk.

Tree Planting and aftercare

See www.trees.org.uk/leaflets.php# for downloadable leaflets on selecting a garden tree, planting, aftercare and veteran tree management.

British Standards

BS 5837: 2012. Trees in Relation to Design, Demolition and Construction – Recommendations.

Bs 3998: 2010. Recommendations for Tree Work.

BS 3936: 1992. Nursery Stock. Part 1: Specification for Trees and Shrubs.

BS 3936: 1992. Nursery Stock. Part 10: Specification for Groundcover Plants.

BS 4043: 1989. Transplanting Root-balled Trees.

BS 8004: 1986. Foundations.

BS 8103: 1995. Structural design of Low-Rise Buildings.

BS 8206: 1992. Lighting for Buildings.

BS 8545:2014. Trees: From nursery to independence in the landscape – Recommendations

BS 3882: 2007. Topsoil.

BS 4428: 1989. General Landscaping Operations (excluding hard surfaces).

Permission to do Works to Protected Trees / Tree Law

Forestry Commission (Edinburgh, 2003), Tree Felling – Getting Permission. Country Services Division - Forestry Commission. Downloadable at www.forestry.gov.uk/website/pdf.nsf/pdf/wgsfell.pdf/\$FILE/wgsfell.pdf

Transport and the Regions (Department of the Environment, 2000), Tree Preservation Orders, A Guide to the Law and Good Practice. Downloadable at www.communities.gov.uk/publications/planningandbuilding/tposguide

C. Mynors, The Law of Trees, Forests and Hedgerows (Sweet and Maxwell, London, 2002)

Communities and Local Government website with numerous downloadable documents, from: http://www.communities.gov.uk/planningandbuilding/planning/treeshighhedges/

Lighting Levels

P.J. Littlefair, B.R.E. 209: Site layout planning for daylight and sunlight A guide to good practice. B.R.E. Bookshop, London.

British Standards Institution. Code of practice for day lighting. British Standard BS 8206: Part 2 (1992).

Chartered Institution of Building Services Engineers. Applications manual: Window Design (London, 1987).

NBA Tectonics. A study of passive solar housing estate layout. ETSU Report S-1126. Harwell, Energy Technology Support Unit (1988).

I.P. Duncan; D. Hawkes, Passive solar design in non-domestic buildings. ETSU Report S-1110. Harwell, Energy Technology.

P. J. Littlefair, Measuring Daylight, BRE Information Paper 23/93 f3.50. (Advises on measuring daylight under the real sky or an artificial sky, allowing for the changing nature of sky light).

High Hedges

Communities and Local Government website with numerous downloadable documents, from: http://www.communities.gov.uk/planningandbuilding/planning/treeshighhedges/

Tree Specific Websites

www.crowntrees.co.uk Crown Consultants site containing useful information

www.trees.org.uk Arboricultural Association

www.rfs.co.uk Royal Forestry Society of England, Wales and N. Ireland

www.treehelp.Info The Tree Advice Trust
www.woodland-trust.org.uk The Woodland Trust
www.treecouncil.org.uk The Tree Council



Crown Ref: 09302 Site: 32 Glenilla Road, Belsize Park

Author: Ivan Button Date: 15th Febuary 2021

Appendix 6: Tree Data Schedule and Site Plans

The Tree Data Schedule and any drawings accompanying this report follow this page. They are also provided as separate documents for ease of printing and screen viewing.

| arp ge | | (m) | t (m) | (cm) | Crow Spread | | Scaled Tree Diagram (m) | | | Recomme (Independe | endations | Vigour | Amenity Value | |
|---------------------------------|----------------------|------------|--------------|---------------|----------------|-----|----------------------------|--|--|---|-----------------------|----------------------------|--------------------------|-----|
| Reference G=Group H=Hedge | Age & Species | Height (m) | Crown Ht (m) | Diameter (cm) | N W | E | | | Notes | developmen | | Physiological Condition | Life Expectancy (yrs) | |
| ~ - | | Ť | Ş | Diar | S | | 9 9 | | | Priority | Inspect Freq (yrs) | Structural Condition | | |
| | Semi-Mature | | | | | | 25 | | | | | Moderate | Moderate | |
| T1 | Lawson Cypress | 12 | 2 | 39 | 2.5 | 2 | | Form: History: | Single stemmed and vertical with a narrow, upright habit. No evidence of significant pruning. | No action | required. | Good | 40+ | |
| | Chamaecyparis | | | | 2 | - | | Defects: | No defects observed. | | | Good | C+ | |
| | lawsoniana. | | | | | | 0 | | | n/a | 3 | doou | C+ | |
| | Semi-Mature | | | | | | 25 | _ | | | | Moderate | Low | |
| T2 | Cherry | 6 | 3 | 12 | 1.5 | 1.5 | | Form: History: | Single stemmed and vertical with a compact crown. No evidence of significant pruning. | No action | required. | Good | 20-40 | |
| | Prunus sp. | | | | 2 | | | Defects: | No defects observed. | | | Good | (| |
| | · | | | | | | 0 T | D. siti | Charles with a state of | n/a | 3 | 0000 | | |
| | Mature | | | 5 | | -9 | Position: Form: | Situated on third party land. Twin-stemmed at 1.5m with a balanced crown. | | | Moderate | Low | | |
| T3 | Cherry 9 | 9 4 | 50 | | 4 | | History: Defects: | | No action required. | | Good | 20-40 | | |
| | Prunus sp. | | | | 5 | · | - | Other: | Two stems with actual diameters of 30 and 40cm. Limited inspection, | n/a 5 | | Good | C + | |
| | Semi-Mature | | | | | | 25 | | dimensions estimated. | n/a | 3 | | | |
| | Holly | | | | 1.5 | | | Form: | Multi-stemmed at ground level with a poorly formed crown. | No action | roquirod | Moderate | Low | |
| T4 | l lony | 7 | 3 | 20 | 1.5 | 1.5 | | History: Defects: | efects: No significant defects observed. Ivy prevented detailed inspection. | No action required. | | Fair | 10-20 | |
| | Ilex aquifolium. | | | | 2 | | | Other: | Poor specimen. Four stems with actual diameters of 10, 6, 9 and 14cm. | n/a | 3 | Fair | C | |
| | Young | | | | | | 25 | | | .,,u | , , | High | Low | |
| _ | Beech | | | 3.5 | | | | Twin-stemmed at 2m with a narrow, upright habit. | No action required. | | | LOW | | |
| T5 | | 8 | 2 | 19 | 2 | | 4 | | History: Defects: | No evidence of significant pruning. No defects observed. | | | Good | 40+ |
| | Fagus sylvatica. | | | | 3 | | 0 | | | n/a | 3 | Good | C | |
| | Semi-Mature | | | | | | 25 | Position: | Situated on third party land. | | | Very Low | Low | |
| Т6 | Sycamore | 16 | 2.5 | 45 | 8.5 | 8 | And Division in | Form: History: | Single stemmed and vertical with a well-formed crown. No evidence of significant pruning. | No action | required. | Poor | | |
| 10 | | | 3.5 | 45 | 7 8 | 0 | | Defects: | Significant deadwood throughout. | | | | <10 | |
| | Acer pseudoplatanus. | | | | | | 0 | Other: | In decline. Limited inspection, dimensions estimated. | n/a | 3 | Fair | C | |
| | Mature | | | | | | 25 | Form: | Twin-stemmed at 1m with a balanced crown. | | | High | Low | |
| T7 | Elder | 9 | 2.5 | 31 | 2 | 2 | | History: | No evidence of significant pruning. | No action | required. | Good | 10-20 | |
| • 7 | Sambucus nigra. | | | | 2.5 | | | Defects: Other: | No defects observed. Two stems with actual diameters of 27 and 16cm. | | | Fair | | |
| | Sambucus mgra. | | | | | | .0 | | | n/a | 3 | raii | | |

| Reference G = Group H = Hedge | Ago 9 Emocios | Height (m) | Crown Ht (m) | Diameter (cm) | | rown ead (m) | Scaled Tree Diagram (m) | (Ind | | (Independ | | Vigour Physiological | Amenity Value Life |
|-------------------------------------|-----------------|-------------------------------|--------------|----------------------|-------------------------------|--|---|---|---|---------------------|-----------------------|-------------------------|--------------------------|
| efer G=G H=H | Age & Species | eigh | N C | net | w | N E | | | Notes | developmen | nt proposals) | Condition | Expectancy (yrs) |
| ~ - | | Ť | ဦ | Dia | | S | 9 9 | | | Priority | Inspect Freq (yrs) | Structural Condition | |
| | Semi-Mature | | | | | 2 | [25] | Form: | Multi-stommed at ground lavel with a halanced groun | | | Moderate | Low |
| Т8 | Elder | 4 1.5 Bas | 30 @ Base |) | - | History: Defects: | Multi-stemmed at ground level with a balanced crown. No evidence of significant pruning. No defects observed. | No action required. | | Good | 10-20 | | |
| | Sambucus nigra. | | | | 2 | | | | n/a | 3 | Fair | С | |
| | Young | | | | | | [25 | | | | | High | Low |
| Т9 | Apple | 3.5 2 6 | 3.5 2 6 | 1.5 1.5 1.5 | | Form: Single stemmed and vertical with a compact crown. History: No evidence of significant pruning. | No evidence of significant pruning. | No action required. | | Good | 20-40 | | |
| | Malus sp. | | | | 1.5 | - | Defects: | No defects observed. | !- | Ι. | Good | C | |
| | Vound | | | | | | [0] | | | n/a | 3 | | |
| | | Young Apple 3.5 2 6 1.5 1.5 | | | | Farme | | | | High | Low | | |
| T10 | Apple | | | 2 6 | | - | - | Form: Single stemmed and vertical with a compact crown. History: No evidence of significant pruning. | · · | No action required. | | Good | 20-40 |
| | Malus sp. | | | 0 | Defects: No defects observed. | | n/a | 3 | Good | C | | | |

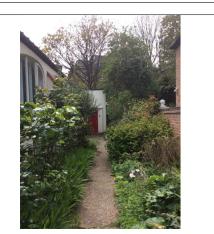


Photo 5



Photo 6

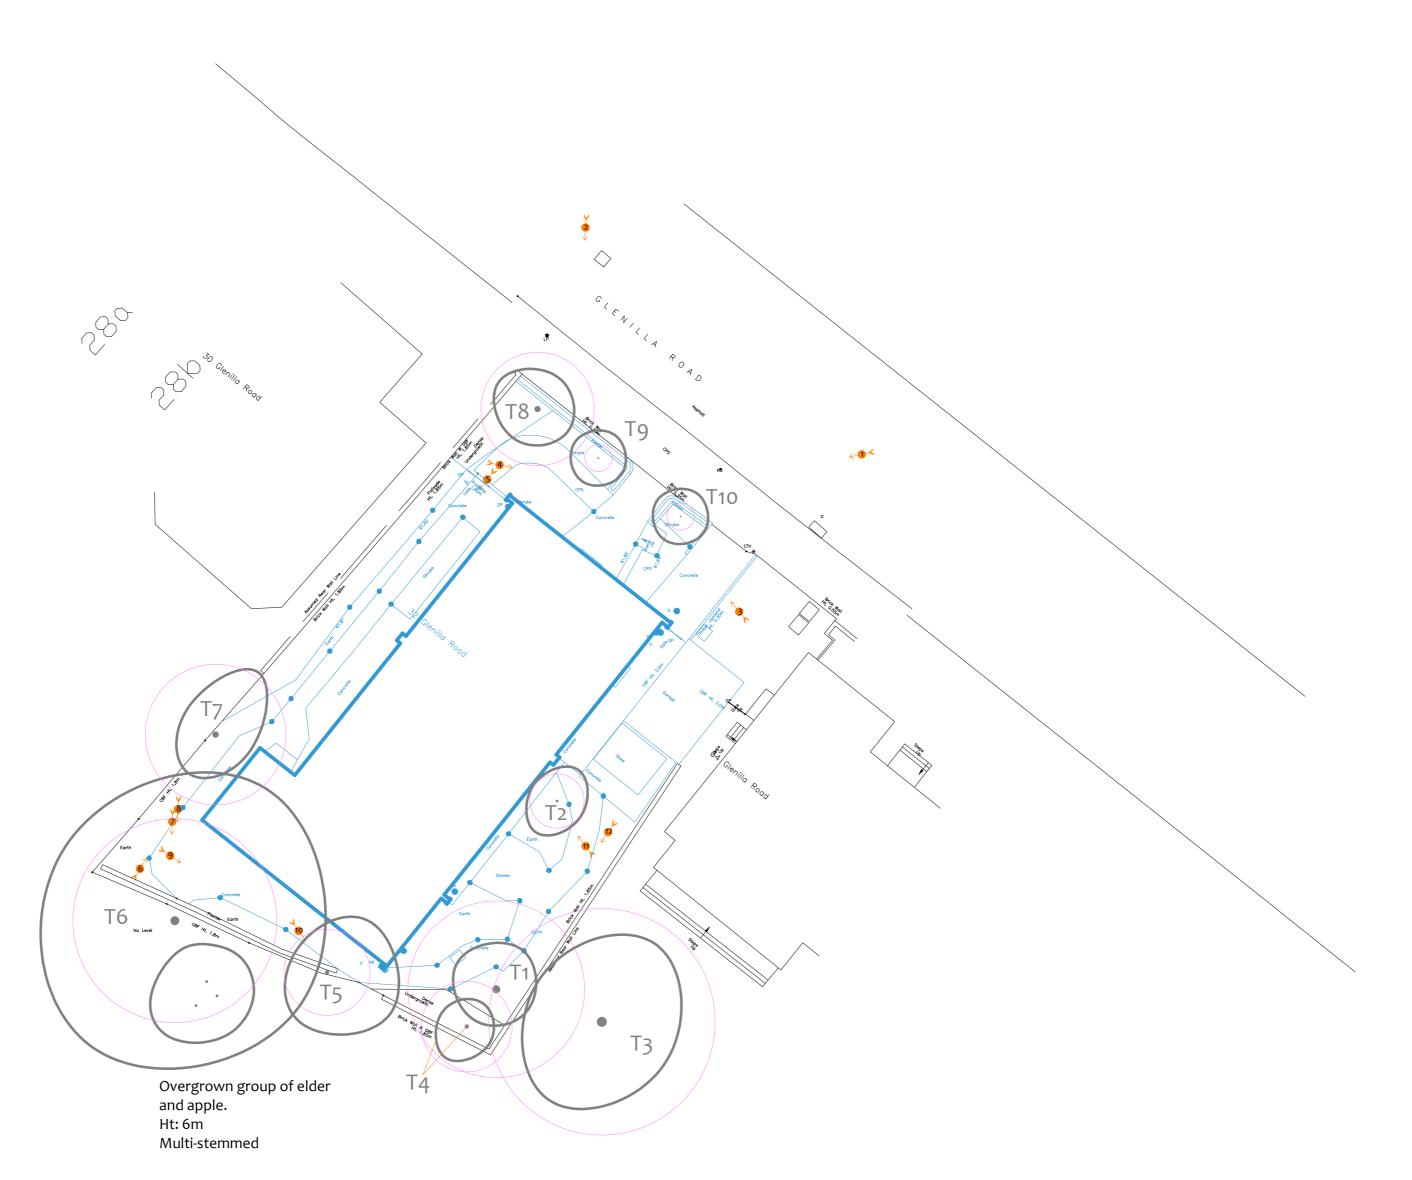



Photo 7



Photo 8

See the accompanying report for more photographs





Tree Constraints Plan

(Existing Layout)



Photo 1



Photo 2



Photo 3




Photo 4


| Drawing No: | CCL 09302 | /TCP Rev: 1 | |
|-------------|---|--------------------|--|
| Title: | Tree Constraints Plan (Existing Layout) | | |
| Site: | _ | illa Road 3 4AN | |
| 0 | 5 | 10m | |

Scale: 1:200

Paper Size: A2










Trees of high quality with an estimated life expectancy of 40+ years.
Usually large trees with significant presence or smaller trees with
excellent form. Retention of these trees is highly desirable.



Trees unsuitable for retention due to their very poor condition.

| BS 5837 Root Protection Area (radius = 12xstem diameter) | |
|---|---|
| Root Protection Area needing amendment due to site conditions, e.g. presence of exising road or building. | 7 |
| Root Protection Area having been amended to account for for site conditions | |

T1=Tree No 1 G2 = Group No 2 H3 = Hedge No 3

| 7 | Photo 1 | |
|---|---------|--|
| | | |

MN = Measured North: Canopy spreads are sometim measured to an approximate defined by site features. Often more accurate, especia where rows of trees are not aligned N-S or E-W.

| | 1 | | | | | |
|--------|-----------|----------------|------------|------------|--------|------------|
| | Tree Ref. | Species | Haidht (m) | Root Pr | otecti | on Area |
| | Hee Kei. | Species | Height (m) | Radius (m) | m² | Square (m) |
| | T1 | Lawson Cypress | 12 | 4.7 | 69 | 8.3 |
| | T2 | Cherry | 6 | 1.4 | 7 | 2.6 |
| | T3 | Cherry | 9 | 6.0 | 113 | 10.6 |
| mes | T4 | Holly | 7 | 2.4 | 18 | 4.3 |
| te N | T5 | Beech | 8 | 2.3 | 16 | 4.0 |
| cially | T6 | Sycamore | 16 | 5.4 | 92 | 9.6 |
| t | T7 | Elder | 9 | 3.7 | 43 | 6.6 |
| | T8 | Elder | 4 | 3.0 | 28 | 5.3 |
| | T9 | Apple | 3.5 | 0.7 | 2 | 1.3 |
| | T10 | Apple | 3.5 | 0.7 | 2 | 1.3 |

Excerpts from the Arboricultural Impact Assessment

It is proposed to demolish the existing buildings and construct a pair of semi-detached residences. These shall occupy four floors including a basement and rooms within the roof space. A sunken garden shall provide light to the basement.

The table below summarises the potential impact on trees due to various activities.

| Activity | Trees Potentially Affected |
|------------------------------------|--|
| Tree Removal: Retention Category A | None |
| Tree Removal: Retention Category B | None |
| Tree Removal: Retention Category C | T1, T2, T5, T7, T8, T9, T10 |
| Tree Removal: Retention Category U | None |
| Tree Pruning | T6 |
| RPA: Foundations | T3 |
| RPA: New Surface | None |
| RPA: Underground Services | None |
| RPA: Change of Ground Levels | None |
| RPA: Soil Compaction | T3, T4 and T6 (preventable by installing tree protection |

In order to facilitate the development, it is proposed to remove seven Retention Category C trees which are located throughout the site. These are all relatively small trees and most are hidden from public antage points. Consequently the impact of tree removal on local amenity shall be minimal.

linor pruning works are recommended to the overhanging branches of T6 to increase lighting levels in

oundations are proposed within the Root Protection Area of T3. However, the small extent of RPA affected coupled with the sympathetic foundation design shall ensure no detrimental impact on this ree. A suitable load spreading surface shall need to be maintained throughout the Restricted Activity

Tree protection measures are specified throughout Section $\underline{6}$ that will ensure no negative impact on

Adequate space has been allowed between the proposal and all trees such that no future pressure to verly-prune or remove trees shall occur as a consequence of the proposal.

See Section 5 of the accompanying report for a more detailed assessment

Suggested pruning of T6 of branches overhanging the boundary to increase lighting levels within the rear garden.

> Proposed build no closer to T6 than existing. Therefore no impact.


Existing Layout (Blue) Proposed Layout (Pale Green)

 \Diamond These small trees are to be removed to enable good access into the site during the build. We recommend the planting of a couple of small trees as mitigation Low amenity value trees to be removed. T6 The foundations for the new basement will extend into to the very edge of the theoretical Root Protection Area of T3. However, only circa 1% of the Root Protection Areas shall be affected, so the T4 Overgrown group of elder potential impact is considered to be negligible. and apple. Ht: 6m Multi-stemmed In order to ensure that the basement does not impact on more than the RPA than is necessary, is it proposed to install the basement in a manner that does not disturb any of the soils beyond the footprint of the basement. This may be done via contiguous piling, sheet piling, pinning or any similar method which restricts excavation to the basement footprint.



Impact Assessment Plan

(Existing Layout with Proposals Overlaid)

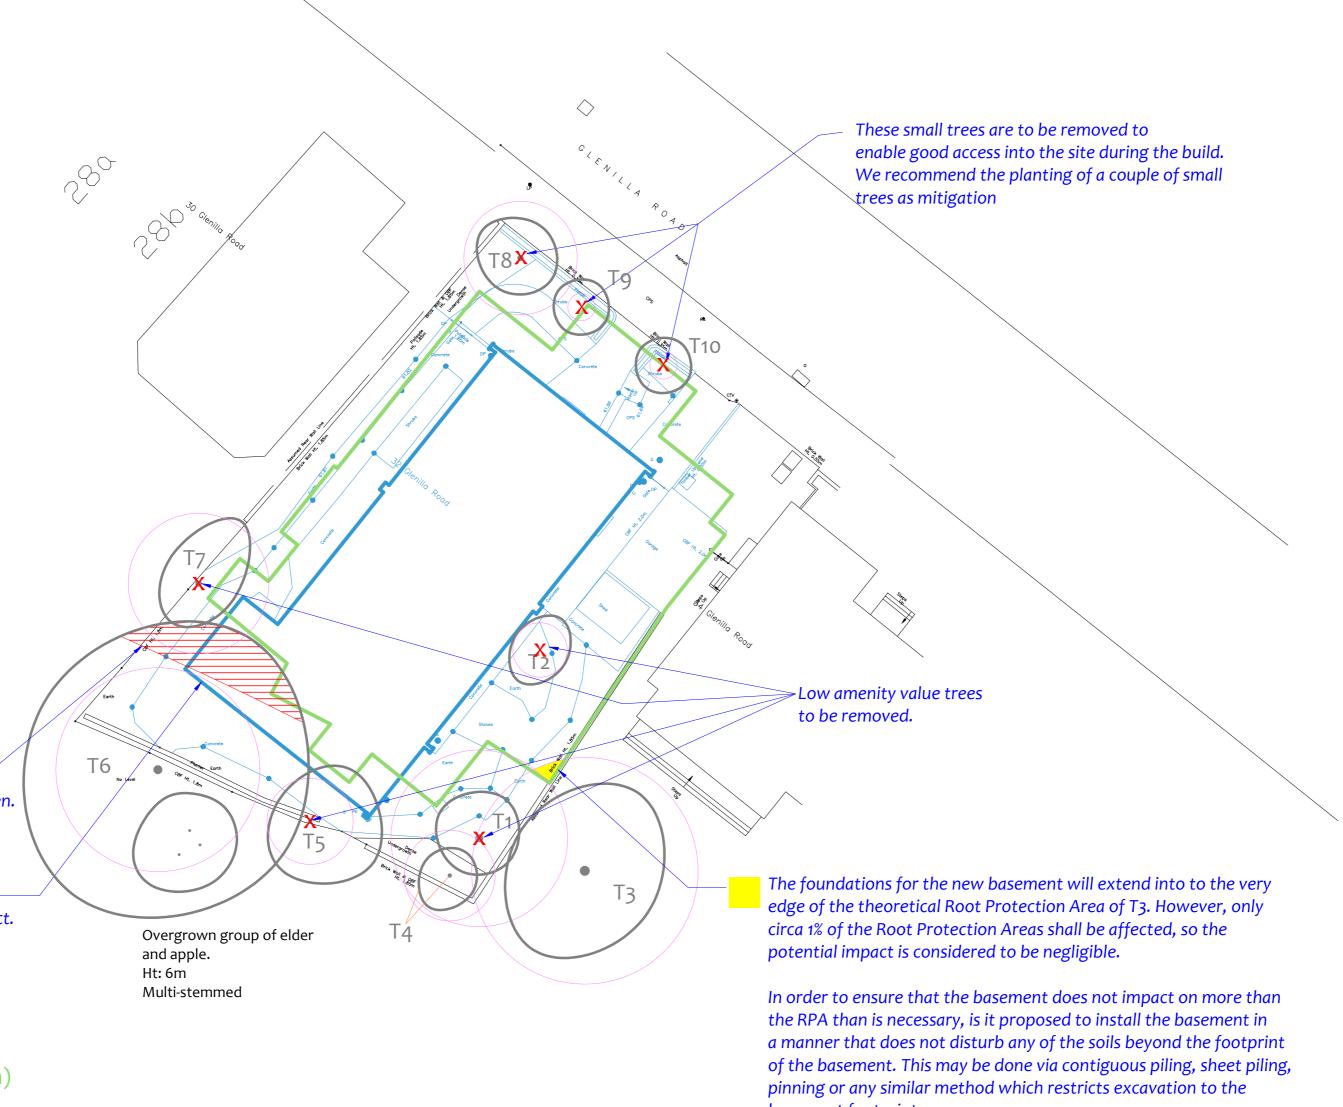

| Drawing No: | CCL 09302 | / IAP Rev: 4 | | |
|-------------|--|--------------|--|--|
| Title: | Impact Assessment Plan (Existing Layout with Proposals Overlaid) | | | |
| Site: | 32 Glenilla NW3 4 | | | |
| 0 | 5 | 10m | | |

Paper Size: A2





Category A tree 0 Category B tree



| 3 | Trees of high quality with an estimated life expectancy of 40+ Usually large trees with significant presence or smaller trees v excellent form. Retention of these trees is highly desirable. |
|---|---|

Trees of moderate quality with a life expectancy of 20+ years. Usually maturing trees, or younger trees with good form. Retentior of these trees is desirable though less than Category A trees

re not considered to be a material planning consideration

rees unsuitable for retention due to their very poor condition.

| | Impact | Assessment | Plan |
|--|--------|------------|------|
|--|--------|------------|------|

| | BS 5837 Root Protection Area (radius = 12xstem diameter) | |
|----------|---|-------------|
| | Root Protection Area needing amendment due to site conditions, e.g. presence of exising road or building. | X |
| | Root Protection Area having been amended to account for for site conditions | X |
| 1 = Tree | e No 1 G2 = Group No 2 H3 = Hedge No 3 | \subseteq |

| ee to be removed to | MN = Measured North: Canopy spreads are sometimes measured to an approximate N | T1 | Laws |
|--|---|-----|-------|
| | | T2 | Che |
| | | T3 | Che |
| | | T4 | Holly |
| | | T5 | Bee |
| ilitate the proposal | defined by site features. Often more accurate, especially | T6 | Syc |
| ee to be removed e to its low quality | where rows of trees are not aligned N-S or E-W. | T7 | Elde |
| | | T8 | Elde |
| anacad pruping | | T9 | Appl |
| oposed pruning | | T40 | Α . |

| | Tree Ref. | Species | Height (m) | 1100ti i oteetioii i ii eu | | |
|-------|-----------|----------------|--------------|----------------------------|-----|-----------|
| | iiee kei. | Species | neight (III) | Radius (m) | m² | Square (n |
| nes | T1 | Lawson Cypress | 12 | 4.7 | 69 | 8.3 |
| | T2 | Cherry | 6 | 1.4 | 7 | 2.6 |
| | T3 | Cherry | 9 | 6.0 | 113 | 10.6 |
| | T4 | Holly | 7 | 2.4 | 18 | 4.3 |
| | T5 | Beech | 8 | 2.3 | 16 | 4.0 |
| ially | T6 | Sycamore | 16 | 5.4 | 92 | 9.6 |
| | T7 | Elder | 9 | 3.7 | 43 | 6.6 |
| | T8 | Elder | 4 | 3.0 | 28 | 5.3 |
| | T9 | Apple | 3.5 | 0.7 | 2 | 1.3 |
| | T10 | Apple | 3.5 | 0.7 | 2 | 1.3 |
| | | | | | | |

Excerpts from the Arboricultural **Method Statement**

Construction Exclusion Zones

Within Construction Exclusion Zones (shaded purple on the Tree Protection Plan) the following restrictions shall apply:

- Fencing shall be erected and maintained throughout the entire project as indicated on the Tree Protection Plan and specified in Section 9 - Tree Protection Barriers.
- No construction activity whatsoever shall occur. • No tree works, other than those specified in this report shall be undertaken.
- No alterations of ground levels or conditions. No chemicals or cement washings permitted.
- No excavation whatsoever
- No temporary structures.
- No spoil shall be stored.
- No fires shall be permitted
- All hazardous materials (including non-essential cement products) shall be forbidden.

Any hard surfaces that require removal shall be removed prior to the installation of the protective $fencing\ or\ following\ all\ other\ major\ construction\ activity\ and\ the\ removal\ of\ the\ fencing.\ Surfaces\ shall$ be removed using hand tools or mechanical excavators operating from outside the Construction Exclusion Zone and marshalled by the appointed arborist.

Ground disturbance shall be limited to a depth of 100mm or the depth of any hard surfacing and the

Restricted Activity Zone A

Within this zone (indicated on the Tree Protection Plan) trees roots are likely to be present and access will be required to facilitate construction. The following restrictions shall apply:

- Removal of existing structures such as, walls, steps and hard surfaces shall be undertaken using hand tools or a mechanical excavator operating from outside the Restricted Activity Zone and carefully marshalled by an appointed arborist. • No new permanent or temporary structures shall be erected without written approva
- from the local authority A suitable load spreading surface shall be installed and/or maintained as specified in Section 10 -Ground Protection Measures. This shall remain in place throughout the entire
- Existing ground levels shall be retained undisturbed or raised by no more than 150mm. Ground levels may only be raised using granular topsoil (not rich in clay) or where new
- No excavation shall occur in this zone without consulting the appointed arborist and obtaining approval from the local authority.
- Storage of materials shall be limited to that which is required for the task in hand. Heavy materials that require storage for more than two days shall be stored outside
- No machinery in excess of 2.5m tall shall pass through or operate in this zone unless carefully marshalled in order to avoid damage to branches.


Restricted Activity Zone B

Within this zone (indicated on the Tree Protection Plan) it is proposed to excavate for the basement. Either contiguous piling (or sheet piling) shall be installed along the edge of the basement, or an alternative method shall be adopted which does not disturb soils beyond the footprint of the basement (e.g. pinning). A typical method of pinning would be to excavate to a specified depth (e.g. 1m), install shuttering and then cast the concrete basement walls. Then to excavate short sections beneath this wall and cast deeper concrete. Then to excavate in between these deeper sections and infill with concrete. In this manner excavation may continue to any specified depth without disturbing soils beyond the footprint of the build.


The specific method adopted will vary between contractors. However, the following restrictions will

- No excavation or ground disturbance shall occur beyond the footprint of the
- Where a small excavator is used, it shall operate from within the footprint of the

See Section 6 for more restrictions that apply throughout the site

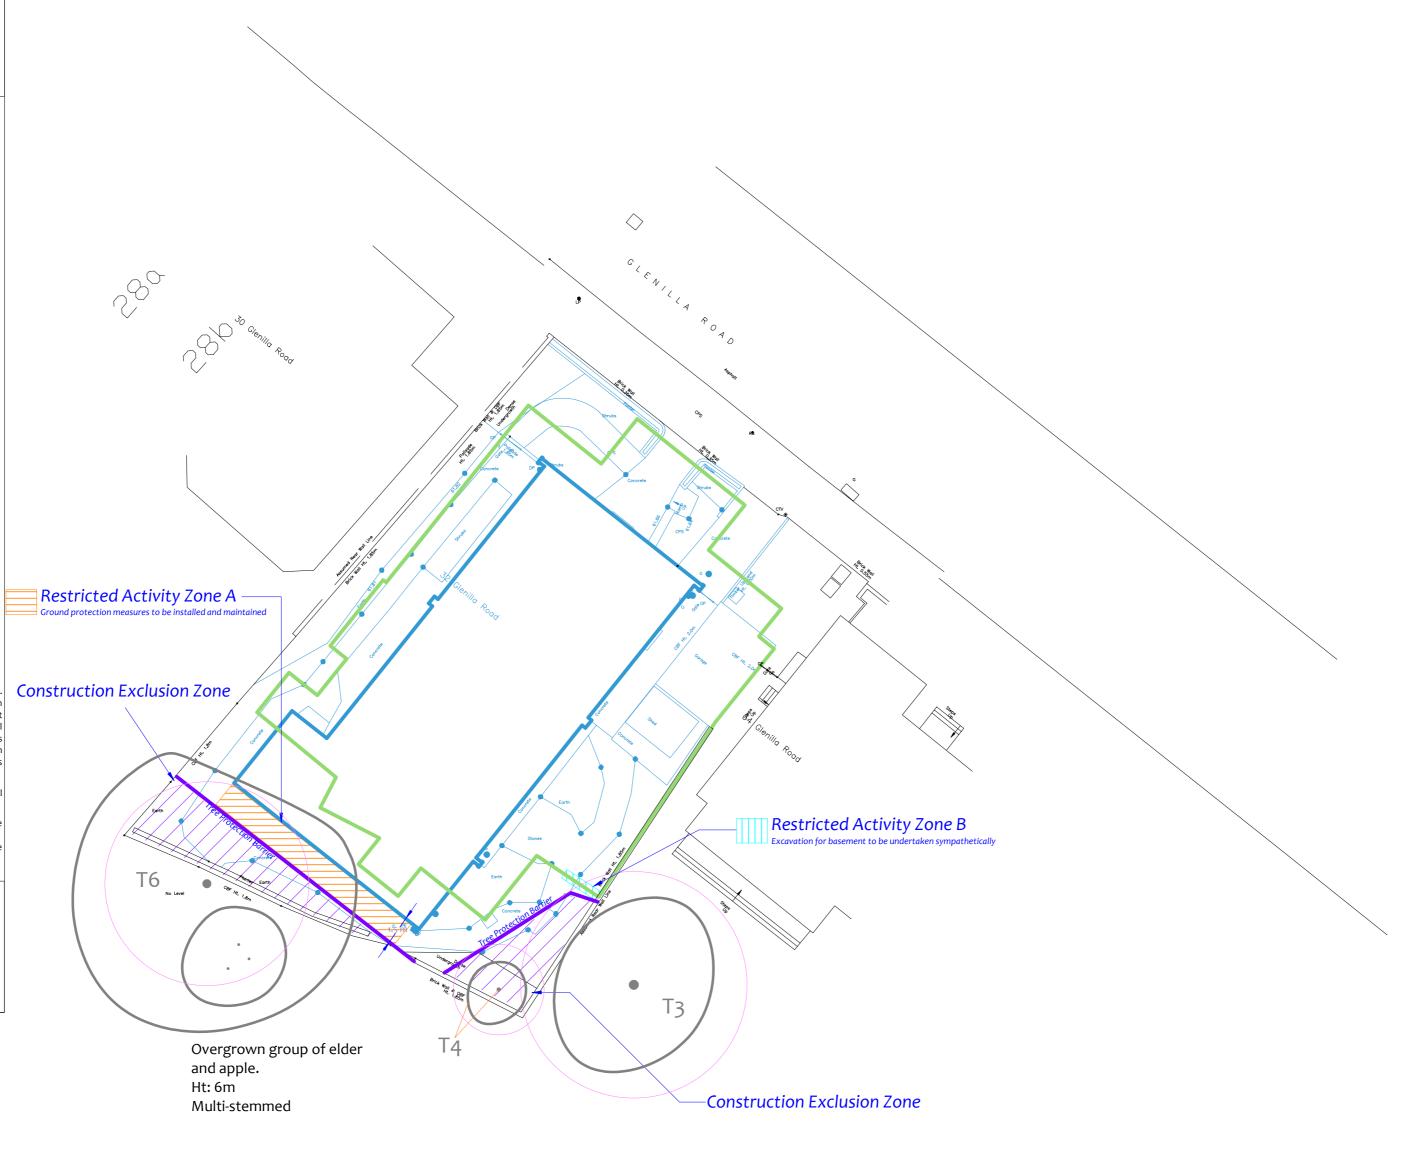


Existing Layout (Blue) Proposed Layout (Pale Green)

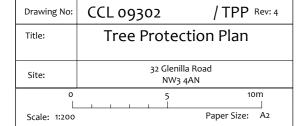




0






Category U tree





Usually maturing trees, or younger trees with good form. Retention of these trees is desirable though less than Category A trees re not considered to be a material planning consideration rees unsuitable for retention due to their very poor condition.

Tree Protection Plan

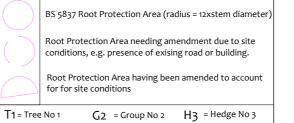



MN = Measured North:


Canopy spreads are sometimes measured to an approximate N defined by site features. Often more accurate, especially where rows of trees are not aligned N-S or E-W.




Tree Protection Plan

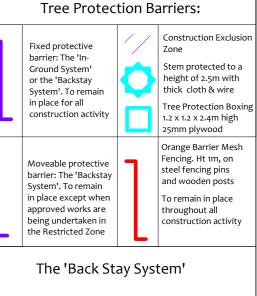

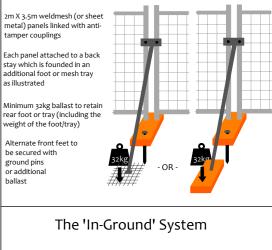

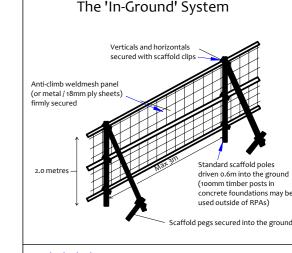



Within this area the following restrictions shall apply

No excavation or land regrading whatsoever No storage of materials, rubble, soil or spoil. No fires within the exclusion zone or within 10m of any tree canopy No site cabins or other temporary structures. No discaharge of polluted water, cement or chemicals of any kind. No use of any machinery, or passage or parking of vehicle No tree works without council consent.

Restricted Activity Zones Restrictions are detailed within the accompanying Method Statement

