


IW/G.5 - Library

These doors have the most exquisite glazing mouldings. They appear to match those on windows EW/G.18, 16, and 19. Interesting that all these are in the same area of the original house. An attempt has been made to strip these glazed doors resulting in damage to the glazing bars, many of which will require repair or replacement

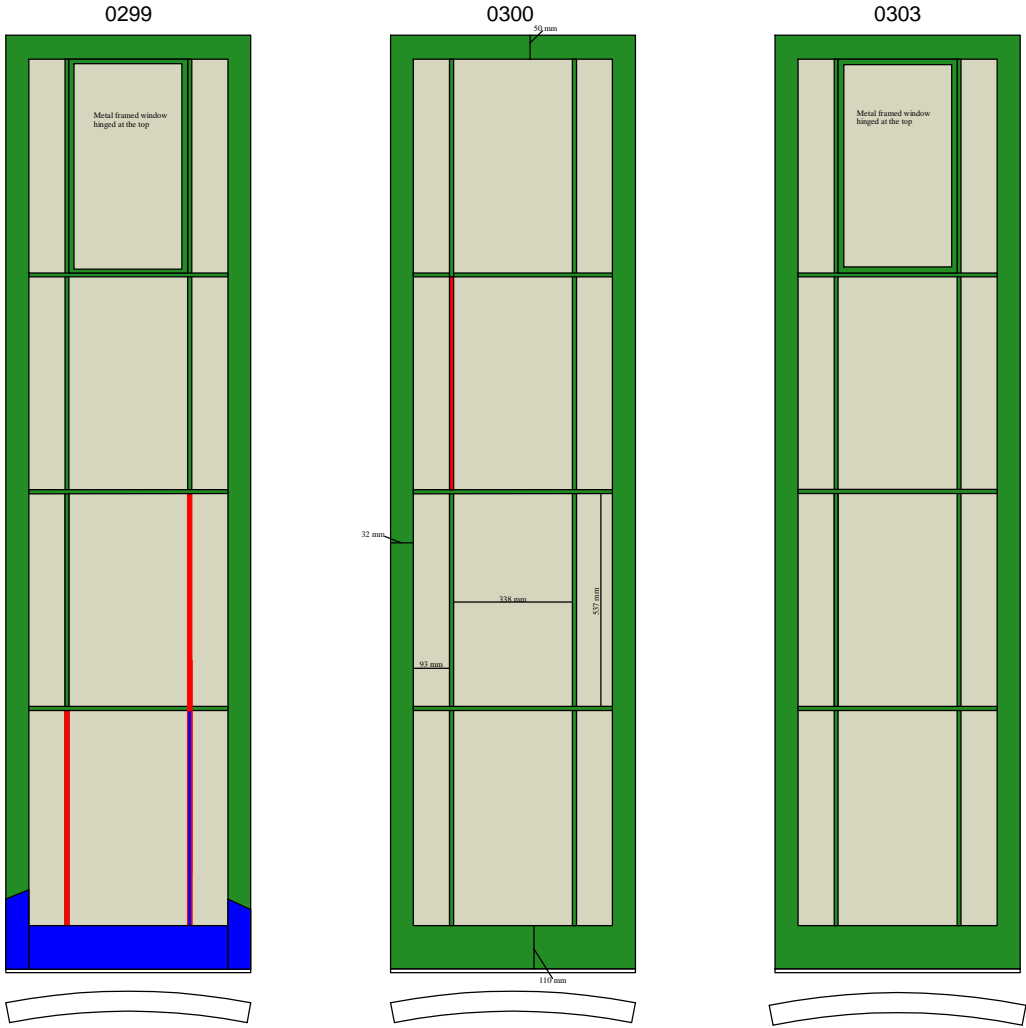

0300 is a door. Also extant are two of the mullions, one from an outside edge and the other from the hinge side of 0300.

The sill is in two parts and both are extant though would require some work to make them servicable.

Many of the glazing bars are damaged and will need replacing

- Missing timber
- Existing timber requiring refurbishment
- Timber recommended to be replaced

Luard Conservation 67 Selions Avenue London NW10 4UD	+44 (0)20 8961 7544 +44 (0)7963 741 117 info@luardconservation.com	The Elms, Fitzroy Park
	IW/G.5 Library Doors	
	NOT TO SCALE	
	Luard Conservation	