


- Key**
- Existing
 - Existing demolished
 - Proposed
 - Existing seating retained and refurbished

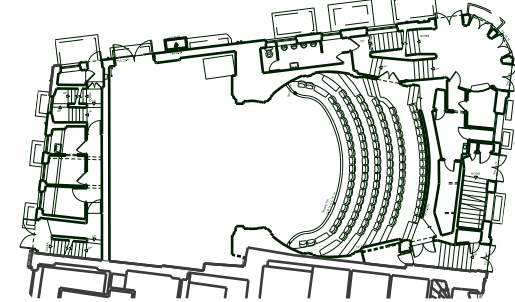

- KEY**
- Site Boundary
 - New Building
 - Existing Building

- FLOOR CEILING TAGS**
- Ceiling Type
 - Floor Type
- See drawing 2201-5-515 & 526 for floor types
See drawing 2201-5-520 for ceiling types

- PARTITION TYPES**
- P1 Bar pocket door
 - P2 Curved wall to Boxes
 - P3 FR60, 60dB Partition
 - P4 FR60, 60dB Partition
 - P5 Tiled wall lining
 - P6 FR60 Wall lining

See drawings 1601-5-109 to 112 for partition location
See drawings 1601-5-510 for partition and lining details.

- FLOOR TYPES**
- F1 New timber raised floor on battens, non-slip finish to Dimmer Room
 - F2 New levelled raised timber floor on battens to SE details
 - F3 New levelled carpet floor on battens
 - F4 New raised timber floor on battens to boxes to SE details
 - F5 Non-slip Linoleum/Vinyl finish on latex levelled screed on existing timber floor build up
 - F6 New carpet floor on existing timber floor build up
 - F7 New rake timber floor on battens to SE details
 - F8 New circle timber steps
 - F9 New carpet floor finish to circle rake and existing stairs
 - F10 Timber floor finish to new Lift Lobby
 - F11 Floor threshold between Floor Type F2 and Floor Type F3/F5
- See drawings 1601-5-109 to 112 for flooring locations
See drawings 1601-5-515 & 516 for details


Note:
Replace exiting carpet floor finish throughout the auditorium space and in the LGF bar area. Allow for re-leveling of floor in the new LGF bar and lift area to accessible levels. Allow for decorating the whole auditorium and BOH spaces at front (on West Street Side) on LGF and GF where works occur. All pavement lights to be checked for leaks and repaired and excising steelwork to be locally strengthened as required. To balance the loss of 24no seats at the back of the Stalls where the new accessible lift is inserted, the existing circle crossing is proposed to be infilled with an additional row of 15no new seats to ensure that the minimum viable number of 400 seats is retained - the theatre is a very small venue already and reducing the seats number below the 400no threshold will compromise the viability of this venue. In addition to the circle infill, the existing box is reinstated (currently a control room) and 4no seats installed in this location. 2no additional new seats are proposed to be added within the lower circle rake achieving a total of 184no seats within the circle level and 405no seats in total. The original upper circle seats are retained and restored. Existing water-fed cast iron radiators retained, refurbished and retrofitted to be electrical radiators to M+E details. Refer to M+E specifications for the proposed lighting, heating and ventilation strategy details and refer to SE details for all structural alterations

THE CONTRACTOR IS TO CHECK AND VERIFY ALL BUILDING AND SITE DIMENSIONS, LEVELS AND SEWER INVERT LEVELS AT CONNECTION POINTS BEFORE WORK STARTS

THIS DRAWING IS TO BE READ AND CHECKED IN CONJUNCTION WITH ENGINEERS AND OTHER SPECIALIST DRAWINGS

THE DRAWING AND THE WORKS DEPICTED ARE THE COPYRIGHT OF THIS PRACTICE AND MAY NOT BE REPRODUCED EXCEPT BY WRITTEN PERMISSION

0 1m 3m

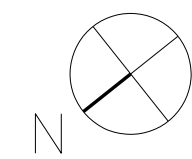

E	20/09/22	Planning			
D	06/09/22	Setting out for information			
C	20/07/22	Planning			
B	19/07/22	Planning			
A	13/07/22	Planning			
/	17/06/22	Planning			
Rev:	Date:	Description			

Job: 2201 Ambassadors Theatre
Client: Ambassador Theatre Group

Drawing: Proposed 1F - Upper Circle
Drawing no: 2201-3-111
Rev: E
Scale: 1:50@A1, 1:100@A3
Status: Stage 3
Date: 17/06/22

citizensdesignbureau
Ground Floor Units 17 & 18, 6 Westgate Street, London, E8 3JH
t : 02030595732
e : everyone@citizensdesignbureau.net