

Proposed Window Schedule

No	Floor	Description	Existing or Proposed Location	Window	size (mm)	Existing Window	Historic/Modern	Action	Proposed Window Type
				Height	Width				
W01	L2	Bedroom 02	Existing	1525	1065	Painted sash, double glazed	Modern	Draughtseal and Overhaul and Fit 1 New Pair of Sashes in Accoya with Heritage Double Glazed units - 6.8mm acoustic laminate. Replace cill	See Sash Window Workshop quote L59667_Q9. Item 1
W02	L2	Bedroom 02	Existing	1525	1065	Painted sash, double glazed	Modern	Draughtseal and Overhaul and Fit 1 New Pair of Sashes in Accoya with Heritage Double Glazed units - 6.8mm acoustic laminate. Replace cill	See Sash Window Workshop quote L59667_Q9. Item 2
W03	L2	Bedroom 03	Existing	1465	1205	Painted sash, double glazed	Modern	Draughtseal and Overhaul and Fit 1 New Pair of Sashes in Accoya with Heritage Double Glazed units - 6.8mm acoustic laminate. Replace cill, replace half pulley stile, splice	See Sash Window Workshop quote L59667_Q9. Item 3
W04	L2	L2 Hallway	Existing	1670	910	Painted sash, double glazed	Modern	Draughtseal and Overhaul and Fit 1 New Pair of Sashes in Accoya with Heritage Double Glazed units - 6.8mm acoustic laminate. Replace cill, replace half pulley stiles, splice repairs to outer iamb	See Sash Window Workshop quote L59667_Q9. Item 4
W05	L1	Principle Bedroom	Existing	2510	1070	Painted sash, single glazed	Historic frame and glass	Draughtseal and Overhaul. Replace cill	See Sash Window Workshop quote L59667_Q9. Item 6
W06	L1	Principle Bedroom	Existing	2510	1070	Painted sash, single glazed	Historic frame and glass	Draughtseal and Overhaul. Replace cill	See Sash Window Workshop quote L59667_Q9. Item 7
W07	L1	Principle Dressing (front)	Existing	1057	940	Painted sash, double glazed	Modern	Install a complete new non Doc L Classic sash window in Accoya with Heritage Double Glazed units - 6.8mm acoustic laminate.	See Sash Window Workshop quote L59667_Q9. Item 5
W08	L1	Principle Ensuite	Existing	1860	1325	Painted sash, double glazed	Modern	Install a complete new Doc L Classic sash window in Accoya with Heritage Double Glazed units - 6.8mm acoustic laminate.	See Sash Window Workshop quote L59667_Q9. Item 8
W09	L1	L1 Hallway	Existing	1780	980	Painted sash, double glazed	Modern	Install a complete new Doc L Classic sash window in Accoya with Heritage Double Glazed units - 6.8mm acoustic laminate.	See Sash Window Workshop quote L59667_Q9. Item 10
W10	L1	Principle Dressing (rear)	Existing	1145	605	Painted sash, double glazed	Modern	Install a complete new Doc L Classic sash window in Accoya with Heritage Double Glazed units - 6.8mm acoustic laminate.	See Sash Window Workshop quote L59667_Q9. Item 9
W11	L0	Front Reception	Existing	1680	1070	Painted sash, single glazed	Historic frame and glass	Draughtseal and Overhaul	See Sash Window Workshop quote L59667_Q9. Item 11
W12	L0	Front Reception	Existing	1680	1070	Painted sash, single glazed	Historic frame and glass	Draughtseal and Overhaul	See Sash Window Workshop quote L59667_Q9. Item 12
W13	LO	L0 Hallway (internal)	Existing - enlarged	1625	590	Painted casement, double glazed	Modern	New painted fixed toughened glass casement window - internal	
W14	LO	Cloakroom	Existing	1300	1070	Painted casement, double glazed	Modern	Install a complete new Doc L Classic sash window in Accoya with Heritage Double Glazed units - 6.8mm acoustic laminate.	See Sash Window Workshop quote L59667_Q9. Item 13
W15	L-1	Kitchen	Existing	1300	1070	Painted sash, single glazed	Historic frame and glass	Draughtseal and Overhaul	See Sash Window Workshop quote L59667_Q9. Item 14
W16	L-1	Kitchen	Existing	1300	1070	Painted sash, single glazed	Historic frame and glass	Draughtseal and Overhaul	See Sash Window Workshop quote L59667_Q9. Item 15
W17	L-1	Utility	Existing	600	1445	Painted sash, double glazed	Modern	Install a complete new Doc L Classic sash window in Accoya with Heritage Double Glazed units - 6.8mm acoustic laminate.	See Sash Window Workshop quote L59667_Q9. Item 16
W18	L-1	Utility	Existing	600	740	Painted sash, double glazed	Modern	Install a complete new Doc L Classic sash window in Accoya with Heritage Double Glazed units - 6.8mm acoustic laminate.	See Sash Window Workshop quote L59667_Q9. Item 17
W19	L-1	wc	Existing	600	770	Painted sash, double glazed	Modern	Install a complete new Doc L Classic sash window in Accoya with Heritage Double Glazed units - 6.8mm acoustic laminate.	See Sash Window Workshop quote L59667_Q9. Item 18
W20 - W22	L0	Extension	Proposed	2420	1300	Painted arched head double-glazed window	Modern	Specification tbc.	
W23 - W24	LO	Extension	Proposed	2420	1300	Painted arched head double-glazed french doors	Modern	Specification tbc.	
W25 - W27	L-1	Extension	Proposed	2420	1300	Painted double-glazed french doors	Modern	Specification tbc.	


Window sizes based on existing survey provided by Client. Window sizes to be checked and confirmed prior to manufacture.

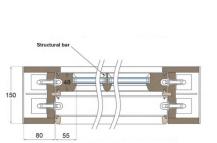

Non D Loc - section through jamb and stiles




Non D Loc - section through frame head, cill and meeting rail

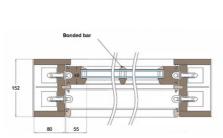


D Loc - section through jamb and stiles




D Loc - section through frame head, cill and meeting rail

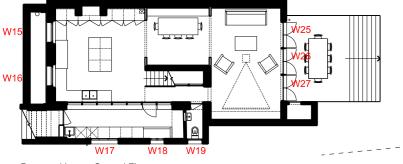




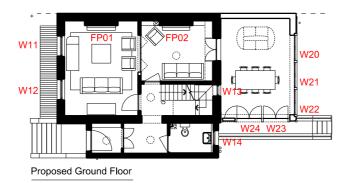

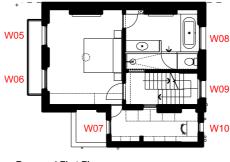

Proposed First Floor

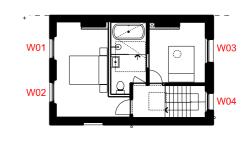

Proposed Second Floor

General Notes

Do not scale from this drawing. Drawings are for the purpose of the stage stated at the base of the drawing and therefore not for construction unless specifically stated, All dimensions to be verified on site prior to construction.

dimensions to be verified on site prior to construction.

For information only unless indicated in status.
Al structure to Structural Engineer's design.
Al services to be Contractor's design.
All works to be in accordance with current Building Regulation requirements an current construction legislation.
It is the contractor's responsibility to cross-reference all design documents and notify the architect of any inadequacy, discrepancy or divergence in or between the full drawing package/design information, but the contractor's method with full drawing package/design information, or the contractor of the constitution of the const

- Refer to window survey for proposed alterations to existing windows.
 Refer to moulding schedule for proposals relating to architraves, coping, ceiling roses, skriting etc.
 Refer to damp proof report and remedials works for damp proofing works to lower ground floor.
 Refer to services information for details relating to drainage and comfort heating/cooling.
 Refer to arboriculturalist reports for tree works.



Date Description Consultant/ Client amendments incorporated

FLOWER MICHELIN

+44(0)20 7751 0444 studio@flowermichelin.com

Unit 7-8,27 Ackmar Road,London,SW6 4UR flowermichelin.com



Project 133 Haverstock Hill, London NW3 4RU

Proposed Windows

312_31_72

Planning

1:200 A3 Scale