



SPRATLEY & PARTNERS 7 CENTENARY BUSINESS PARK, STATION ROAD, HENLEY-ON-THAMES, OXFORDSHIRE RG9 1DS . 01491 411277 ISSUED ONLY FOR THE PURPOSE INDICATED. THIS DRAWING TO BE READ IN CONJUNCTION WITH ALL CONSULTANTS INFORMATION. ALL DIMENSIONS TO BE CHECKED ON SITE. THIS DRAWING IS COPYRIGHT.

REV. ISSUED DESCRIPTION DRAWN CHECKED L2 26.07.24 Annotation updated. - - -

- 1. Existing vents in-filled in line with new ceiling buildup.
- 2. New cornice installed to match existing locally.
- 3. Refer to internal elevations for details on new reveal treatment. Existing landing boxing and lobby entrance reveal retained, stripped back and redecorated.
- 5. New service risers to be sized to miss existing cornices.
- 6. Existing coal shoots in-filled.
- 7. New reveals to lift opening.

NOTES:

- 8. New concealed fire curtain to opening head. 9. Waterproofing extending to ceiling within RM.22.LG.05.
- 10. Refer to structural engineers information for structural details.

New moisture resistant plasterboard under suspended metal frame. Ceiling Finish Type 04 - Existing Bulkheads Existing bulkheads / structural openings retained and repaired as required ready to receive decoration. Any areas of damaged plaster or beading to be removed and reinstated.

Ceiling Finish Type 03 - New MR Plasterboard

Ceiling Finish Type 02 - New Plasterboard New plasterboard and skim ceiling bellow timber joists.

Ceiling Finish Type 05 - Rendered Vaults New tanking membrane over rendered and decorated.

Ceiling Finish Type 01 - Existing Ceiling
Existing plasterboard ceiling retained and repaired ready for redecoration.
Any damaged or missing areas of ceiling to be replaced to match existing.

Ceiling Finish Type 06 - New Plasterboard Fourth New plasterboard and skim ceiling bellow timber joists.

CORNICE KEY CO-01

CEILING FINISHES KEY:

Existing Cornice Existing cornice retained, stripped back and redecorated. Any cracking to be made good and for any new or damaged cornice to be replaced to match existing in size, material and

CO-02 New Plaster Cornice

New cornice to match existing within building.

CEILING ROSE KEY:

- CR-01 Existing Ceiling Rose Retained Existing ceiling rose retained, prepared and redecorated to match ceiling. Existing paint to be fully stripped back before redecorating. Any redundant fixing locations and cracking to be made good.
- CR-02 New Ceiling Rose New plaster ceiling roses to match existing. New ceiling rose decorated to match ceiling.

FITTINGS KEY:

New recessed spotlight.

Recessed emergency spotlight. New pendant light.


□□□ New wall light.

Bulkhead light.

Lighting shown for reference only, refer to MEP information for details.

With exception of works to parapet gulleys, tile replacement, and cast iron air bricks, all external works have already secured Full Planning & Listed Building Consent under application refs. 2023/0224/P and 2023/0882/L. They have been detailed on the plans for completeness.

All external fabric repairs have already secured Listed Building Consent 2022/1811/L.

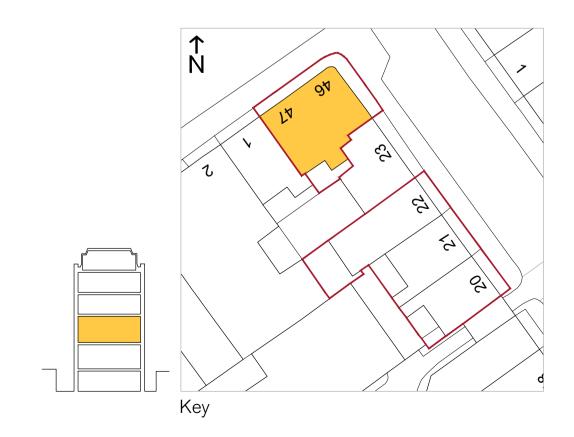

PROJECT DESCRIPTION 46-47 BS PROPOSED HOLBORN LINKS PROJECT 5 FIRST FLOOR RCP 20-22 SP & 46-47 BS

EDR

DATE SCALE AT A1 JULY '21 1:50 PLANNING

CW

DRAWING NO PL.1392 REV L2



