
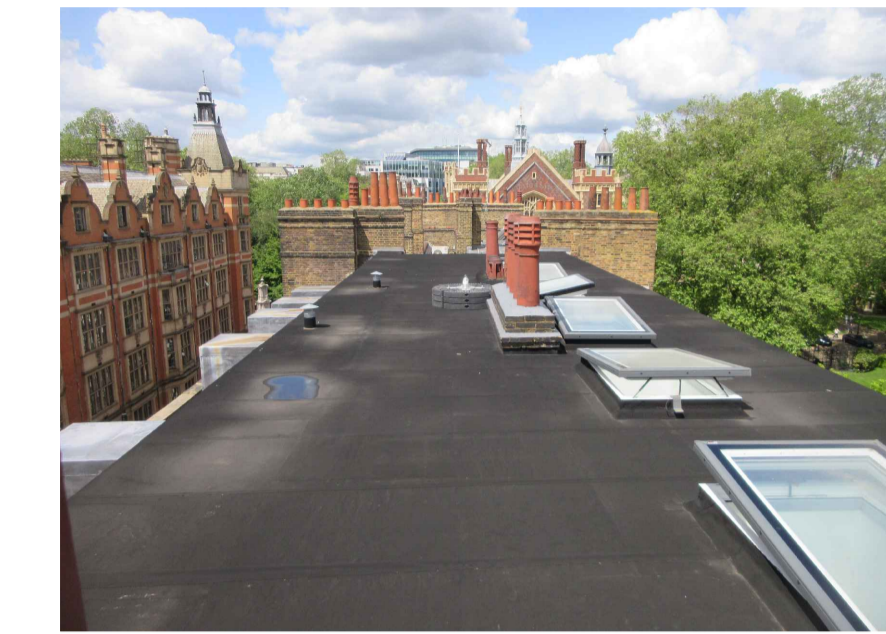


New Square No.9 1:50
Roof Plan PROPOSED

Images

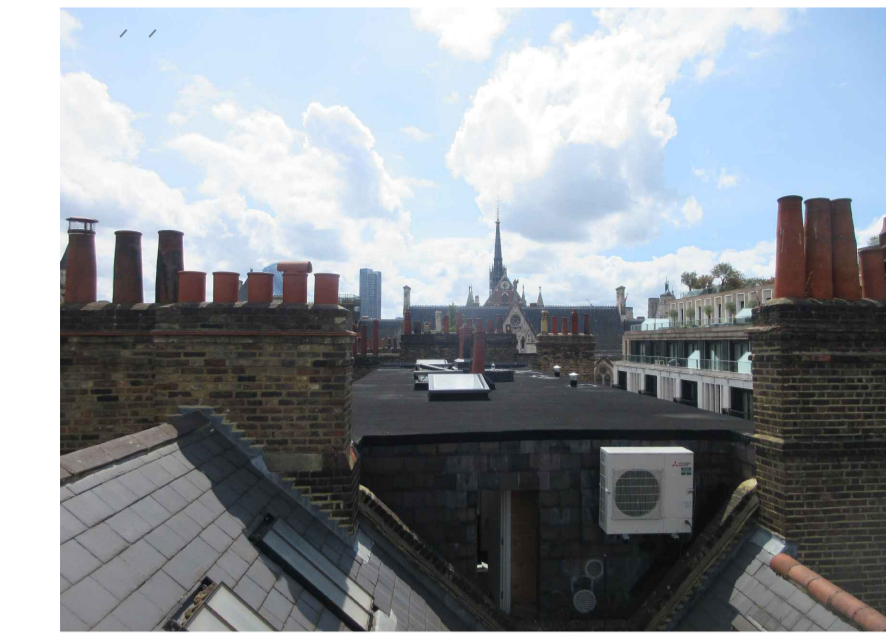

Notes



Chimneys
Vegetation to be removed and flaunching to be renewed where cracked or failing (NHL 5.0).


Chimney stacks and party walls above the roof line to be repointed where pointing is cracking and failing. Creasing tiles to be replaced where damaged or missing and like-for-like brick replacement for the occasional perished brick. Bed joint reinforcement introduced across minor cracking. Cement pointing to be replaced with hydraulic lime (NHL 3.5).

Pots replaced where found fractured.

Roofs
Minor running repairs to damaged leadwork and slating and localized re-wedging and repointing of flashing grooves. (NHL 3.5)

Access
Safety access harness wires, fixing points and ladders installed where shown to complete the installation.

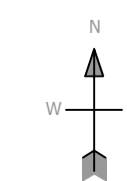

Drawn JW	Rev 0400	Notes For List B / Faculty and Tender	
Job No 0400	Job LINCOLN'S INN - NEW SQUARE		
Proj No 209	Title N9 Roof Plan PROPOSED	<small>This document is copyright and the property of Chartrrey Conservation Architects Ltd. Any copies of this drawing, made by any method from any media, must also include a copy of this page. ©Chartrrey Conservation Architects Ltd</small>	
Scale 1:50 at A1			