




Front Plan as Existing 1:100

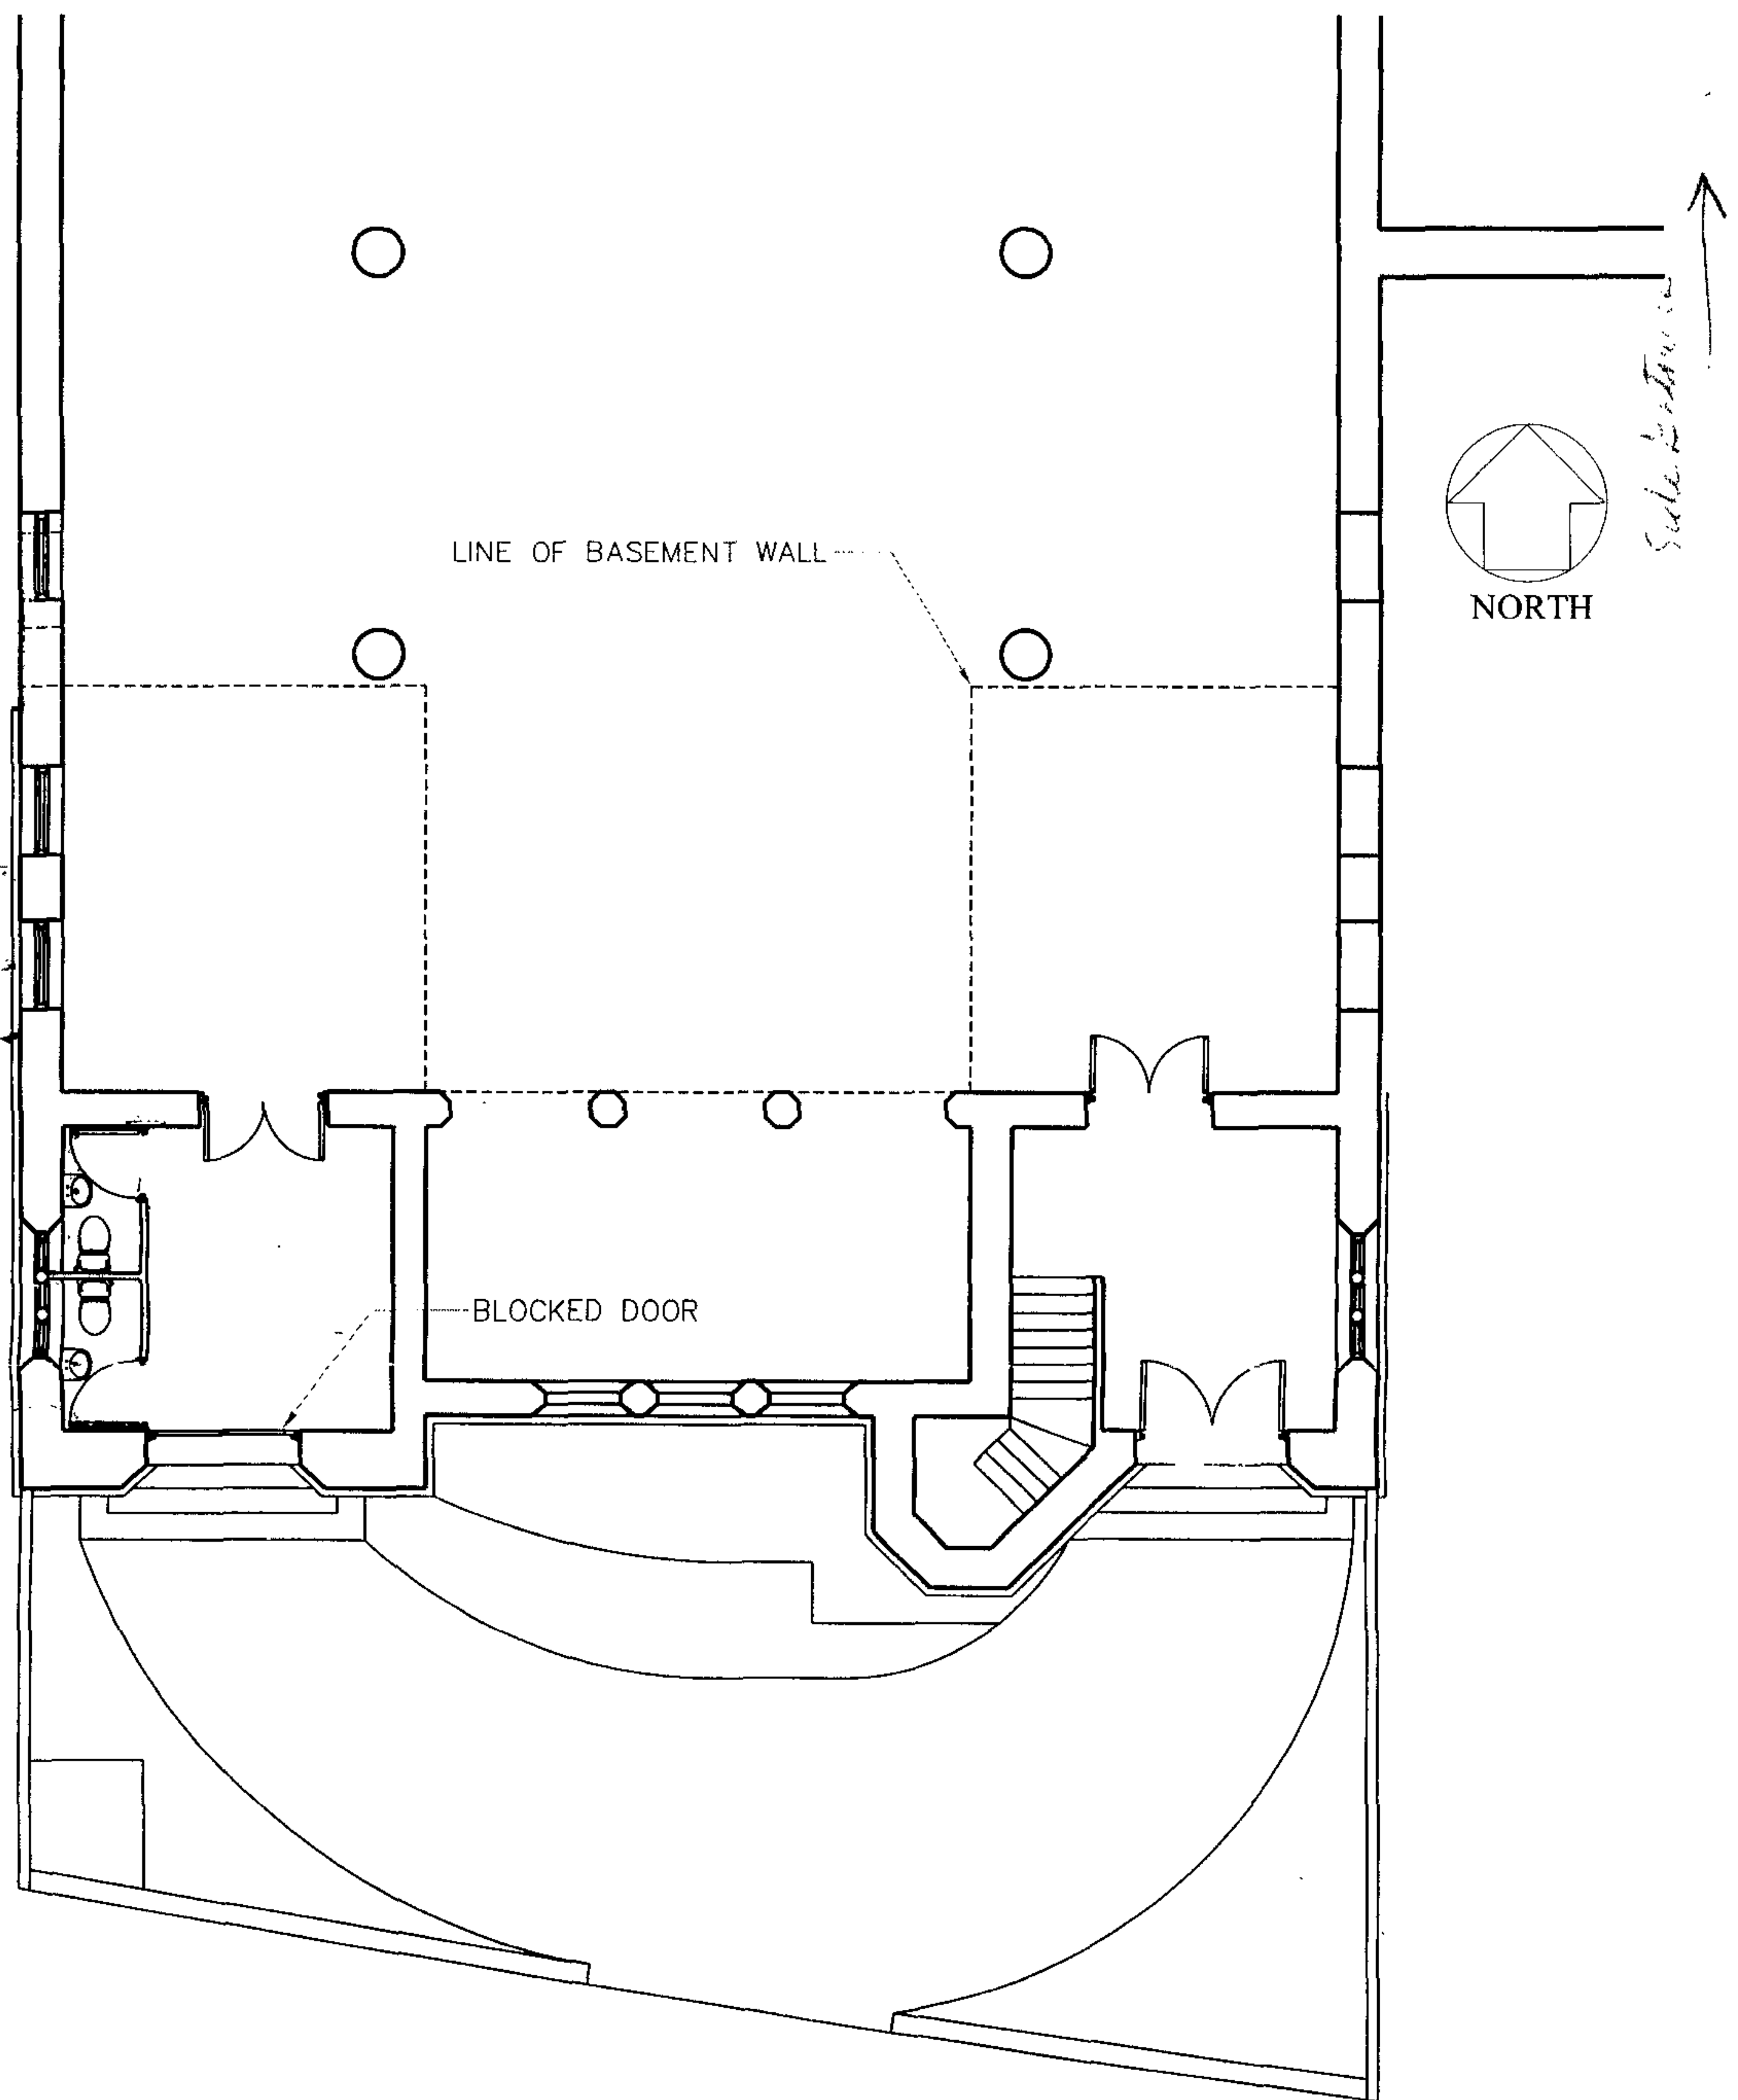


RUSSELL TAYLOR ARCHITECTS

85 BLACKFRIARS ROAD LONDON SE1 8HA
mail@rtarchitects.co.uk

TEL: 020 7261 1984 FAX: 020 7928 0610
www.rtarchitects.co.uk

St Lukes ~ Hampstead 6/05/02
1:100 IT 7/6/06.

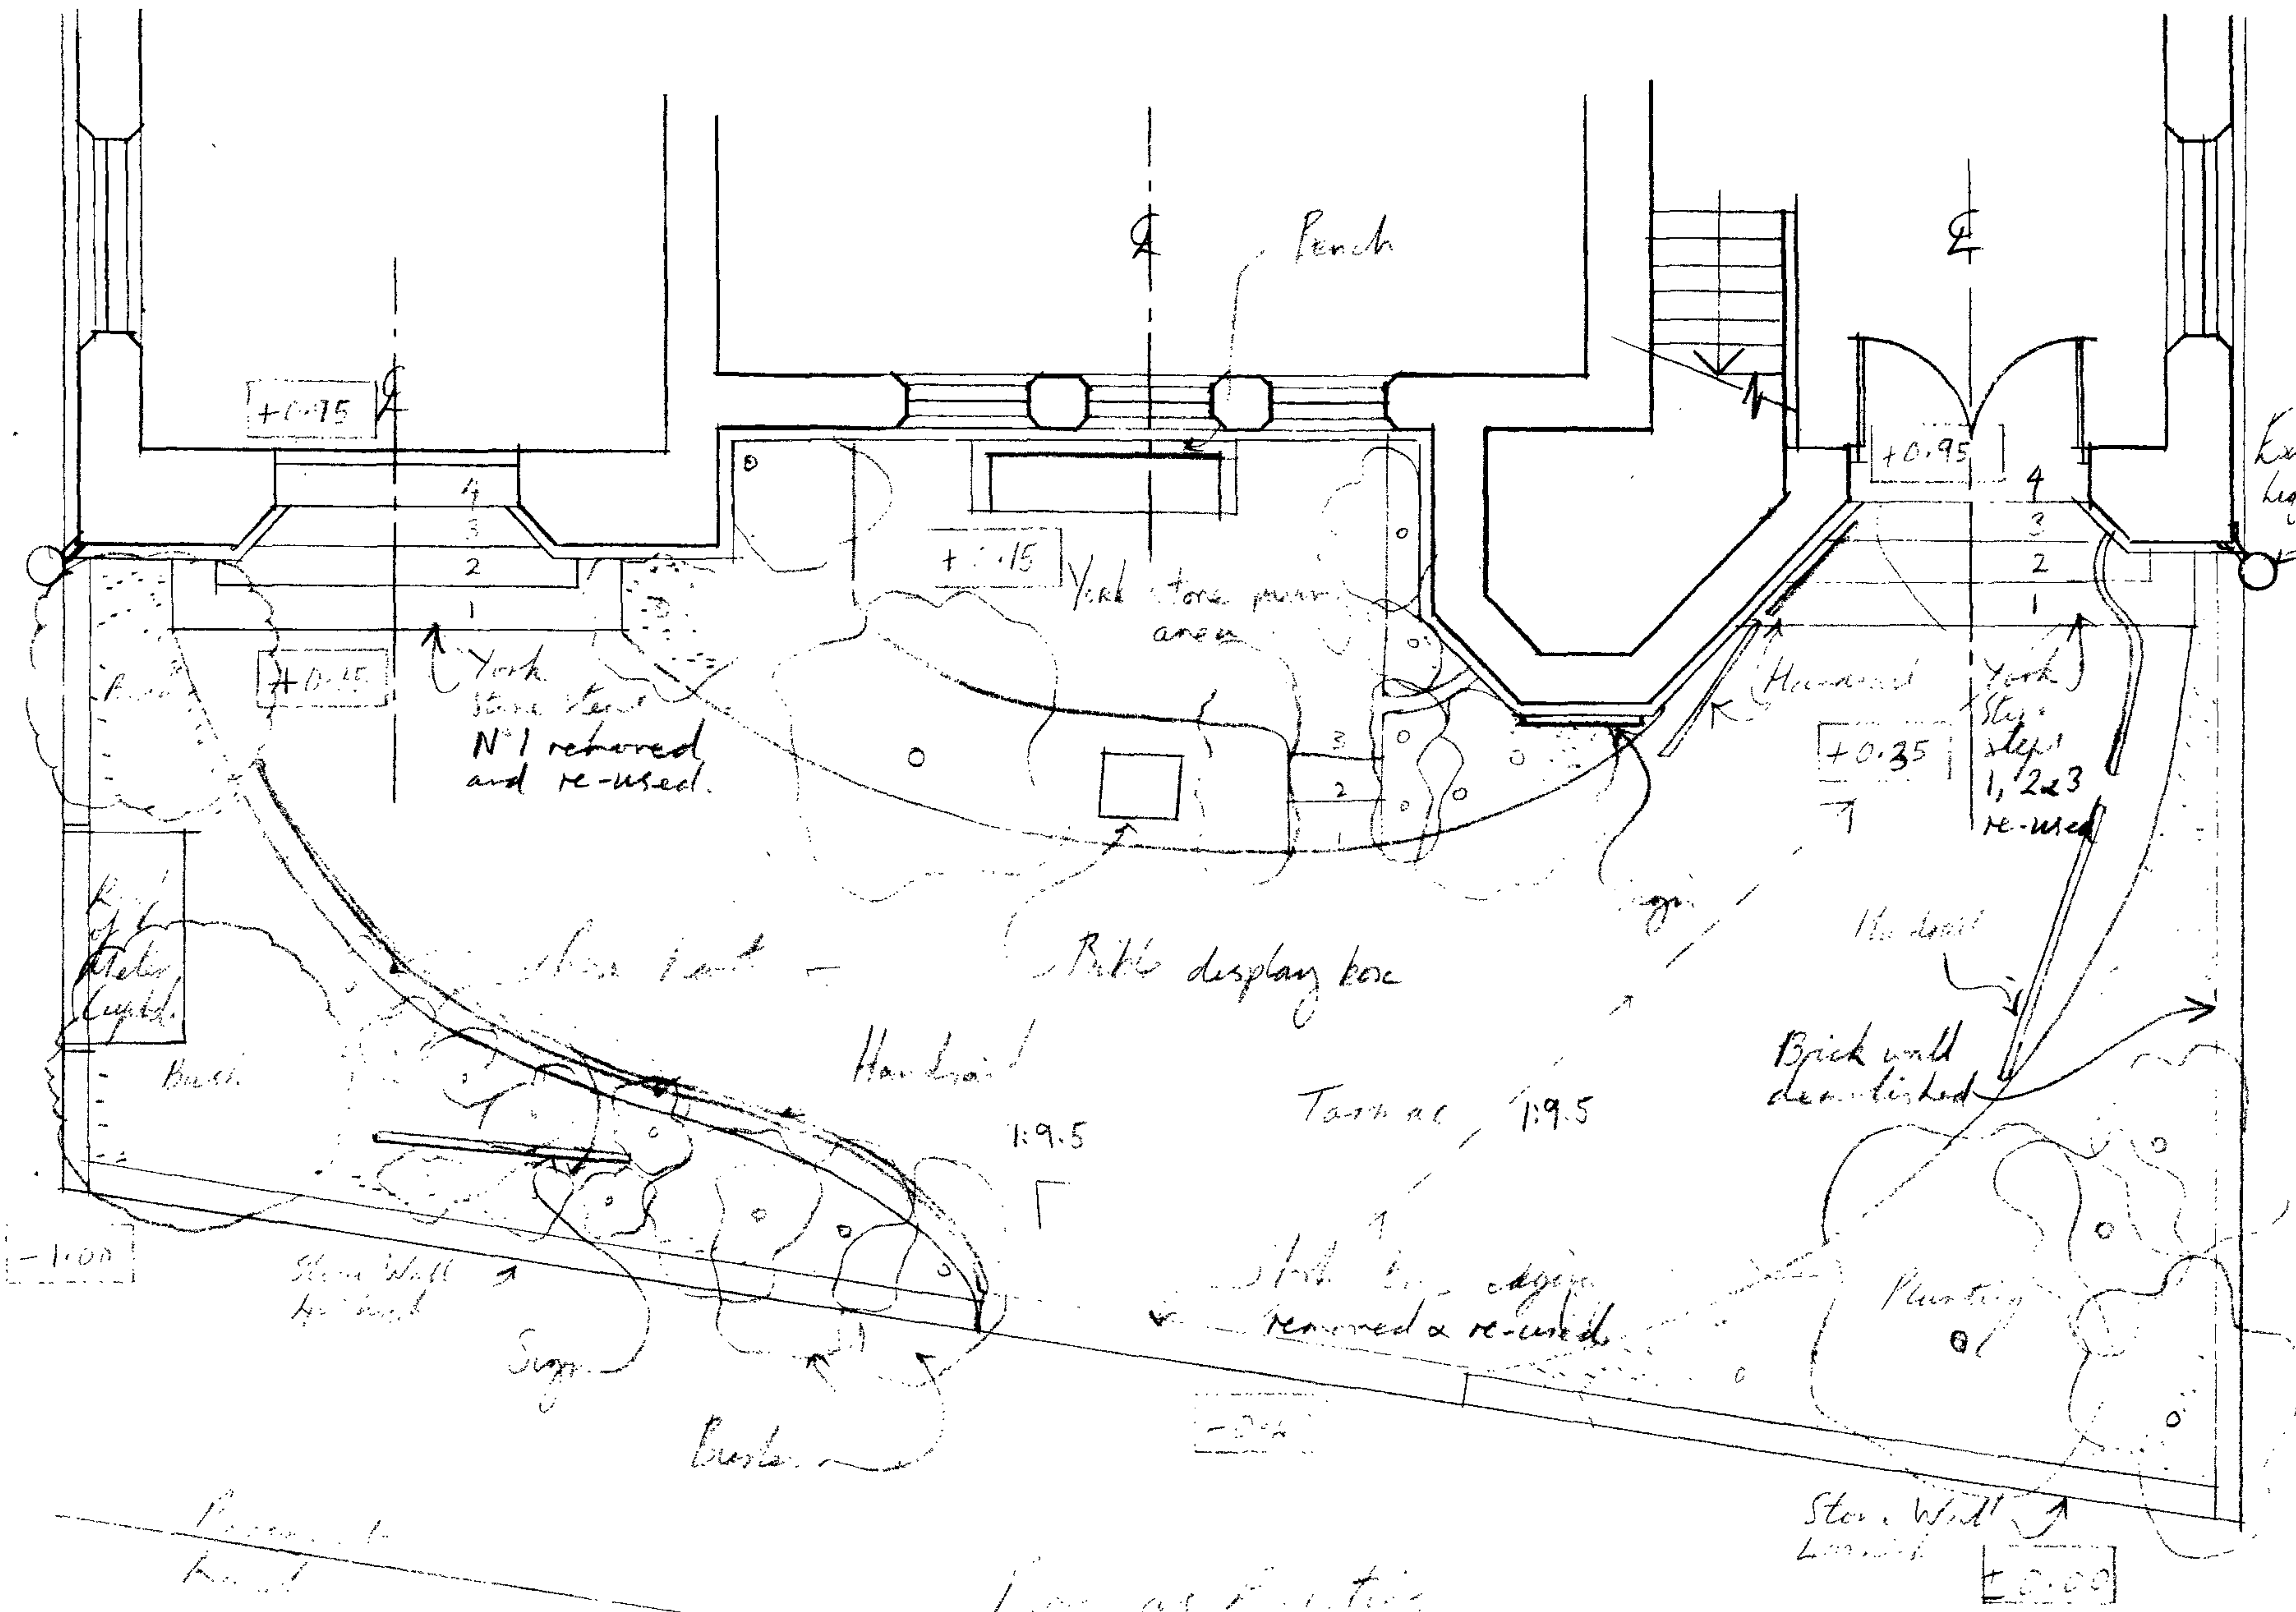



Notes on Planting
 All planting replanted
 or removed except
 bush on LH side of 2nd Portal

Rev A - 17/08/06

St Lukes - Harpenden 6105/2/03A
 1:50 RT 6/6/06

RUSSELL TAYLOR ARCHITECTS
 85 BLACKFRIARS ROAD LONDON SE1 8HA
 TEL: 020 7261 1984 FAX: 020 7928 0610
 mail@rtarchitects.co.uk www.rtarchitects.co.uk


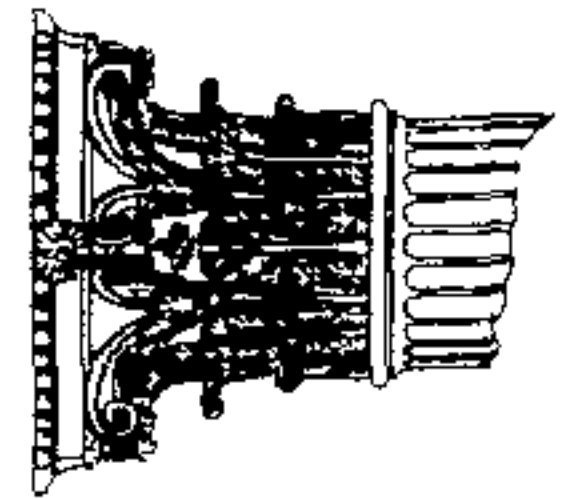


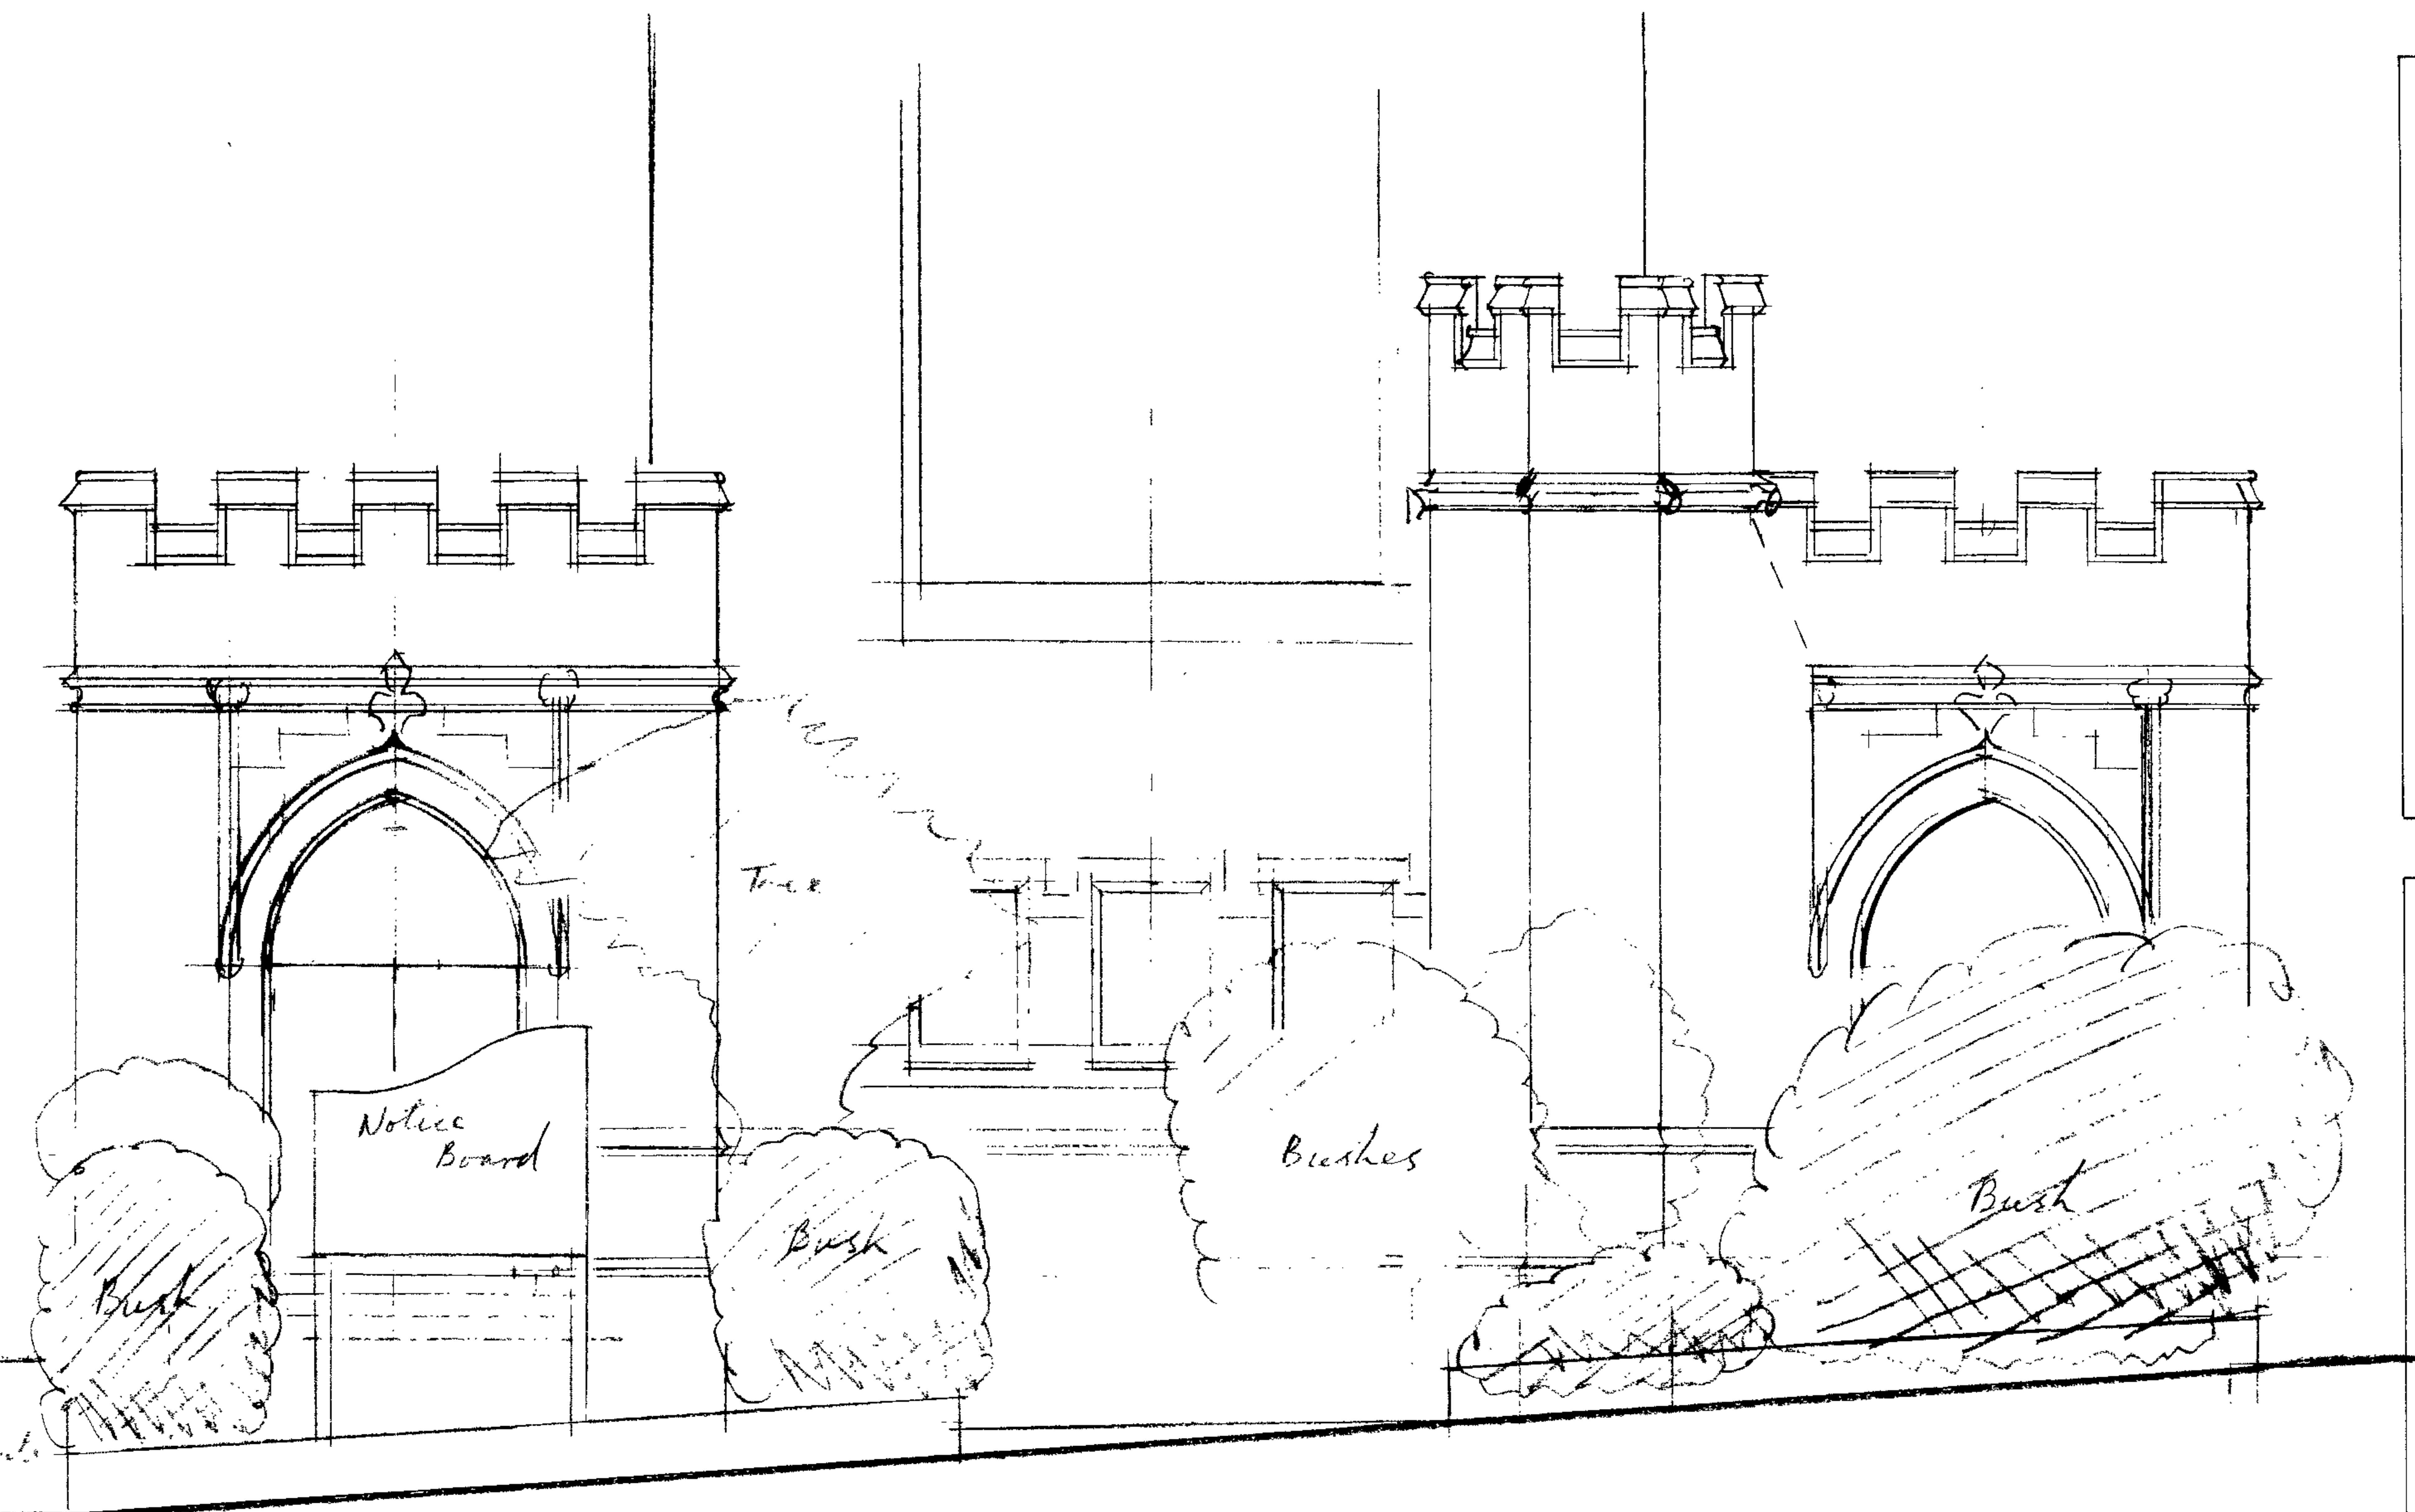

Front Elevation as Existing
 Limestone and Red Brick in Period
 bond with half stone dressings.


RUSSELL TAYLOR ARCHITECTS
 85 BLACKFRIARS ROAD LONDON SE1 8HA
 TEL: 020 7261 1984 FAX: 020 7928 0610
 mail@rtarchitects.co.uk www.rtarchitects.co.uk

St Lukes - Harpenden 6/05/2/04
 1:50 RT 6/11/06

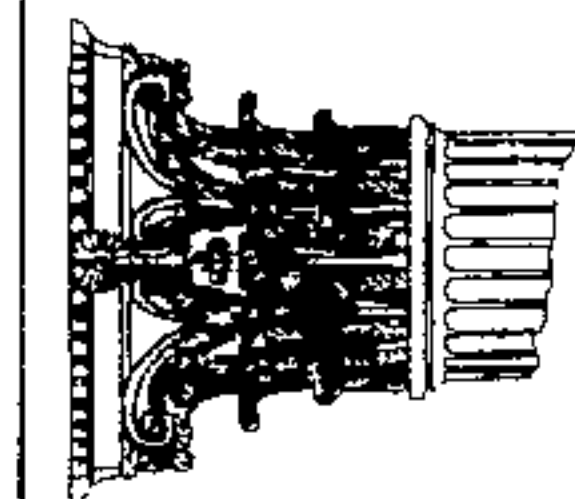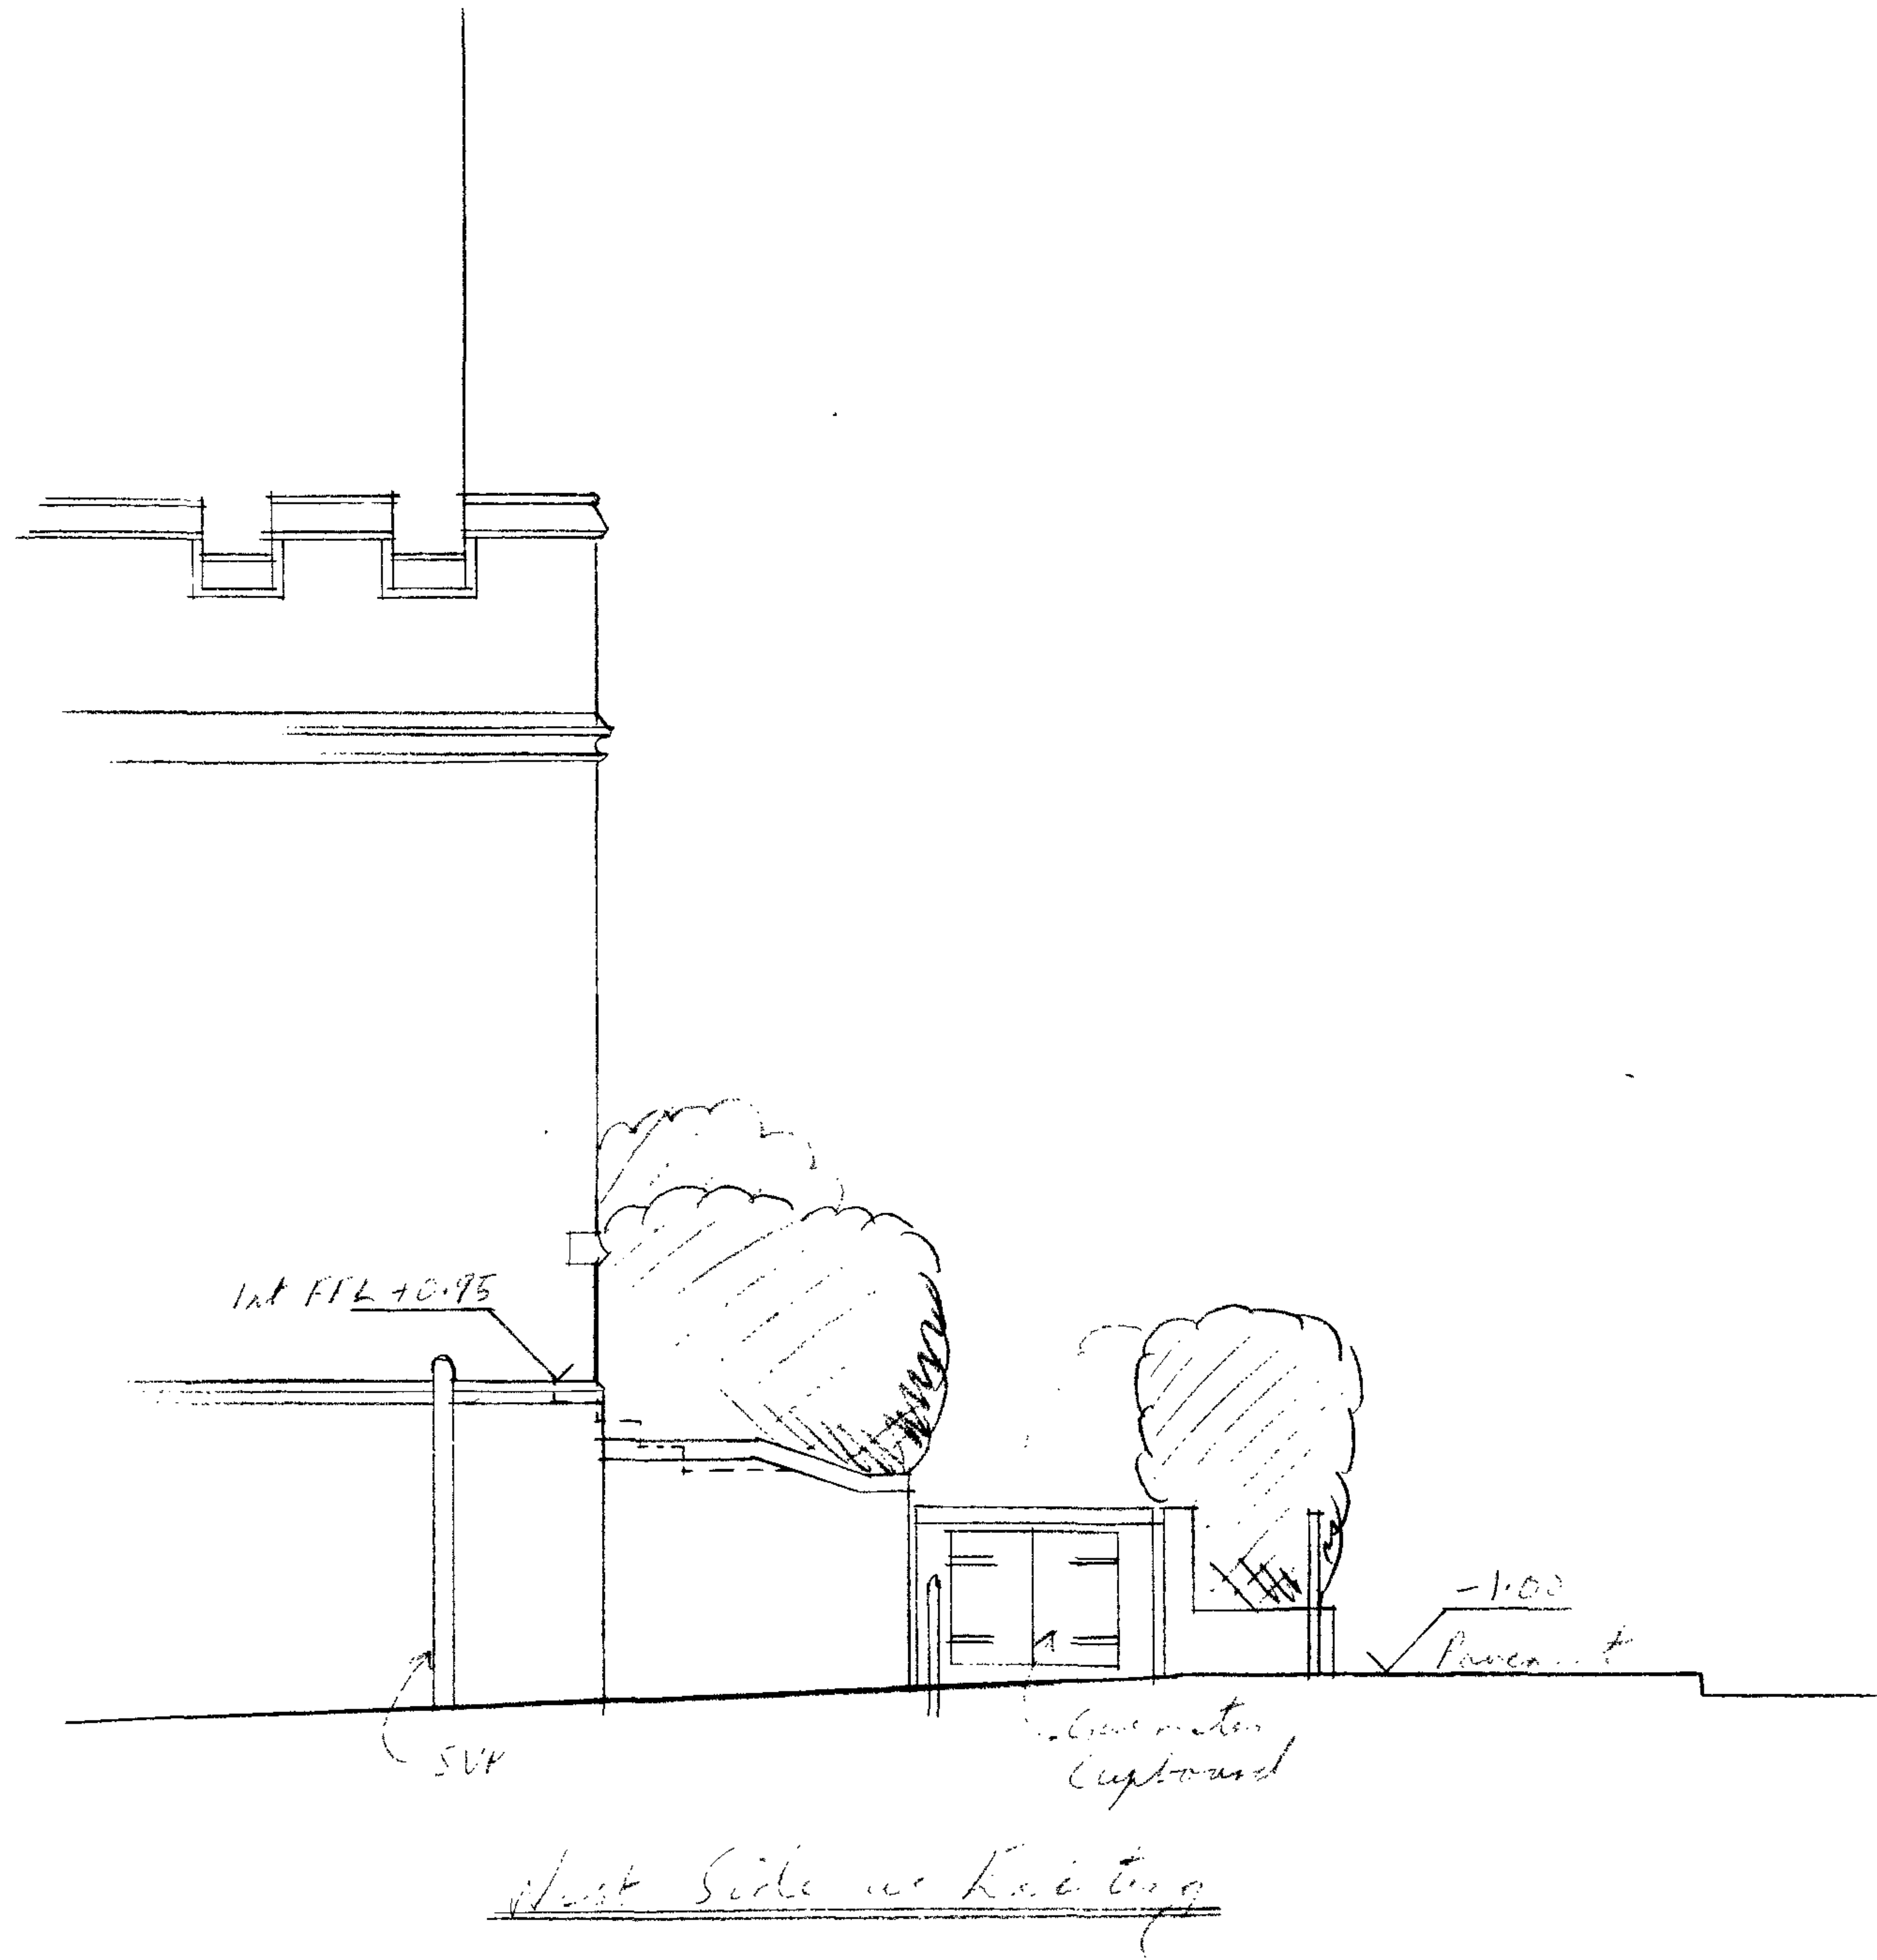

RUSSELL TAYLOR ARCHITECTS
 83 BLACKFRIARS ROAD LONDON SE1 8HA
 TEL: 020 7261 1984 FAX: 020 7928 0610
 mail@rtarchitects.co.uk www.rtarchitects.co.uk

St Lukes - Hampstead 6/05/2/06
1:50 RT 6/6/06

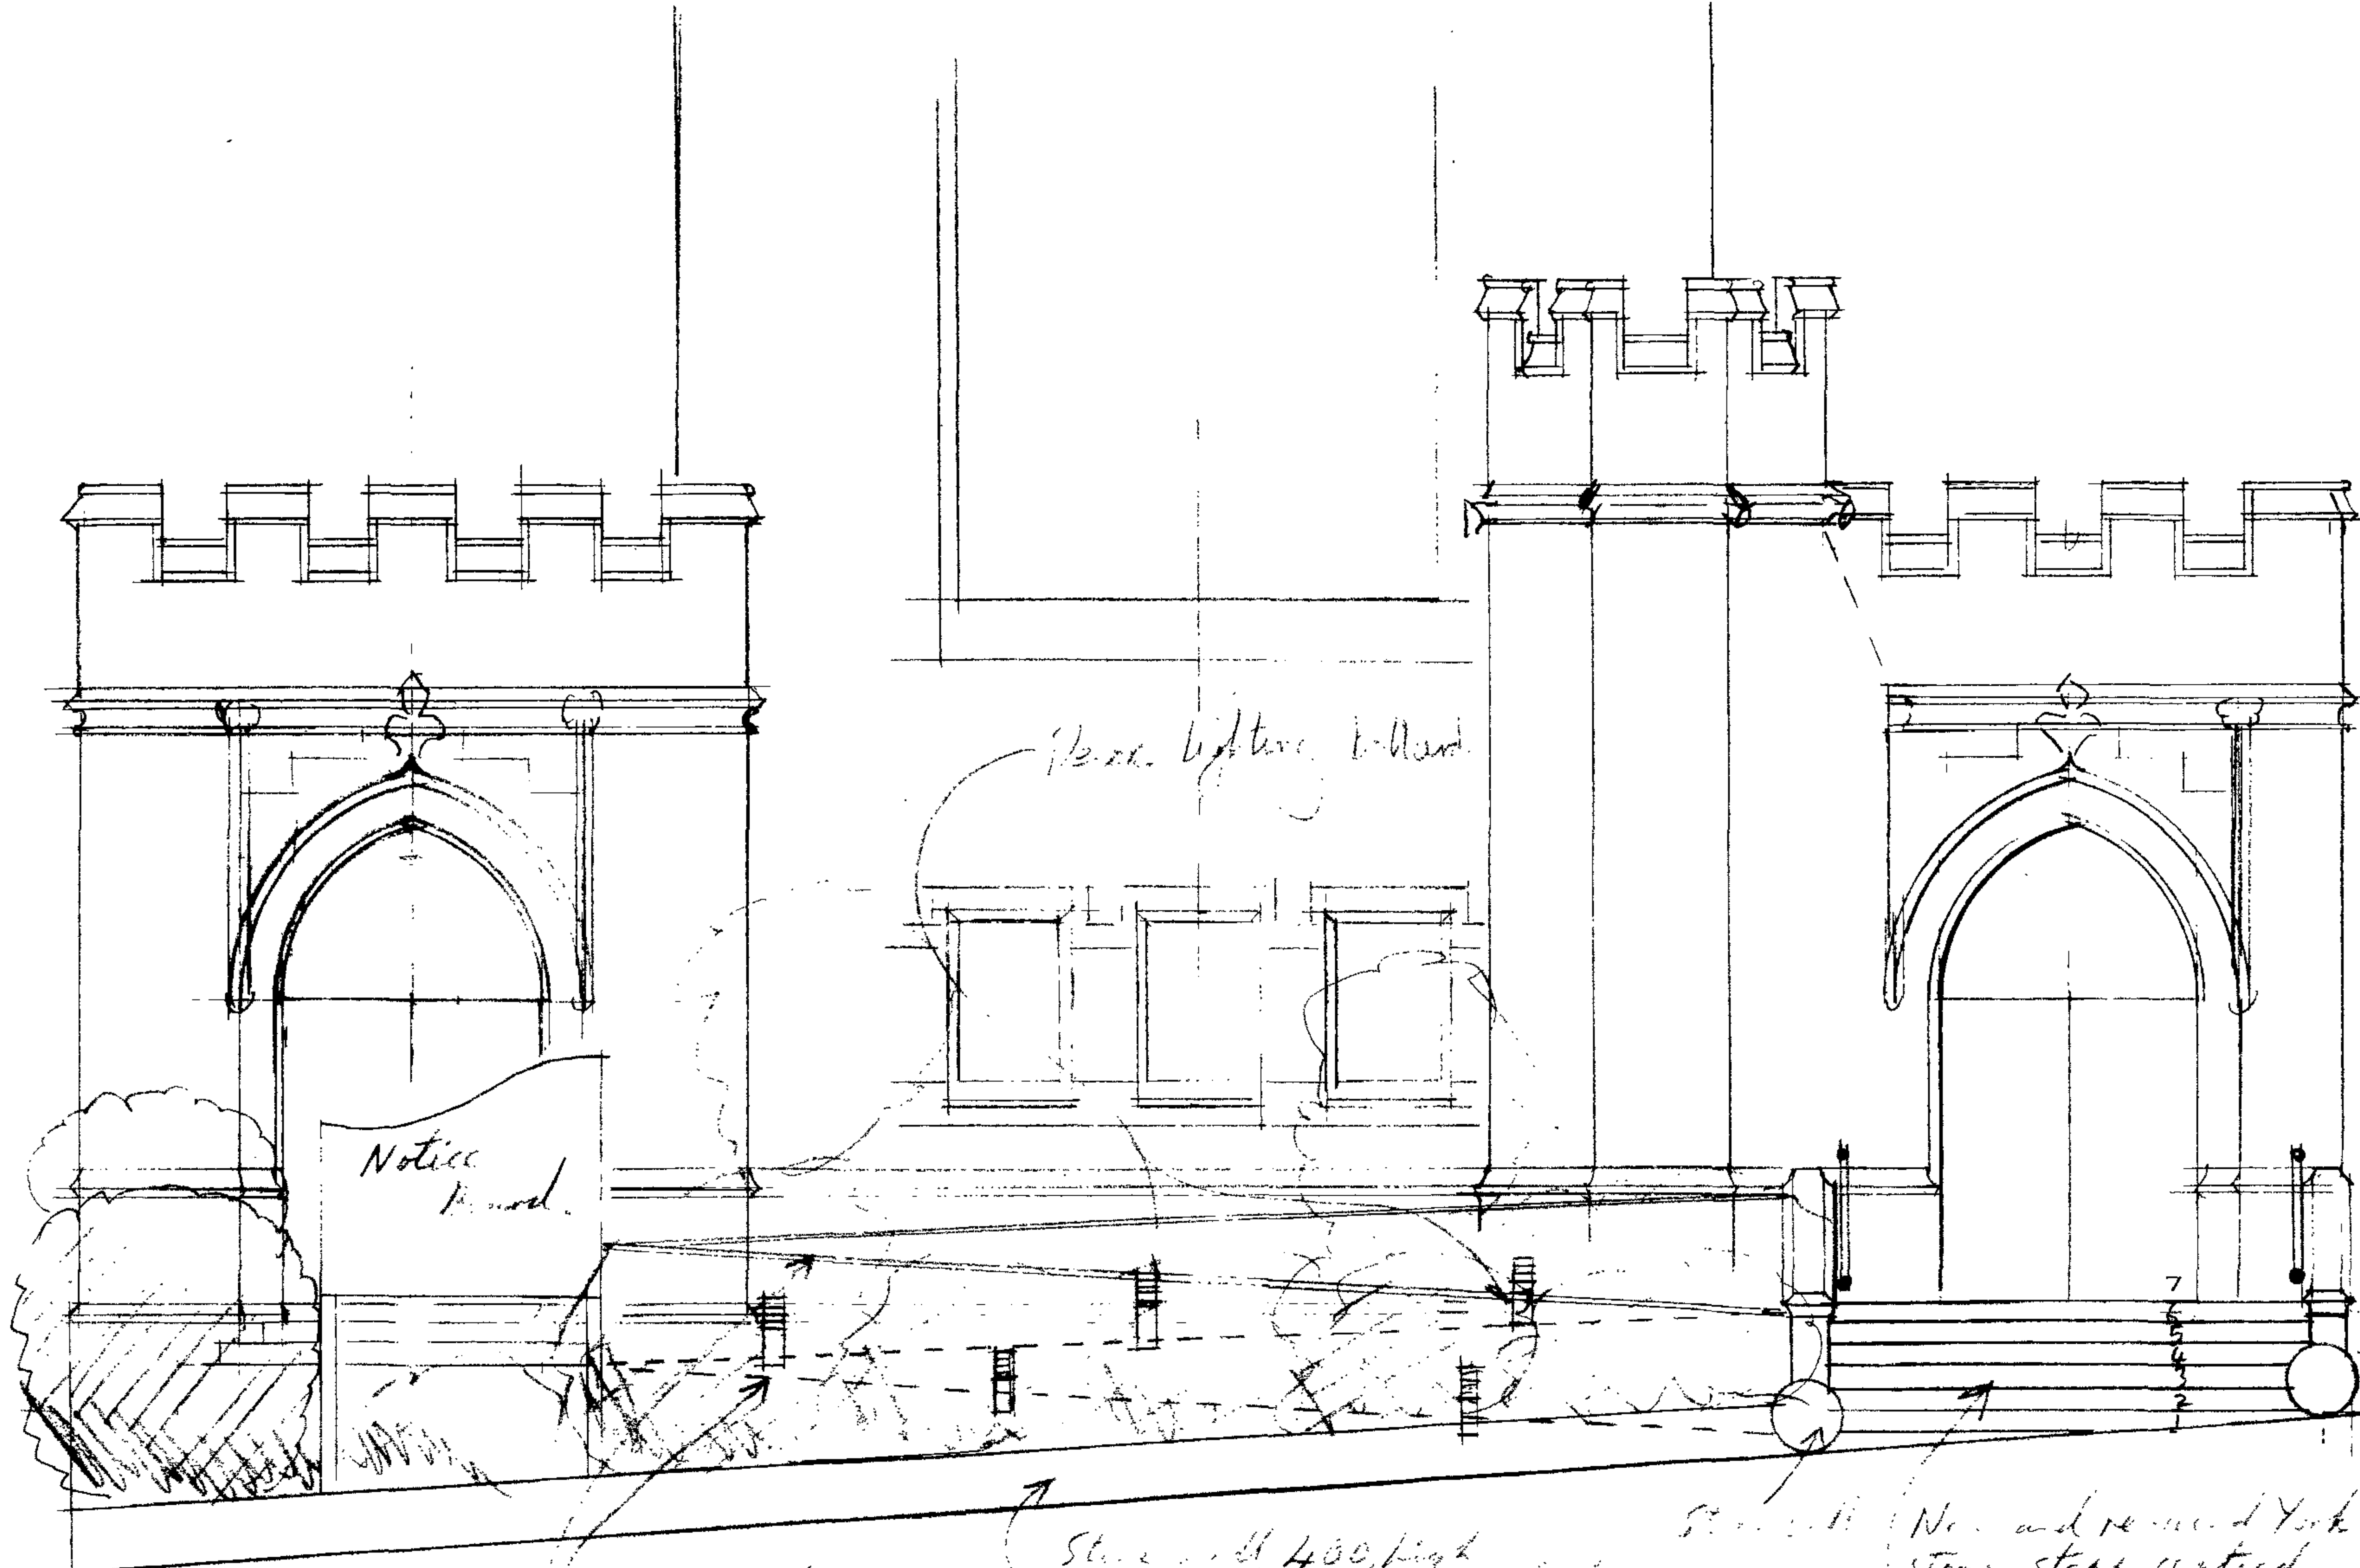

Ramps and handrails
bedded in plaster


Stone wall 400 high
repaired and extended

Front Elevation as Proposed

New and re-used York
stone steps, centred
on Portland.


Rev A - 21/08/06

St Lucia - Hangerland 6/05/2/08A
1:50 RT 12/6/06

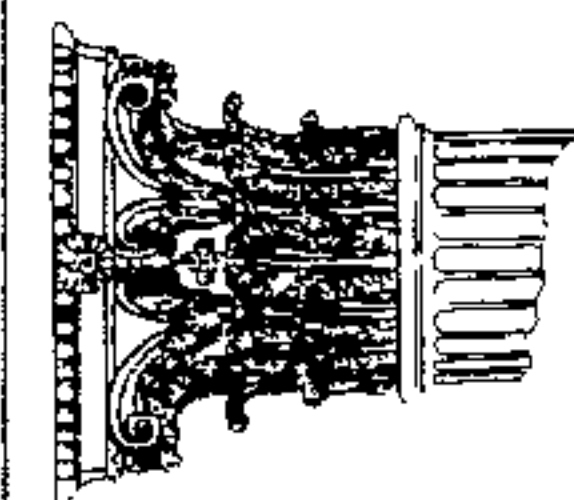


RUSSELL TAYLOR ARCHITECTS

85 BLACKFRIARS ROAD LONDON SE1 8HA
TEL: 020 7261 1984 FAX: 020 7928 0610
mail@rtarchitects.co.uk www.rtarchitects.co.uk


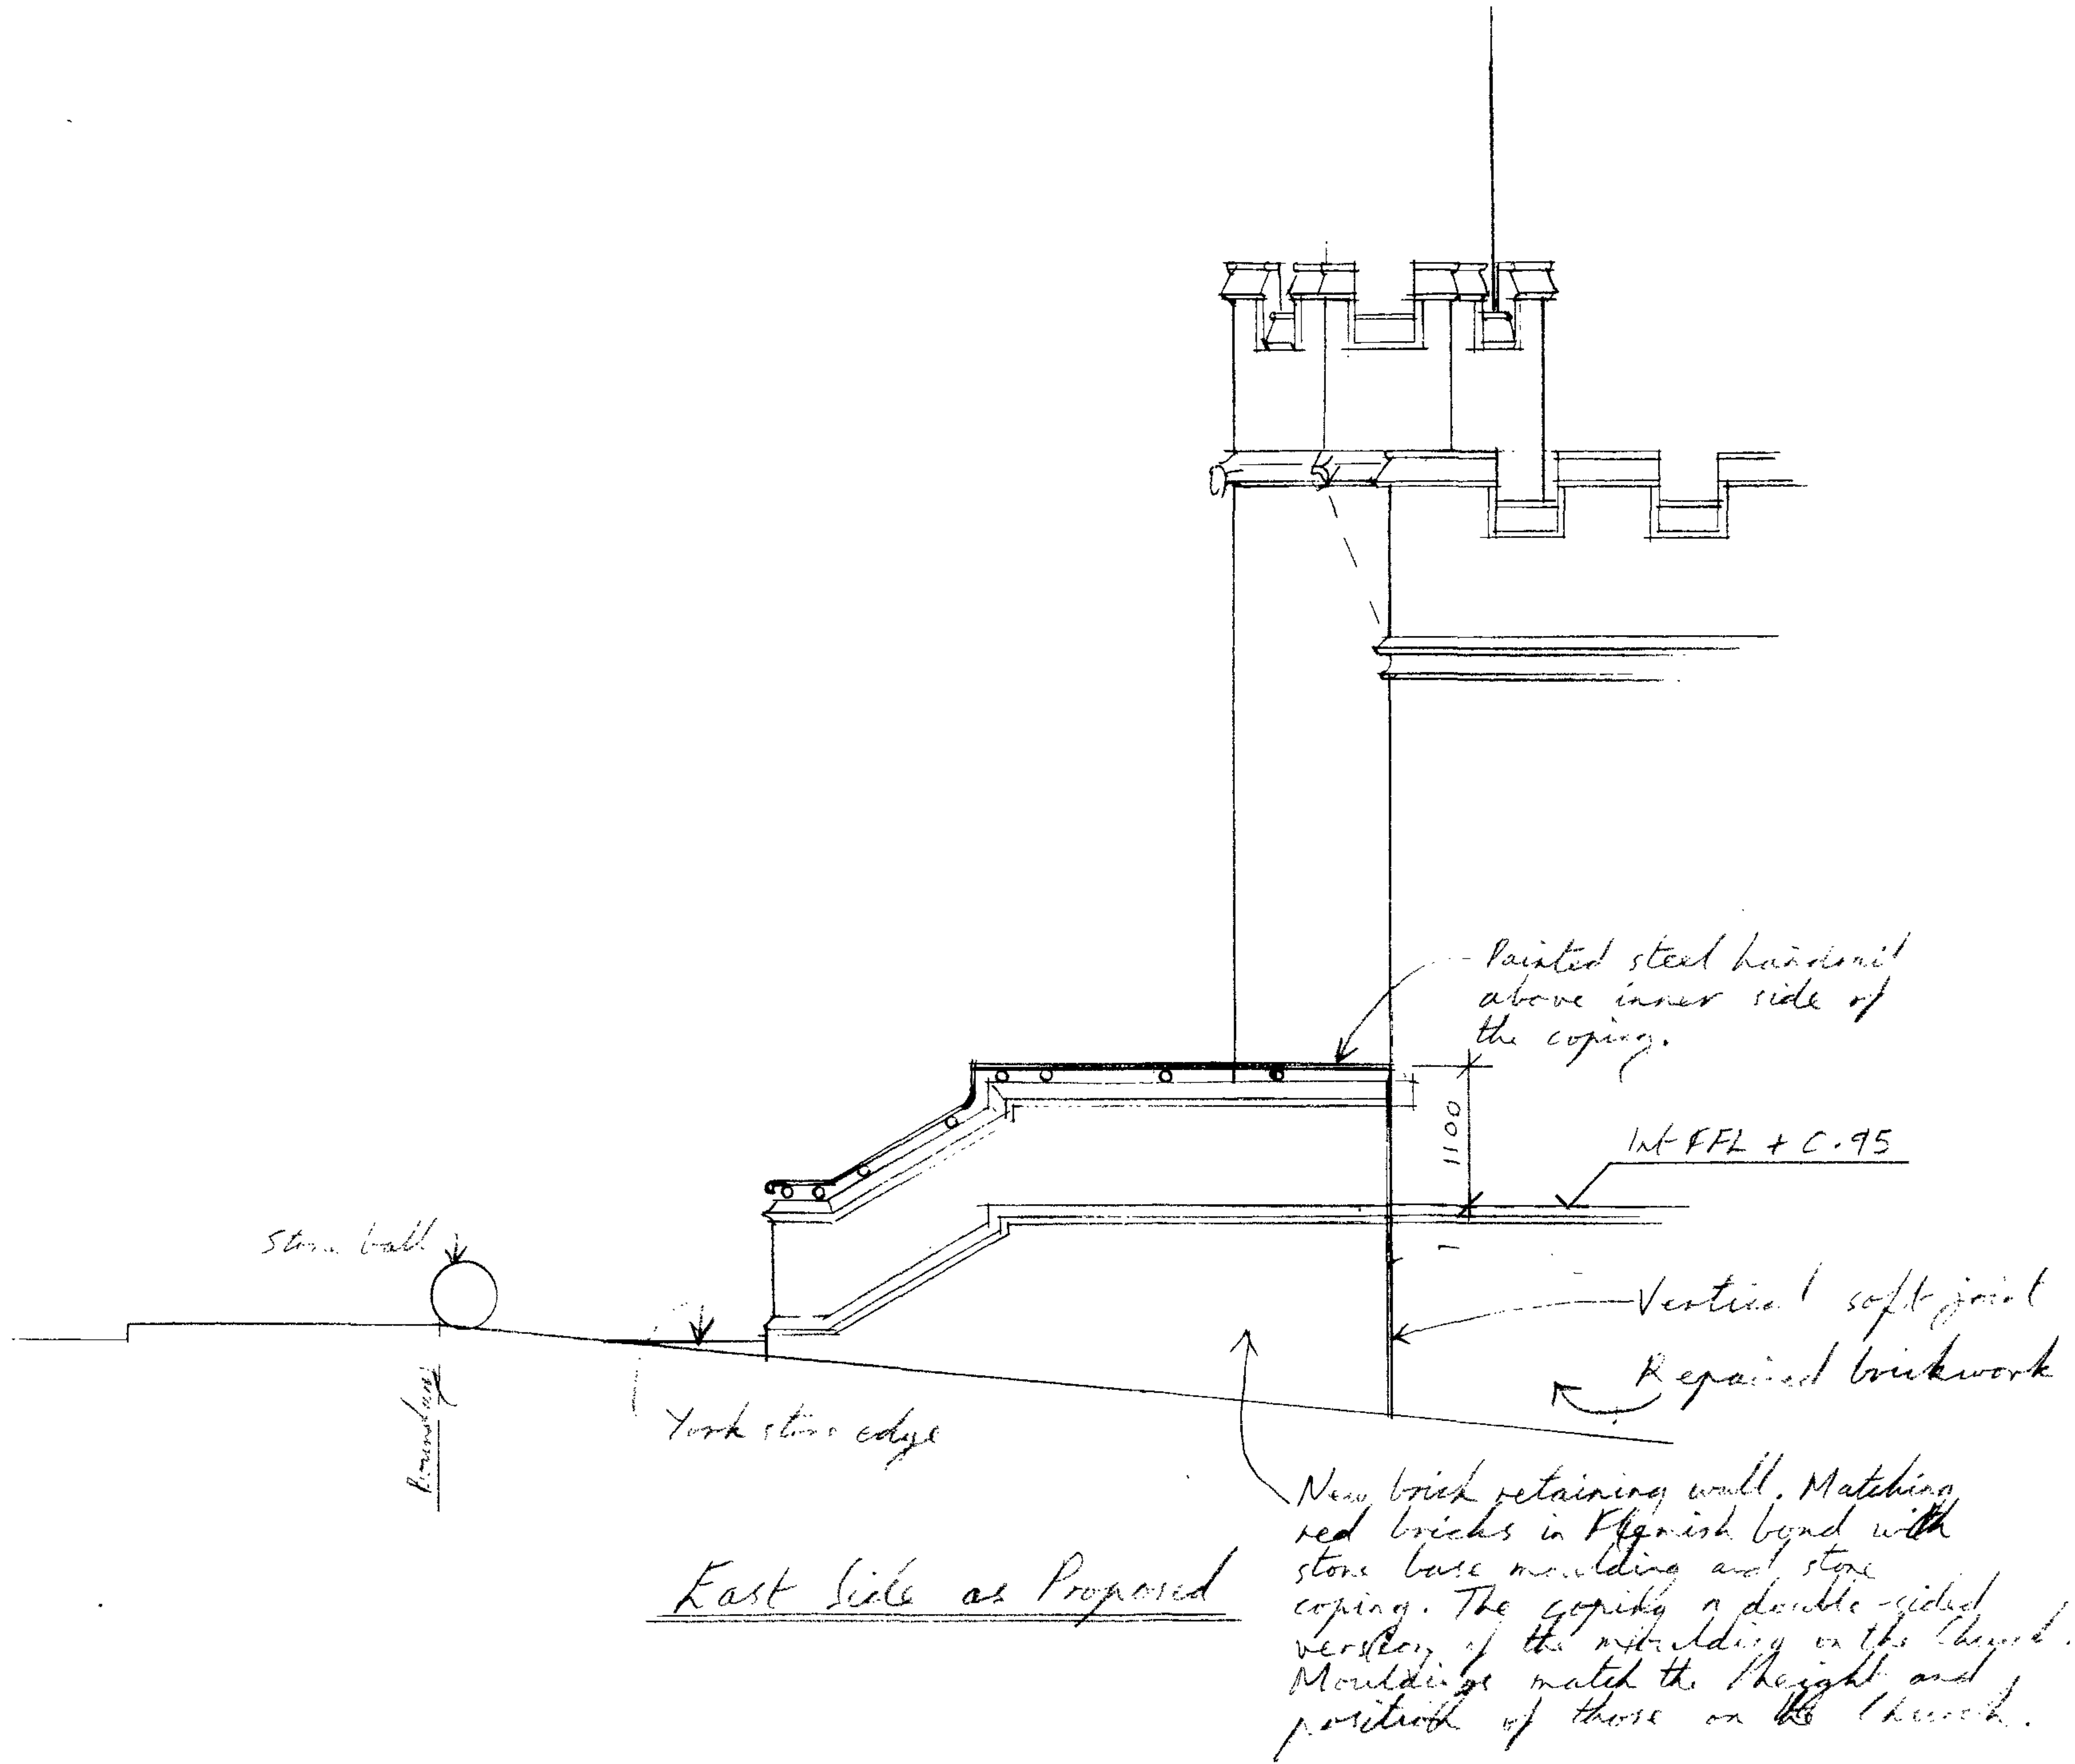


RUSSELL TAYLOR ARCHITECTS

85 BLACKFRIARS ROAD LONDON SE1 8JA
 TEL: 020 7261 1984 FAX: 020 7928 0610
 mail@rtarchitects.co.uk www.rtarchitects.co.uk

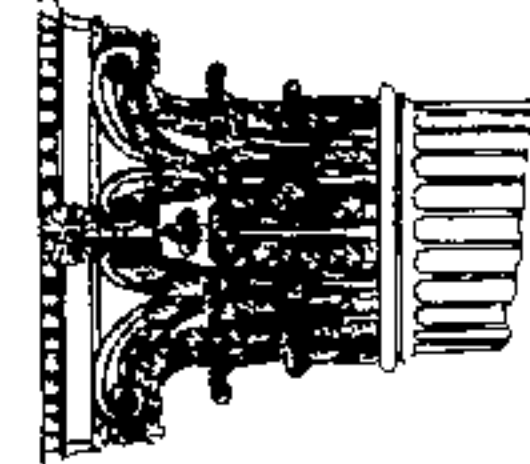

St Luke's - Hampstead 6/05/2/09
 1:50 RT 12/6/06

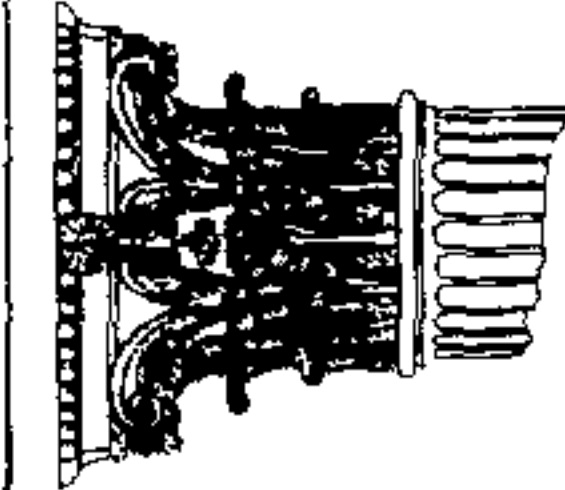
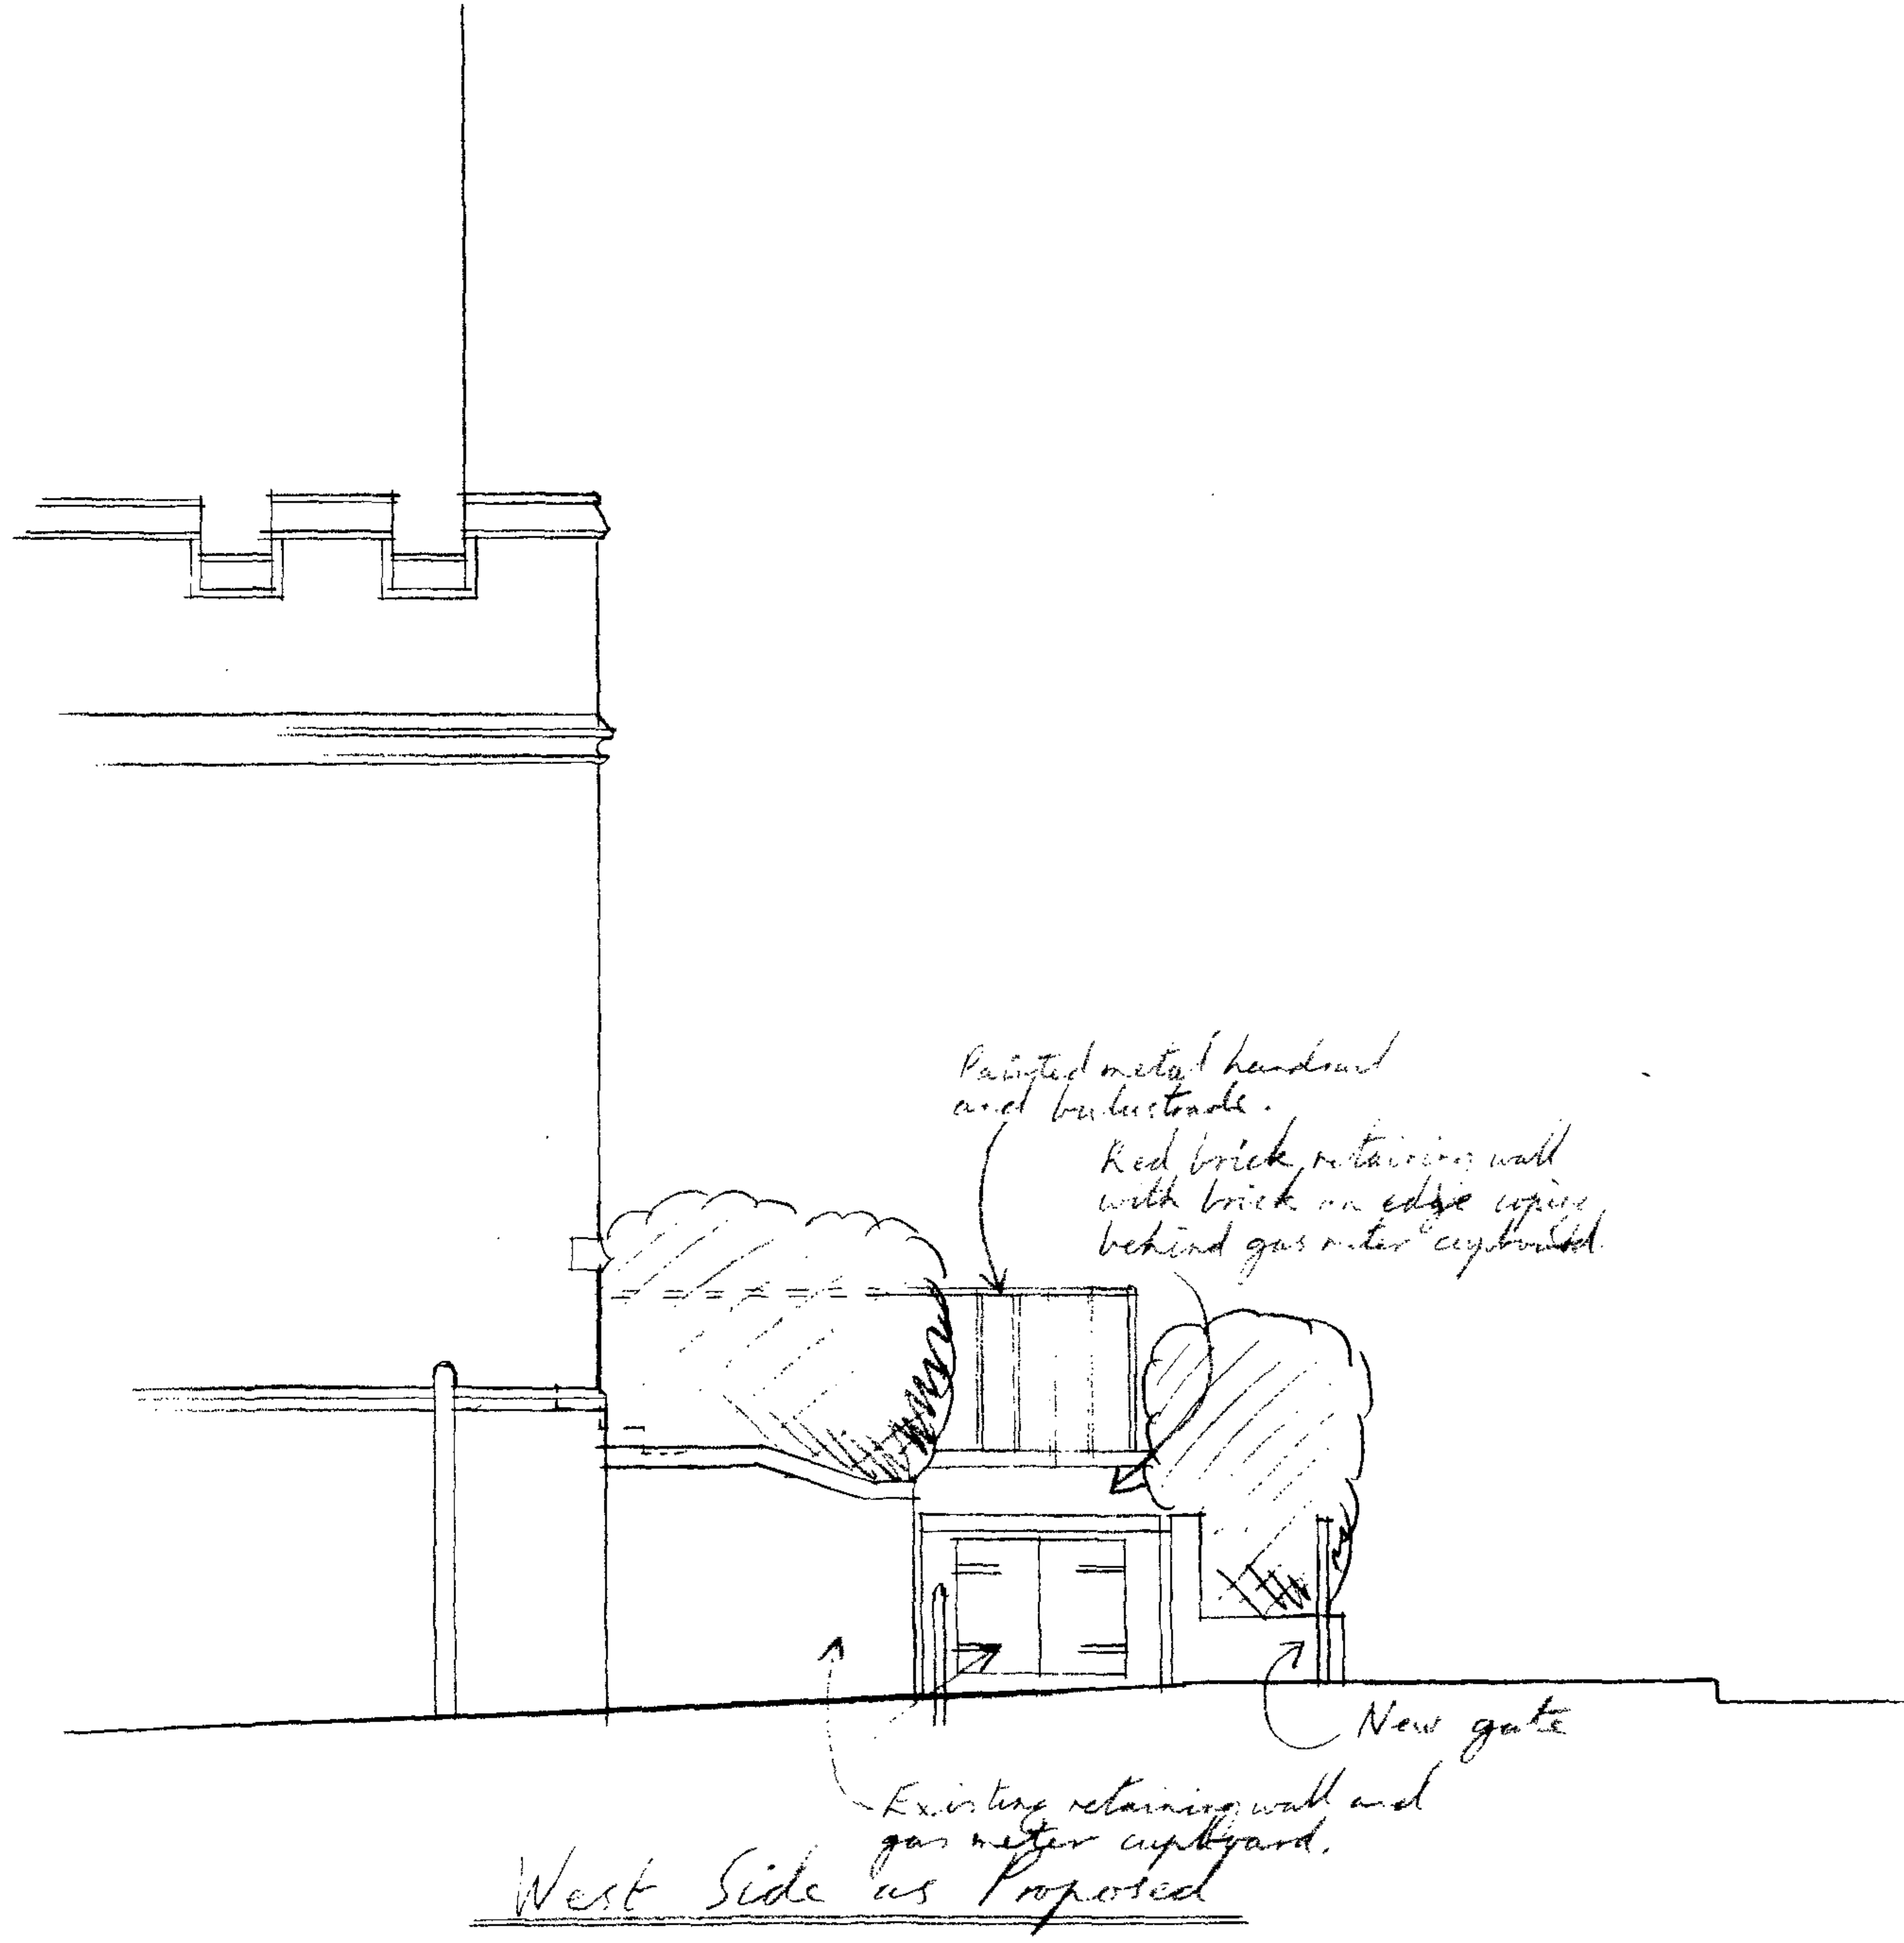


RUSSELL TAYLOR ARCHITECTS

85 BLACKFRIARS ROAD LONDON SE1 8HA
 TEL: 020 7261 1984 FAX: 020 7928 0610
 mail@rtarchitects.co.uk www.rtarchitects.co.uk

St Lukes - Hampstead 8/05/2/10



1:50 RT 6/6/06

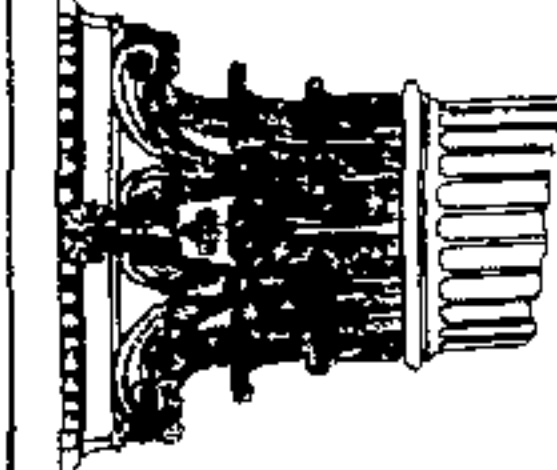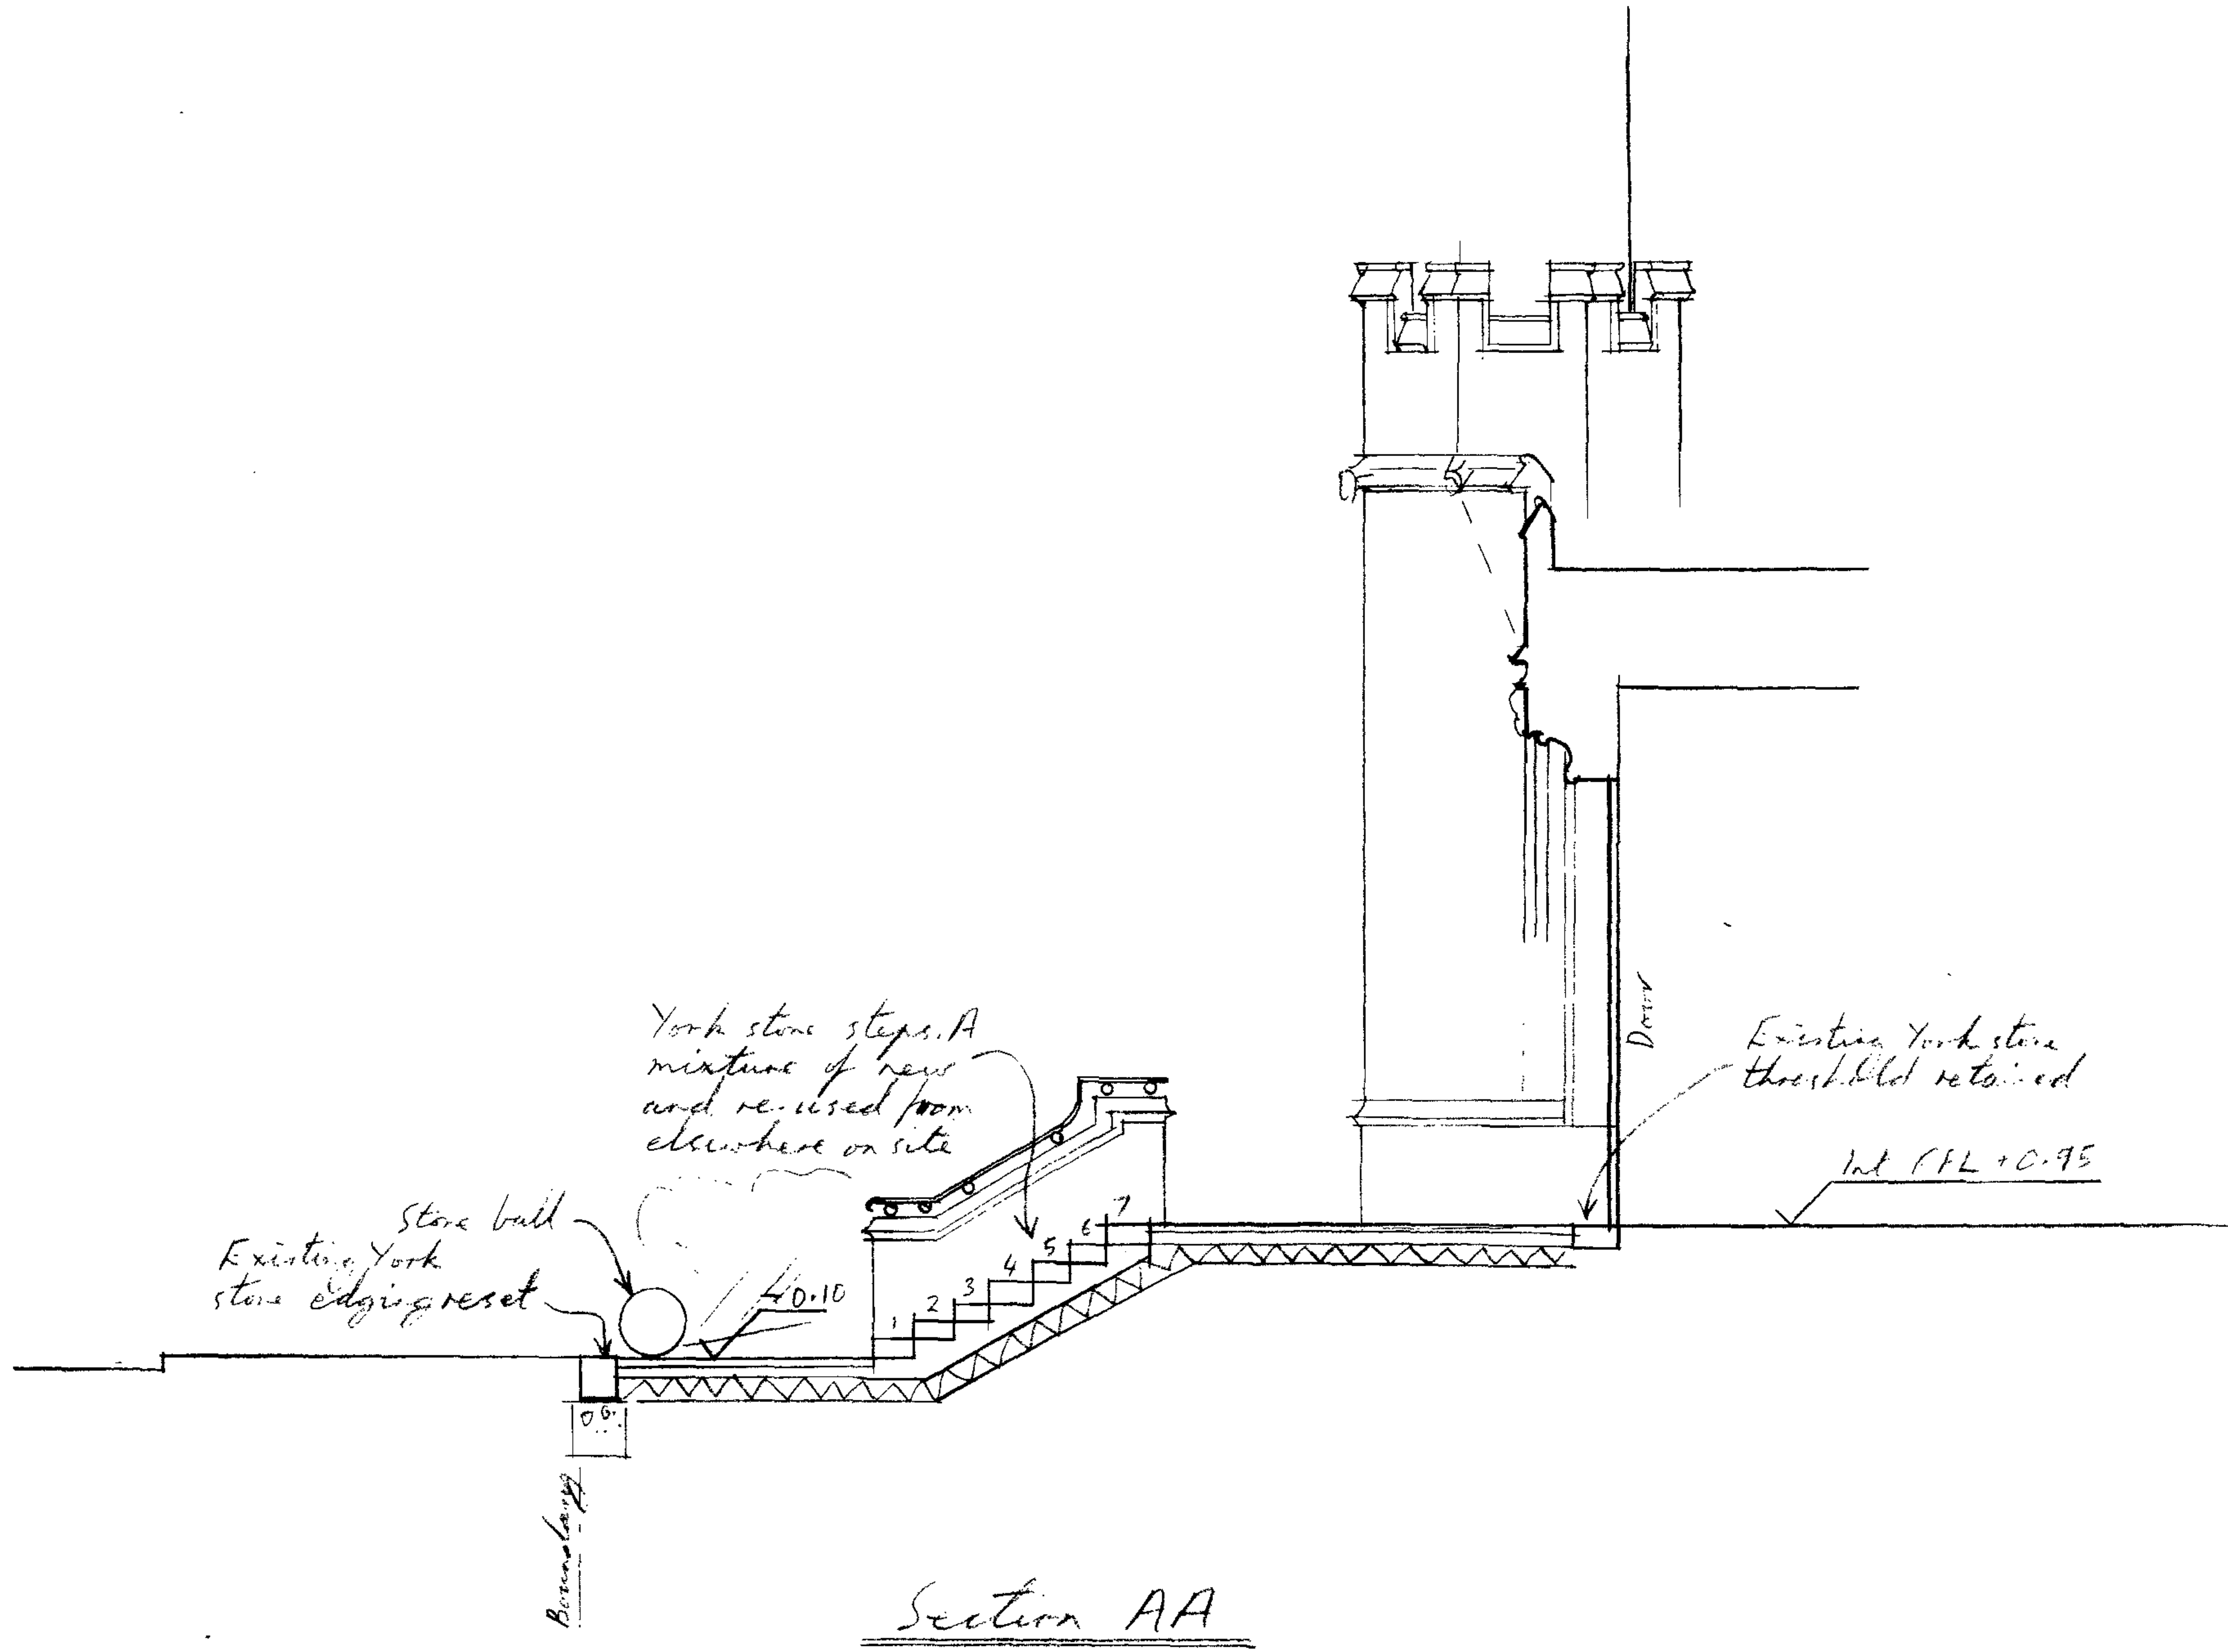

RUSSELL TAYLOR ARCHITECTS

85 BLACKFRIARS ROAD LONDON SE1 8HA
 TEL: 020 7261 1984 FAX: 020 7928 0610
 mail@rtarchitects.co.uk www.rtarchitects.co.uk


St Luke's - Hampstead 6/05/2/11
1:50 RT 12/6/06

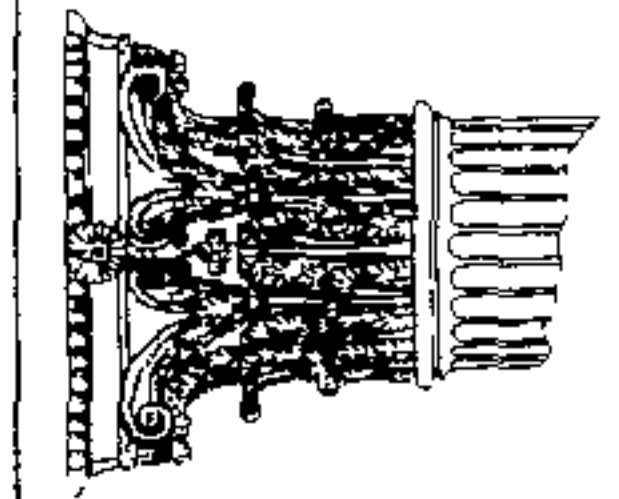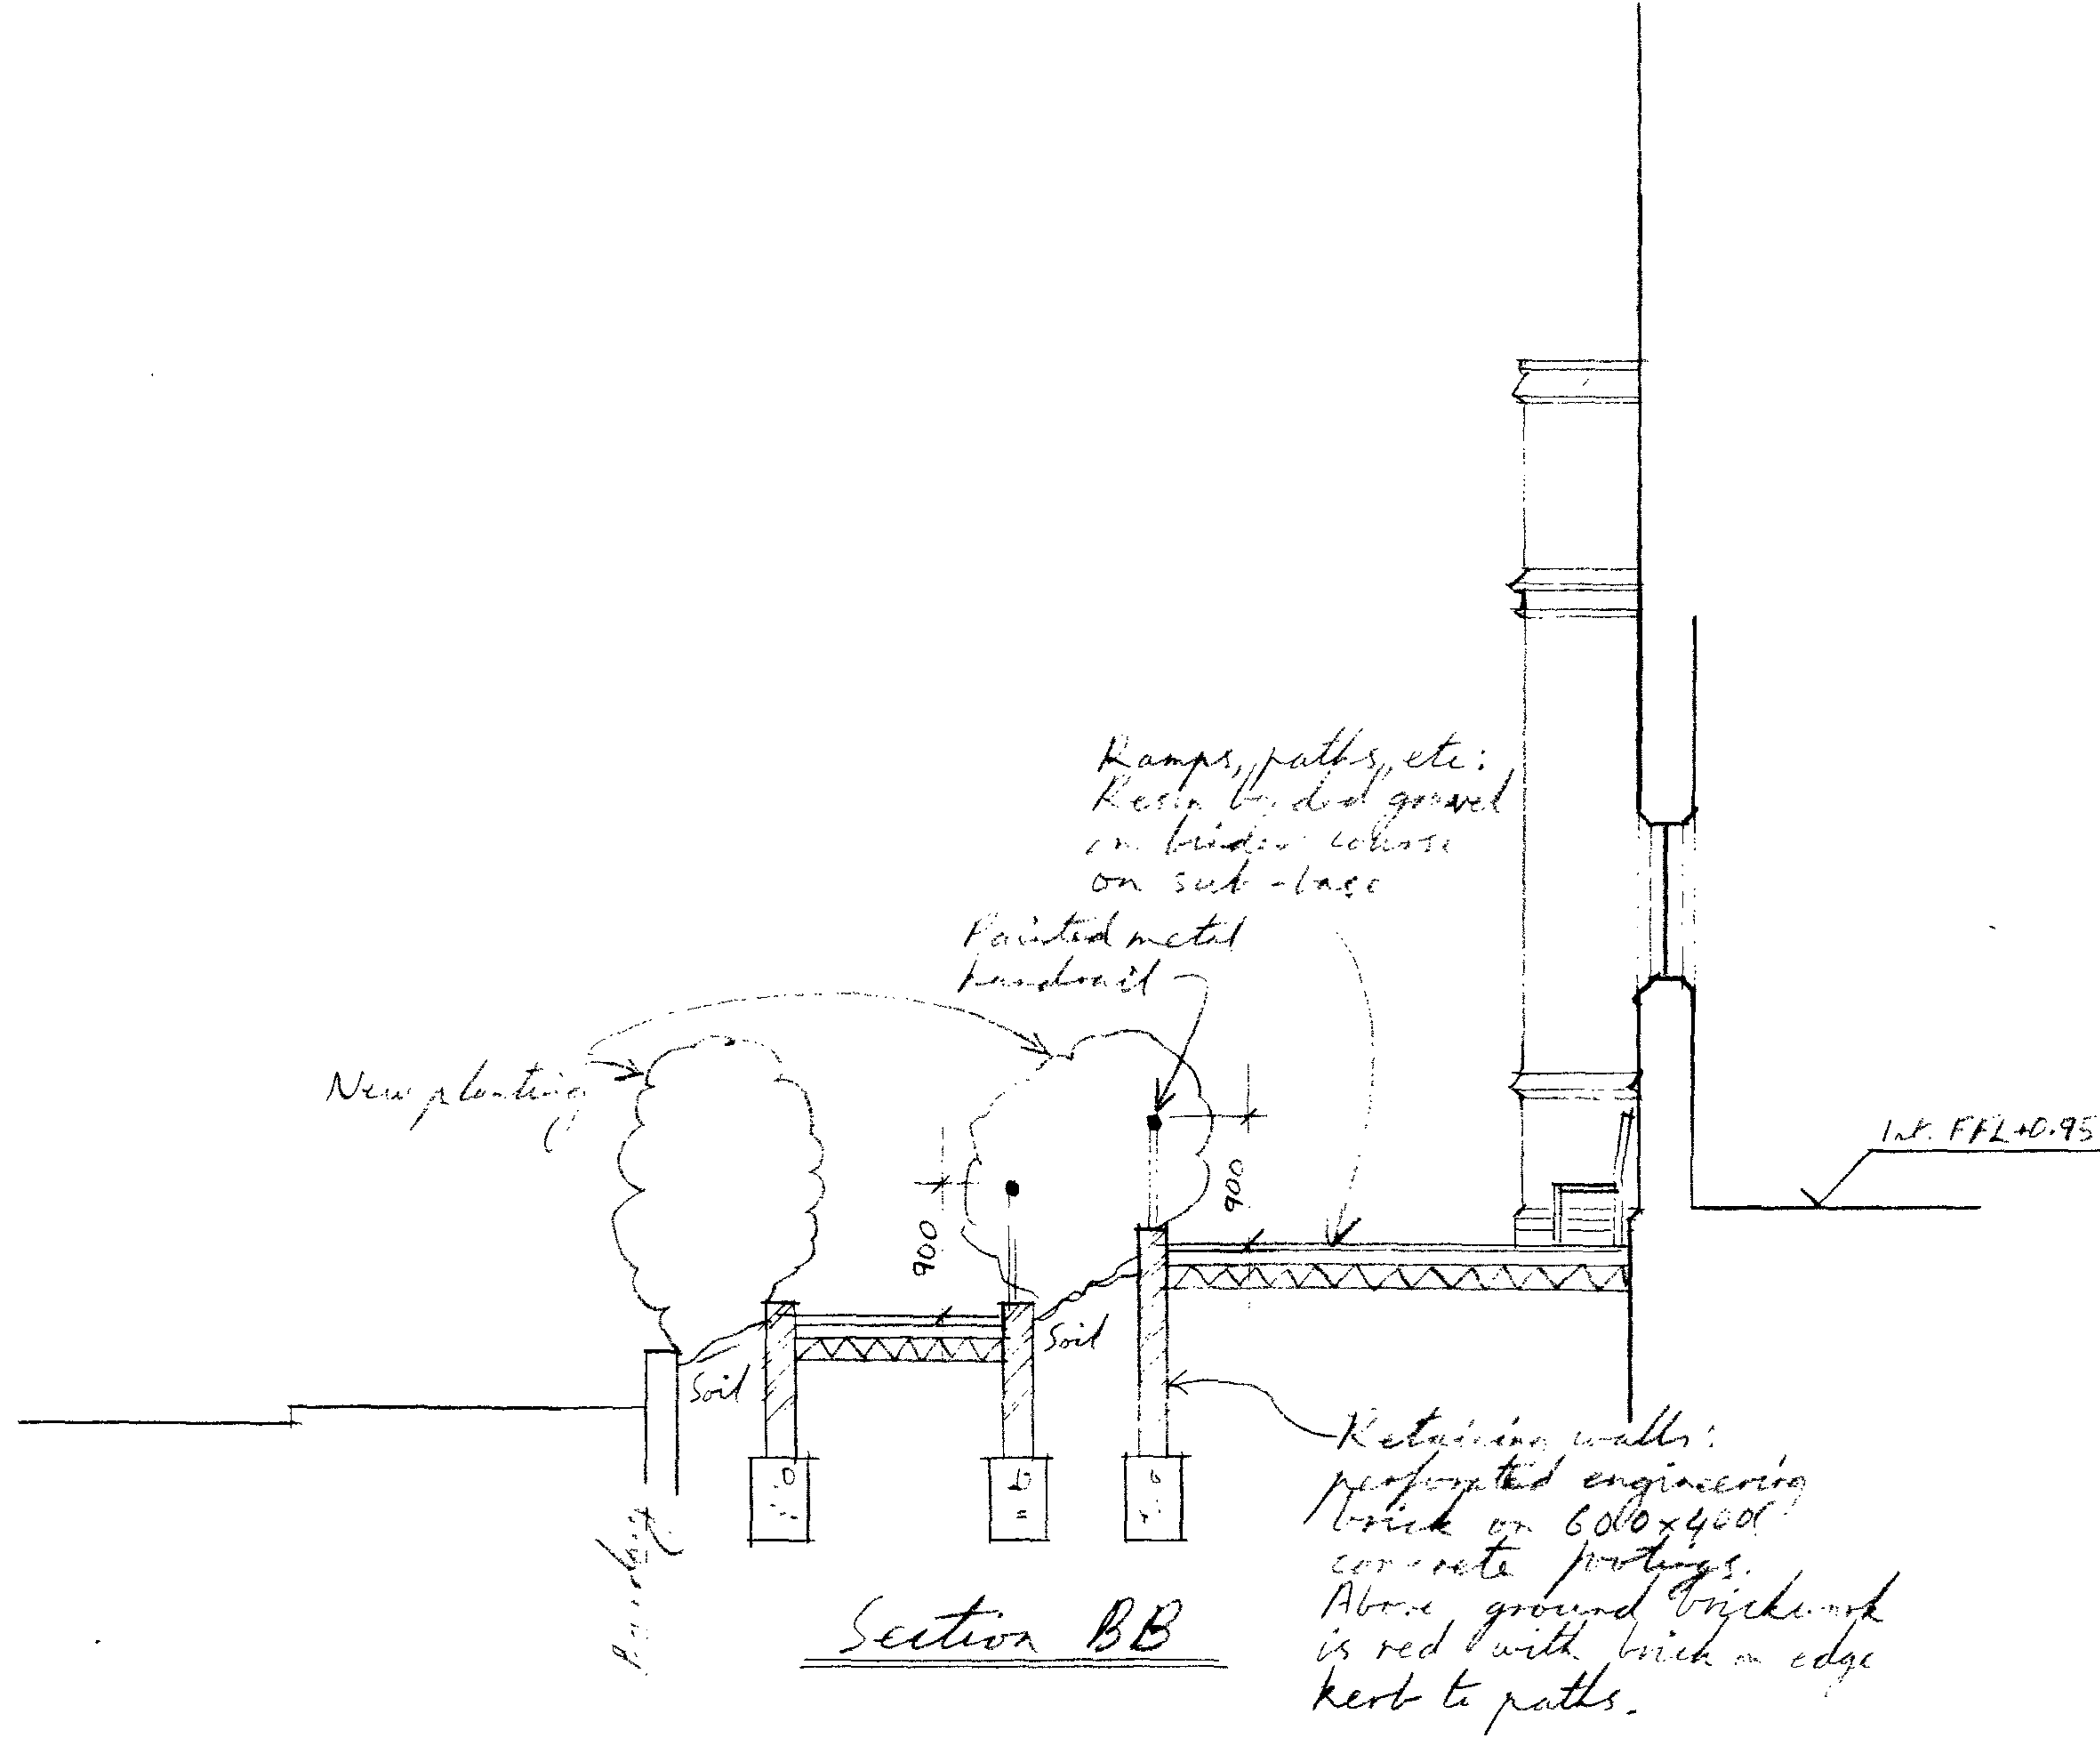


RUSSELL TAYLOR ARCHITECTS

85 BLACKFRIARS ROAD LONDON SE1 8HA
TEL: 020 7261 1984 FAX: 020 7928 0619
mail@rtarchitects.co.uk www.rtarchitects.co.uk

St Lukes - Mansstead 6/05/12
1:50 RT 12/6/06

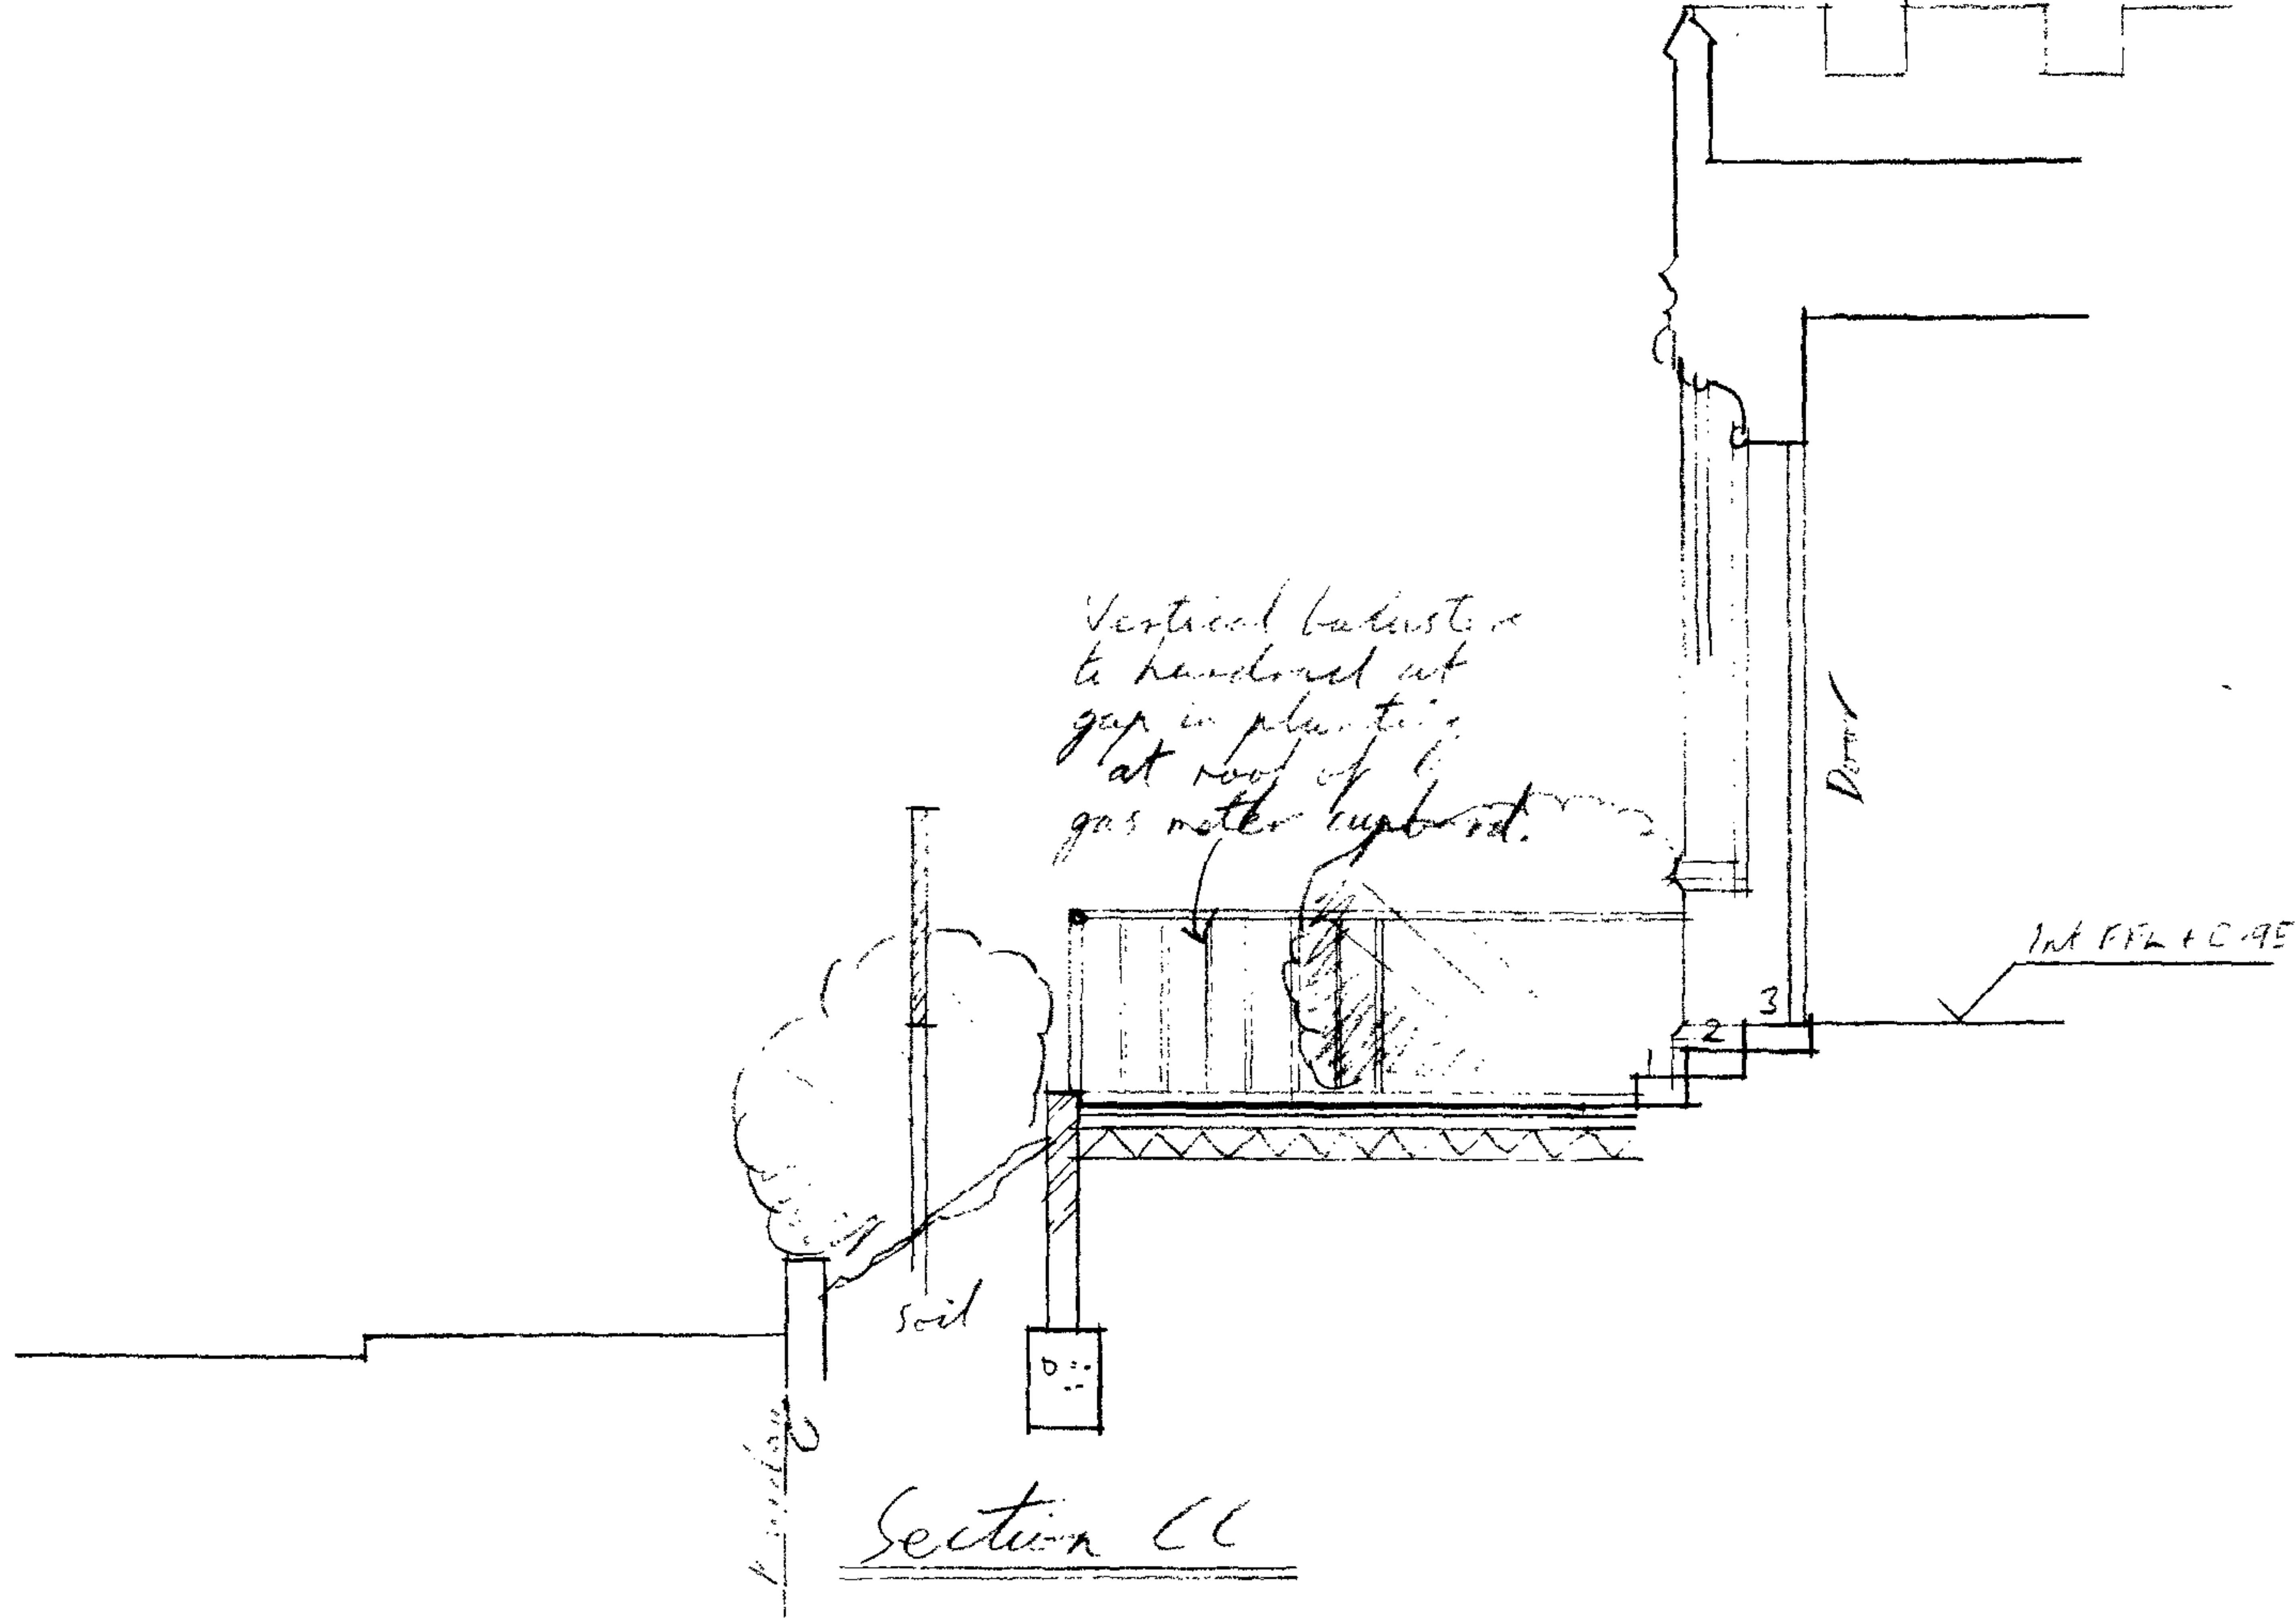


Section CC

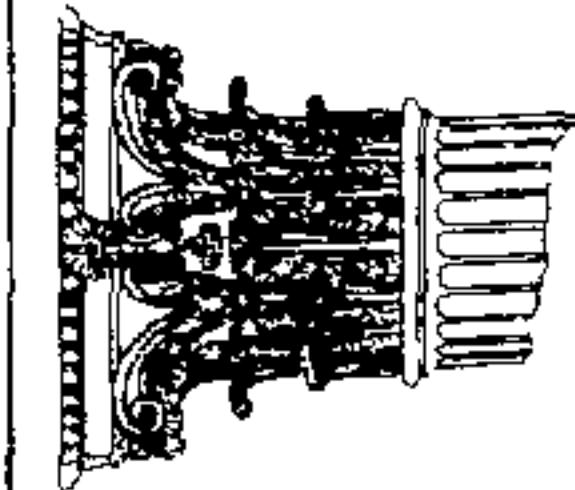

RUSSELL TAYLOR ARCHITECTS

85 BLACKFRIARS ROAD LONDON SE1 8HA
 TEL: 020 7261 1984 FAX: 020 7928 0610
 mail@rtarchitects.co.uk www.rtarchitects.co.uk

St Lukes - Hampstead 6/05/13
1:50 RT 12/6/08

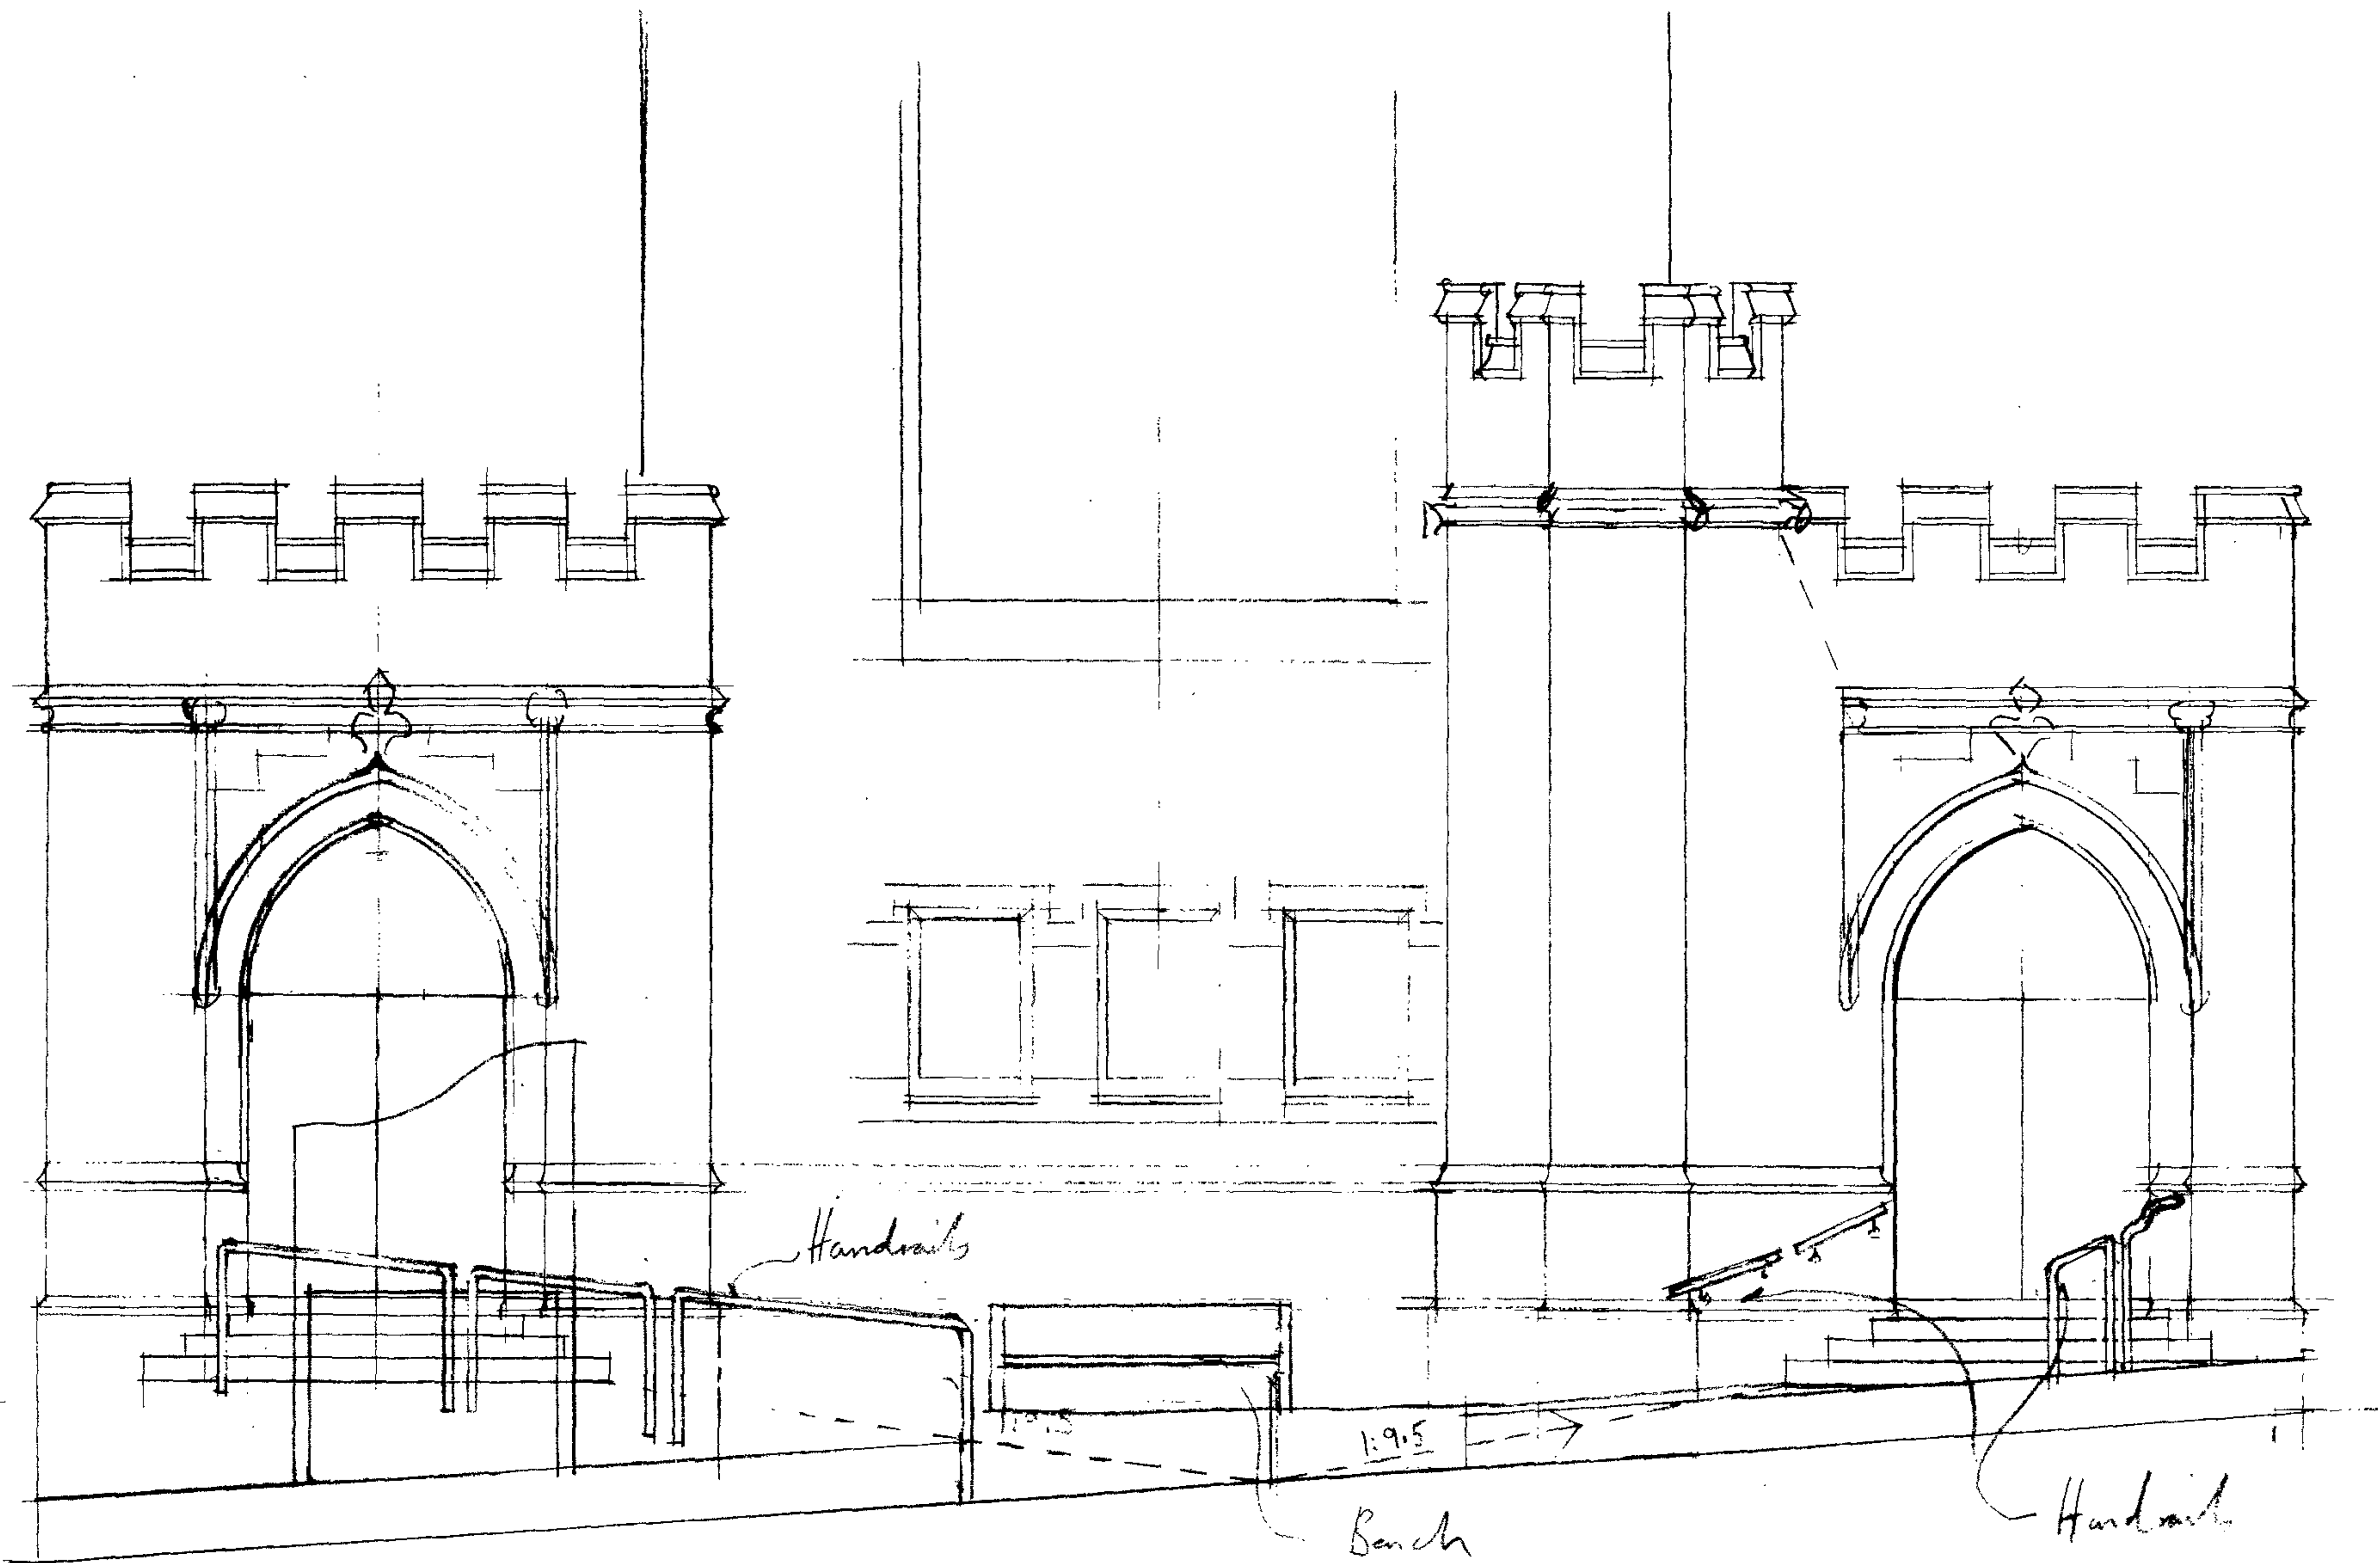

Front Elevation of Entrance Elevation 1:50

Elevations: Red brick in Flemish bond with
litho stone dressings.


Rev B 6/09/08


St Lukes Church - Hampton 6/05/14 B

RT 1:30 4/07/06

RUSSELL TAYLOR ARCHITECTS


85 BLACKPRIARS ROAD LONDON SE1 8HA
TEL: 020 7261 1984 FAX: 020 7928 0610
mail@rtarchitects.co.uk www.rtarchitects.co.uk

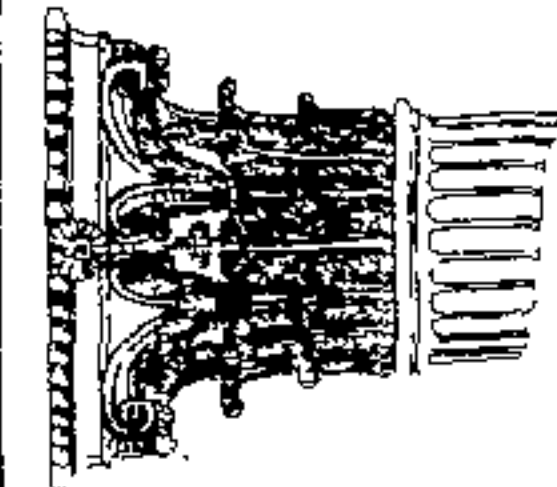

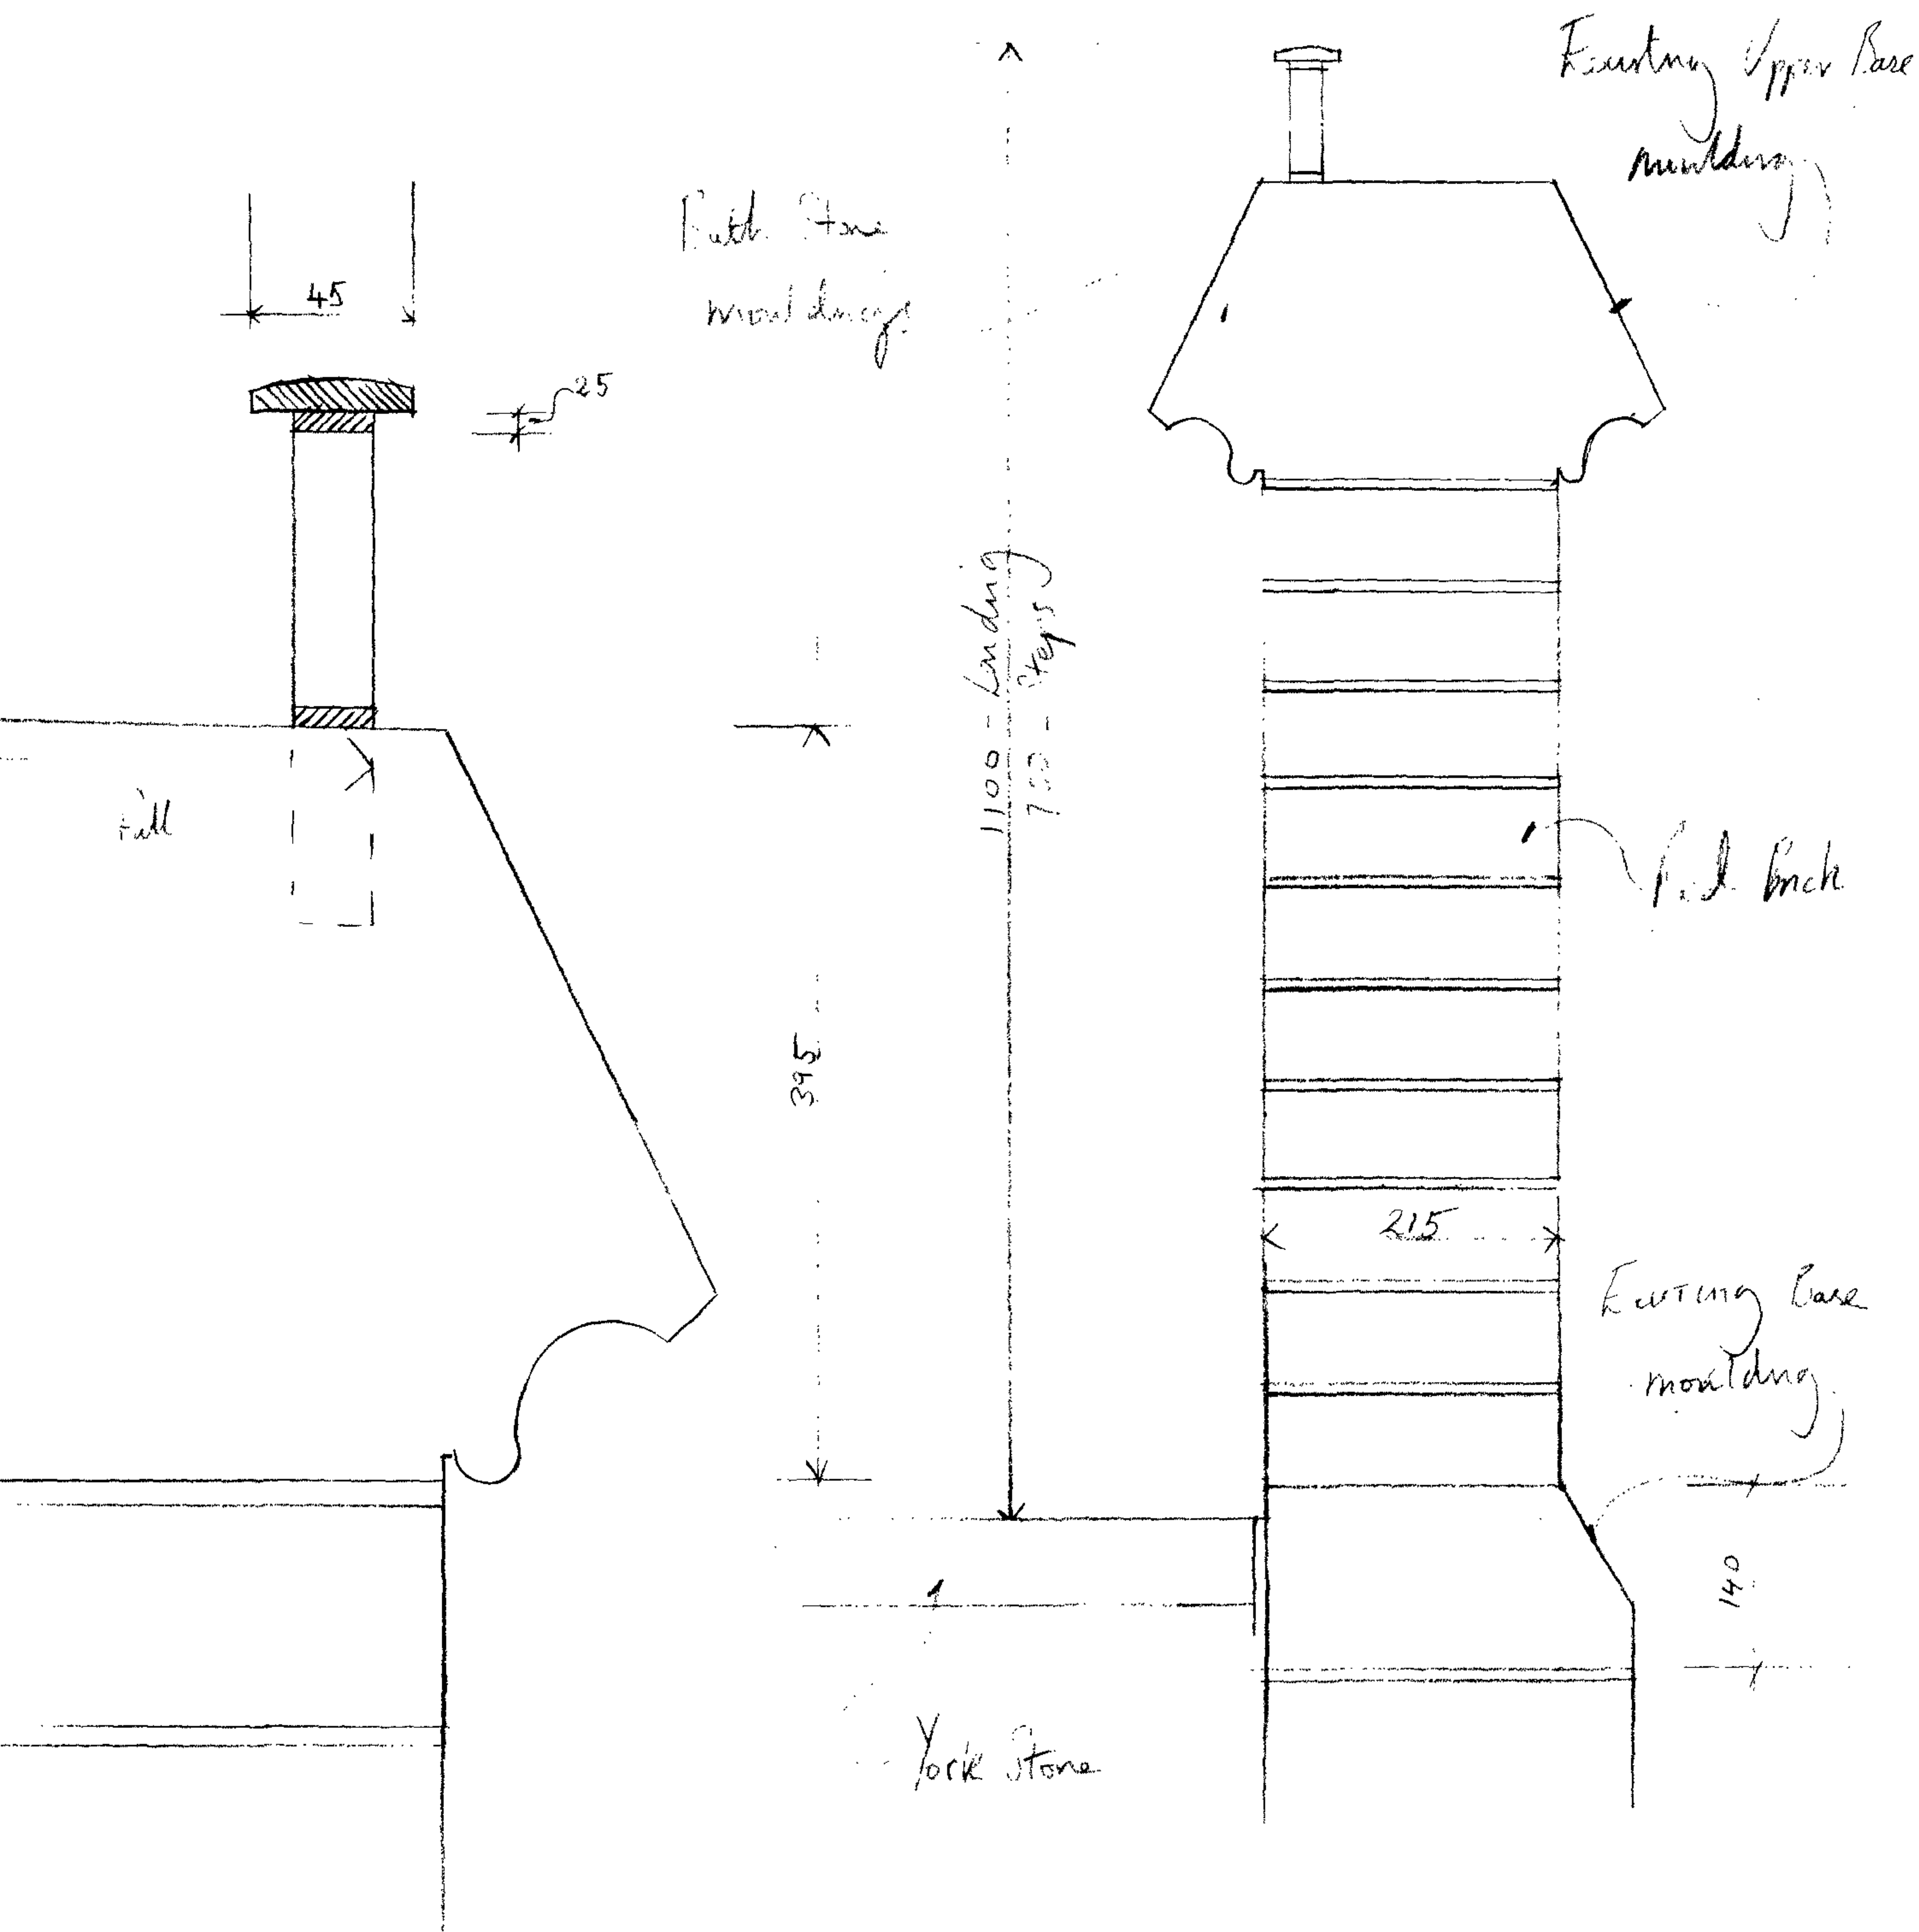

NEW COPING AND HANDRAIL AT 1:2

SECTION THROUGH PROPOSED WALL 1:5

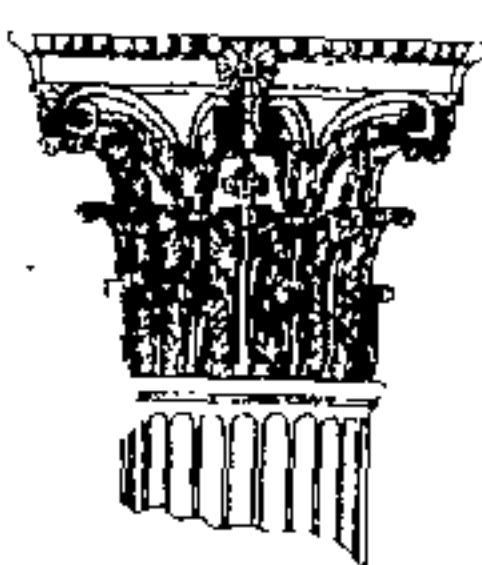


RUSSELL TAYLOR ARCHITECTS

85 BLACKFRIARS ROAD LONDON SE1 8HA
mail@rtarchitects.co.uk

TEL: 020 7261 1984 FAX: 020 7928 0610
www.rtarchitects.co.uk

St Lukes ~ HAMPTSTEAD 6/05/2/15

TT 1:2, 1:5 21/05/06

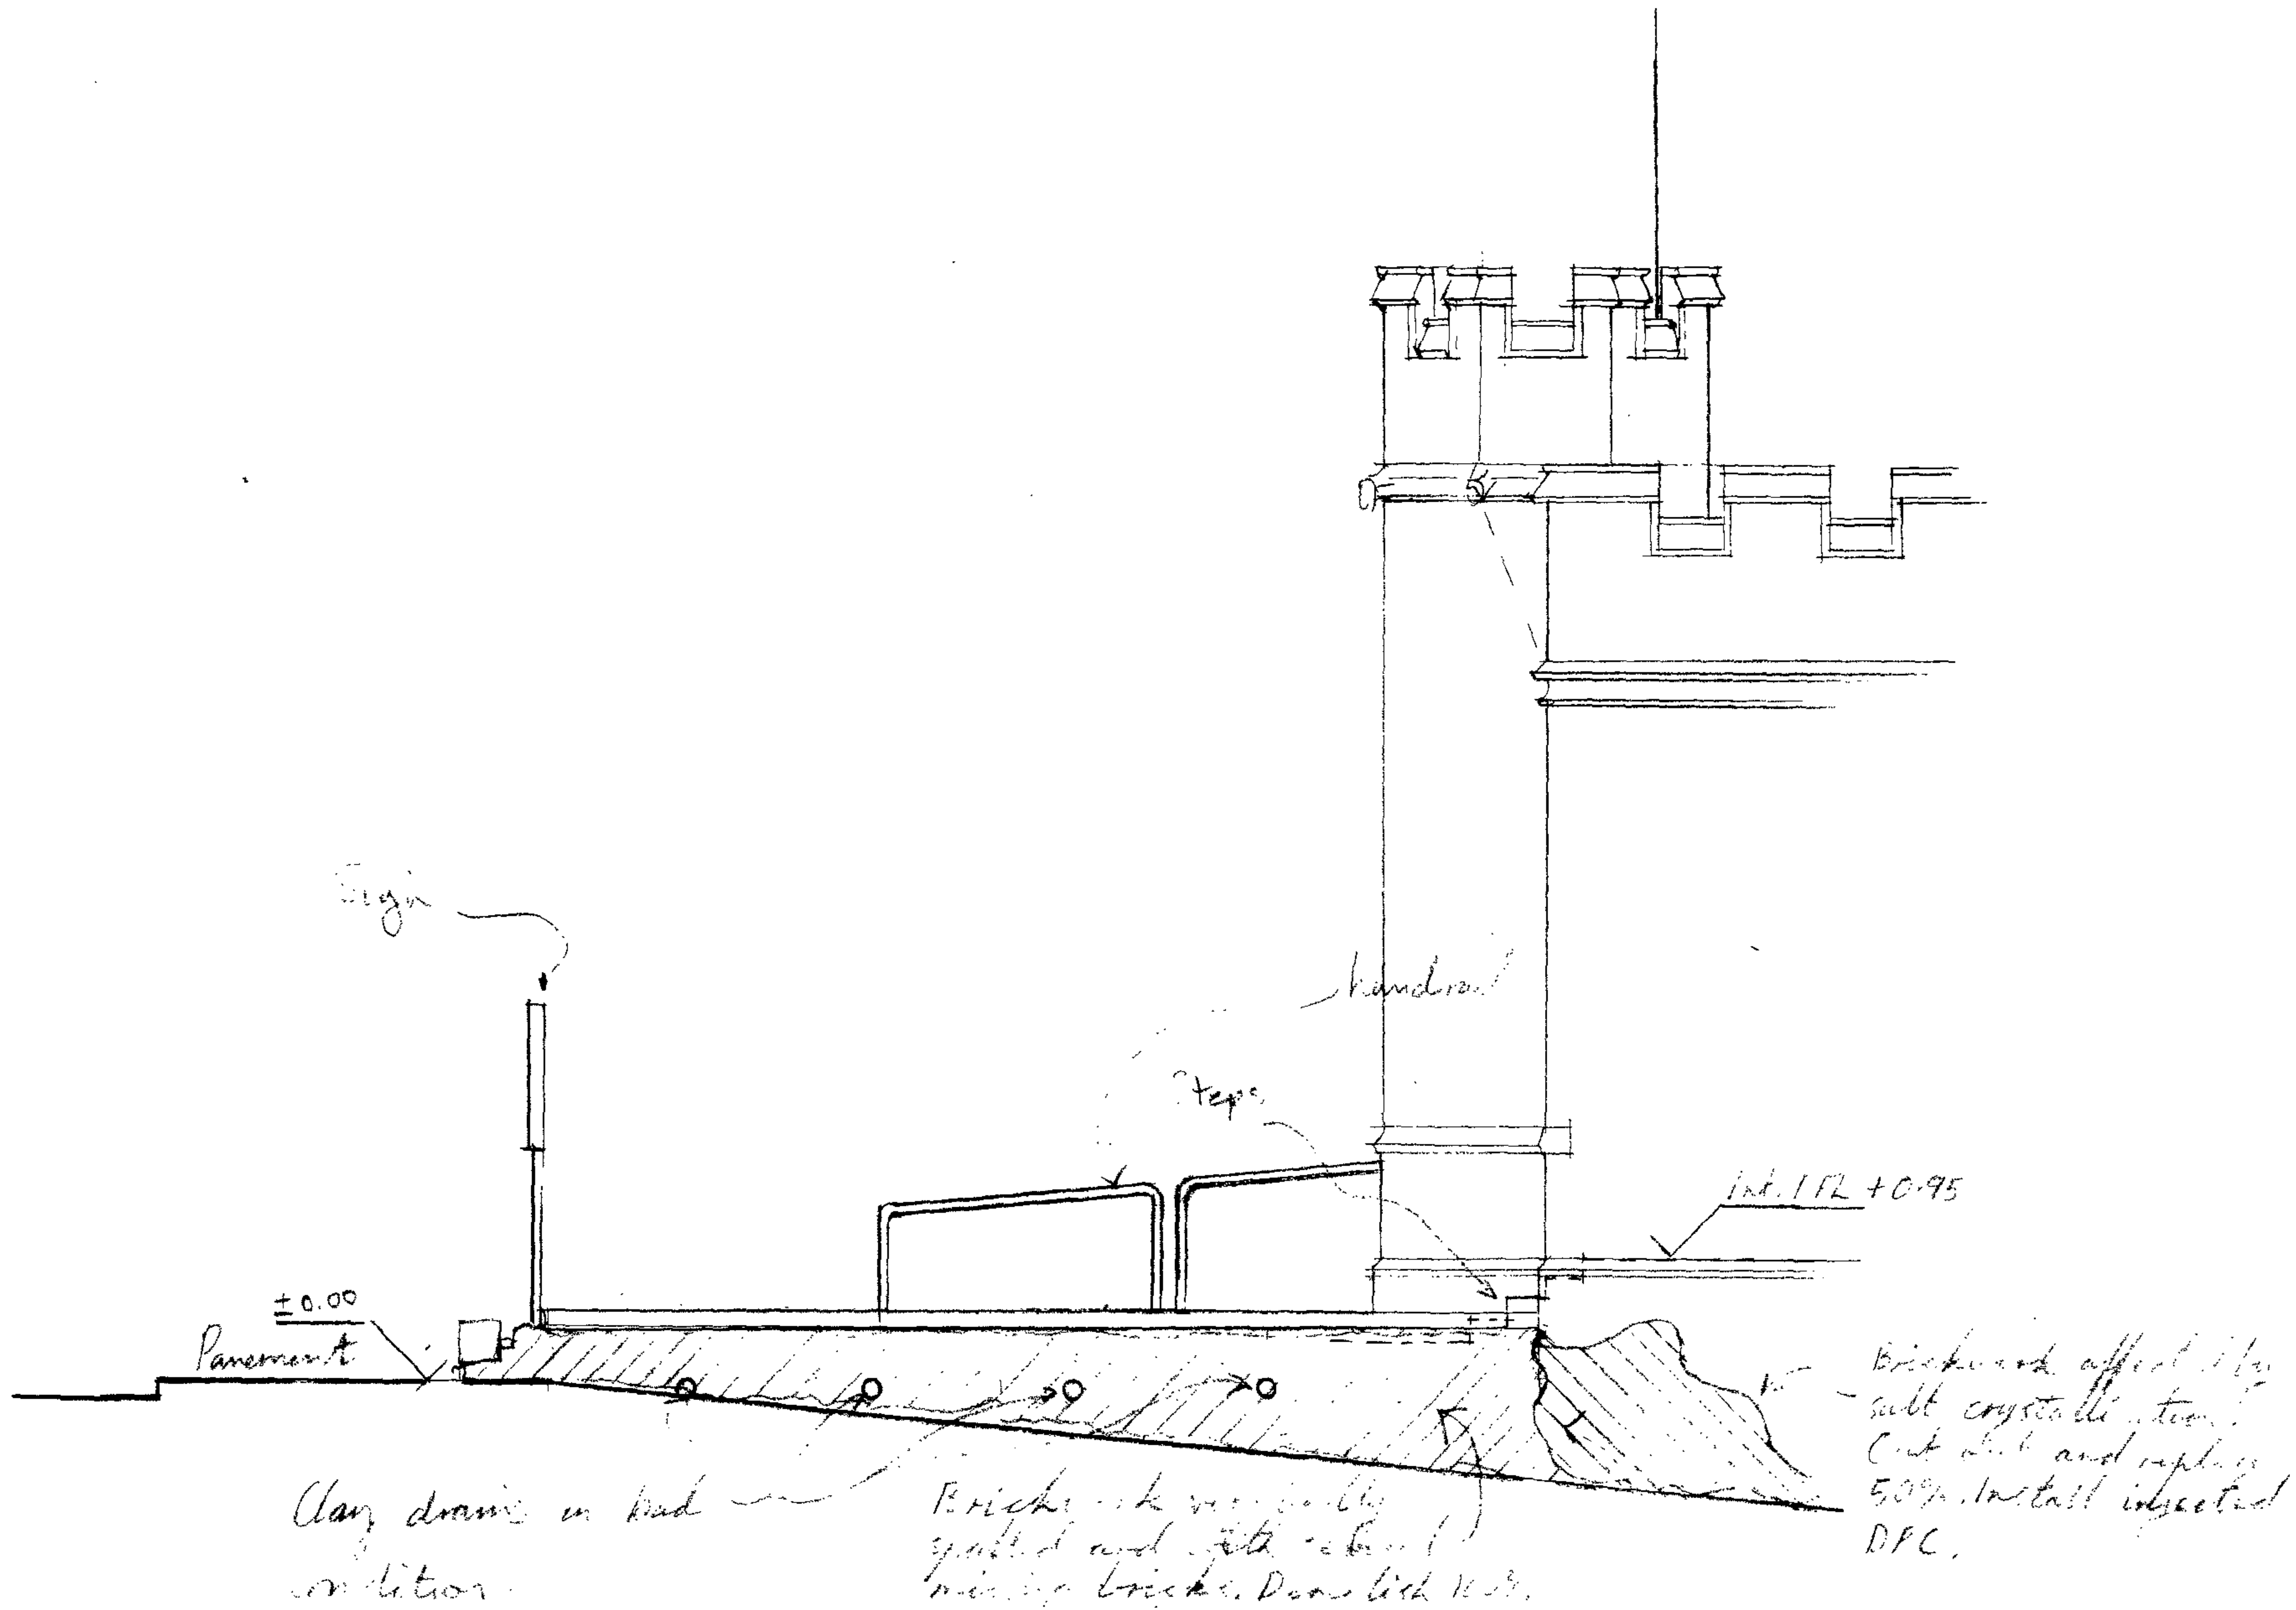

East Side of Building
Excluding Foliage

Received with RECEIVED
 7 SEP 2006


6/10/12/16


+ LULU'S CROWN

5/10/12/16

RUSSELL TAYLOR ARCHITECTS

85 BLAUFRIDGERS ROAD LONDON SE1 8HA
 TEL: 020 7261 1984 FAX: 020 7928 0610
 mail@rtarchitects.co.uk www.rtarchitects.co.uk

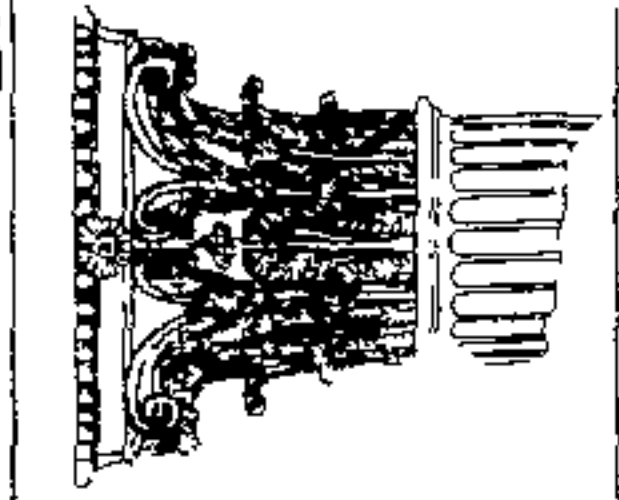


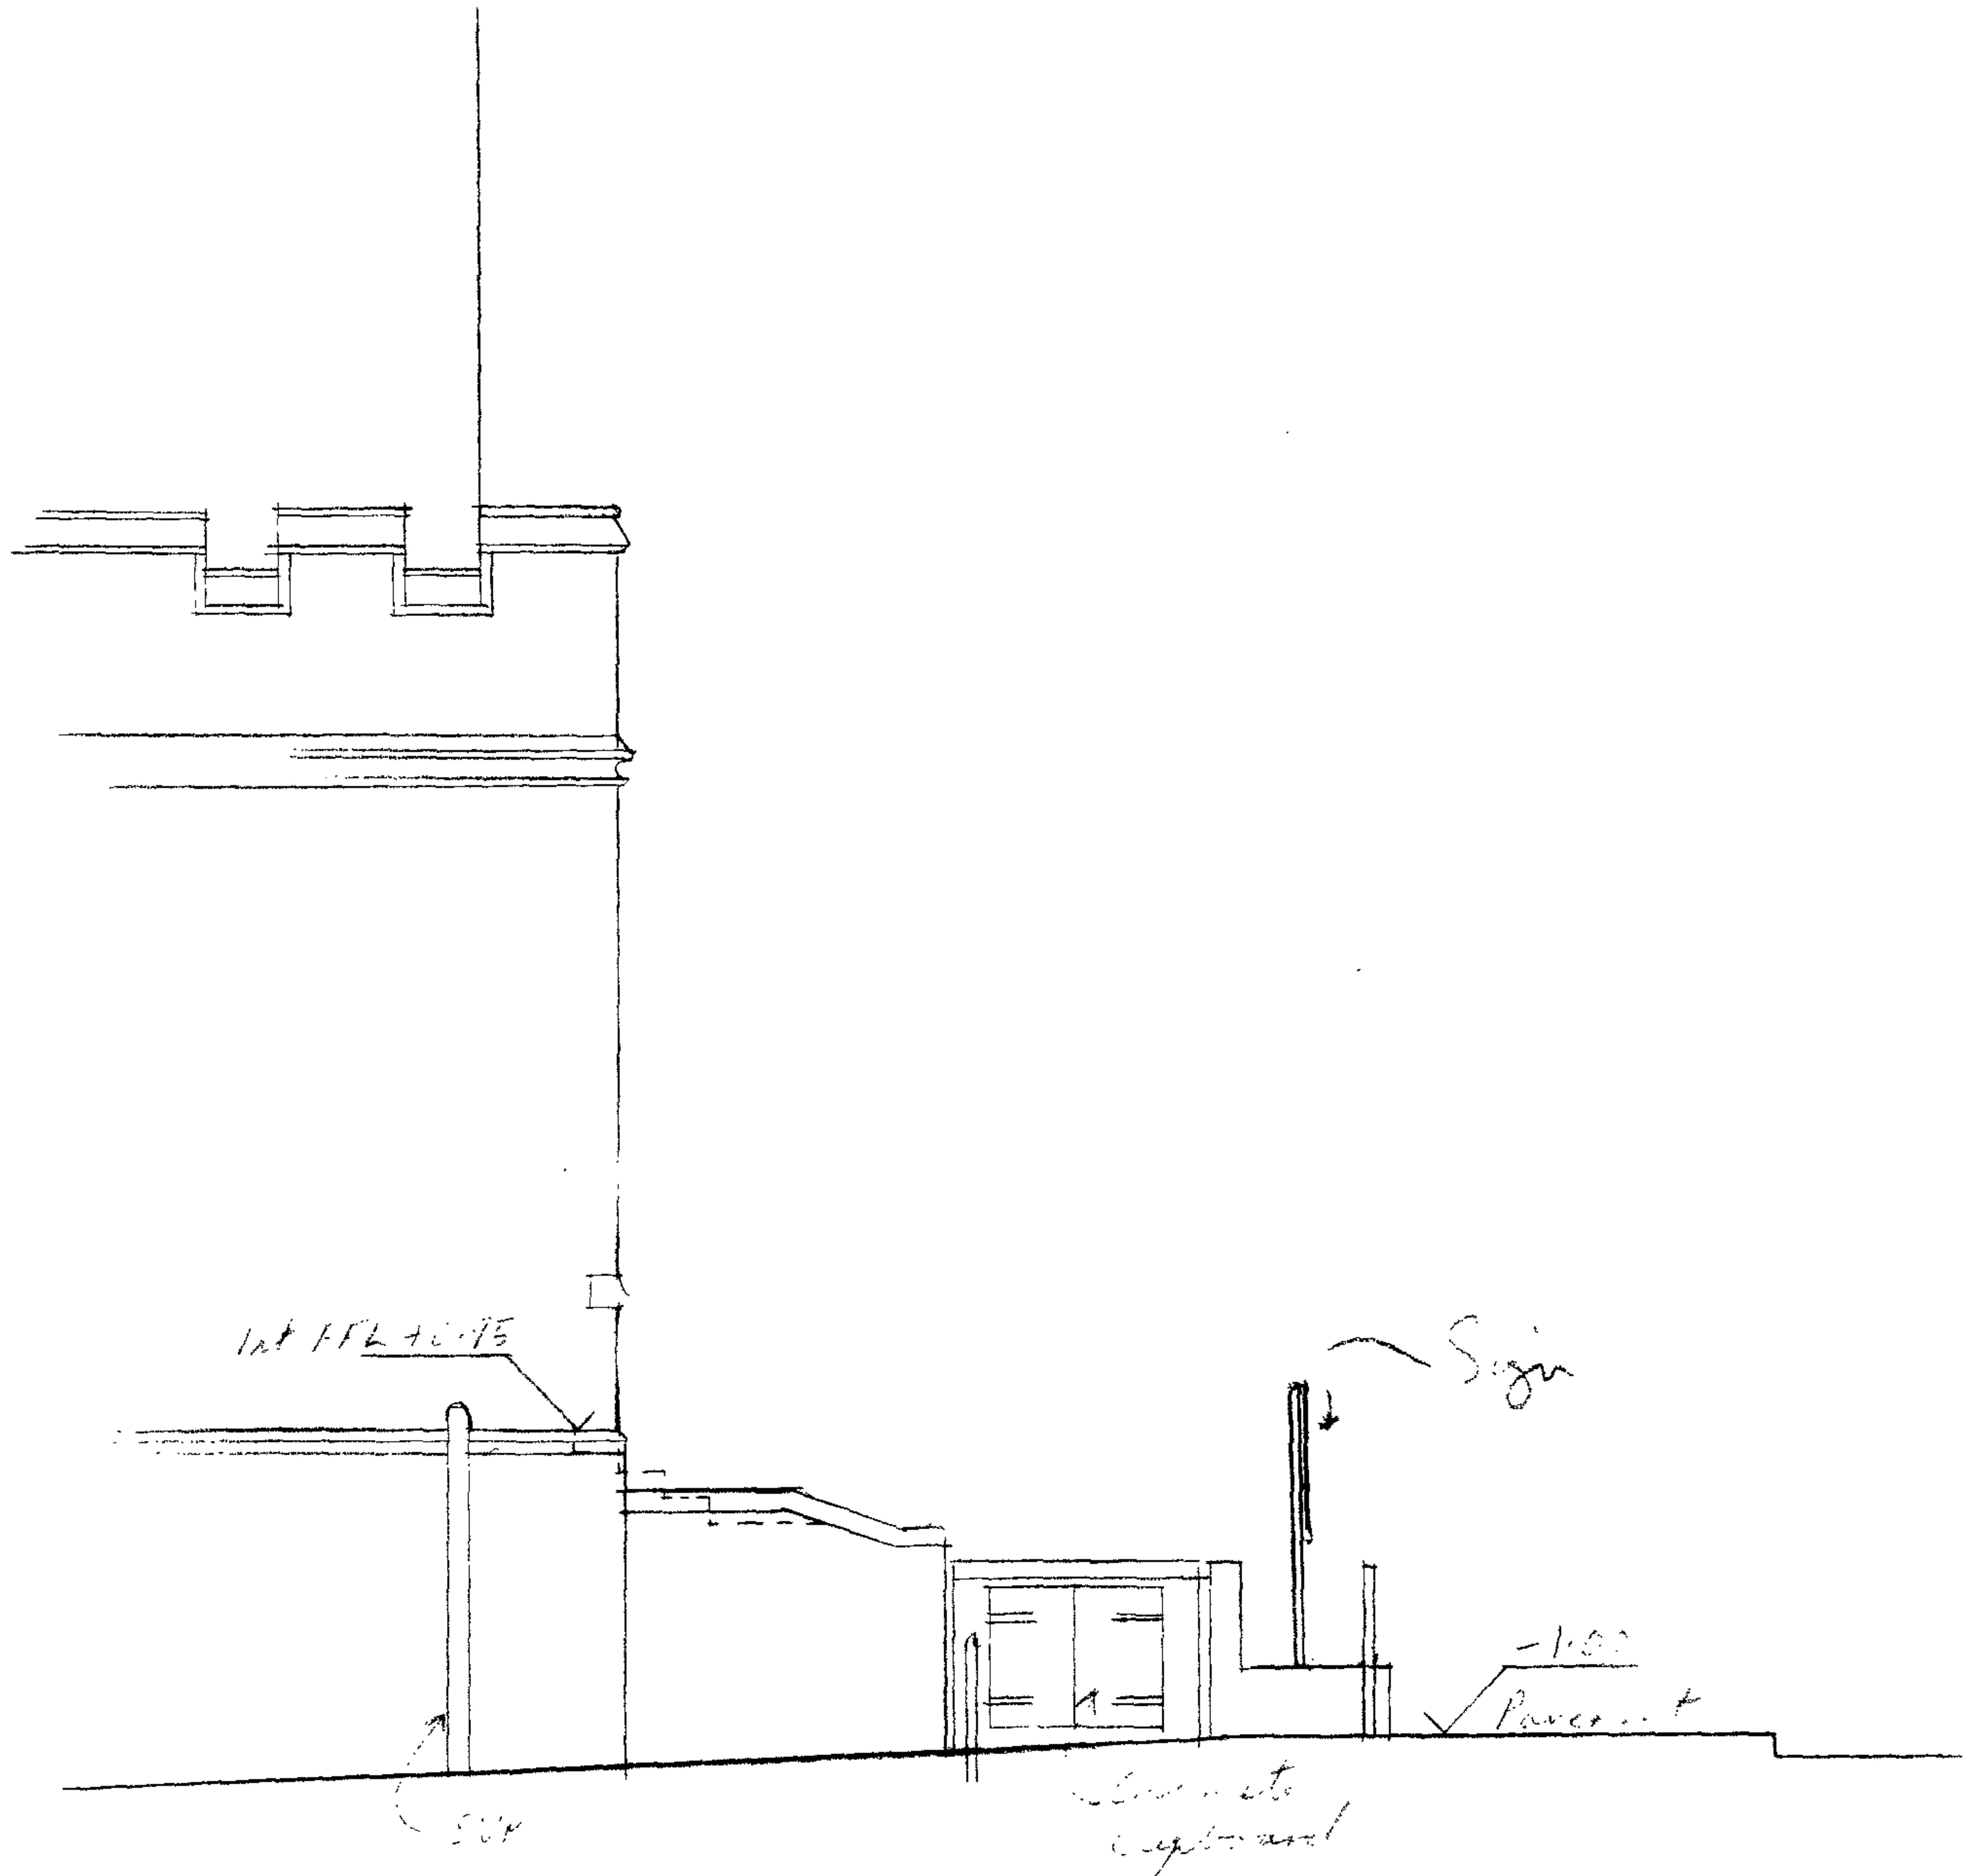


West Side as Existing
EXCLUDING FORMER

St Lucia - Hand-drawn 6/05/12/17
 1:50 6/09/11 TT

RUSSELL TAYLOR ARCHITECTS
 85 BLACKFRIARS ROAD LONDON SE1 8HA
 TEL: 020 7261 1984 FAX: 020 7928 0610
 mail@rtarchitects.co.uk www.rtarchitects.co.uk

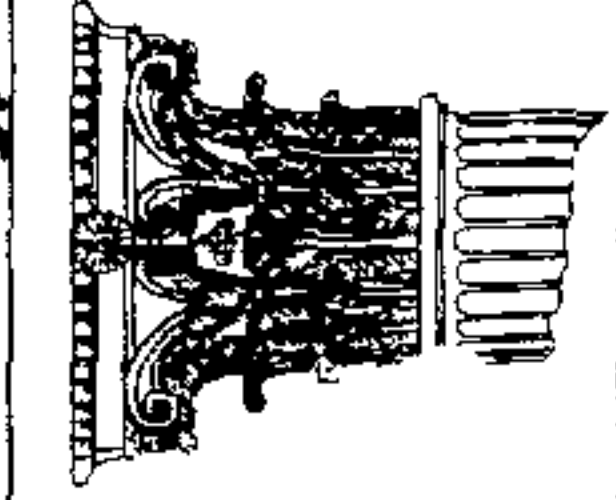

- 7 SEP 2008

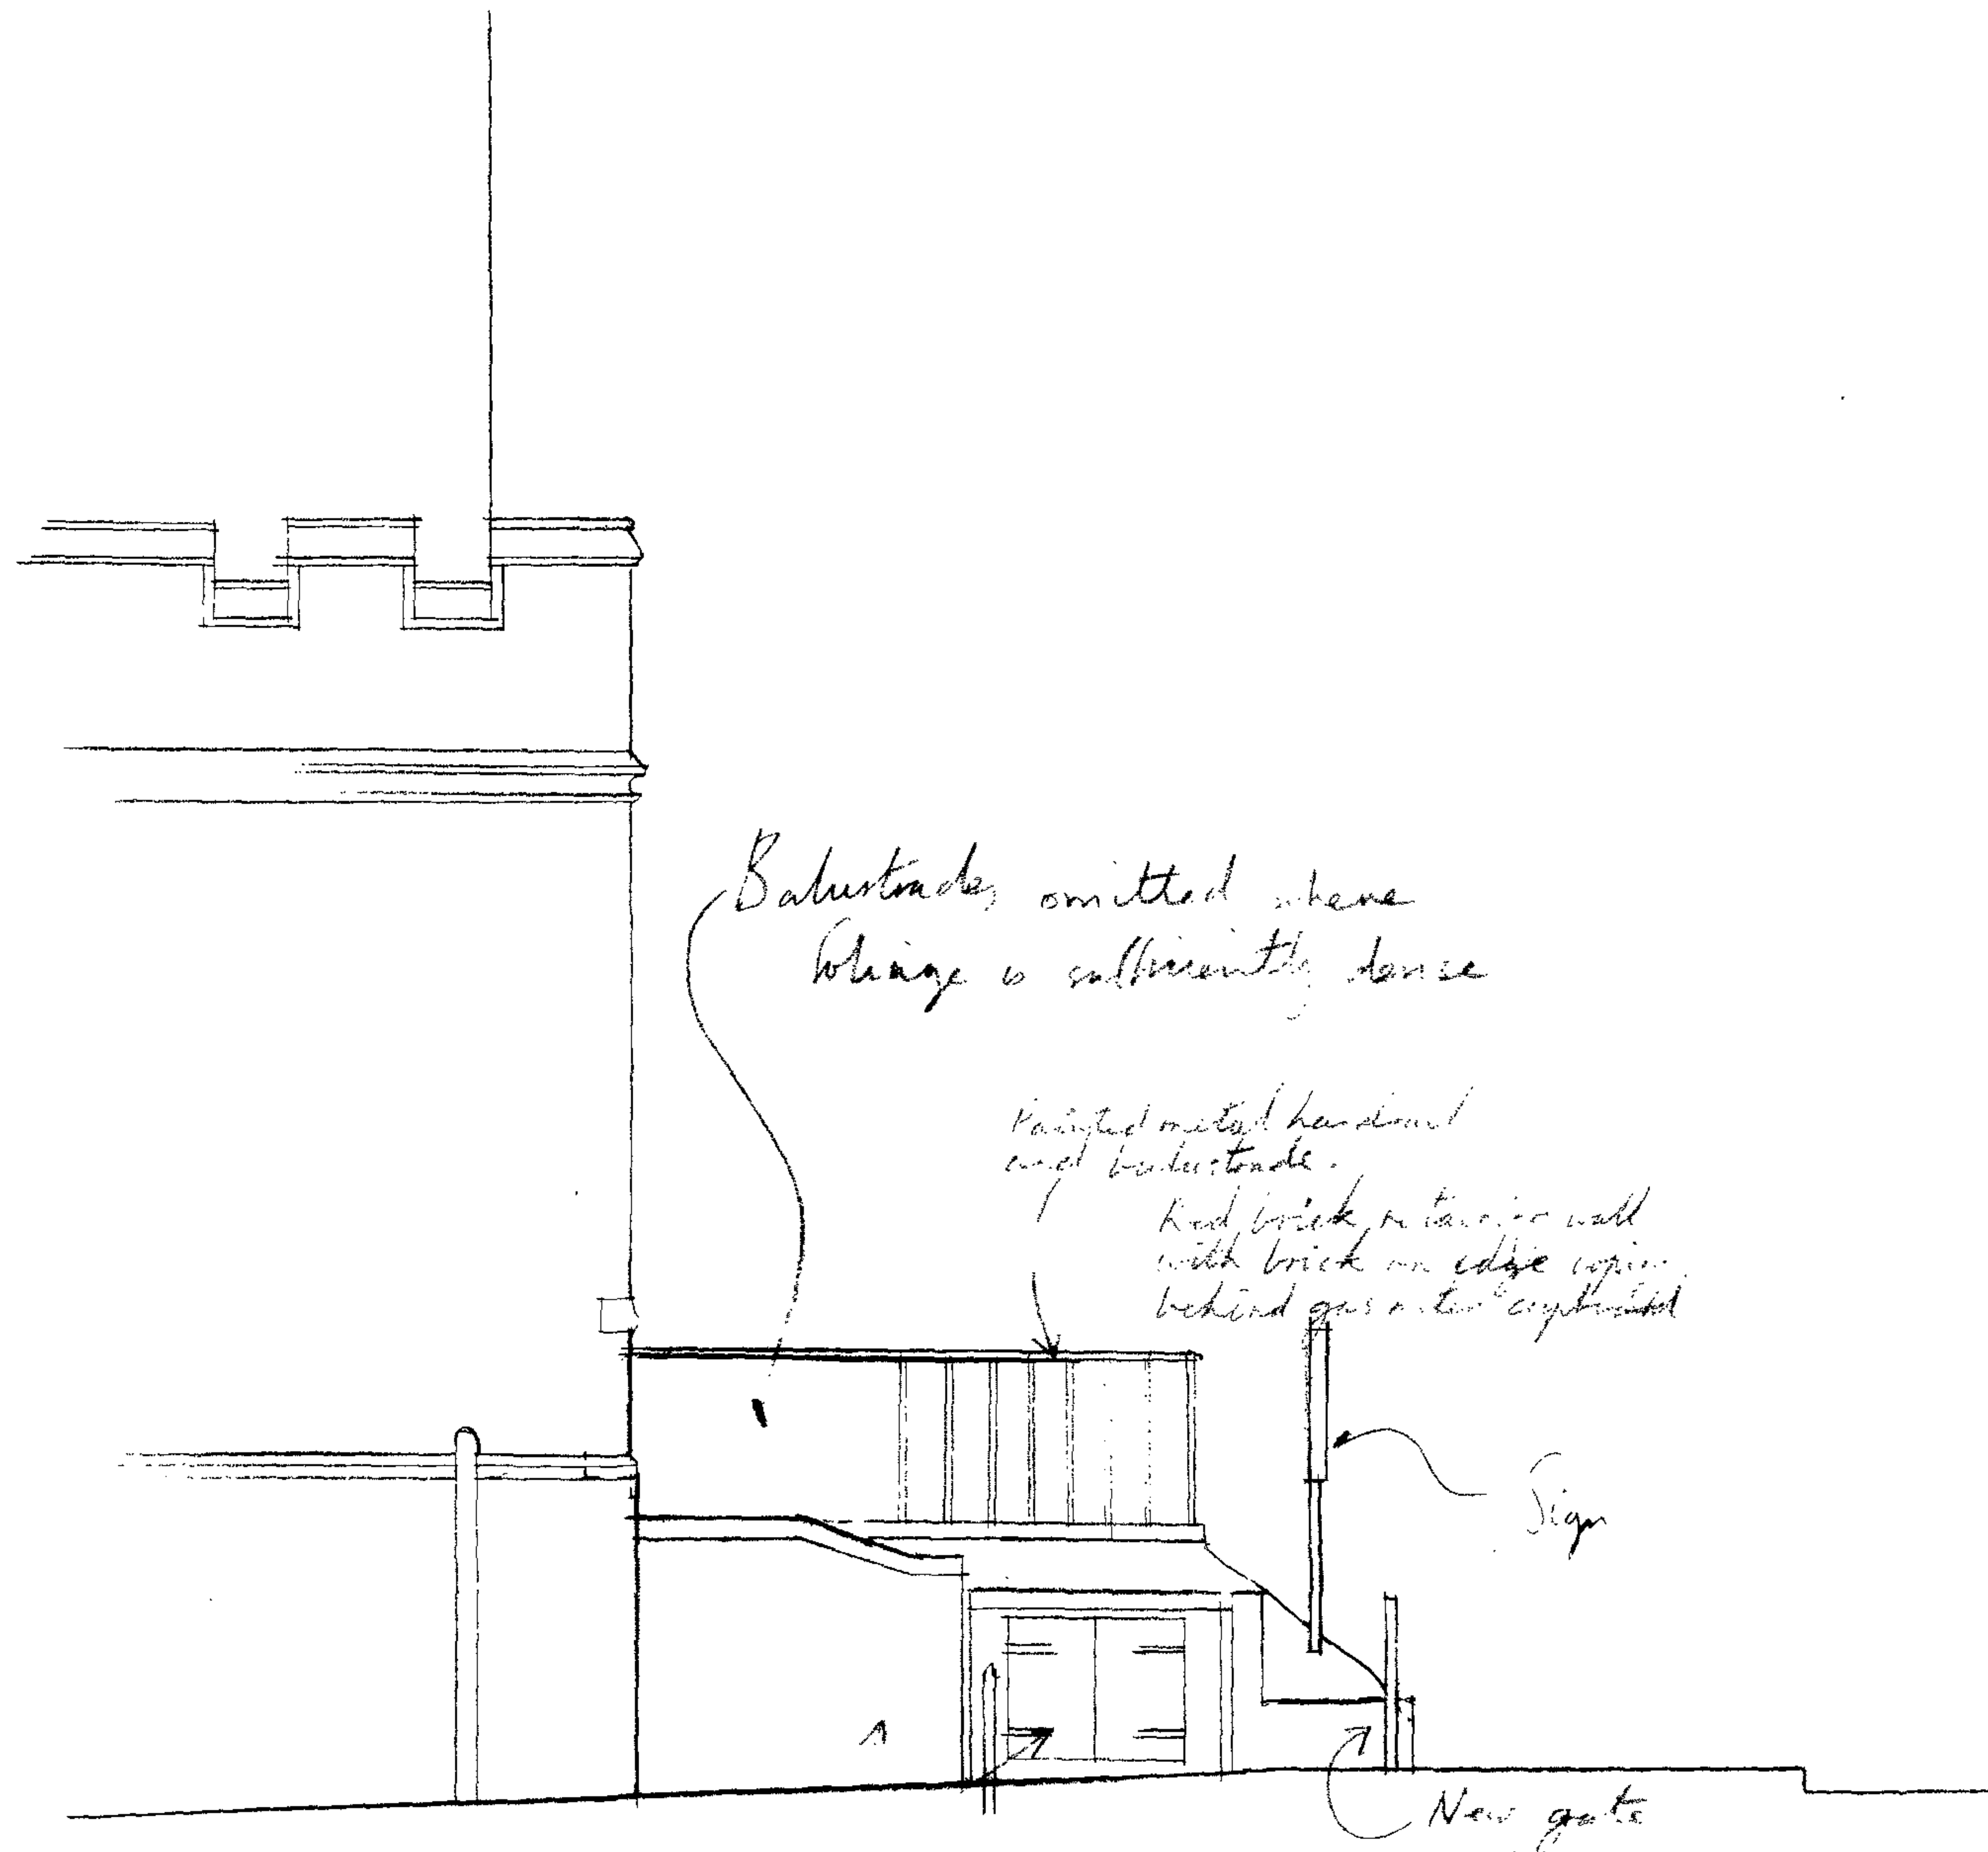



West Side as Proposed
 EXCLUDING FOLIAGE

- 7 SEP 2006

St Lukes Church - Camp 6/05/18
 IT 1:50 5/04/06

RUSSELL TAYLOR ARCHITECTS
 85 BLACKFRIARS ROAD LONDON SE1 8HA
 TEL: 020 7261 1984 FAX: 020 7928 0610
 mail@rtarchitects.co.uk www.rtarchitects.co.uk

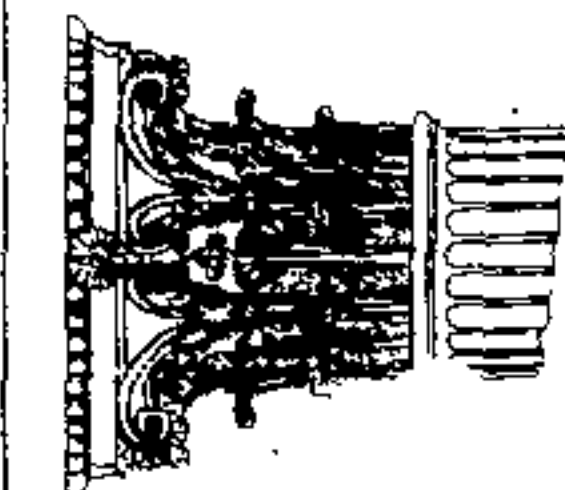

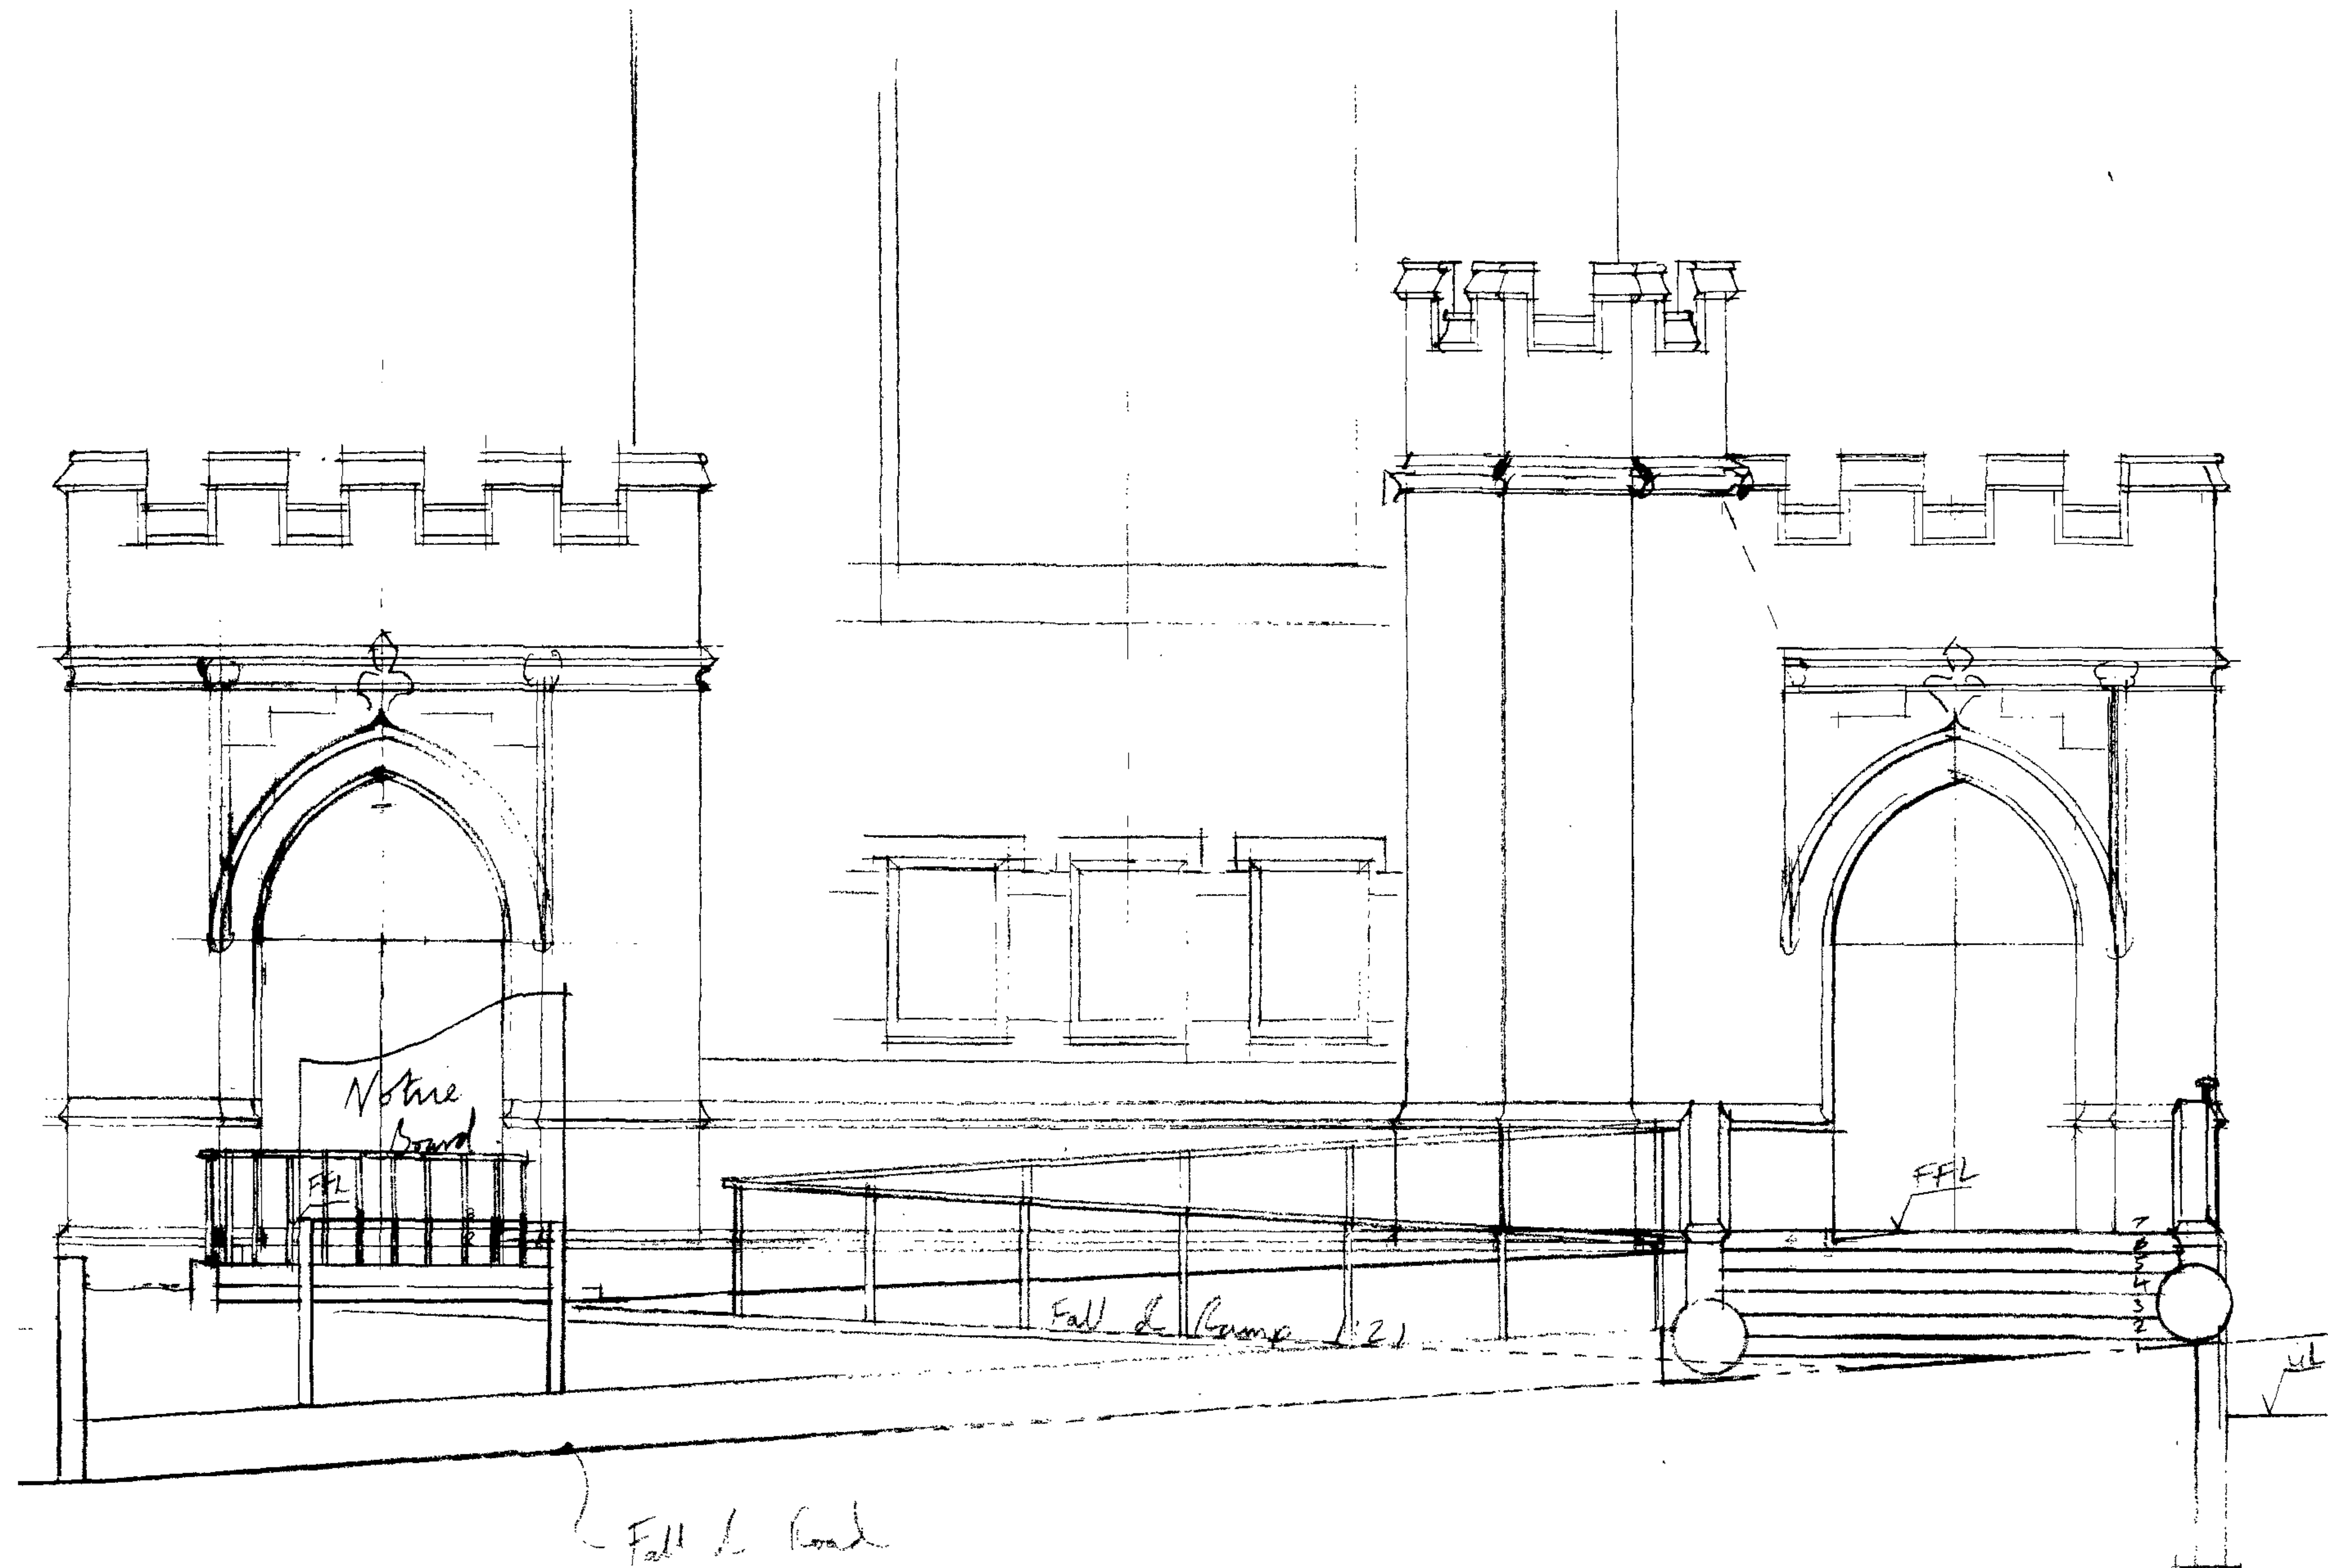


Front Section of Ramp 1:50
As Proposed Excluding Foliage

RECEIVED
 - 7 SEP 2006

St Luke's - Hampstead 6/05/19
 TT 1:50 6/09/06

RUSSELL TAYLOR ARCHITECTS
 85 BLACKFRIARS ROAD LONDON SE1 8HA
 TEL: 020 7261 1984 FAX: 020 7928 0610
 mail@rtarchitects.co.uk www.rtarchitects.co.uk

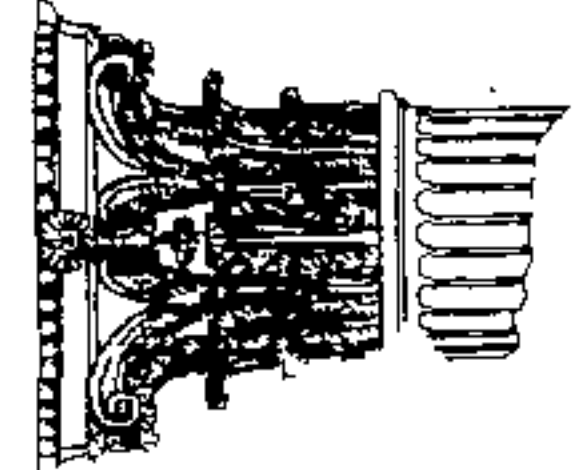


SECTIONS FF

SECTION GG

For handrail section
see drawing 6105/2/15

45



Painted Metal

On West face
of intermediate
landing (opposite
secondary entrance):

balusters occur
at 125mm centres
Elsenhove balus-
ter occur at
1200mm centres



1100

125 125 125 125

Paint on edge
copied to top of
retaining wall
forming 100 high
upstand to
ramp edge

25

Rein bonded
gravel

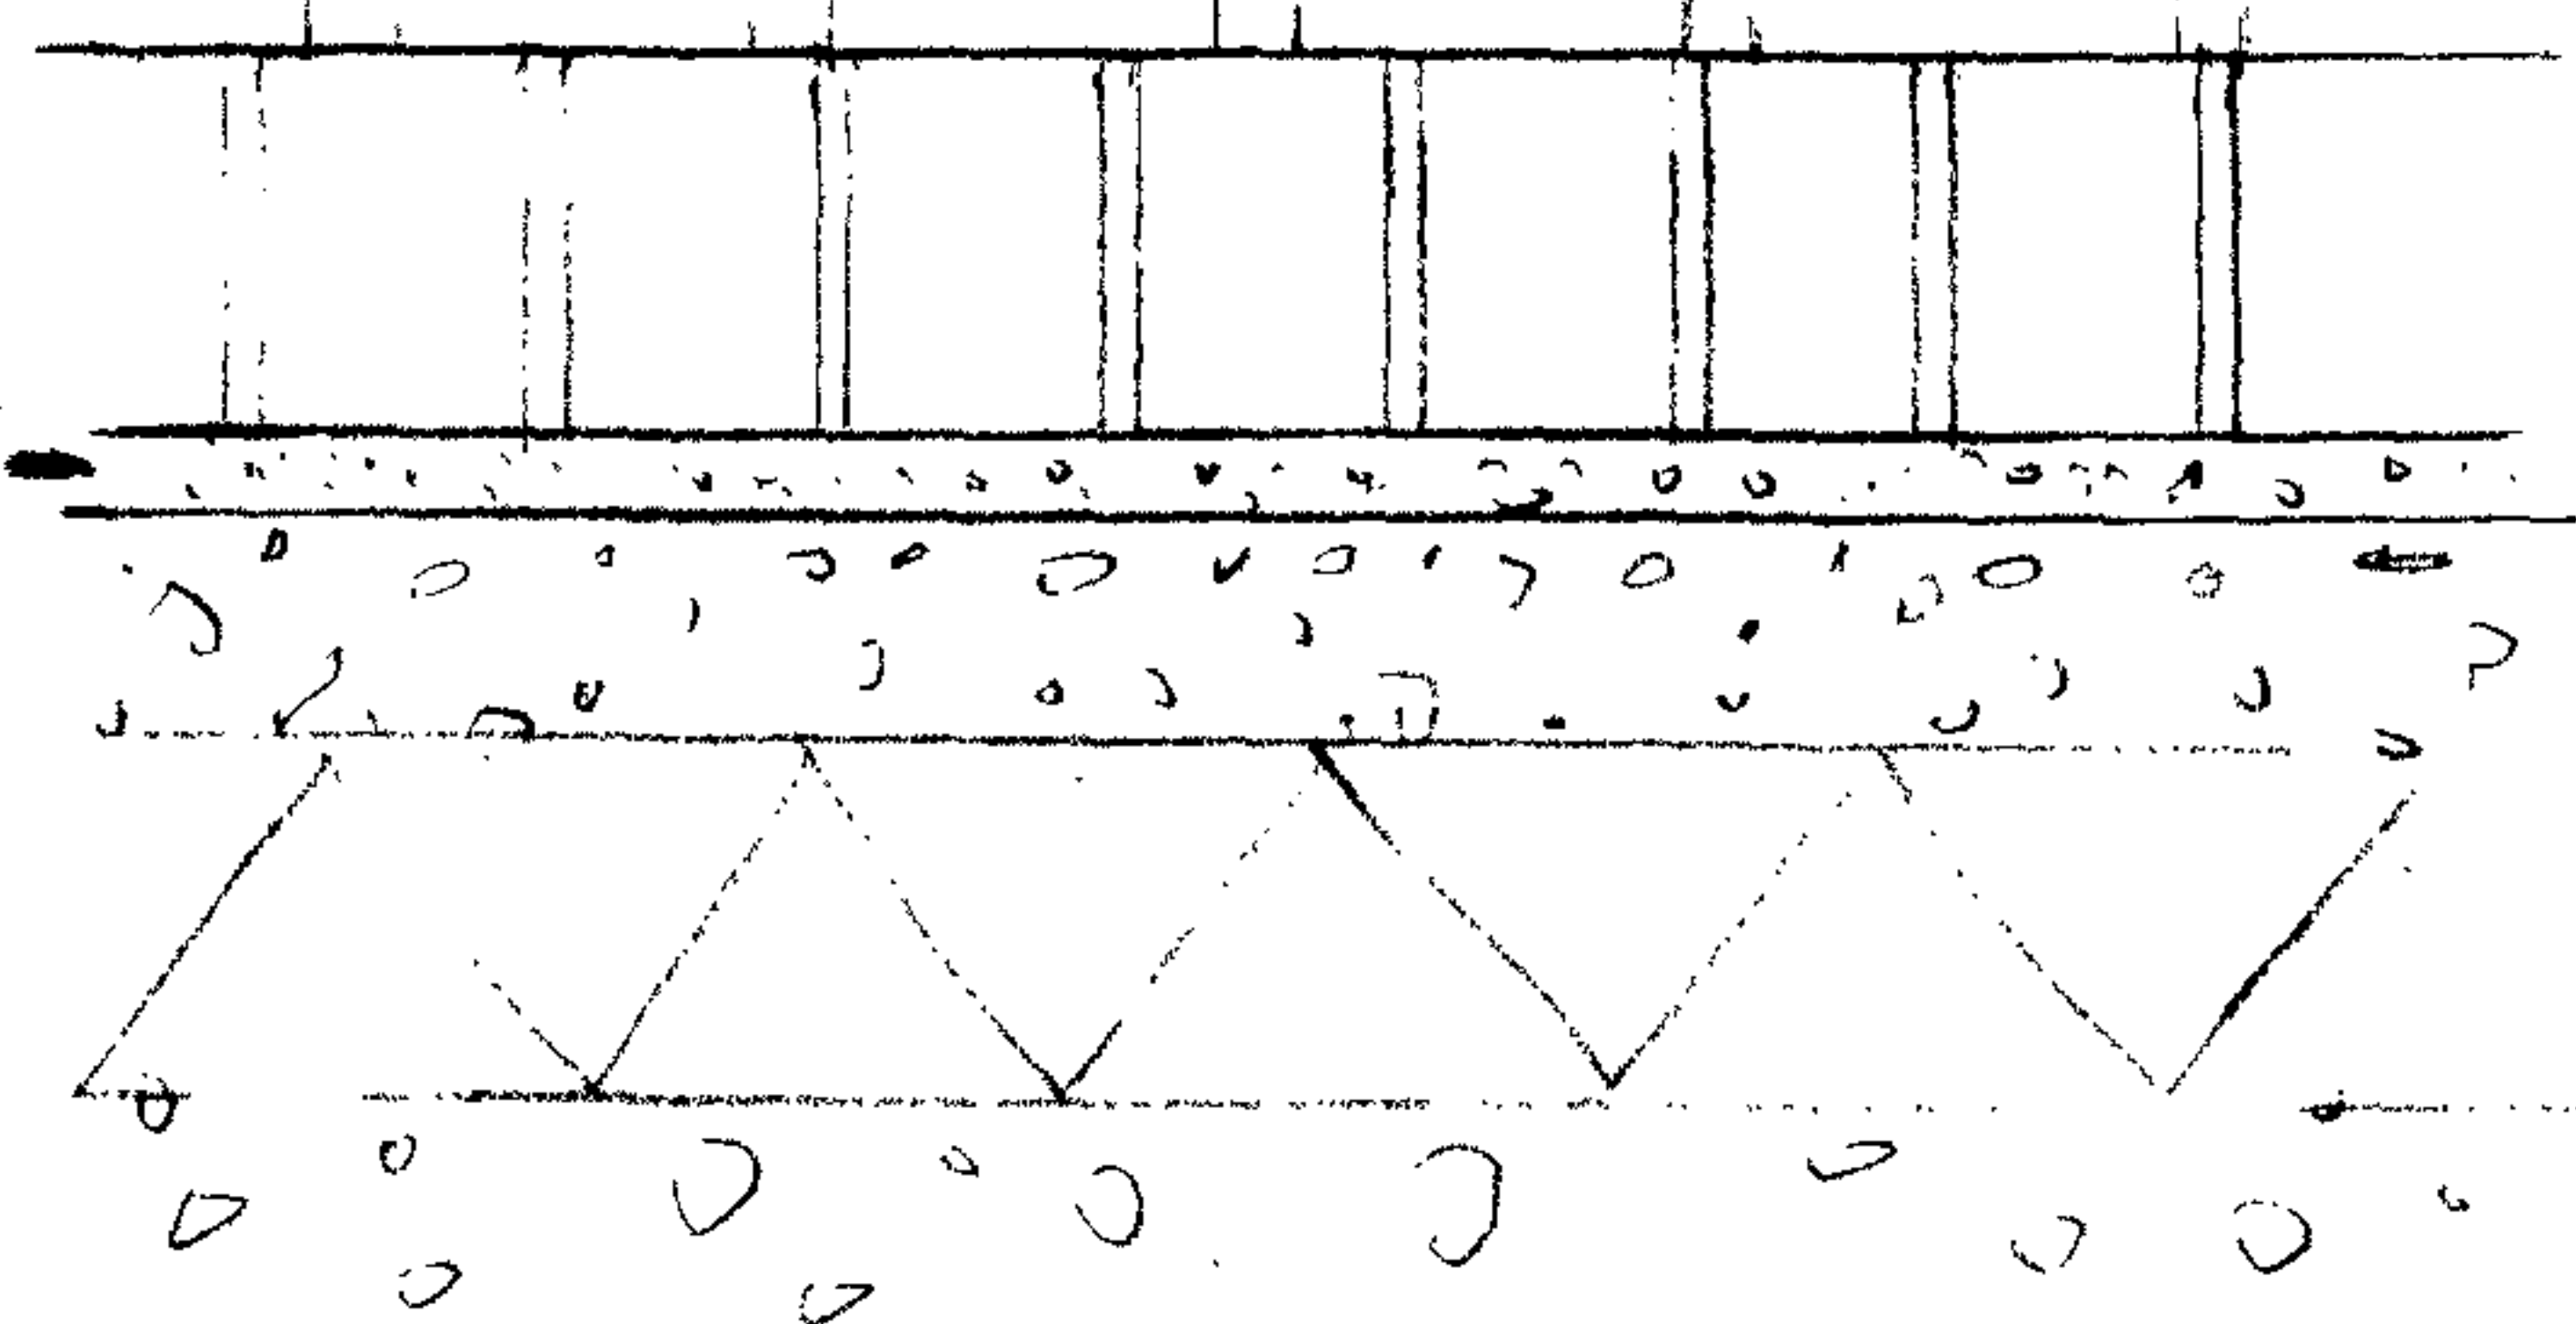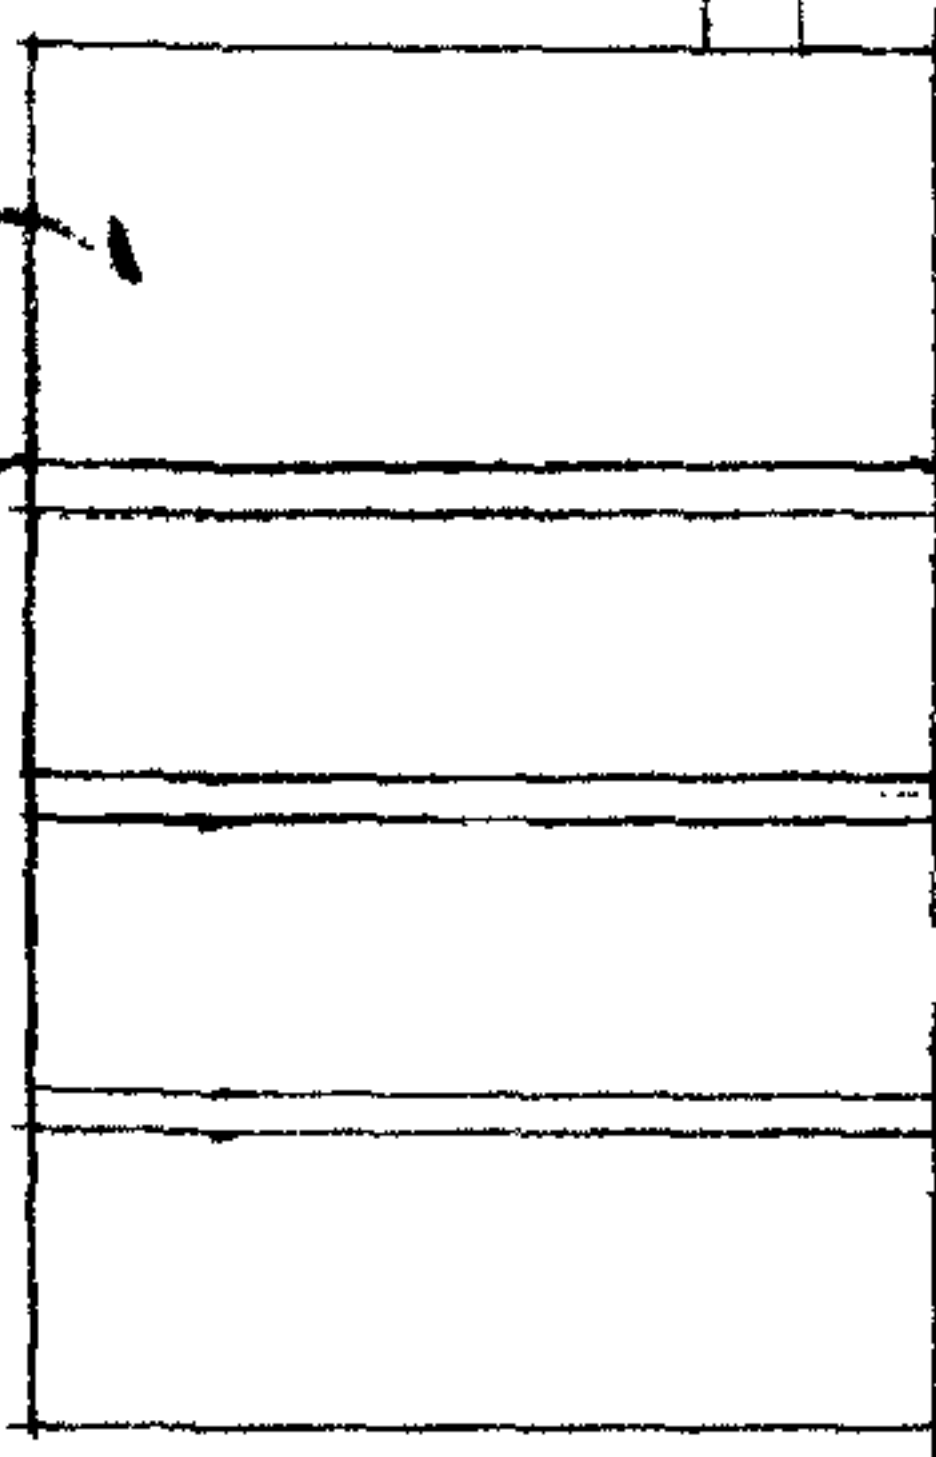

SECTIONS FF and GG

Ramp Handrail Details 1:5


Rev A - 6/09/15



RUSSELL TAYLOR ARCHITECTS
85 BLACKFRIARS ROAD LONDON SE1 8HA
mail@rtarchitects.co.uk TEL: 020 7261 1984 FAX: 020 7928 0610
www.rtarchitects.co.uk

St Luke's Church - Ramp 6105/2/20
TS 15 4/09/00


PLAN As Proposed 1:20

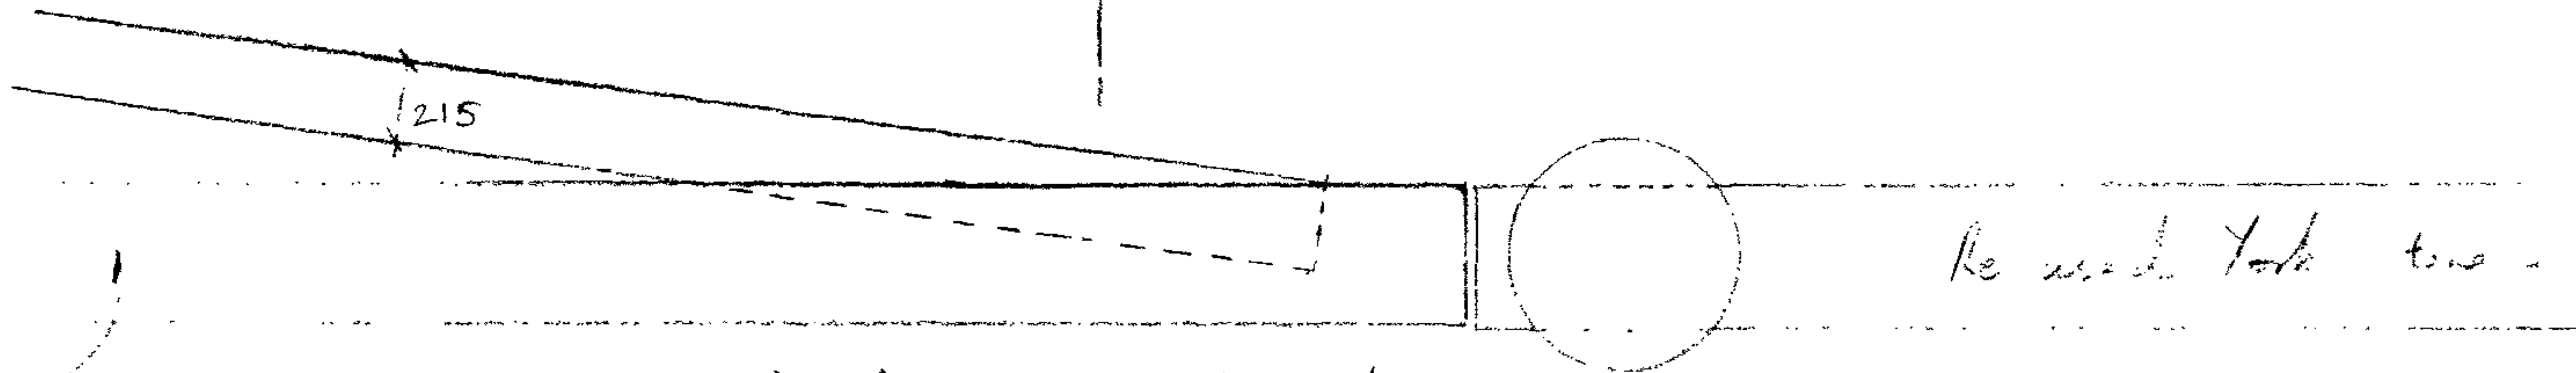

400mm high wall repaired and extended




D II

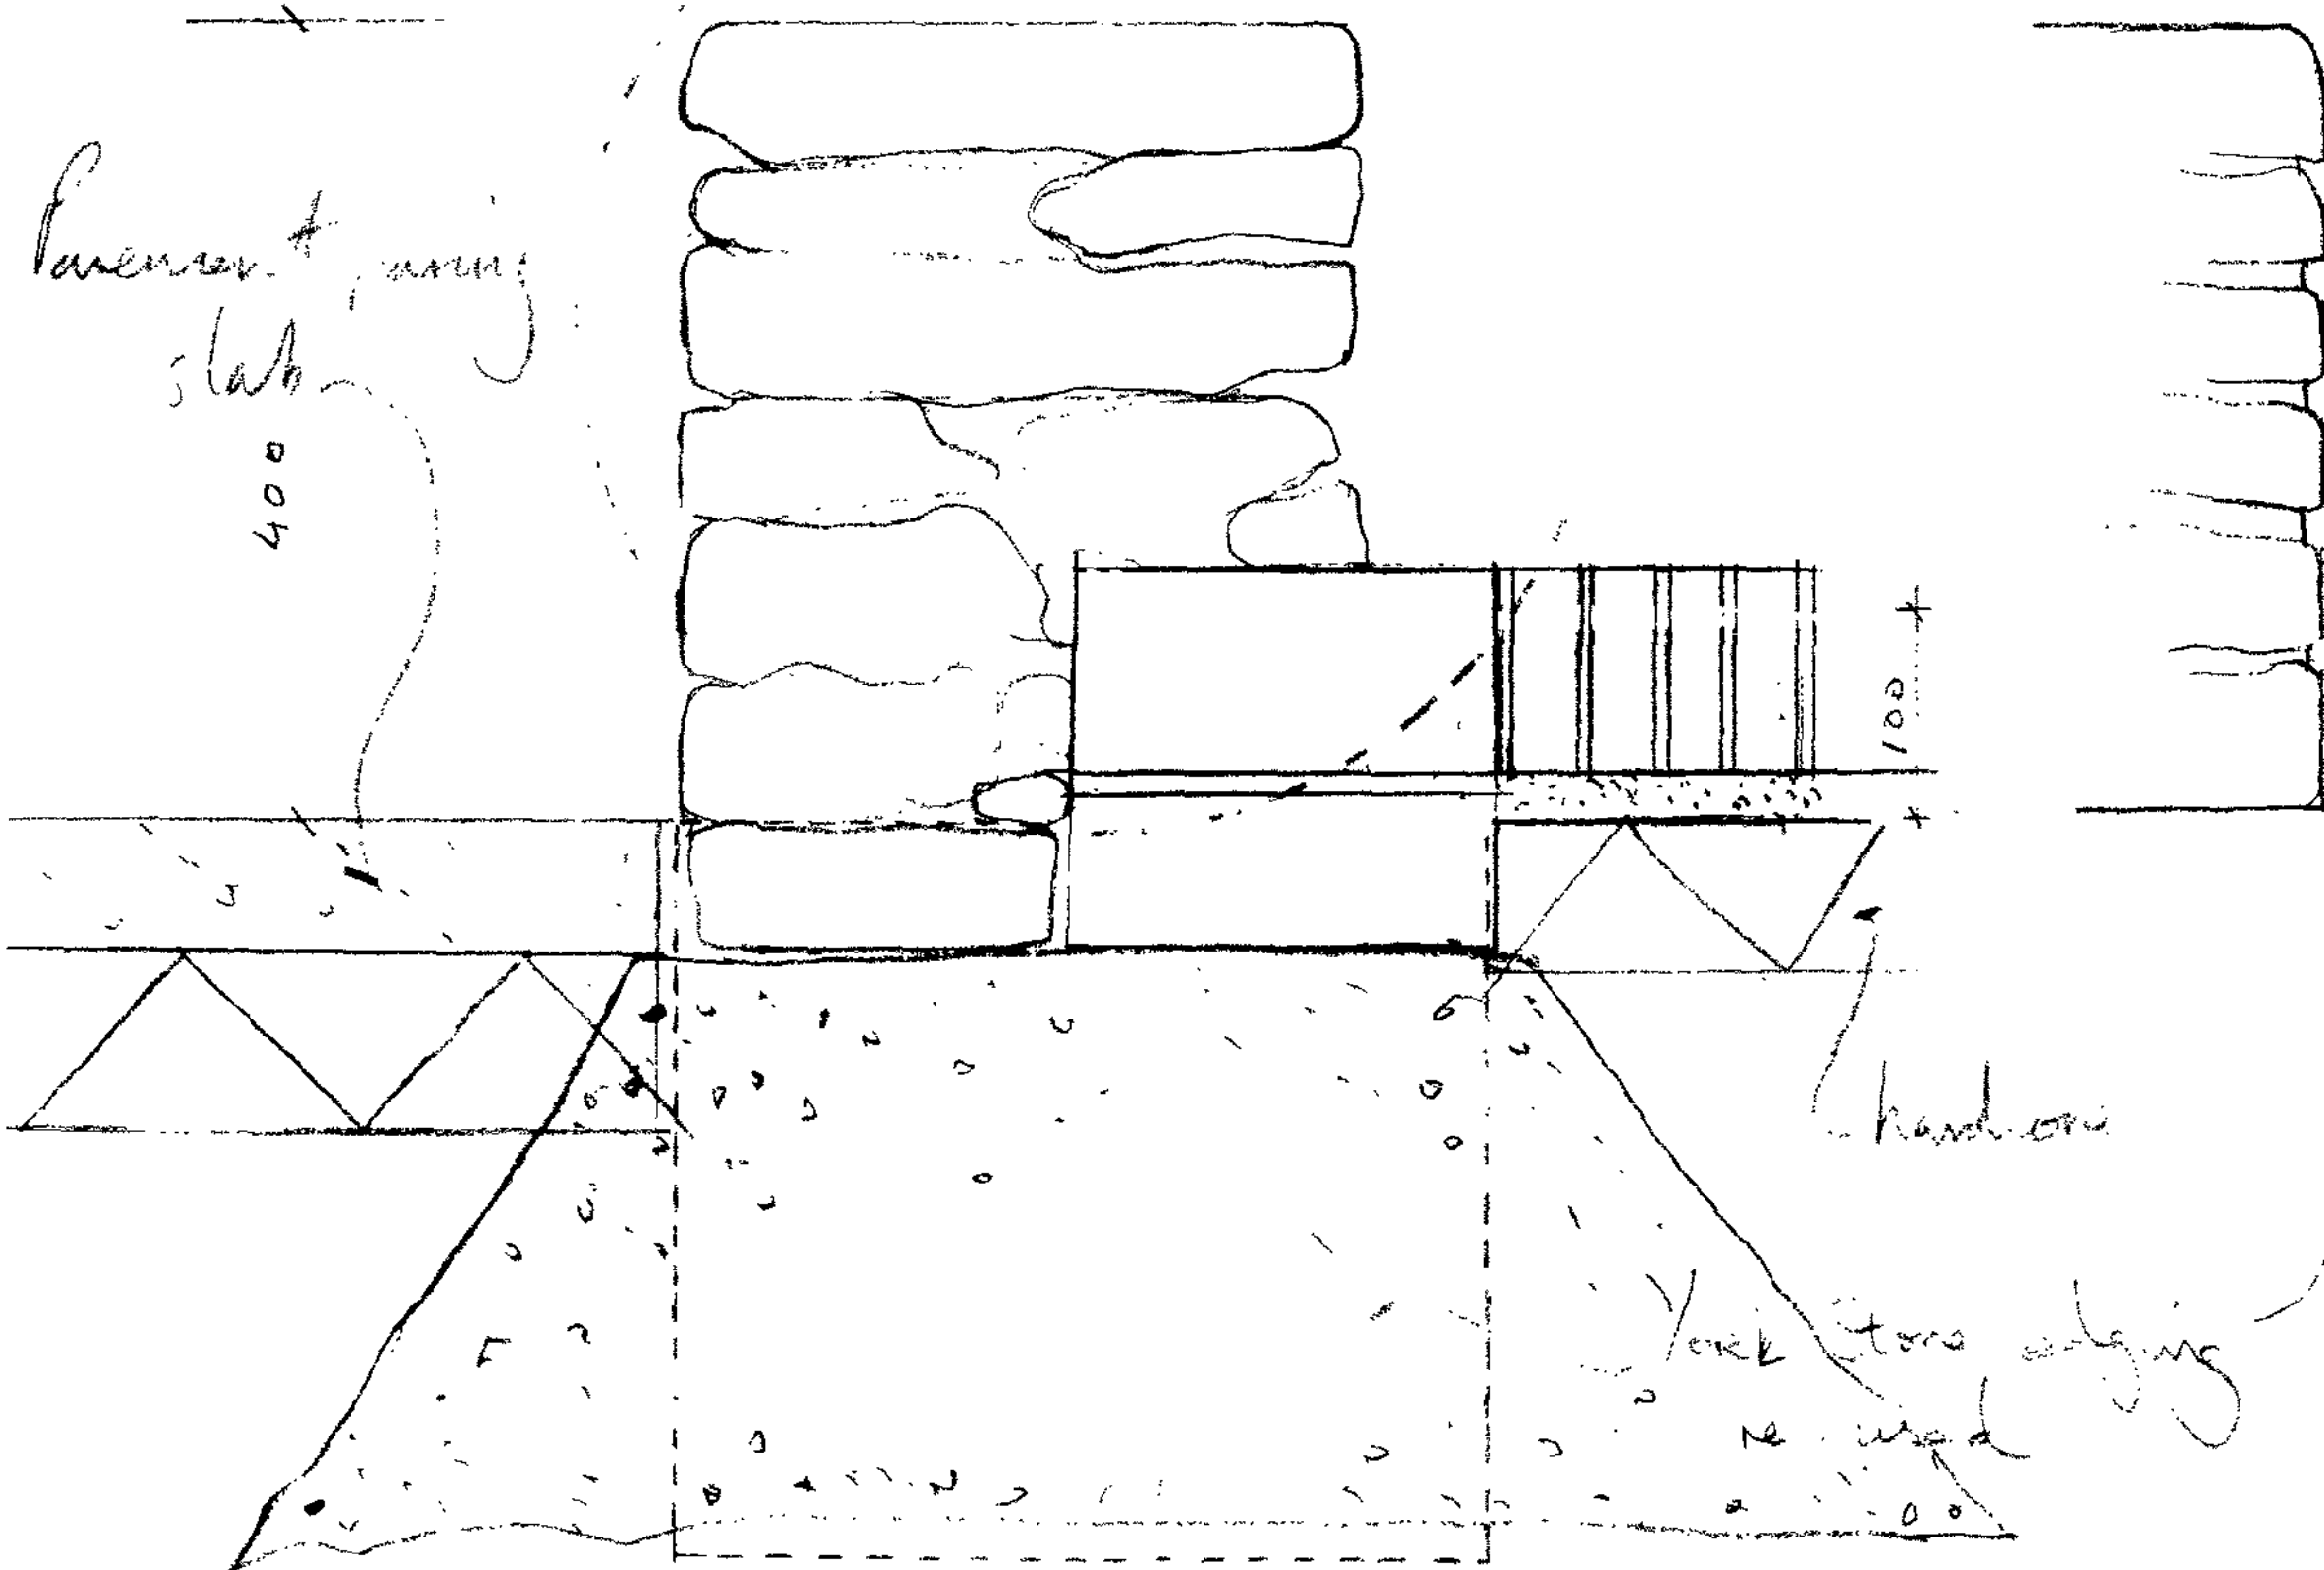

SECTION E-E

Stone Ball

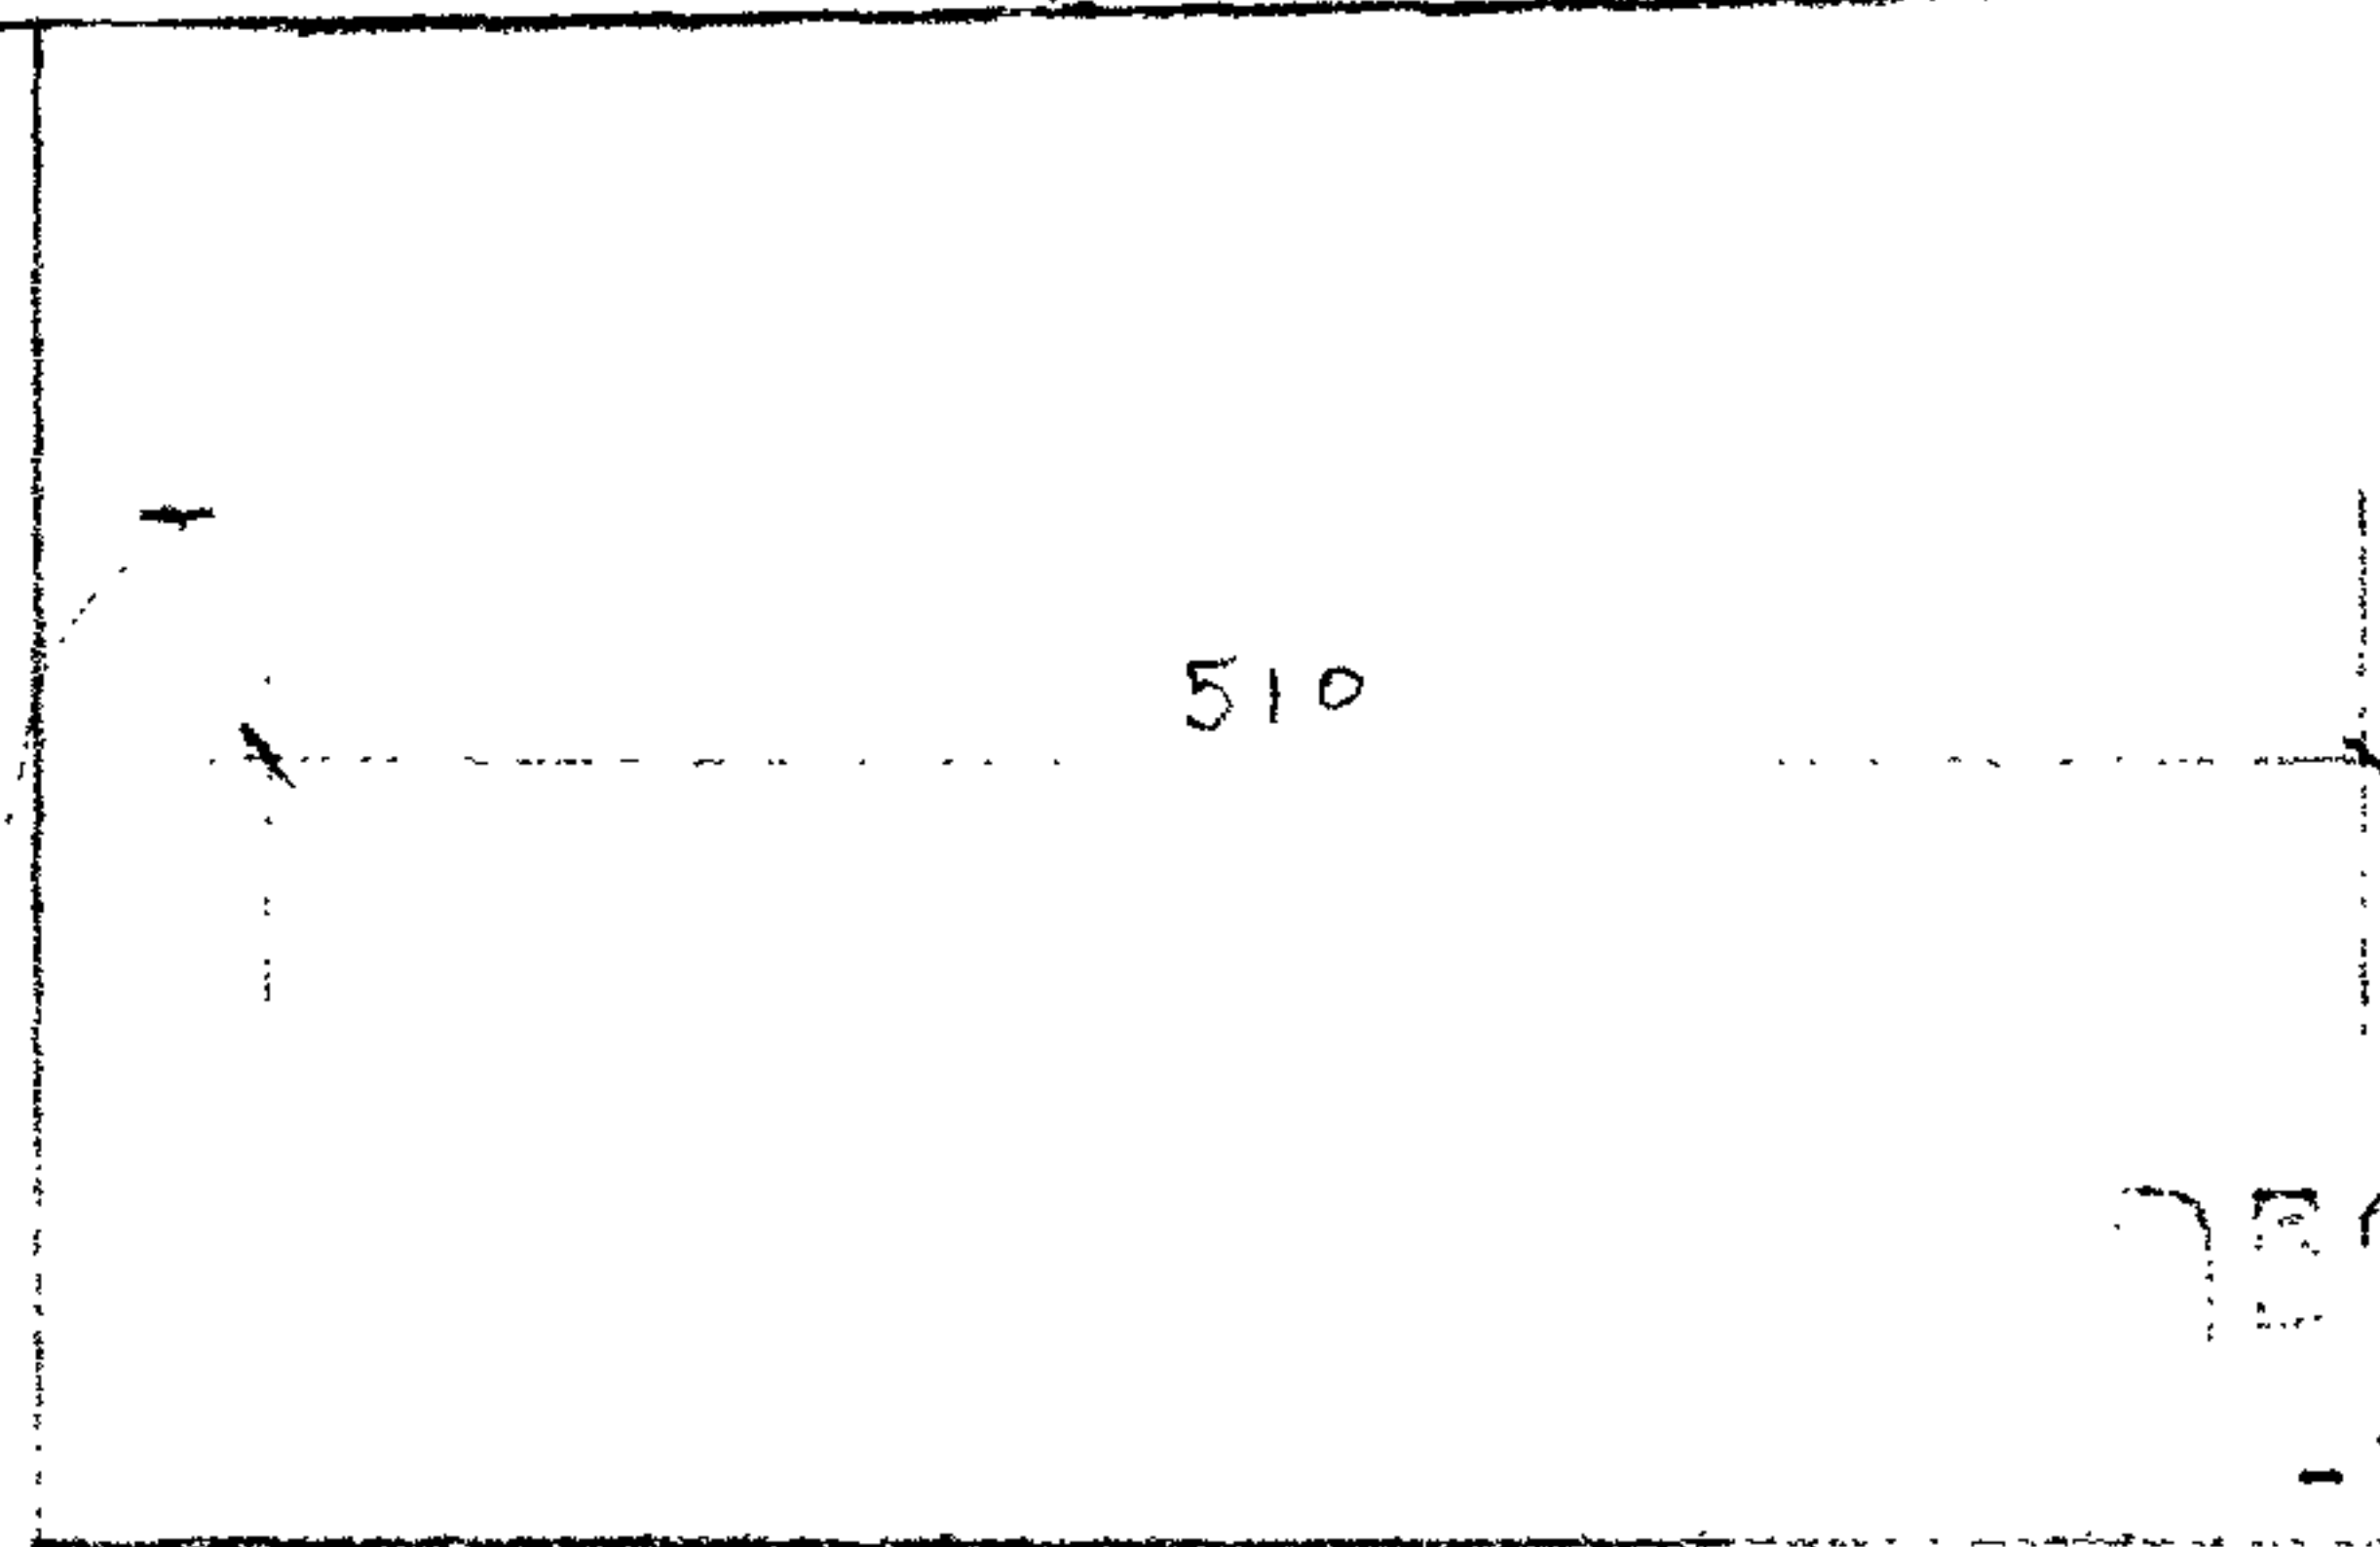


SECTION D-D

ST. LUKE'S CHURCH 6/05/21

TT 1:5 6/07/06


RUSSELL TAYLOR ARCHITECTS

85 BLACKFRIARS ROAD LONDON SE1 8HA
TEL: 020 7261 1984 FAX: 020 7928 0610
mail@rtarchitects.co.uk www.rtarchitects.co.uk

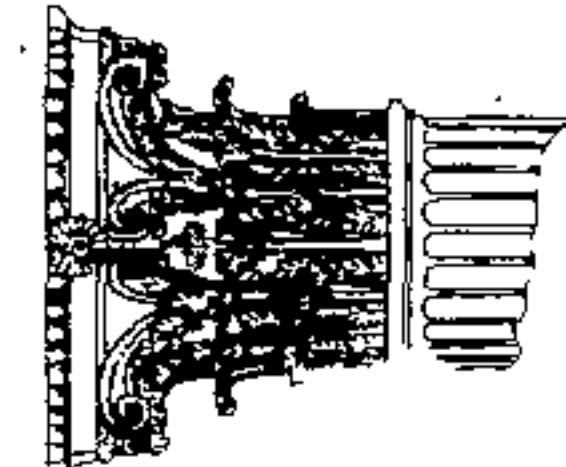

- 7 SEP 2006

SECTION JJ 1:50

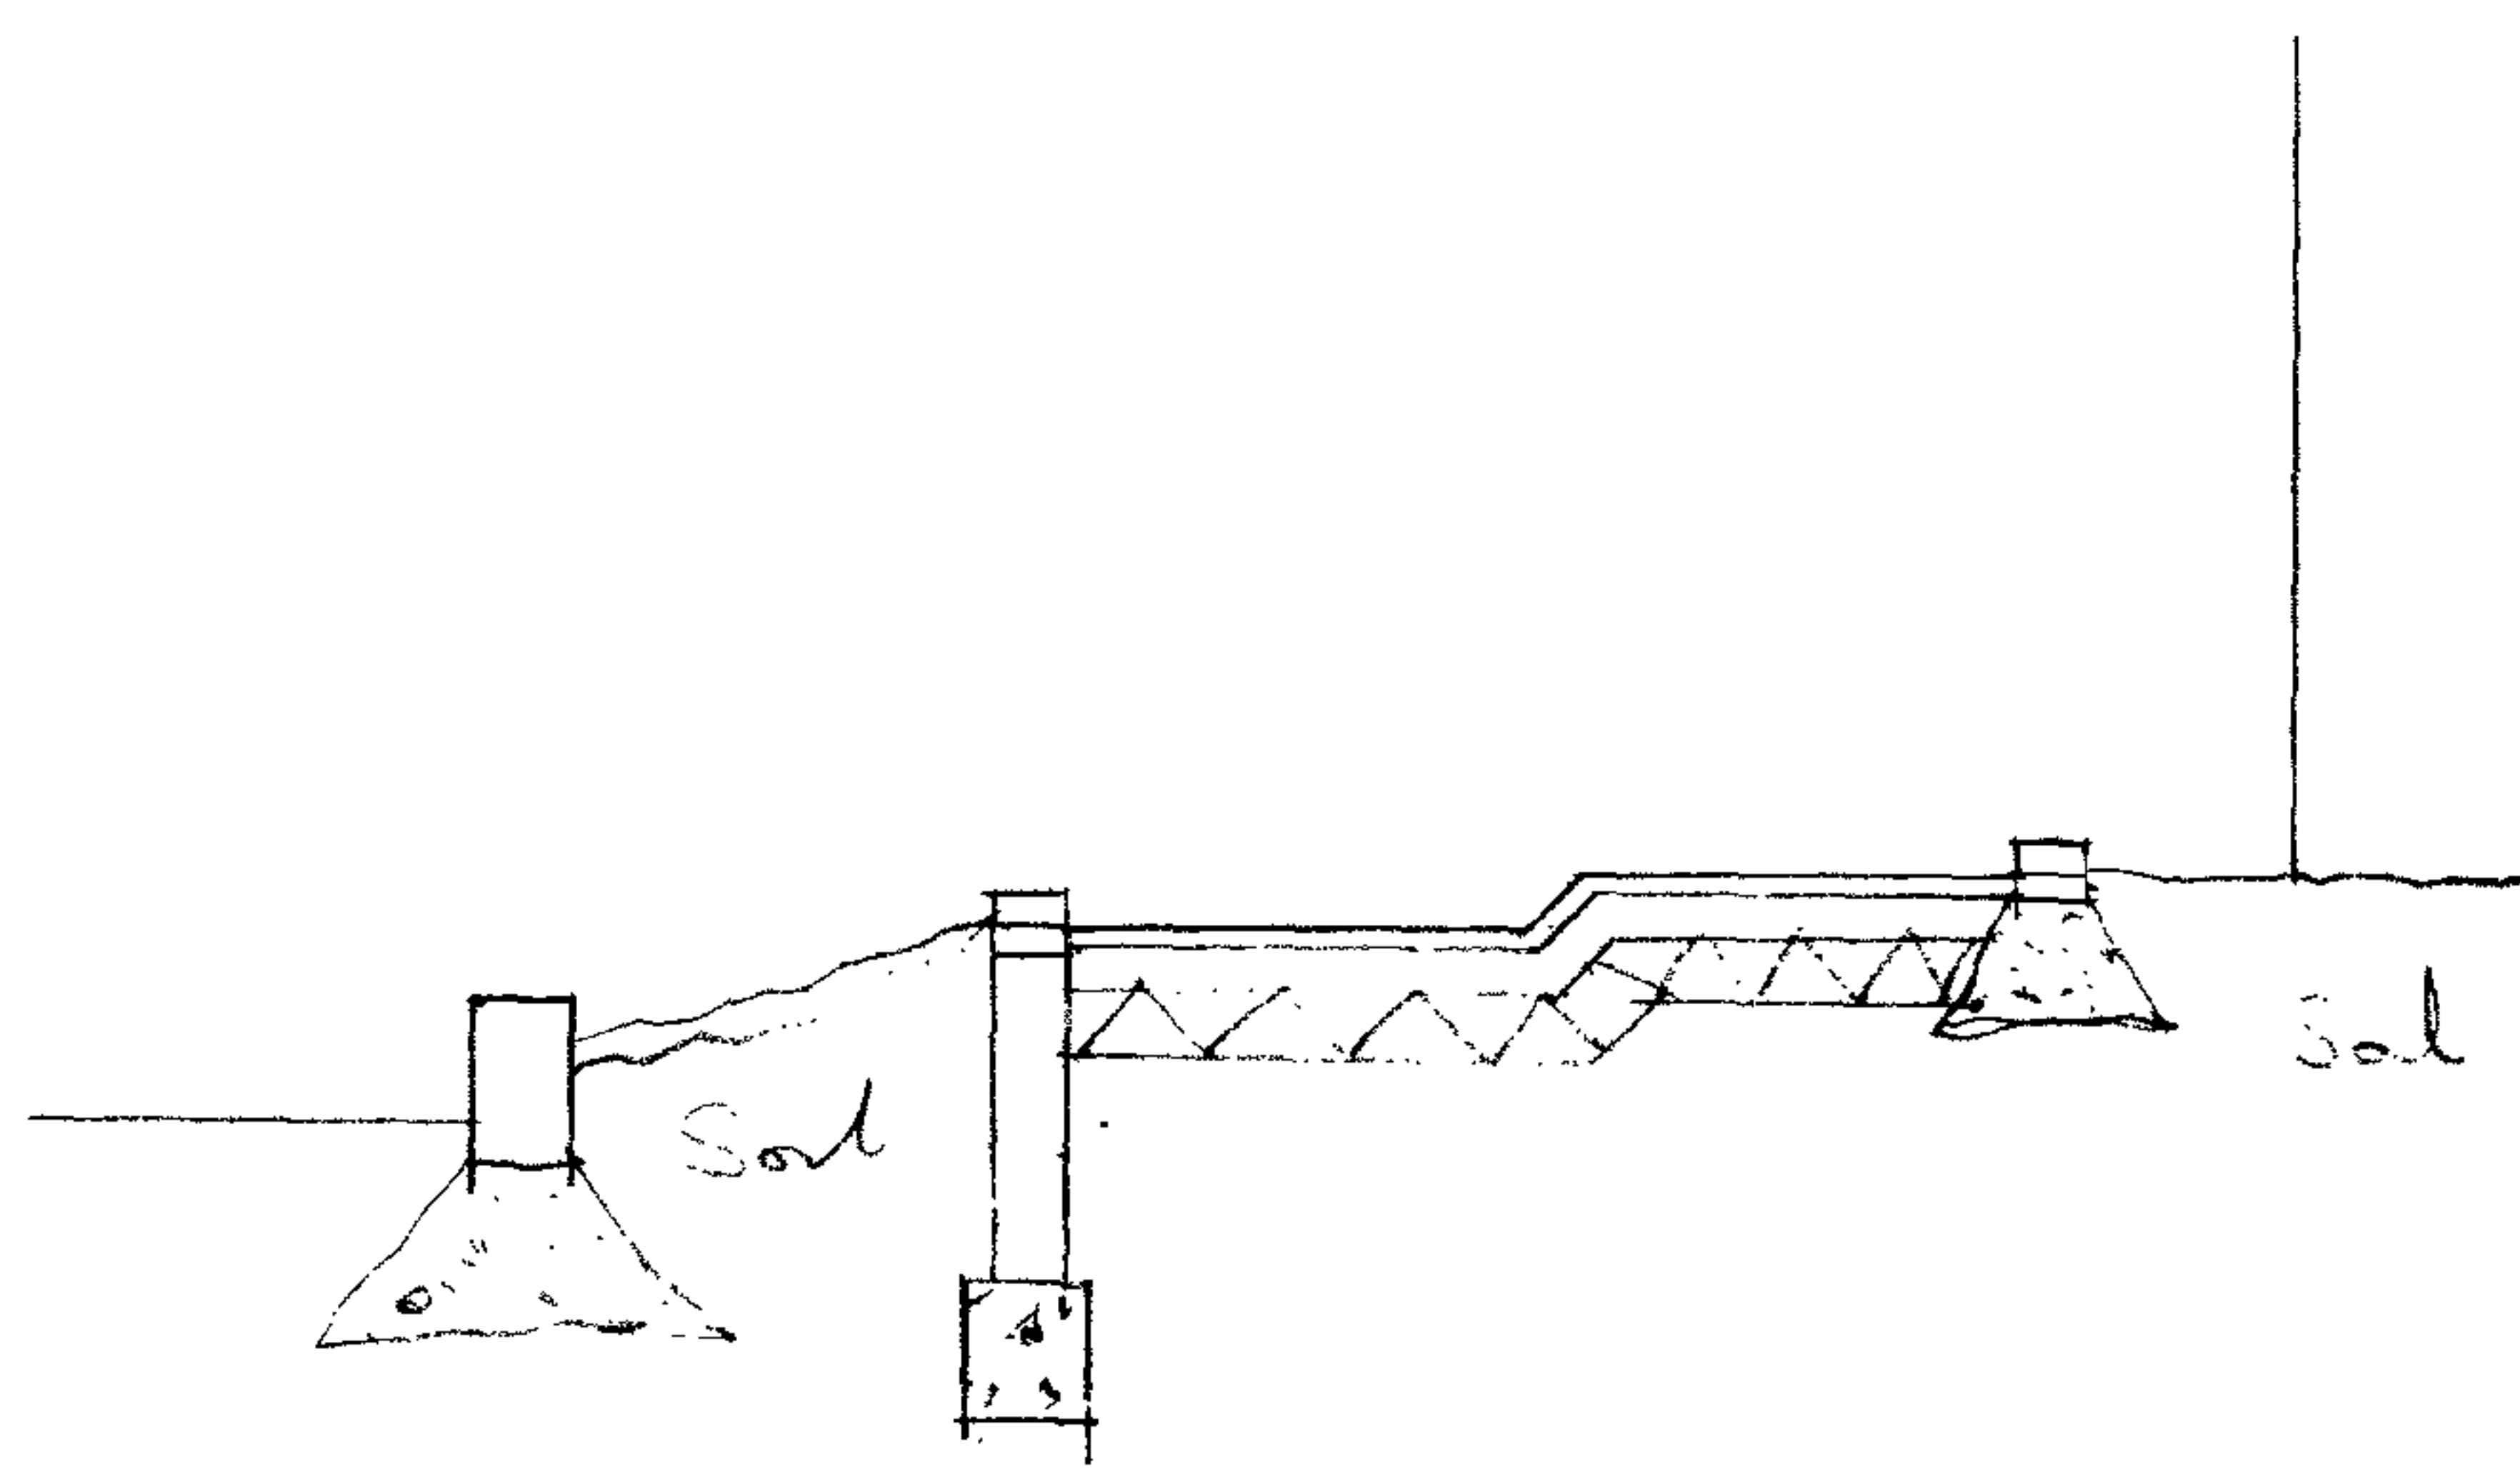


ST LUCAS - HURST - 6105/2/22
 TT 1:5 6/00/06

12m kerri bonded
 gravel


2.15

No handrail

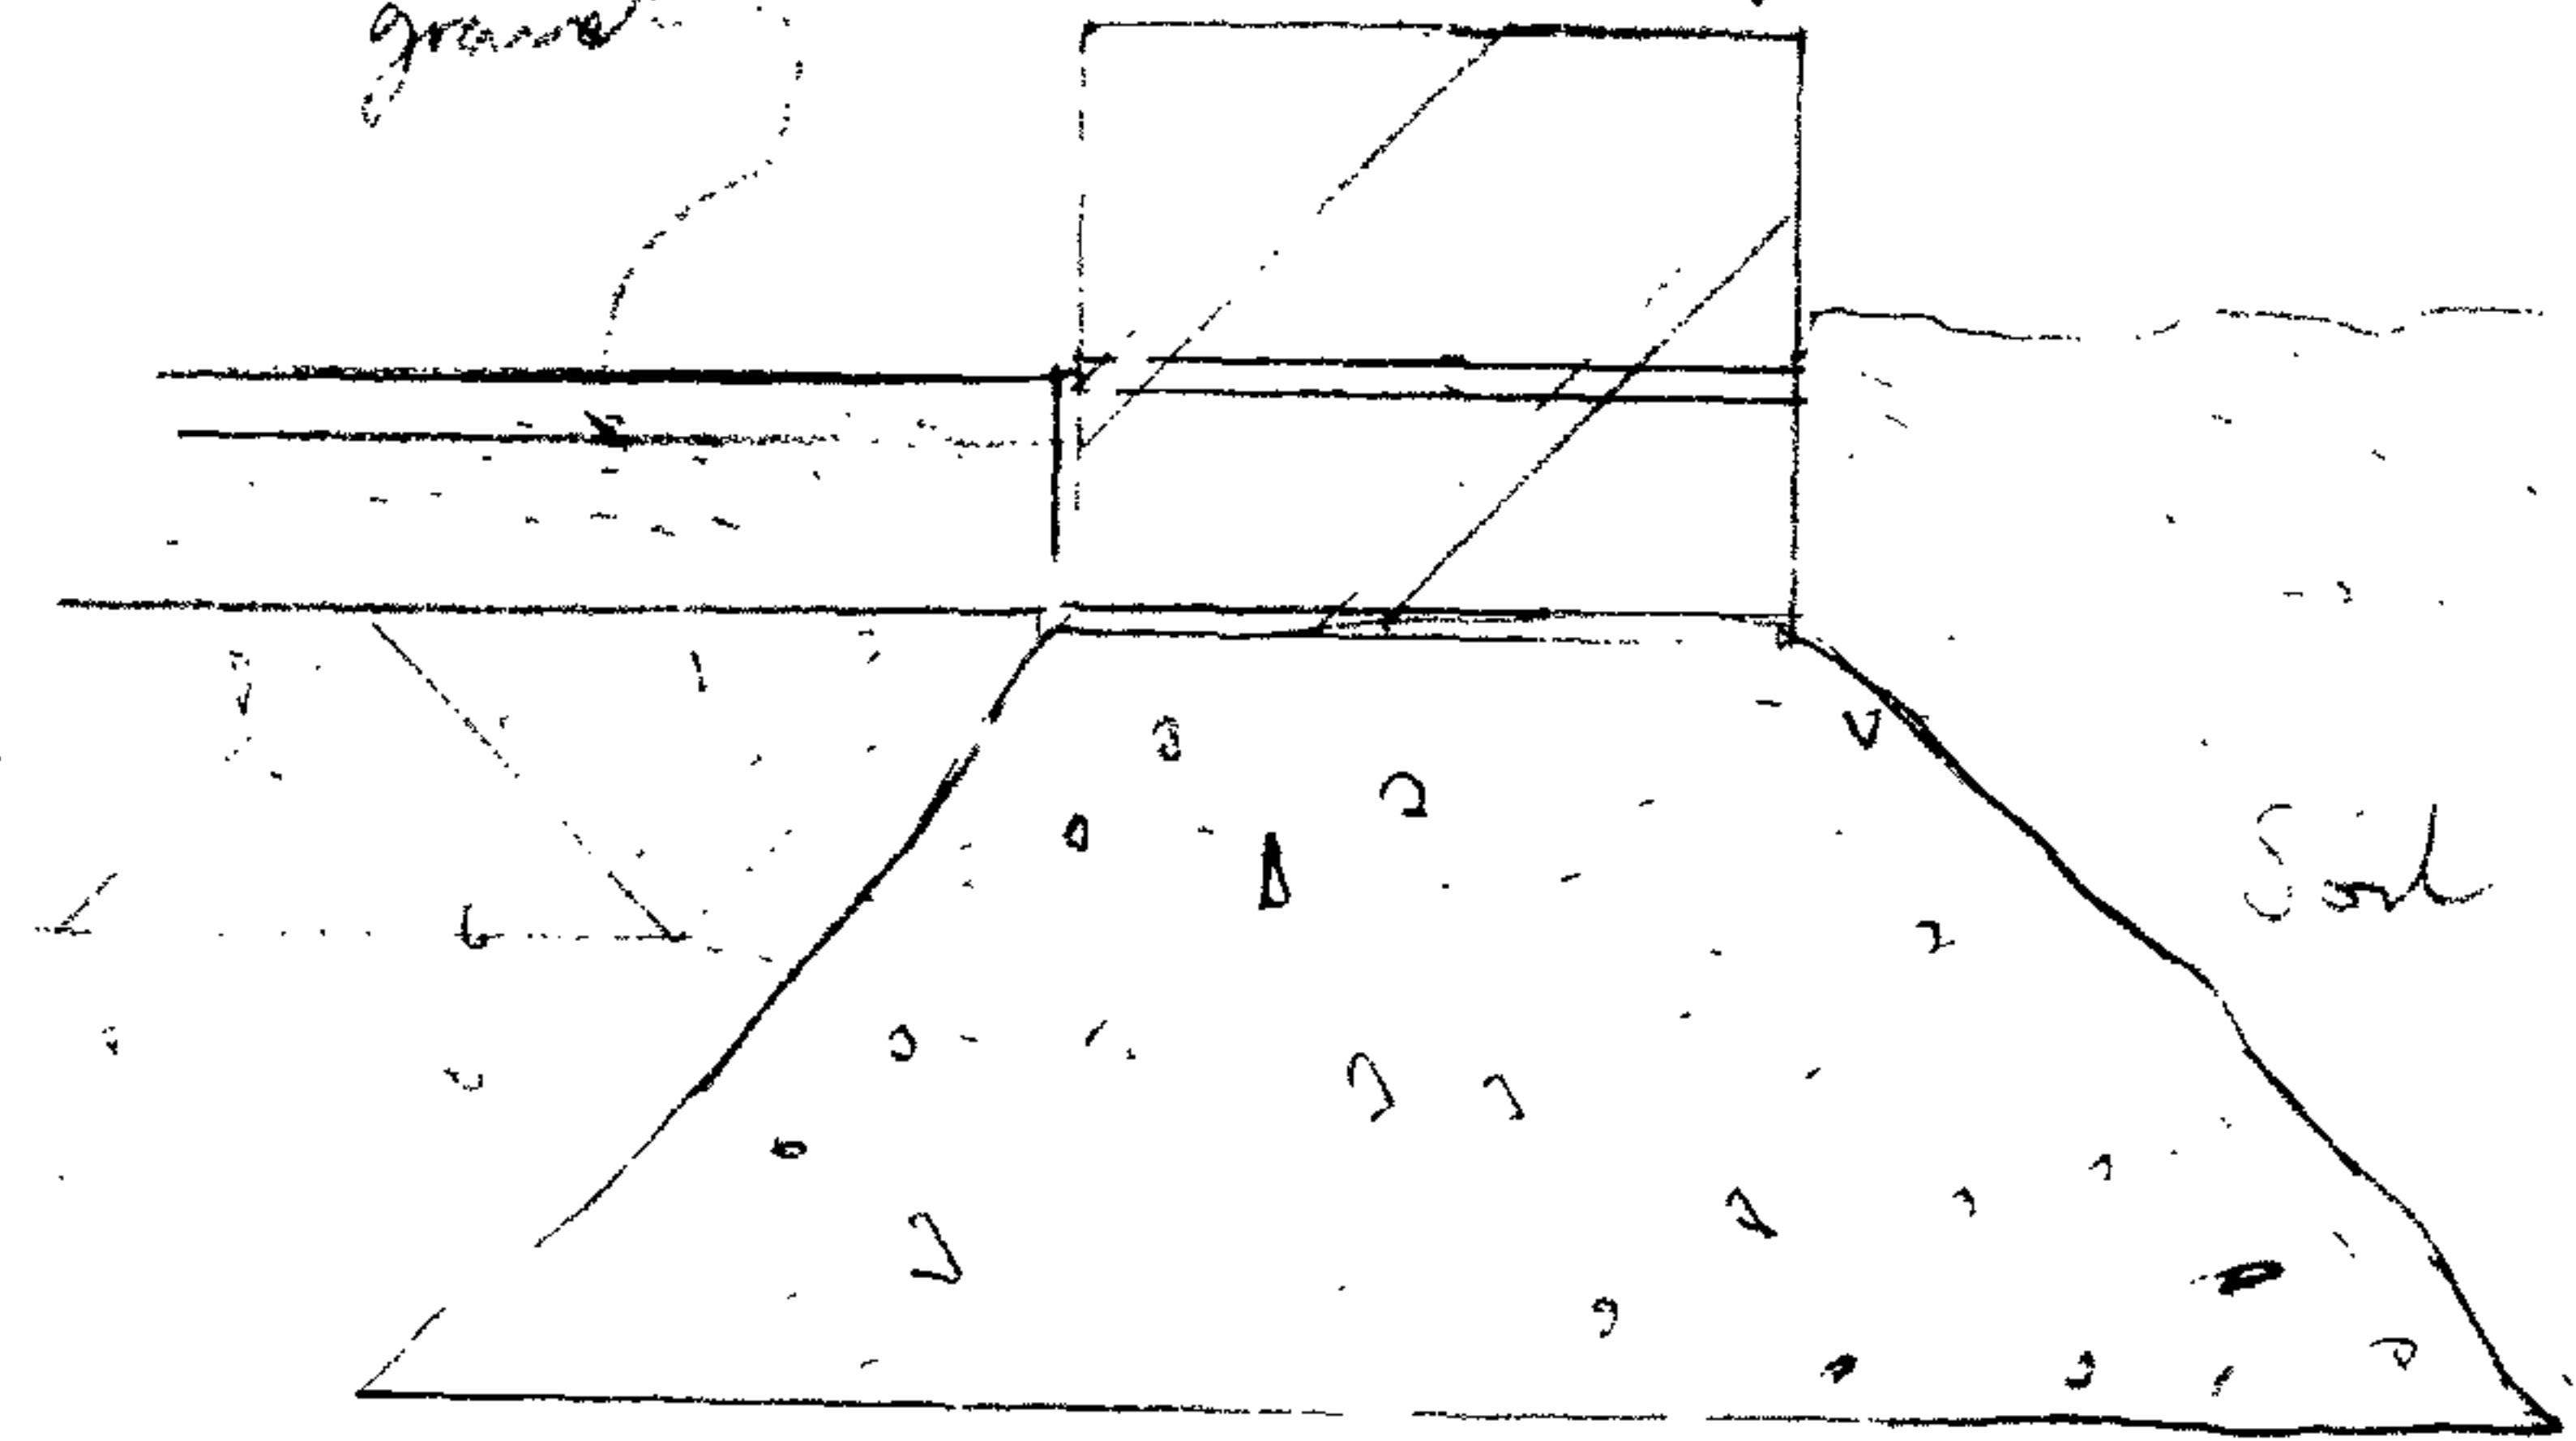

SECTION HH 1:5


Top of retaining
 wall

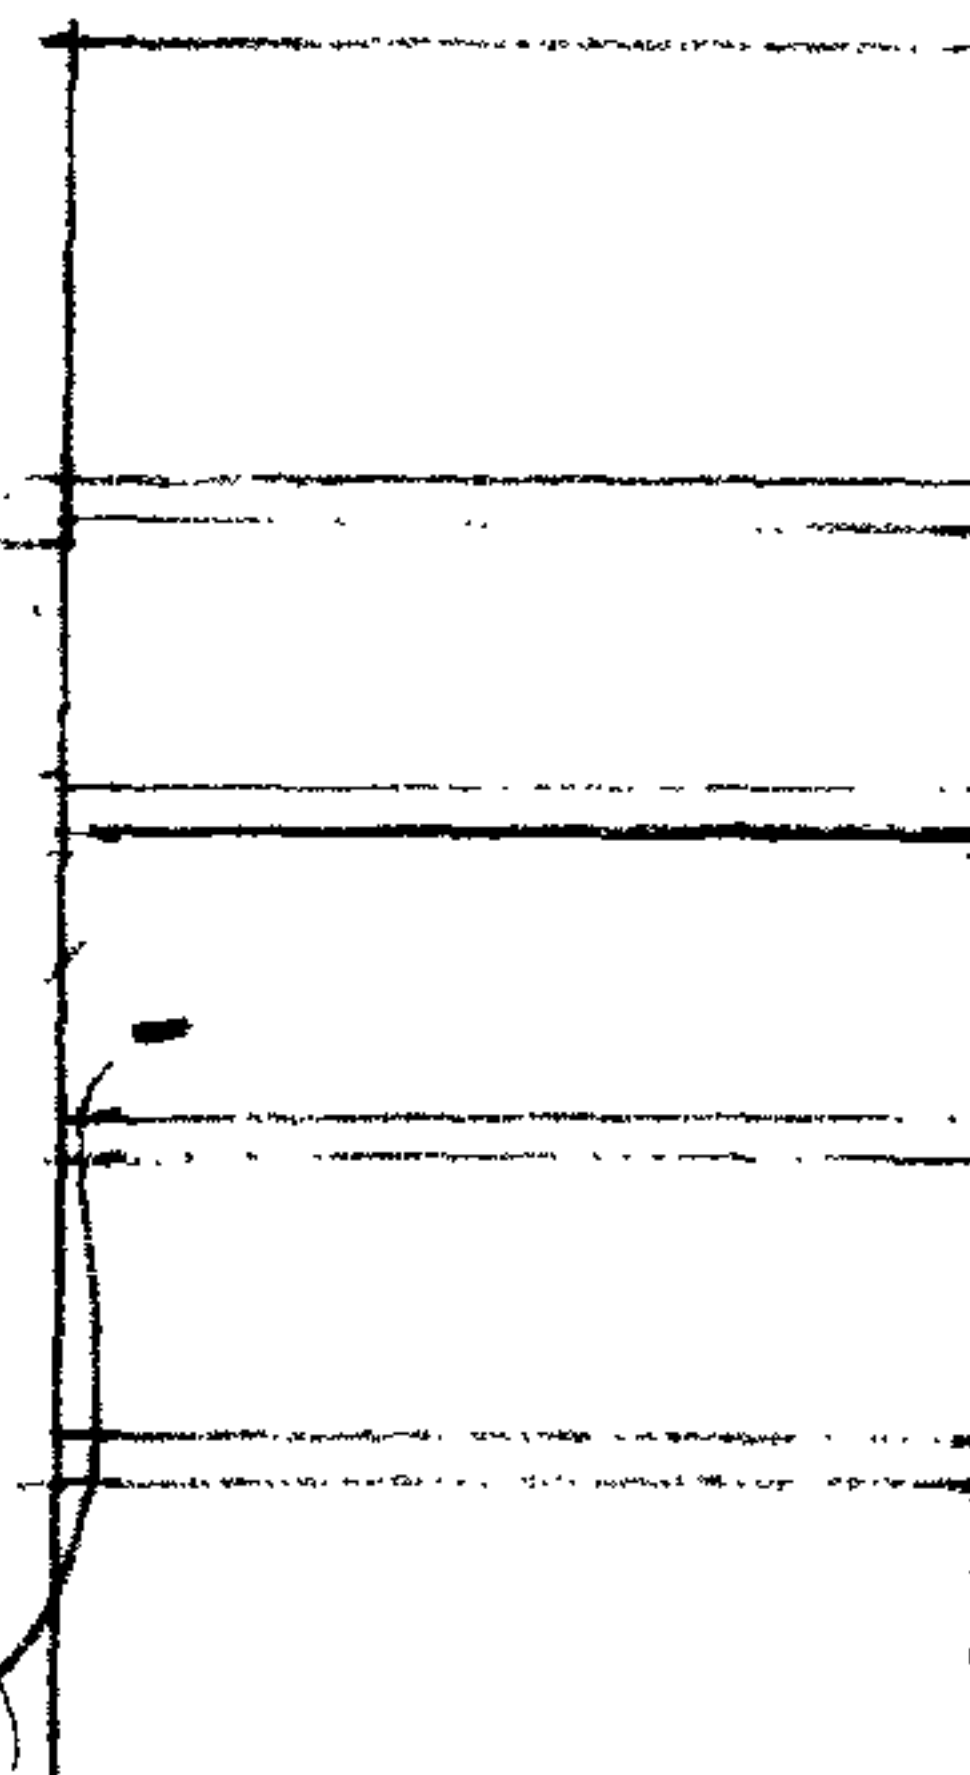


25 SEP 2005

SECTION II 1:5

RUSSELL TAYLOR ARCHITECTS
 85 BLACKFRIARS ROAD LONDON SE1 8HA
 TEL: 020 7261 1984 FAX: 020 7928 0610
 mail@rtarchitects.co.uk www.rtarchitects.co.uk

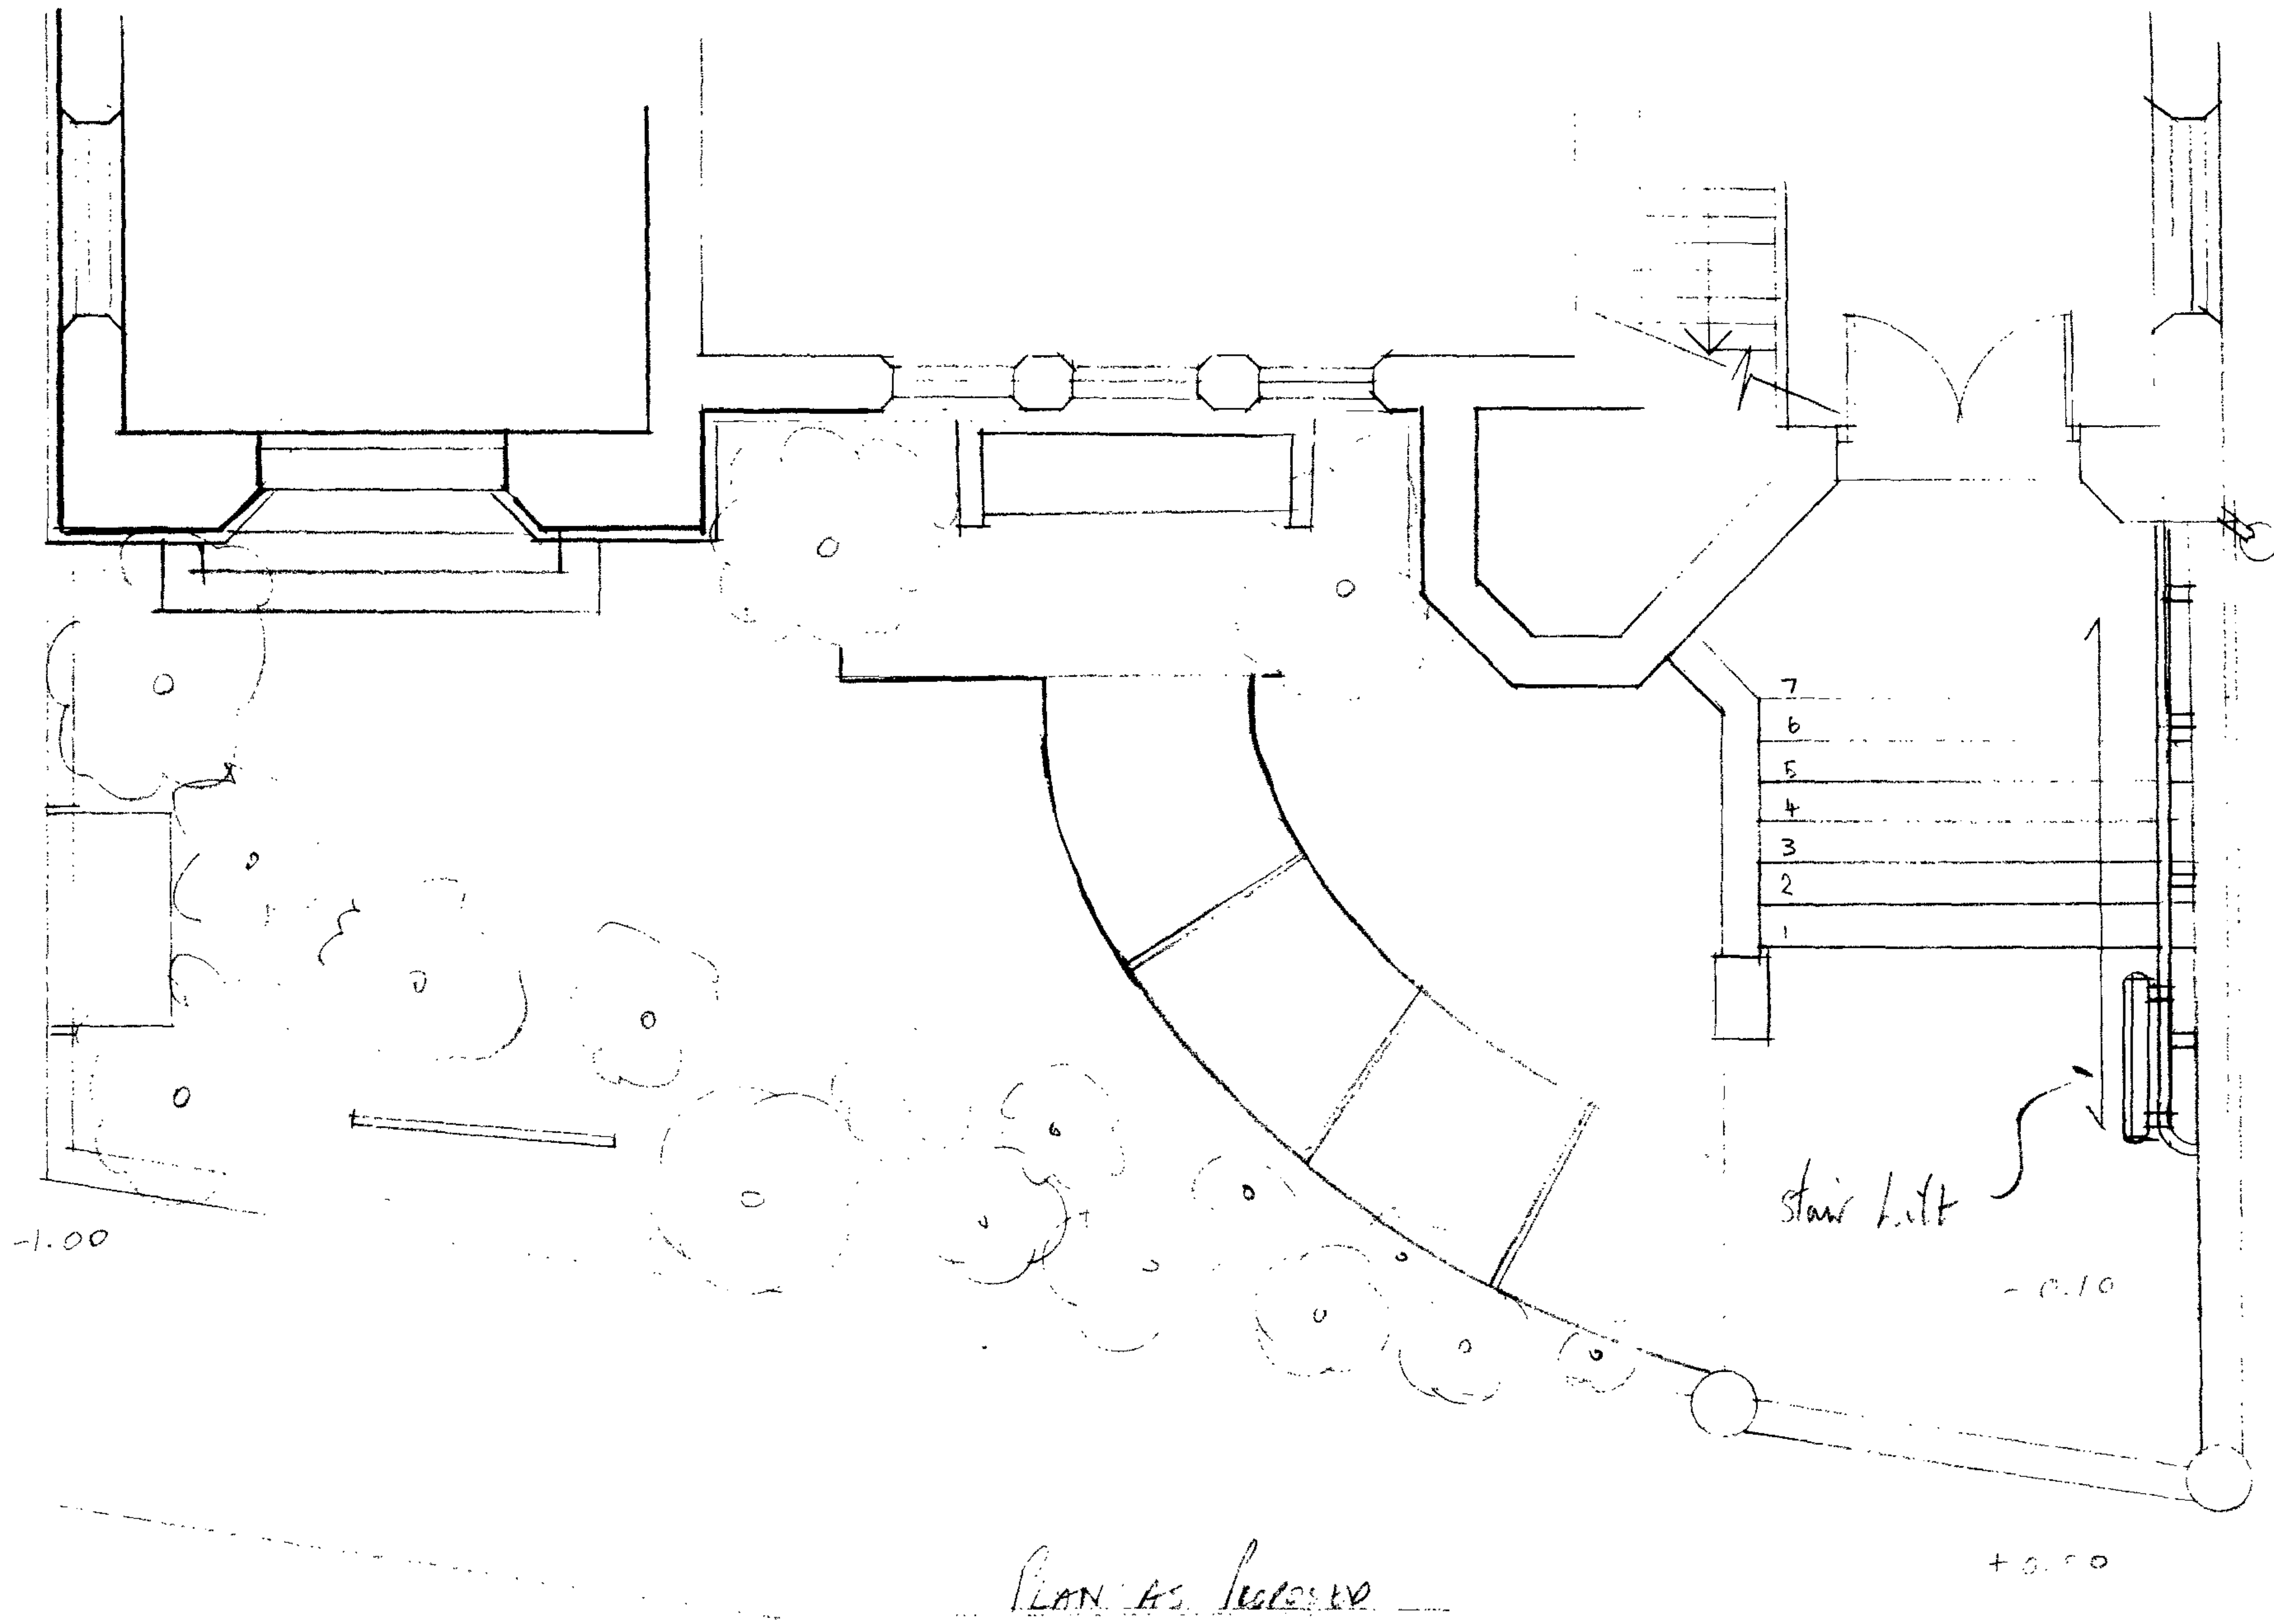

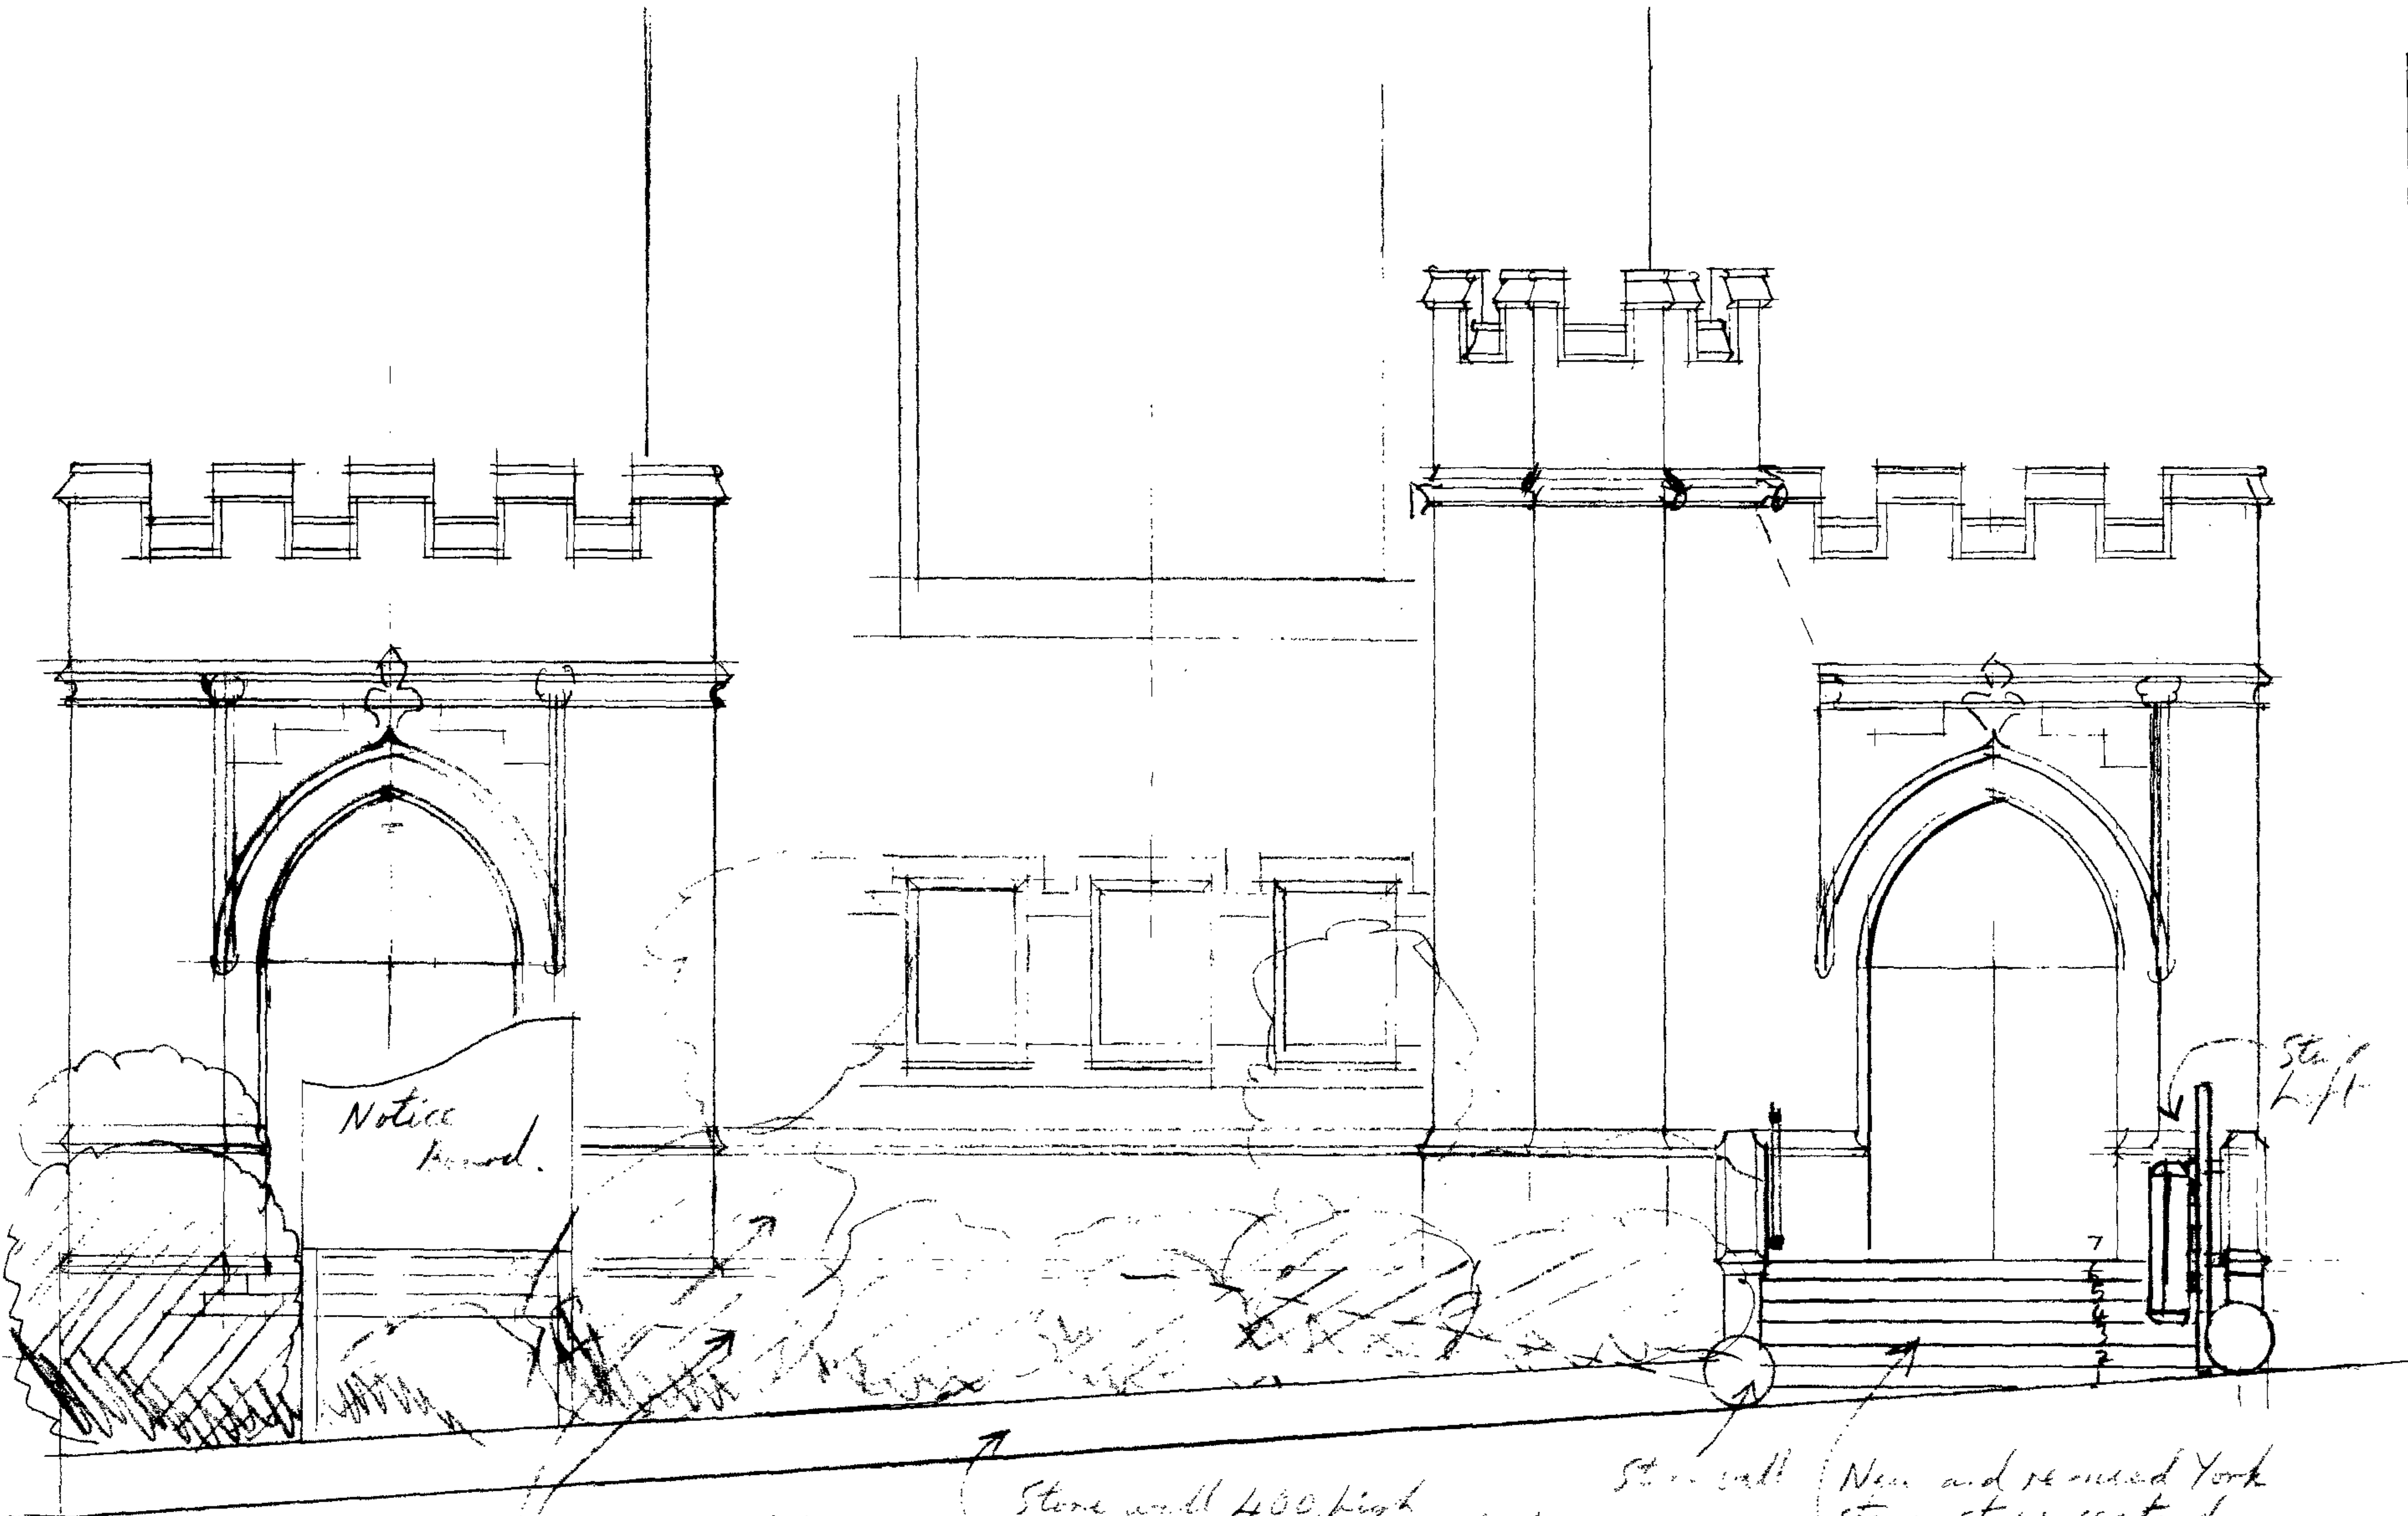


Stone wall 400 high
repaired and extended

Front Elevation as Proposed

New and repaired York
stone steps centred
on Portal.


Steps
Left

St Lukes - Harrogate 6/05/2/2004
1:50 RT 12/6/06

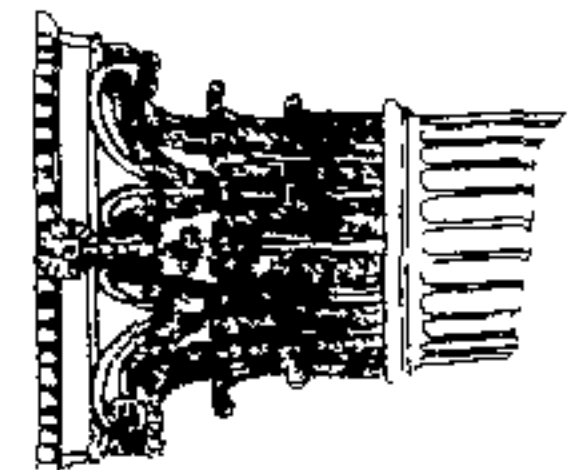


RUSSELL TAYLOR ARCHITECTS
85 BLACKFRIARS ROAD LONDON SE1 8HA
mail@rtarchitects.co.uk

TEL: 020 7261 1984 FAX: 020 7928 0610
www.rtarchitects.co.uk

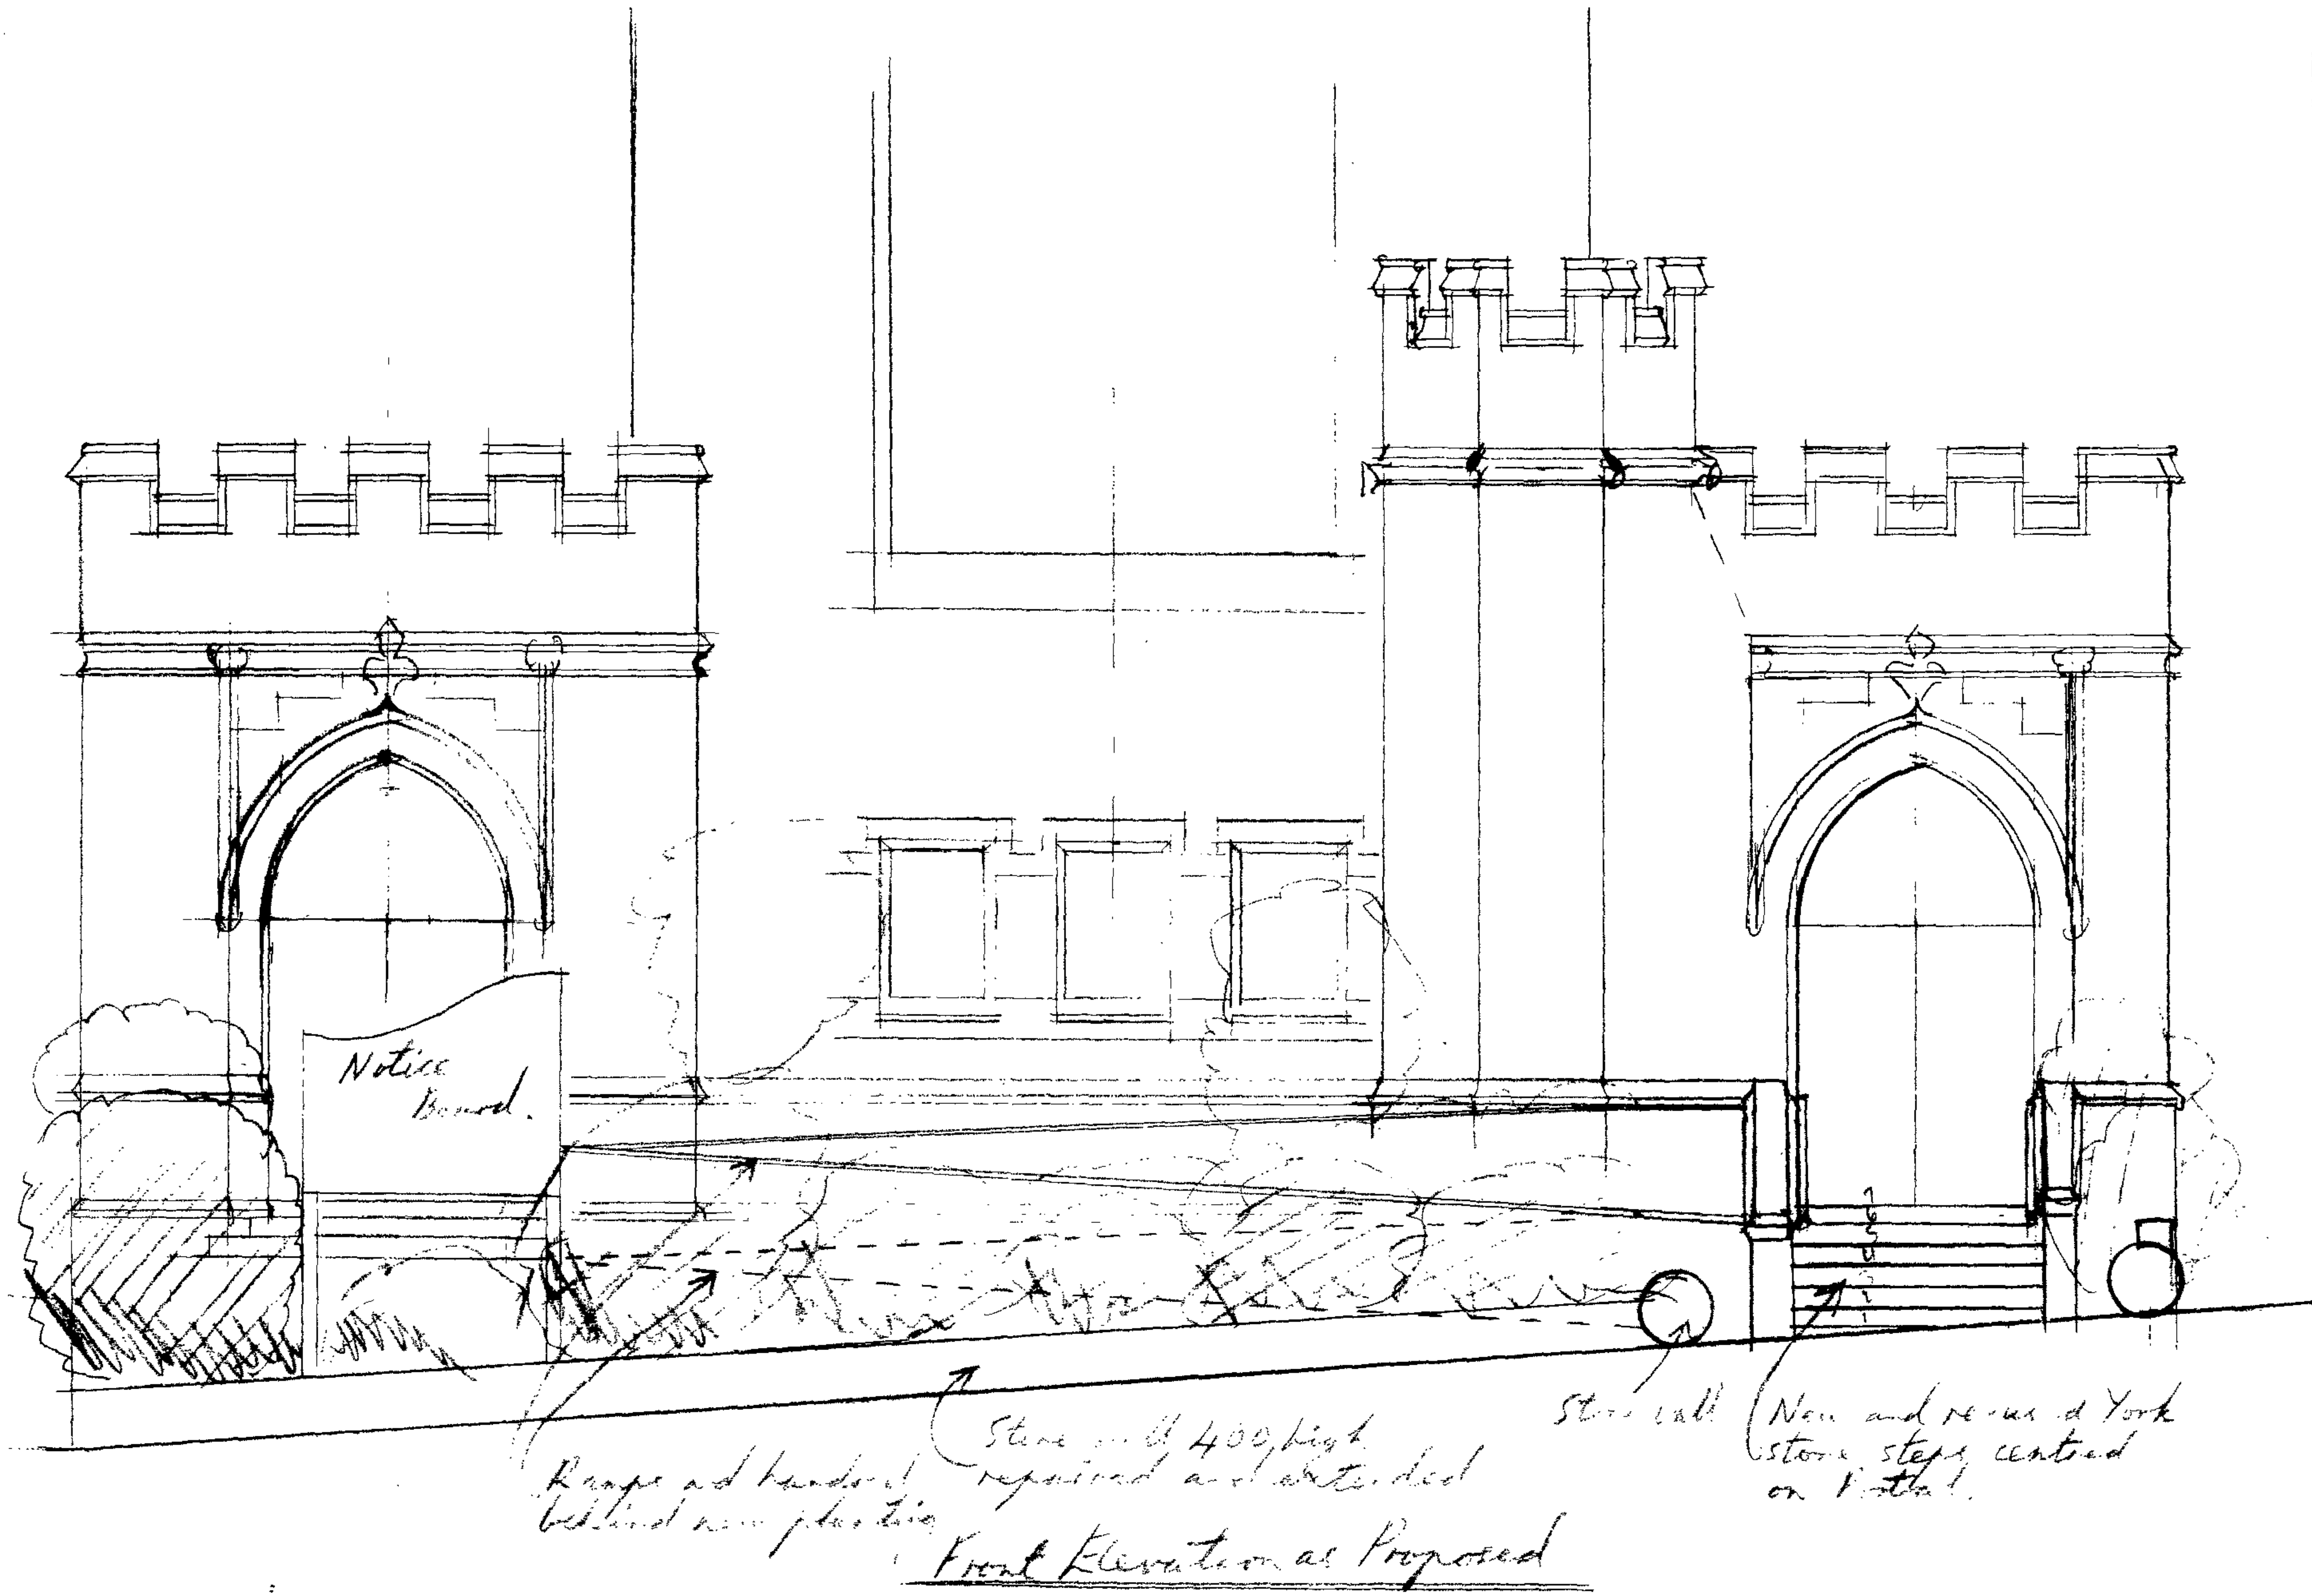

St Lukes - Hangerford 6/05/2/05
1:50 R7 12/6/06

RUSSELL TAYLOR ARCHITECTS
 85 BLACKFRIARS ROAD LONDON SE1 8JA
 TEL: 020 7261 1984 FAX: 020 7928 0610
 mail@rtarchitects.co.uk www.rtarchitects.co.uk

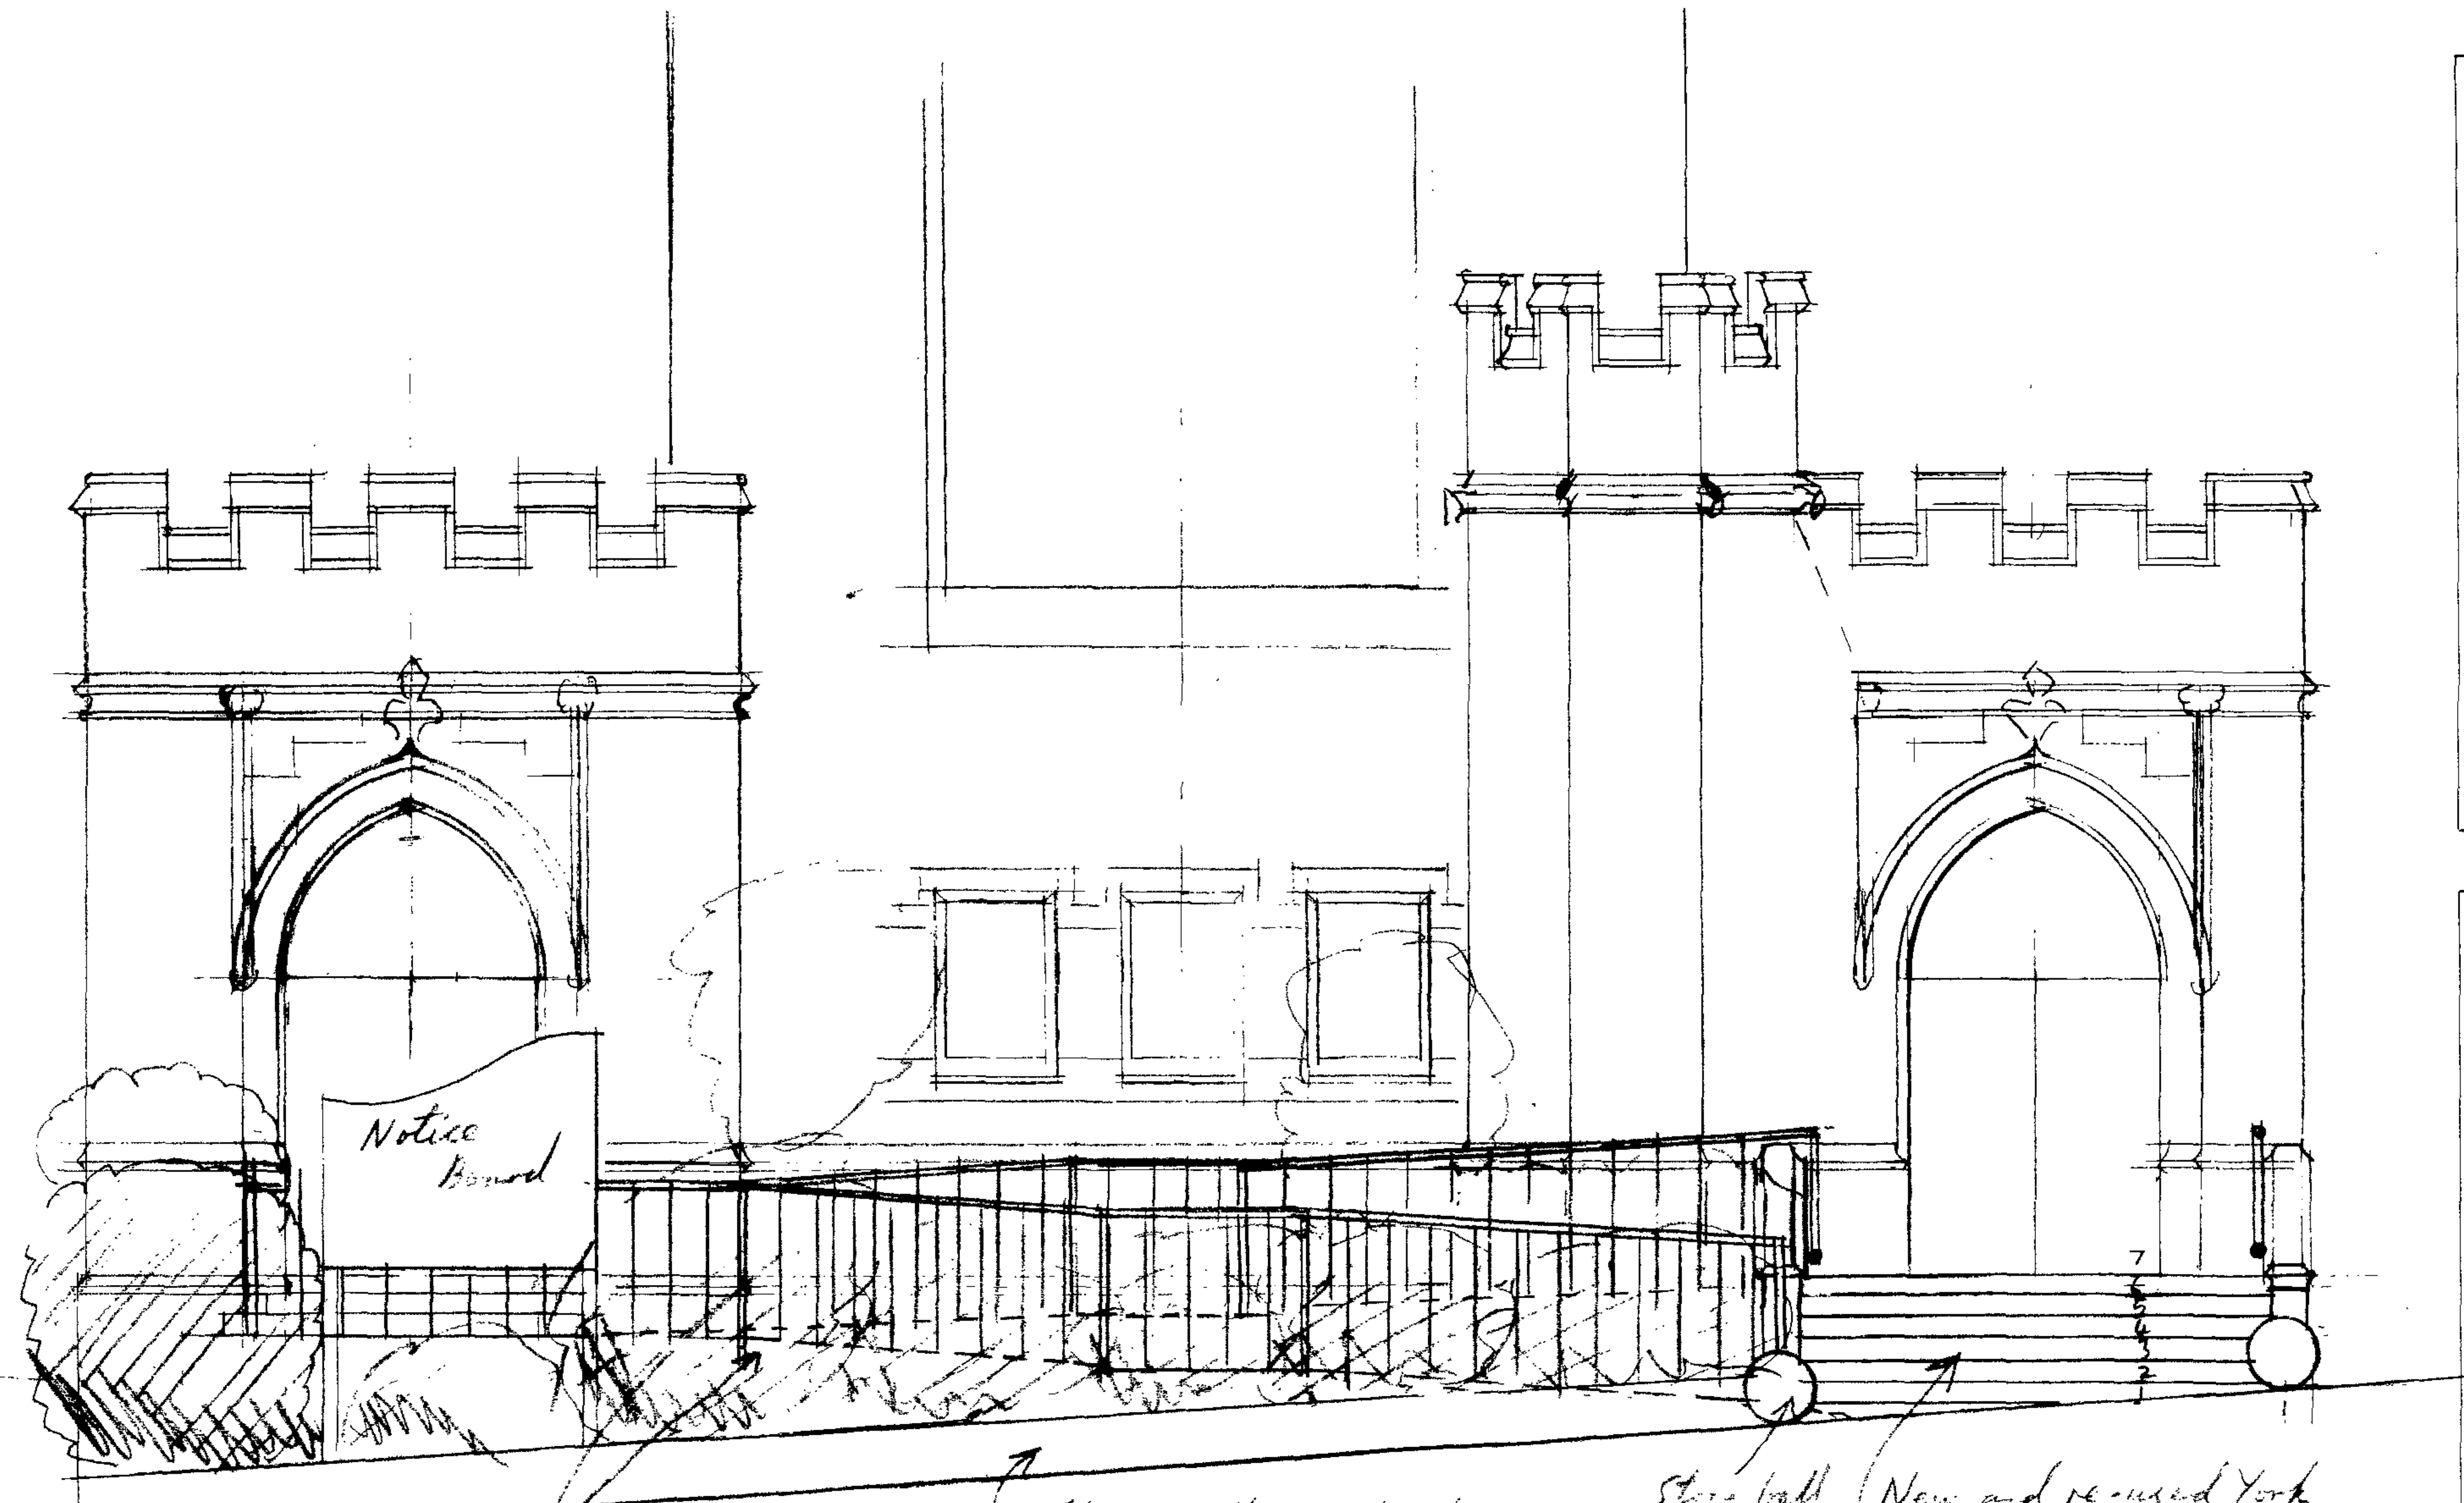


Ramps and handrail
behind new planting

Stone wall 400 high
required and extended

Front Elevation as Proposed

Stone ball

New and re-used York
stone steps centred
on Portal.

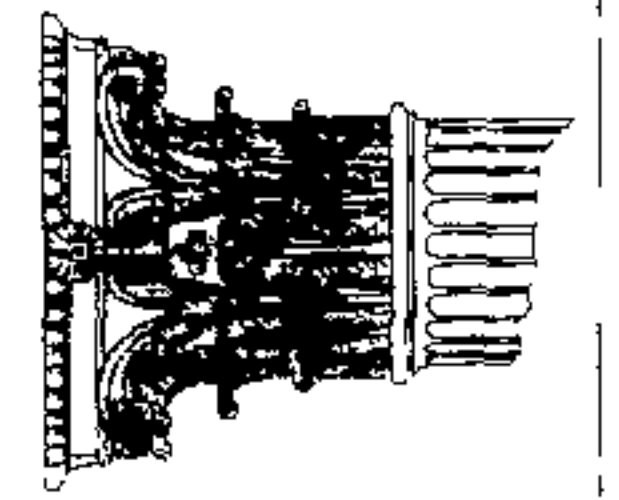

RUSSELL TAYLOR ARCHITECTS

85 BLACKFRIARS ROAD LONDON SE1 8HA
TEL: 020 7261 1984 FAX: 020 7928 0610
mail@rtarchitects.co.uk www.rtarchitects.co.uk

St Lukes - Haysland 6/05/2/046
1:50 RT 12/8/06