

- Notes
- 1

Guaged Brickwork over window head
- 2

Painted Hardwood box sash window
- 3

Painted concrete window cill
- 4




Outline of window frame behind brickwork
- 5

Brickwork dressed to front of existing masonry wall
- 6

Selected brickwork - Reclaimed dark london multi stock matching brick to front of 7 Warwick Court
- 7

Flat recessed lime mortar pointing
- 8

Mastic weather seal

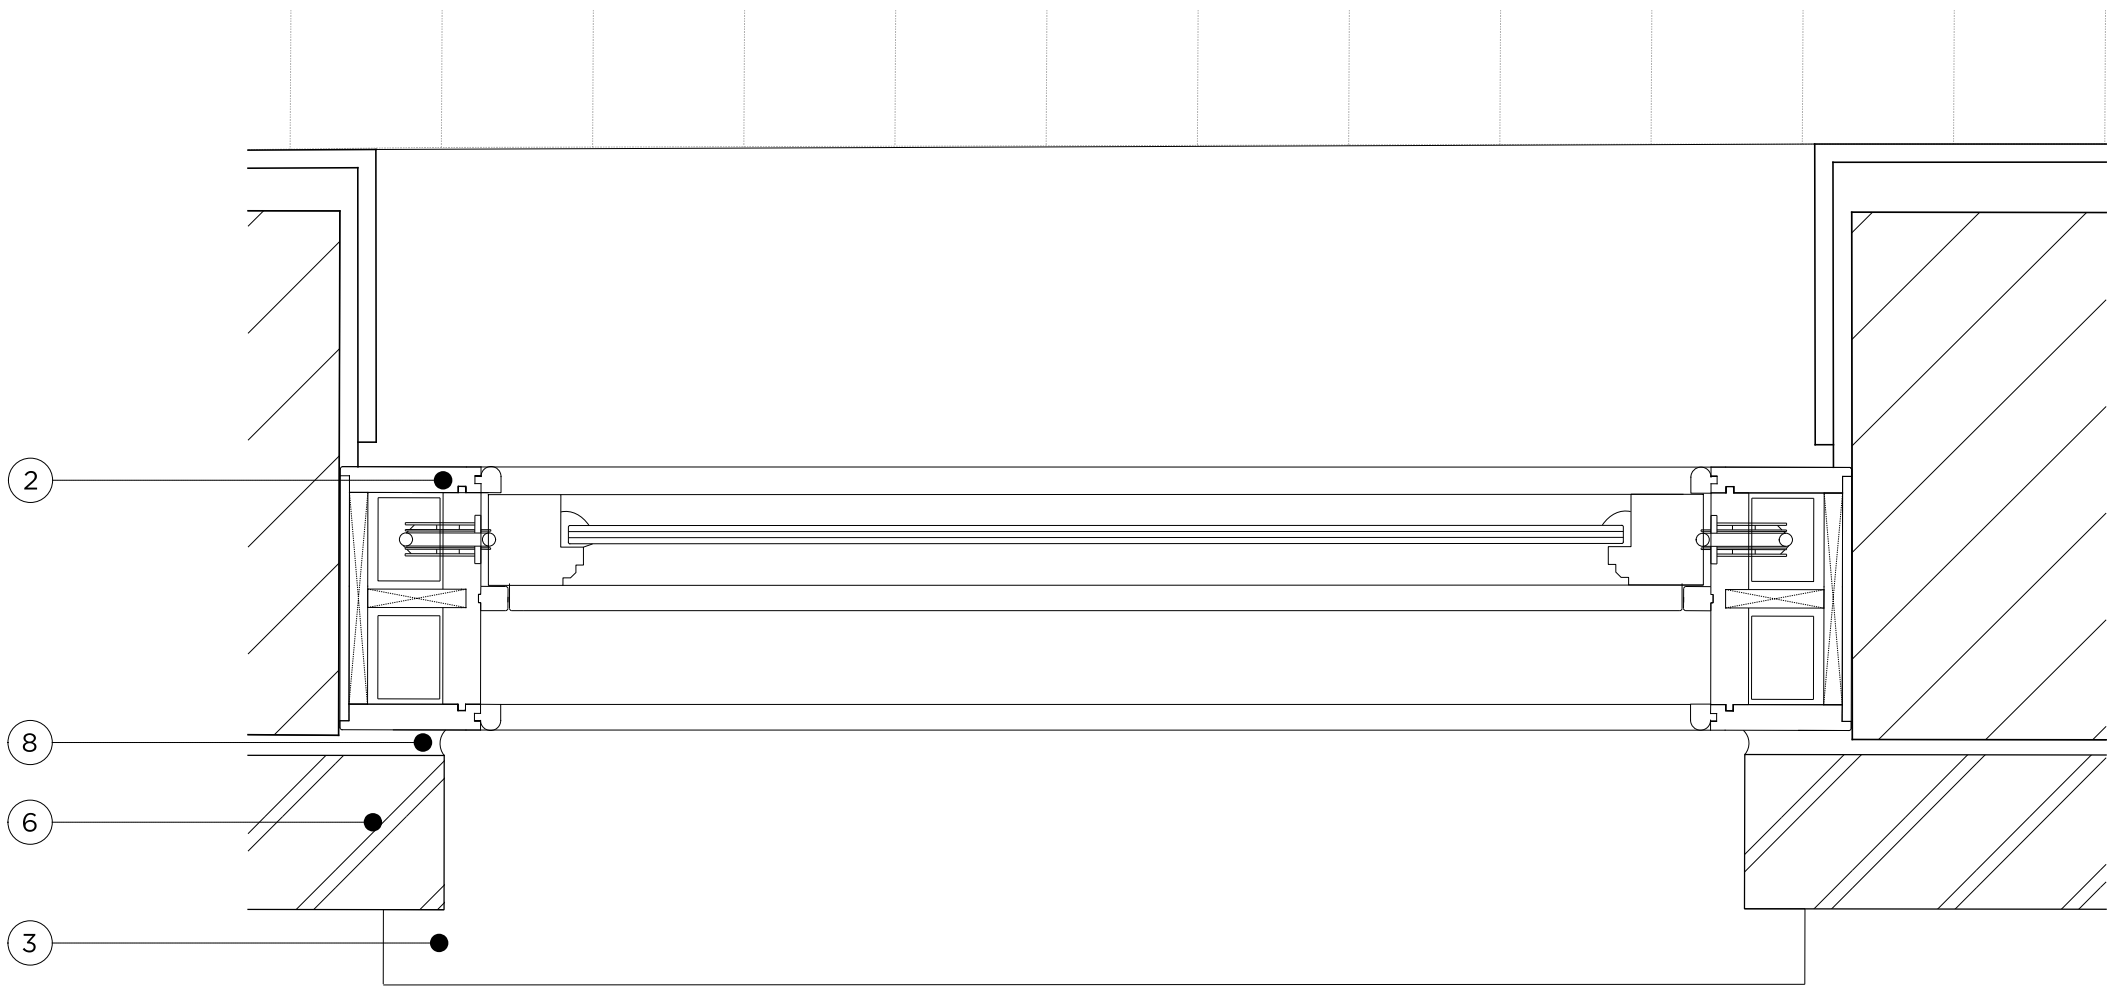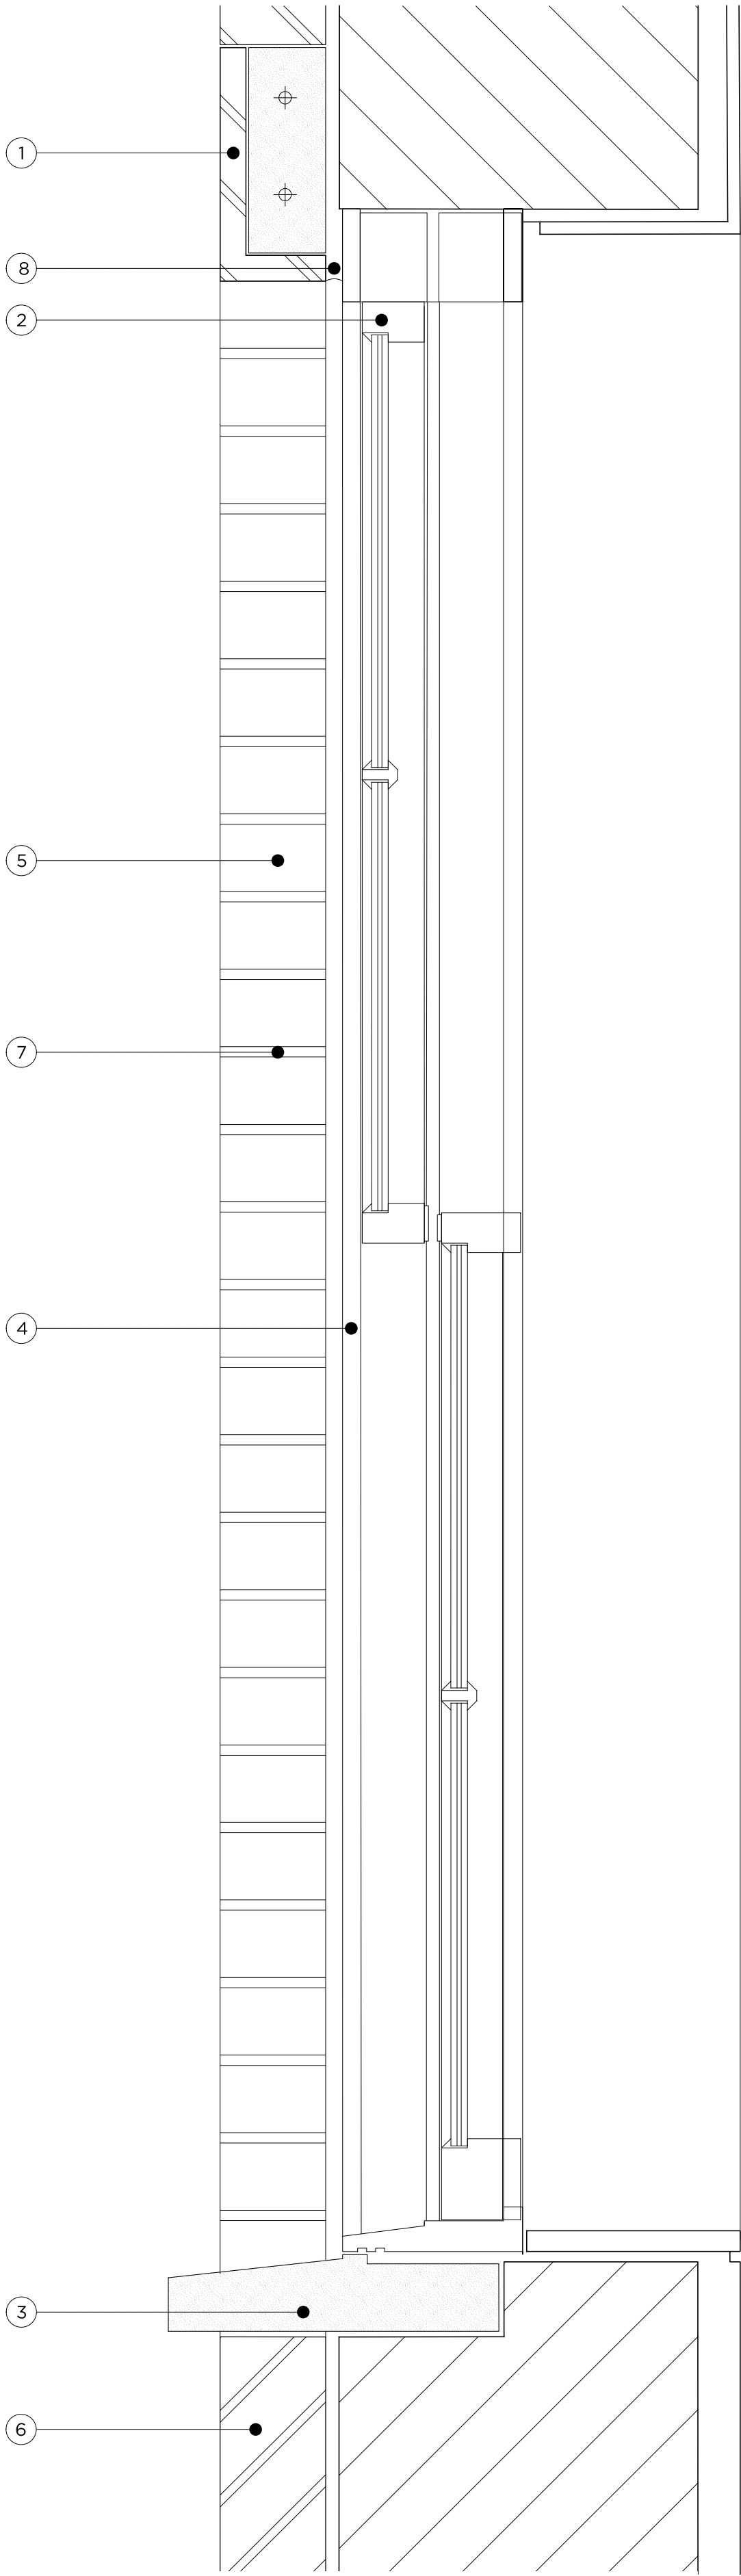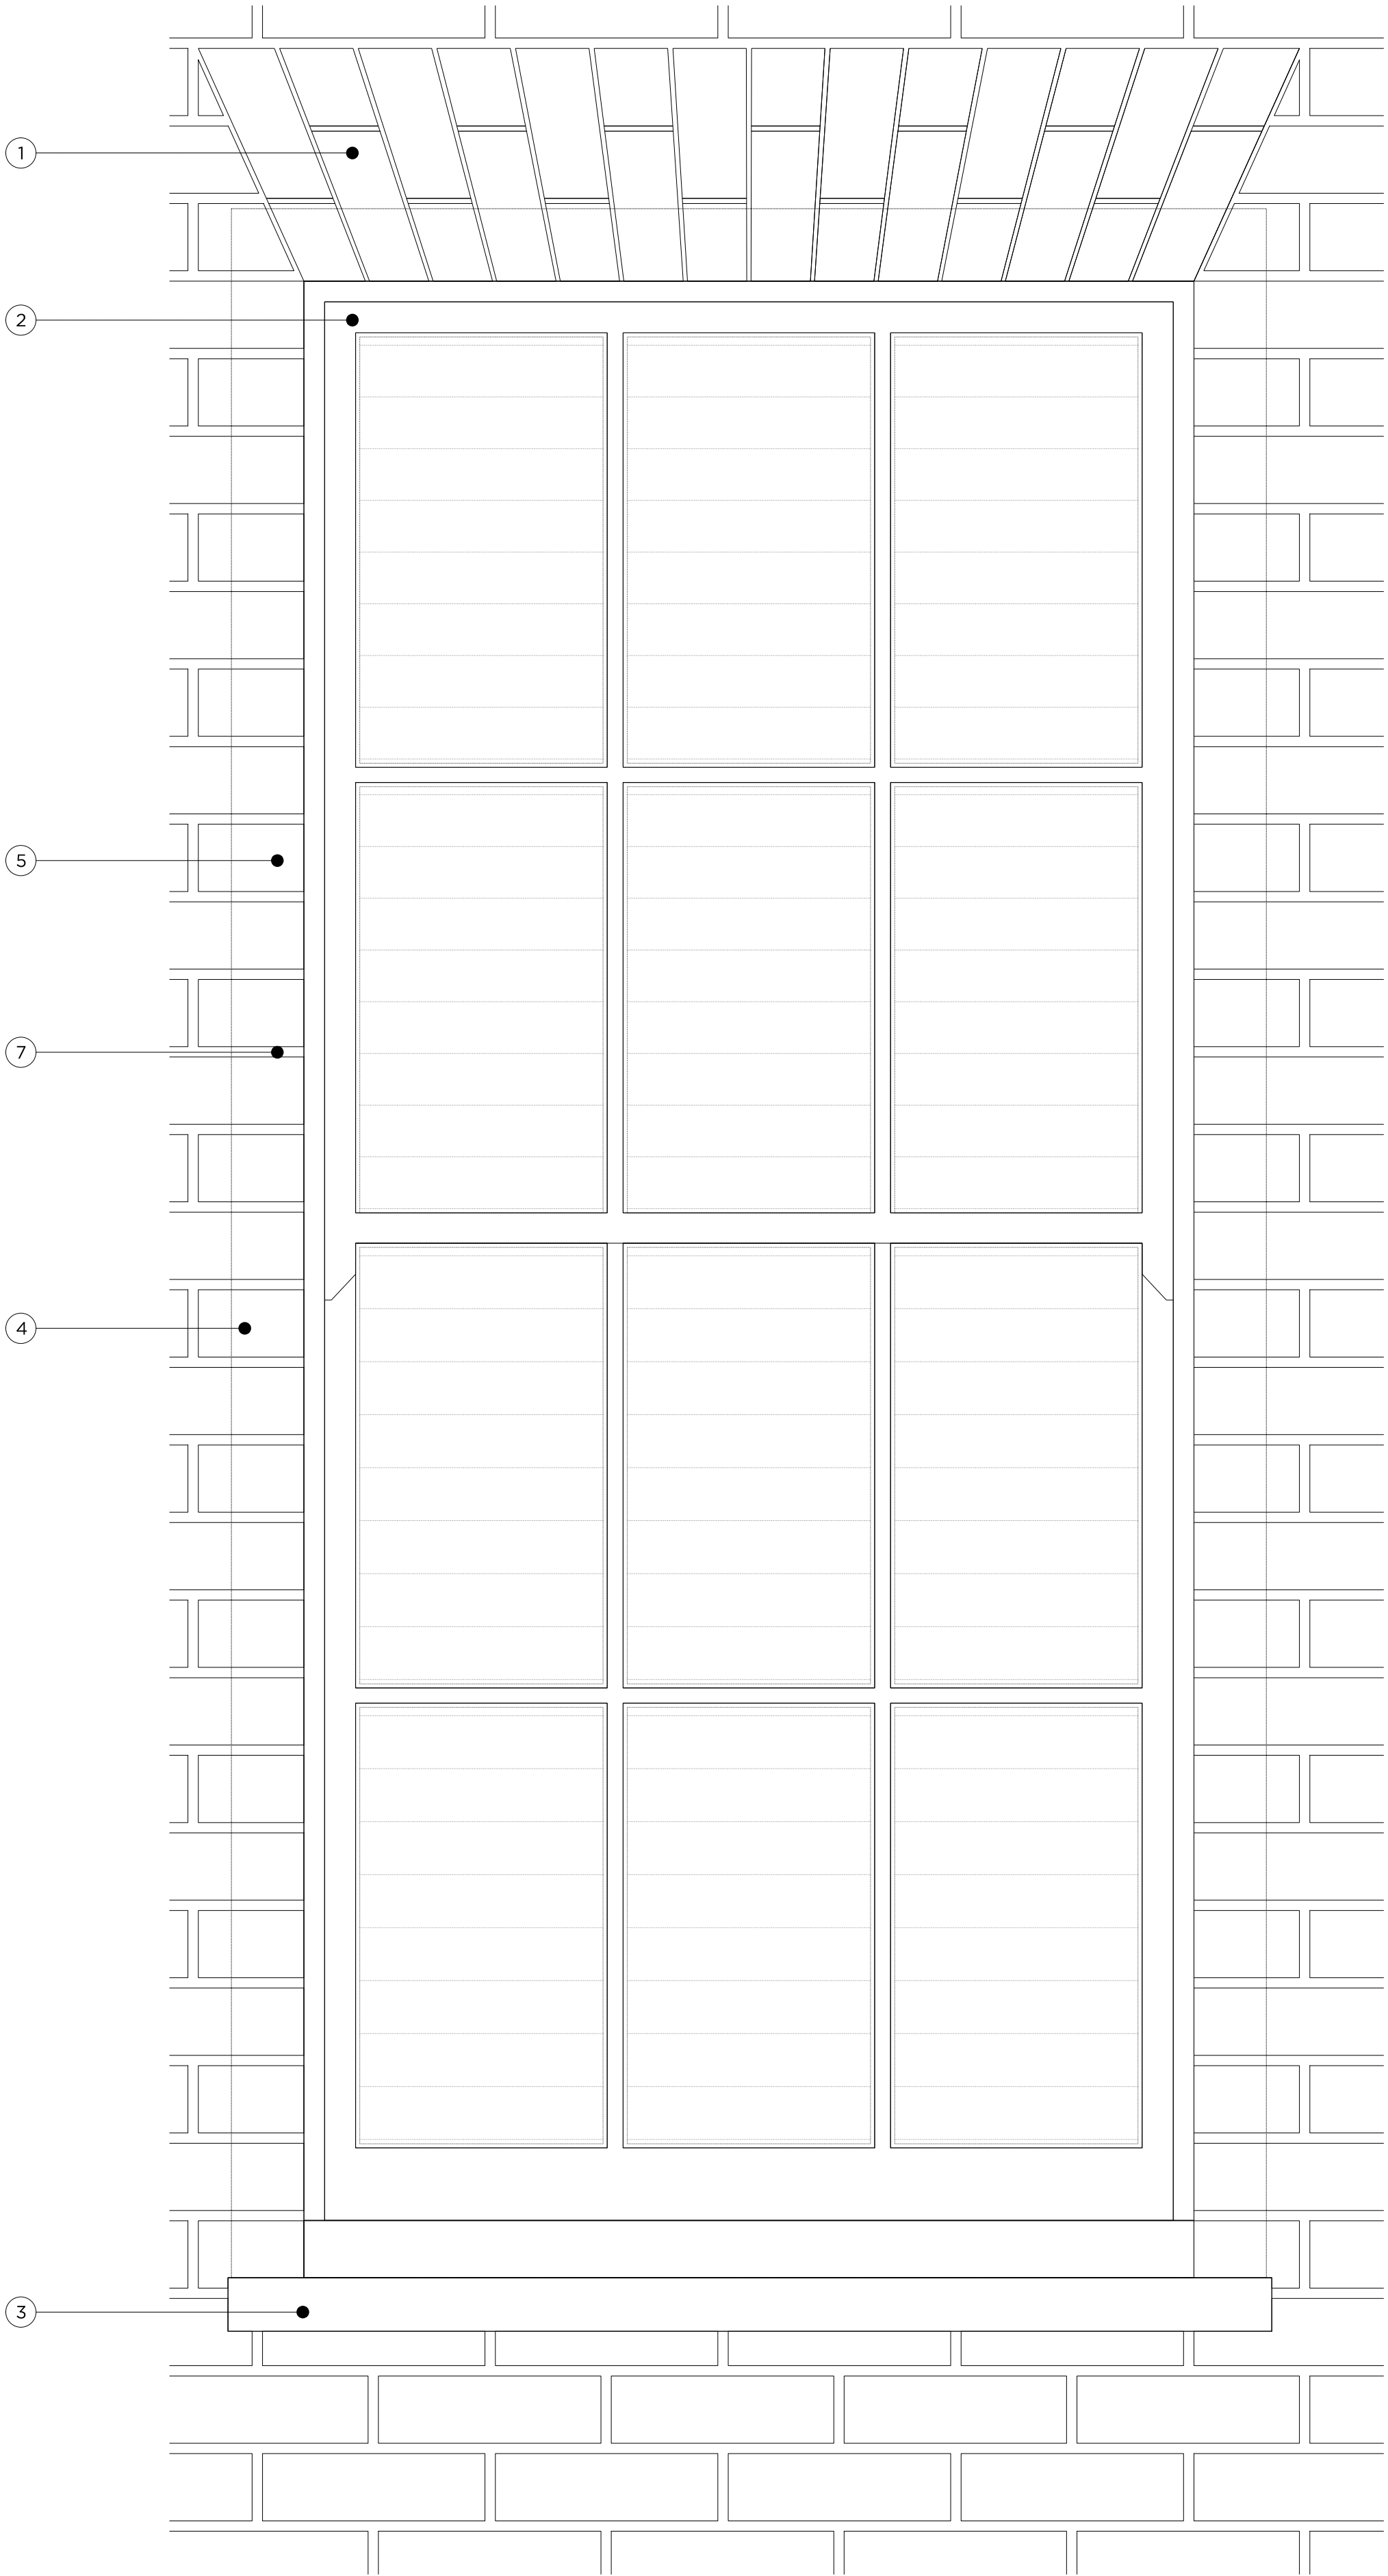

Key Plan, Scale 1:250

Demolition Key:

Existing structure / ground

Proposed removal of existing structure (in section)

Proposed removal of existing structure (in elevation)

Proposed removal of existing structure (in section)

Hatch denotes removal of existing concrete slab.

Hatch denotes proposed structure (in elevation)

Proposed finishes legend

Proposed straight-plank hardwood floor finish on specified floor build-up.

Proposed tiled floor finish on specified floor build-up.

Portland stone.

Timber decking.

Natural stone floor tiles.

Proposed slate roof finish on existing and new roof structure.

General Notes:

1. Refer to the Door and Window Schedules for a detailed summary of each door and window.

2. All existing floor finishes and existing ply to be carefully removed.

3. Existing floorboards to be carefully removed and reused where possible.

4. New drainage and concrete slab to be laid at basement level.

5. Existing slate roof finish to be carefully removed and stored, and new roof felt installed using slate to be reused. New slates to match existing to replace any damaged slates. Existing roof structure to be retained and repaired where required. Existing roof structure to be removed and replaced on a like-for-like basis.

6. Joints are to be doubled up and strengthened where required to support increased loads, to Structural Engineer's details.

7. Existing internal walls are to be skimmed and prepared to take new wall finishes as required. All defective existing plaster to be removed and replaced.

8. All existing panning, mouldings and cornices to have existing paint finish removed for new paint decoration.

9. Existing structural timber beams to be exposed and treated with wood preservative. Ends to be wrapped in DPC and rotten timber to be replaced.

Proposed legend notes

01 Existing panelling to be refurbished and redecorated.

02 Existing window replaced with double-glazed, timber framed sash window.

03 Non-original fireplace to be removed and replaced with traditionally-detailed fireplace.

04 Non-original skirting/trunking to be removed.

05 Traditionally detailed, compliant, timber balustrade to replace existing.

06 Existing sash windows refurbished and fitted with secondary glazing internally.

07 Zinc, brompton bicycles & £250 bicycle anchor to be supplied to each flat.

08 New, double-glazed, timber framed sash windows. Refer to design & Access Statement.

09 New lift.

10 Damaged window sills replaced on a like-for-like basis.

11 Lightwell to be lowered by 1100mm. New, painted metal stairs to accommodate level change.

12 Existing rear envelope retained. New, contemporary brick-clad rear extension to replace existing.

13 Proposed bin store.

14 New, double-glazed, anodised aluminium, recessed lift. Framed windows, with etched glass louvers fitted externally.

15 New, fixed, double-glazed, anodised aluminium framed glazing panels.

16 New, double-glazed, walk-on rooftop.

17 New, double-glazed, conservation rooftop.

18 Partial demolition of existing roof, new ridge proposed, matching height and width of existing.

19 New, automatic-covering vent to communal stair.

20 Terrace to the east of proposed rear extension, with timber decking new planting and wind-around glass balustrade.

21 No, proposed condenser in attenuated enclosure.

22 Proposed condensers in attenuated enclosure, refer to M&E design.

23 Reconfigured stair to basement level, with compliant, traditionally-detailed, timber balustrade.

24 New, single-glazed, timber framed window to match existing, fitted with secondary glazing internally.

25 Existing fireplace to be protected and covered.

26 Reconfiguration of existing stair.

27 New dummy window.

28 New double-glazed, traditionally detailed French door.

29 Linking to early wall.

30 Proposed lead dormer arrangement to line through with existing windows. Replacement of existing non-original dormer windows.

31 Terrace to flat 01, with new planting and Yorkstone paving.

32 Existing joists to be trimmed out.

33 Single, surviving cast-iron spandrel to ground floor stair to be preserved and maintained.

34 Existing structural timber beams to be exposed and treated with wood preservative. Ends to be wrapped in DPC and rotten timber to be replaced.

35 Slate to be removed, retained and new membrane installed. Existing slates to be reused and any new slates to match existing.

36 Facade Refurbishment.

37 Existing facade to be re-rendered and redecorated.

38 Etched glass partition.

39 New Railings.

40 Fixed & obscure proposed windows.

41 Proposed roof.

42 Paint to be removed from Brickwork and redecorated as required.

Brickwork/window detail precedent  
Project: John Street Architect: MWA

Brickwork/window detail precedent  
Project: John Street Architect: MWA

Brickwork/window detail precedent  
Project: John Street Architect: MWA

Rev A	26.09.2016	Issued for Planning
Rev -	16.09.2016	Issued for Planning

PLANNING

Project No.

14029

Client

GFZ Developments

Date

September 2016

Scale

1:100 @ A3 / 1:50 @ A1

Project

7 Warwick Court

Drawing Title:

Brickwork/Window Detail

Drawing No.

300\_106

Rev.

A

Drawn

DG

Approved

TB

Signed

AB

Marek Wojciechowski Architects Ltd.

66-68 Margaret Street W1W 8SR

T. 020 7580 9336

www.mw-a.co.uk

Copyright Marek Wojciechowski Architects Limited.

No implied license exists. This drawing should not be used to calculate areas for the purposes of valuation. All dimensions to be checked on site by the contractor and such dimensions to be their responsibility. Do not scale drawings. All work must comply with relevant British Standards and Building Regulations requirements. Drawing errors and omissions to be reported to the architect.