
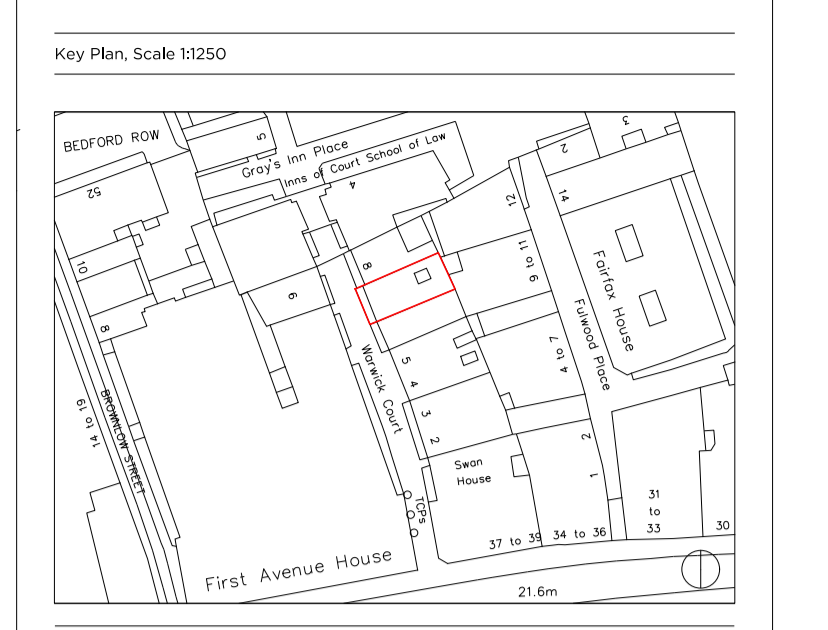
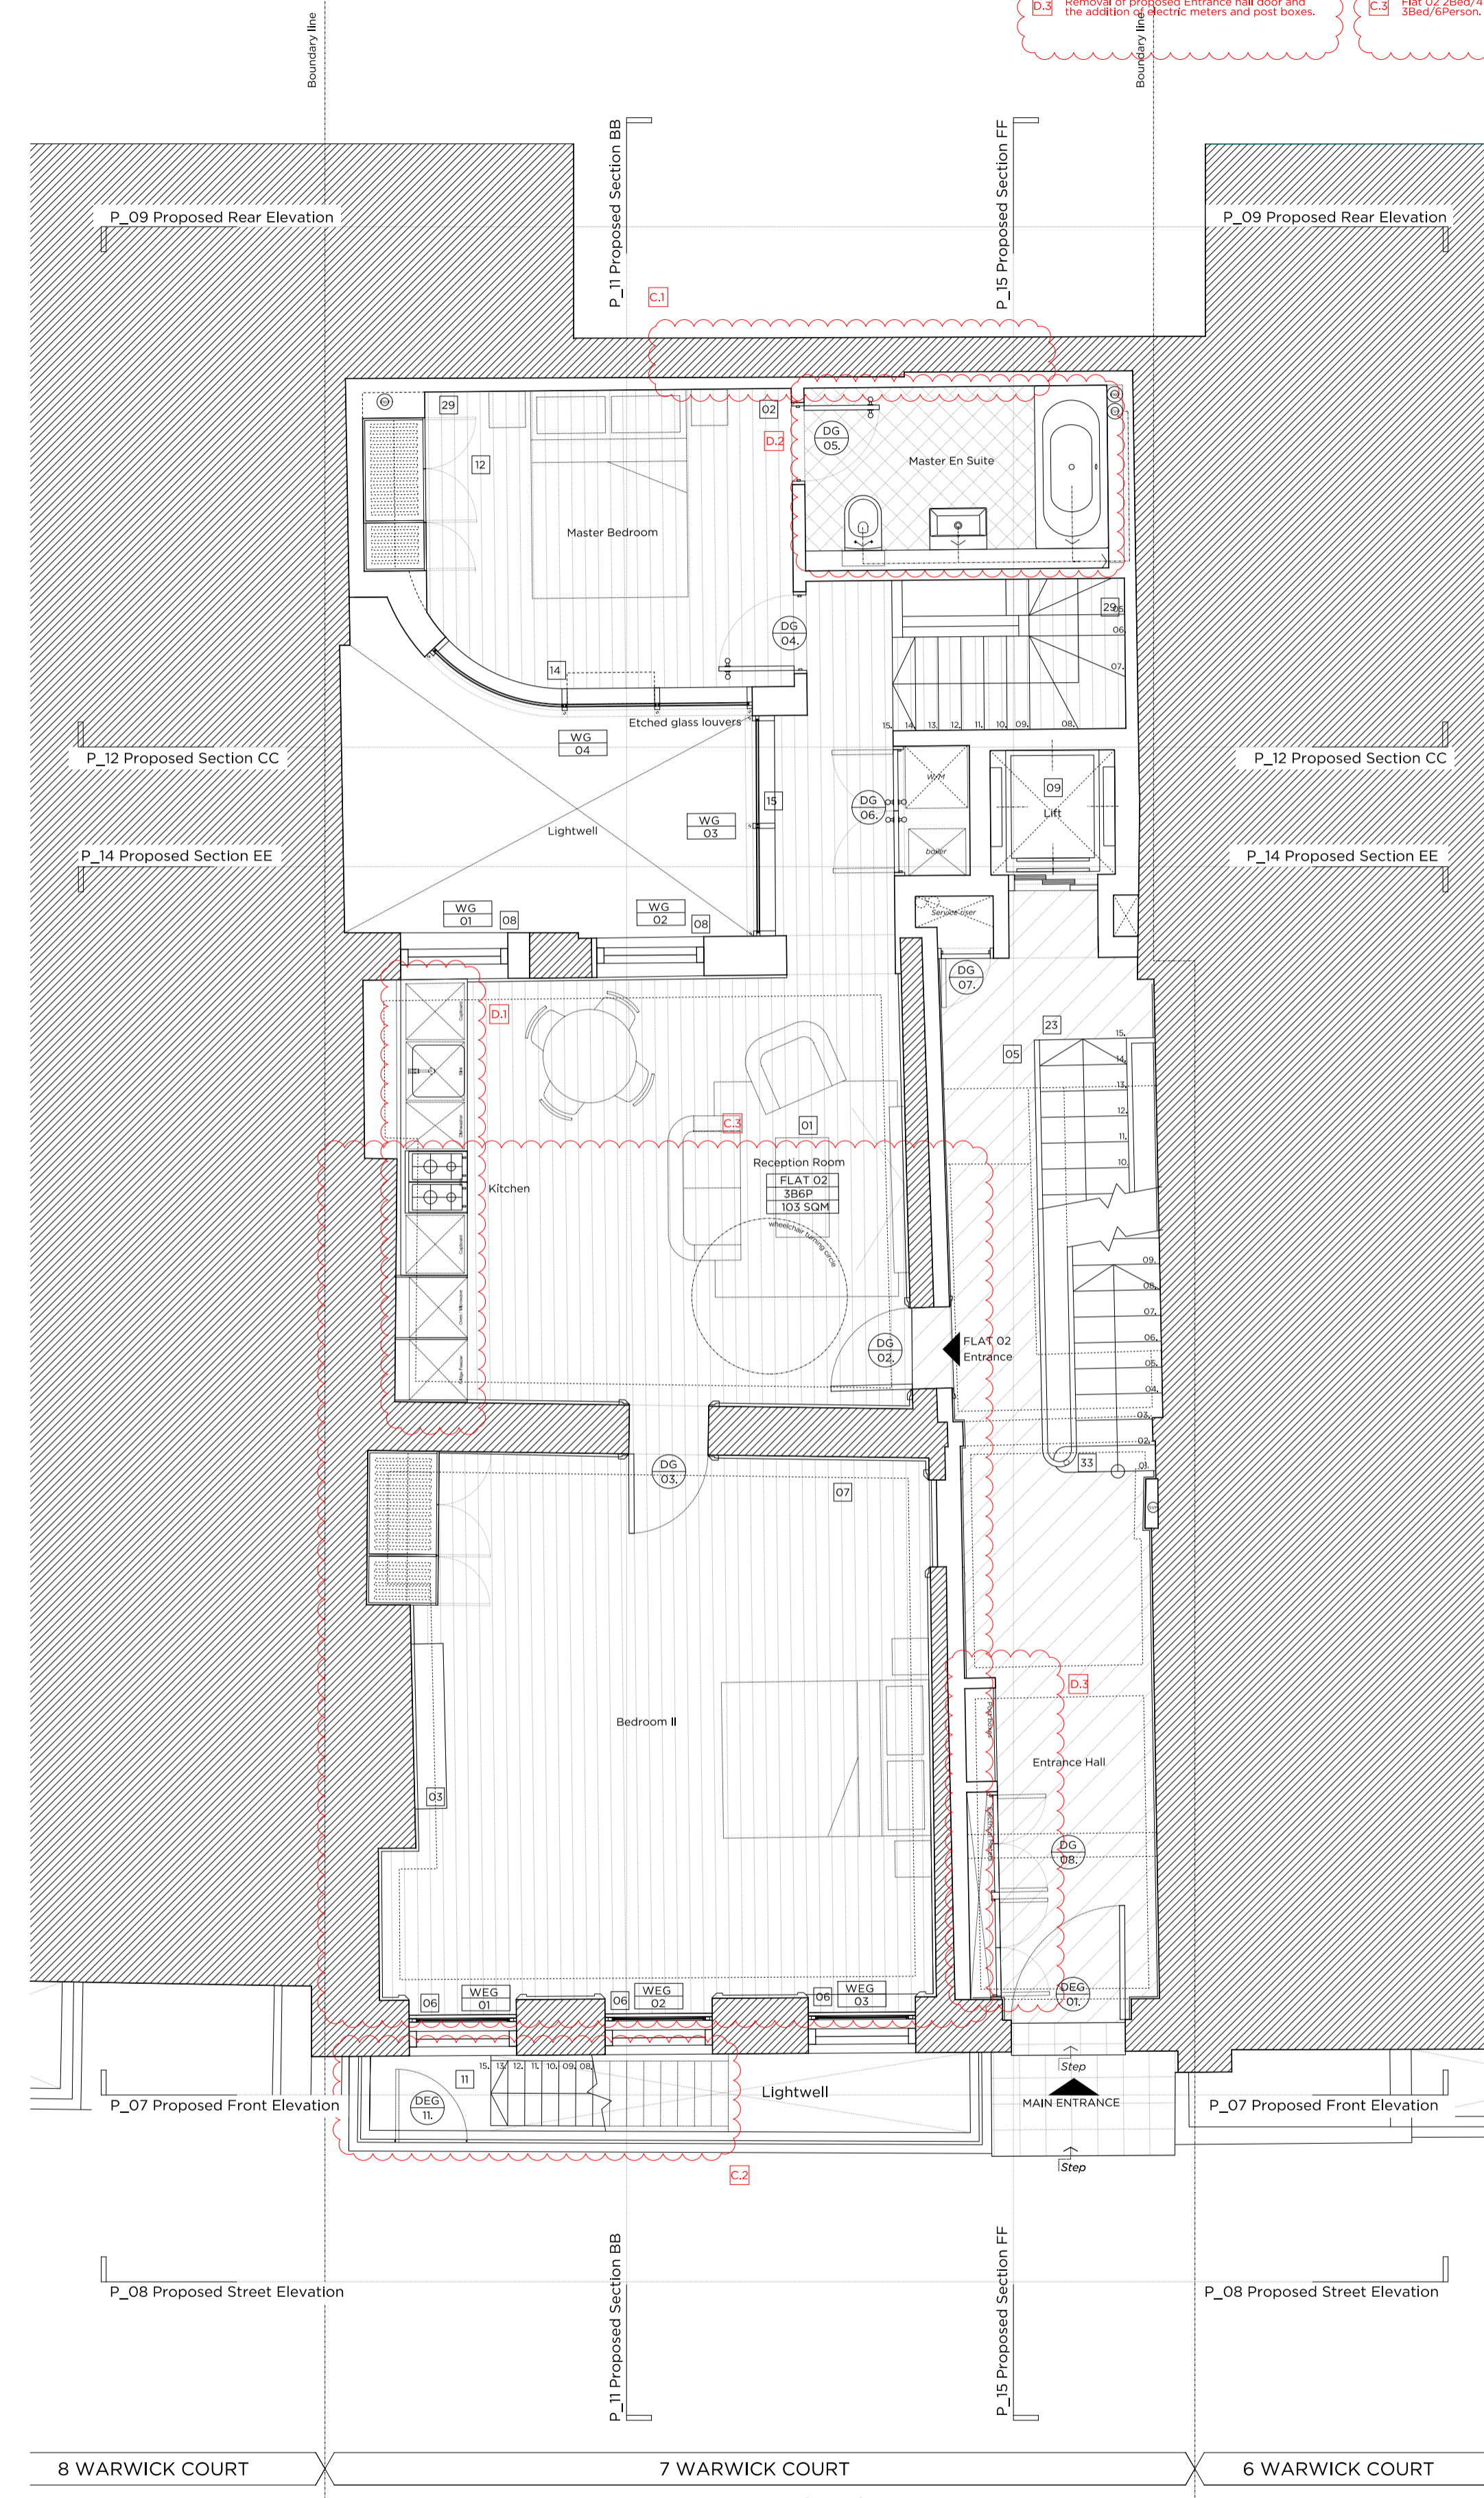


- B. Revision Notes:**
- 1. Proposed Kitchen update.
 - 2. Proposed Master Ensuite layout update.
 - 3. Removal of proposed Entrance hall door and the addition of electric meters and post boxes.
- C. Revision Notes:**
- 1. Window in rear wall which has been shown as existing now removed.
 - 2. Railings and lightwell stair to remain in existing position.
 - 3. Rise 02 Stair/Person to become 5Bed/6Person.

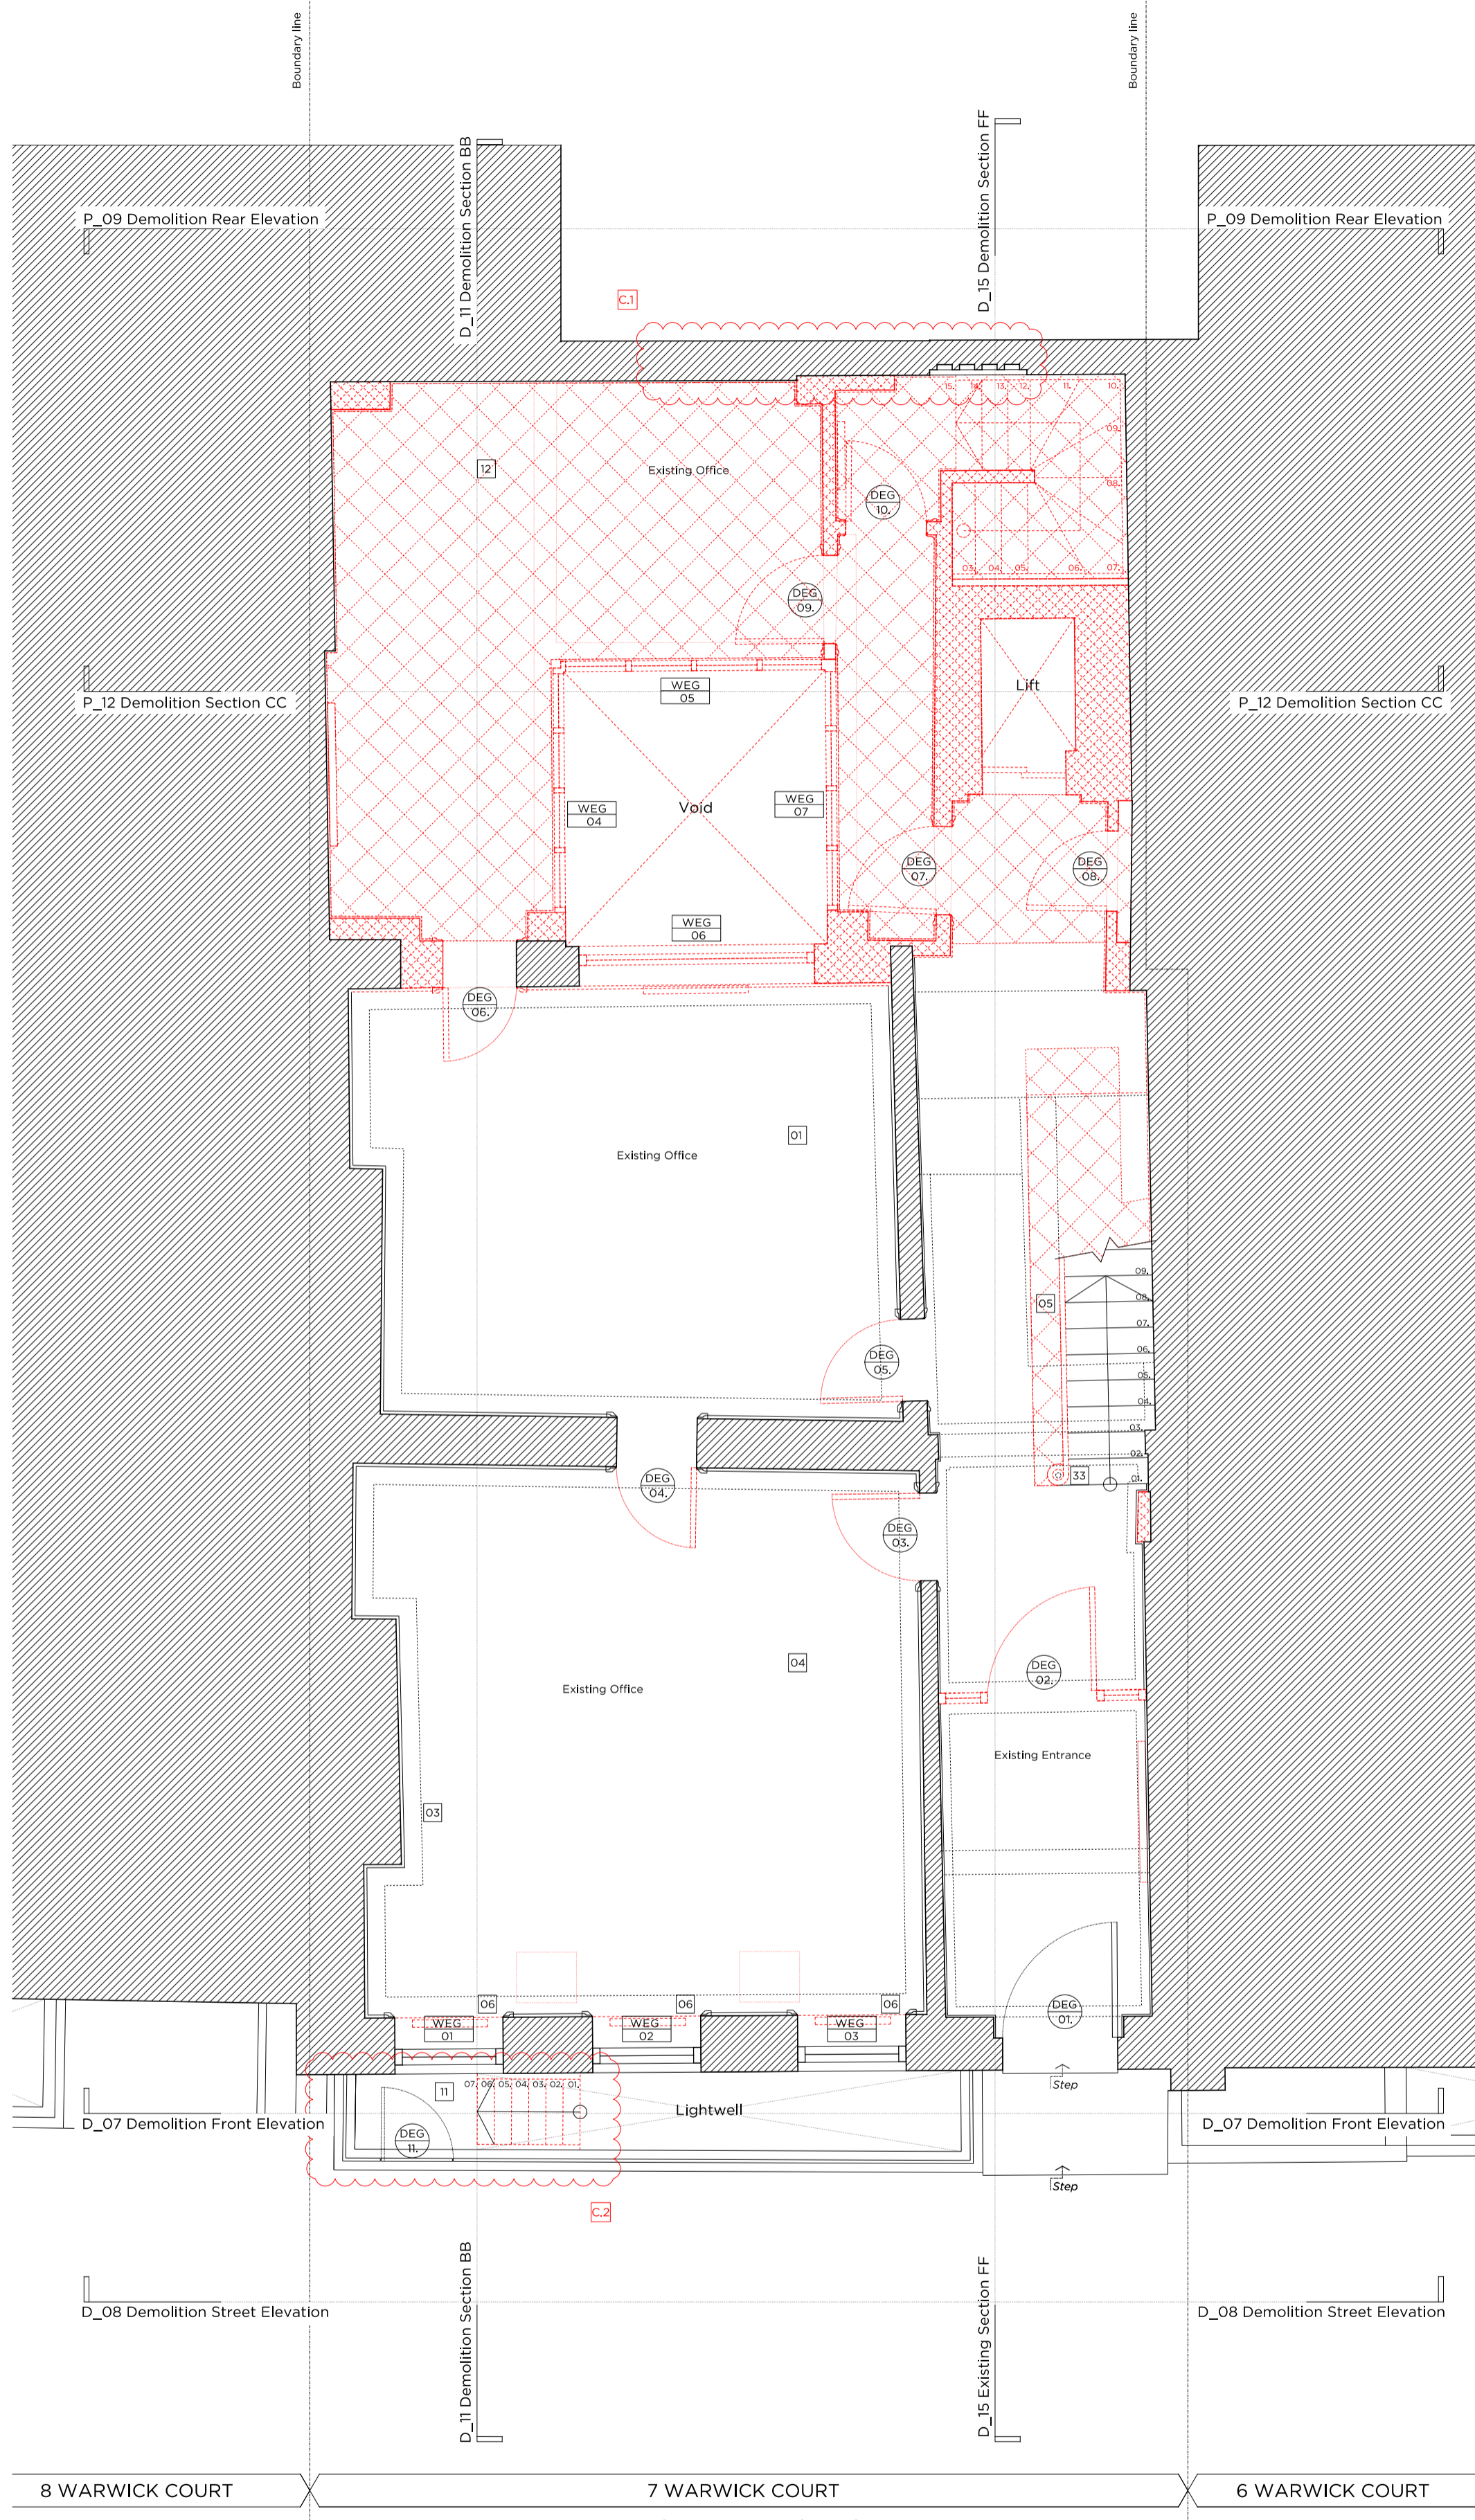

- Demolition Key:**
- Existing structure / ground
 - Proposed removal of existing structure (in section)
 - Proposed removal of existing structure/finishes (in elevation)
 - Proposed removal of existing structure (in section)
 - Hatch denotes removal of existing concrete slab.
 - Hatch denotes proposed removal of existing structure (in elevation)
- Proposed finishes legend**
- Proposed straight-grain hardwood floor finish on specified floor build-up.
 - Proposed larch floor finish on specified floor build-up.
 - Portland stone.
 - Timber decking.
 - Natural stone floor tiles.
 - Proposed slate roof finish on existing and new roof structure.
- General Notes:**
1. Refer to the Door and Window Schedules for a detailed summary of each door and window.
 2. All existing floor finishes and existing ply to be carefully removed.
 3. Existing floorboards to be carefully removed and reused where possible.
 4. New/adding floorboards to be installed. New finishes/joints are to be installed to the top of the existing joists in order to level. See Structural Engineer's Information. Low profile UPH floorboards.
 5. New drainage and concrete slab to be laid at basement level.
 6. Existing slate roof finish to be carefully removed and stored and new roof felt installed. Existing slates to be kept. New slates to match existing to replace any damaged slates. Low profile UPH floorboards. Existing canopy and dormer windows to be removed and replaced on a like-for-like basis.
 7. Joists are to be inspected and strengthened where required to support increased loads. To Structural Engineer's detail.
 8. Existing internal walls are to be skimmed and prepared to take new wall finishes as required. All defective existing plaster to be removed and replaced.
 9. All existing panelling, mouldings and cornices to have existing paint finish removed for new paint decoration.
 10. Existing structural timber beams to be exposed and treated with wood preservative. Ends to be wrapped in DPC and rotten timber to be replaced.

- Proposed legend notes**
- 01 Existing skirting to be refurbished and redecorated.
 - 02 Existing window replaced with double glazed, timber framed sash window.
 - 03 Non-original skirting to be removed and replaced with traditionally-detailed fireplace.
 - 04 Non-original skirting/trunking to be removed.
 - 05 Traditionally detailed, compliant, timber skirting to replace existing.
 - 06 Existing sash windows refurbished and fitted with secondary glazing internally.
 - 07 New, broompan bicycles & £250 bicycle voucher to be supplied to each flat.
 - 08 New, double-glazed, timber framed sash windows. Refer to Detail & Access Statement.
 - 09 New lift.
 - 10 Damaged window sills replaced on like-for-like basis.
 - 11 Lightwell to be lowered by 100mm.
 - 12 New, painted metal stair to accommodate level change.
 - 13 Existing rear envelope retained. New, soft-wood, timber framed rear envelope to be preserved and maintained.
 - 14 Proposed bin store.
 - 15 New, double-glazed, anodised aluminium, restricted frame windows, with etched glass louvers fitted externally.
 - 16 New, fixed, double-glazed, anodised aluminium framed glazing panels.
 - 17 New double-glazed, walk-on rooflight.
 - 18 New double-glazed, conservation rooflight.
 - 19 Partial demolition of existing roof, new ridge proposed, matching height and width of existing.
 - 20 New, automatic-opening vent to communal stair.
 - 21 Terrace to the roof of proposed rear entrance with timber decking glass balustrade.
 - 22 Proposed condensate in attenuated enclosure, refer to M&E design.
 - 23 Rerouted stair to basement level, with timber balustrade.
 - 24 New, single glazed, timber framed window to match existing, fitted with secondary glazing internally.
 - 25 Existing fireplace to be protected and covered.
 - 26 Reconfiguration of existing stair.
 - 27 New dummy window.
 - 28 New double-glazed, traditionally detailed French door.
 - 29 Lining to party wall.
 - 30 Proposed head dormer arrangement to flow through with existing windows. Redesign of existing non-original dormer windows.
 - 31 Terrace to flat 03, with new planting and Yorkstone paving.
 - 32 Existing joists to be trimmed out.
 - 33 Single surviving cast-iron spindle to ground floor stair to be preserved and maintained.
 - 34 Single surviving cast-iron spindle to be removed, retained and new membrane installed. Existing slates to be re-laid and any new slates to match existing.
 - 35 Facade refurbishment.
 - 36 Existing facade to be re-extended and redecorated.
 - 37 Etched glass partition.
 - 38 New Railings.
 - 39 Fixed & obscure proposed windows.
 - 40 Proposed Roof.
 - 41 Paint to be removed from Brickwork and redecorated as required.

Rev D	01.11.16	Issued for planning submission
Rev C	12.09.16	Issued for planning submission
Rev B	07.07.16	Issued for planning submission
Rev A	03.12.15	Issued for planning submission

PLANNING

Project No. **14029**

Client **GFZ Developments Ltd.**

Date **October 2015**

Scale **1:100 @ A3 / 1:50 @ A1**

Project **7 Warwick Court**

Drawing Title **Demolition & Proposed Ground Floor Plan**

Drawing No. **P_01** Rev. **D**

Drawn	Approved	Signed
DI	MW	AB

Marek Wojciechowski Architects Ltd.

66-68 Margaret Street W1W 8SR T. 020 7580 9336 www.mw-a.co.uk

Copyright Marek Wojciechowski Architects Limited. No implied license exists. This drawing should not be used to calculate areas for the purposes of valuation. All dimensions to be checked on site by the contractor and such dimensions to be their responsibility. Do not scale drawings. All work must comply with relevant British Standards and Building Regulations requirements. Drawing errors and omissions to be reported to the architect.